

## Report Version 5 Hazardous Materials Initial Site Assessment (ISA)

August 28, 2019

District: Fort Worth

CSJs 0008-13-125, etc.

### Southeast Connector

The environmental review, consultation, and other actions required by applicable Federal environmental laws for this project are being, or have been, carried-out by TxDOT pursuant to 23 U.S.C. 327 and a Memorandum of Understanding dated December 16, 2014, and executed by FHWA and TxDOT.

TxDOT Environmental Affairs Division Effective Date: April 2017 510.02.DS Version 5

### Hazardous Materials Initial Site Assessment (ISA) Report

This ISA complies with the Federal Highway Administration's (FHWA's) policy dealing with hazardous materials discussed in FHWA's *Supplemental Hazardous Waste Guidance* (January 16, 1997) located at <a href="http://www.environment.fhwa.dot.gov/guidebook/vol1/doc7b.pdf">http://www.environment.fhwa.dot.gov/guidebook/vol1/doc7b.pdf</a>.

FHWA's policy emphasizes three objectives: 1) identify and assess potentially contaminated sites early in project development, 2) coordinate early with federal/ state/ local agencies to assess the contamination and the cleanup needed; and 3) determine and implement measures early to avoid or minimize involvement with substantially contaminated properties.

In addition, completing the ISA will aid in identifying hazardous material issues early, avoiding construction delays, and reducing the department's liability associated with the purchase of contaminated right of way.

Maintain a copy of the completed ISA report with all applicable attachments in the project file.

For additional information, refer to TxDOT's online manual: *Hazardous Materials in Project Development*: <a href="http://onlinemanuals.txdot.gov/txdotmanuals/haz/index.htm">http://onlinemanuals.txdot.gov/txdotmanuals/haz/index.htm</a> and the Hazardous Materials Toolkit Site: <a href="http://www.txdot.gov/inside-txdot/division/environmental/compliance-toolkits/haz-mat.html">http://www.txdot.gov/inside-txdot/division/environmental/compliance-toolkits/haz-mat.html</a>

### **Abbreviations and Acronyms**

CALF	Closed and Abandoned Landfill	
CERCLIS	Comprehensive Environmental Response Compensation and Liability Information System	
EA	Environmental Assessment	
EIS	Environmental Impact Statement	
ECOS	Environmental Compliance Oversight System	
ERNS	Emergency Response Notification System	
EPA	Environmental Protection Agency	
ESA	Environmental Site Assessment	
HAZMAT	Hazardous Materials	
MS4	Municipal Separate Storm Sewer System	
MSWLF	Municipal Solid Waste Landfill	
NPL	National Priorities List	
RCRA	Resource Conservation and Recovery Act	
ROW	Right of Way	
SEMS	Superfund Enterprise Management System	
TCEQ	Texas Commission on Environmental Quality	
TRRC	Texas Railroad Commission	
US	United States	
USGS	United States Geological Survey	
VCP	Voluntary Cleanup Program	

# TxDOT Hazardous Materials Initial Site Assessment (ISA) Report Project Information CSJ No: 0008-13-125, etc. City: Arlington, Forest Hill, Fort Worth, Kennedale Tofal 13, 76105, 76112, 76113, 76119, 76140 HWY: I-20/I-820/US 287 Limits: I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road

Section 1: Identify Previously Completed Environmental Site Assessments, Known Hazmat Conditions, Preliminary Project Design, and Right-of-Way Requirements		
Note: Obtain information/comments from design, right-of-way, and/or environmental staff. Attach maps and/or details as appropriate.		
☐ Yes ☐ No ☑ Unknown	Are there any previous environmental assessments, testing, or studies performed within the proposed project area related to contamination issues (to include Phase I ESAs)? If yes, explain here if there are any concerns to the proposed project:	
⊠Yes □ No	Have the project schematics and/or plan-profile sheets (if available) been reviewed?* Look for substantial excavations (including utilities and storm sewer designs), new ROW and easements, and bridge demolitions or renovations.	

<sup>\*</sup> For consultants: this information shall be supplied by TxDOT.

### Section 2: Demolition and Renovation Information Related to Asbestos and Lead-Containing-Paint

☑Yes ☐No Are there proposed bridges or building demolitions or renovations for this project?

**Note**: If "Yes" is selected, buildings or structures being acquired through the acquisition process are assessed and mitigated for asbestos, as needed, within the ROW process according to the TxDOT ROW Manual ROW Vol. 6 Miscellaneous -Chapter 1 Section 5. Bridge structures being demolished or renovated are assessed and mitigated for asbestos and lead-containing-paint, as needed, within the construction process according to Standard Specification Item 6.10 (and applicable Provisions), and the TxDOT guidance document: Guidance for Handling Asbestos in Construction Projects, dated January 26, 2007.

### **Section 3: Project Screening**

**Note:** Section 3.1 is only applicable for Categorically Excluded (CE) projects. If you are uncertain of the project type, select "No" and continue to Section 3.2.

**Section 3.1** Determine if the proposed project has a low potential to encounter contamination. Refer to the preliminary schematics for project limits and internet-based maps for surrounding land use.

Yes
No or an EA or EIS Project

Are the limits of the proposed project within a historically undeveloped area and outside the boundaries of a designated MS4 permitted area? Historically undeveloped areas are locations where no commercial buildings are located within one-half (0.5) miles of the proposed project limits and the surrounding land use is historically agricultural, forest, or ranch lands.

If "Yes" is selected, the ISA is complete. The proposed project has a low potential to encounter contamination. Complete Sections 9 and 10 of this ISA and maintain a copy and all applicable attachments in the project file.

### If "No" is selected, proceed to Section 3.2 of this ISA.

### Section 3.2

**Note:** Determine if the project includes any of the activities listed below:

⊠ Yes □ No	<b>Project Excavations:</b> Will the work consist of substantial excavation operations. Substantial excavation includes, but is not necessarily limited to:	
	<ul> <li>Underpass construction,</li> </ul>	
	Storm sewer installations, and	
	Trenching or tunneling that would require temporary or permanent shoring.	
Yes	Dewatering of Groundwater: Are there proposed de-watering operations. If yes, what is the	
☐ No	estimated depth to groundwater?	
⊠ Yes	Encroachments: Are there known or potential encroachments into the project area?	
☐ No	Encroachments include soil and groundwater contamination, dump sites, tanks, and other issues in the ROW.	
	ROW and Easements: Are there any acquisitions of new ROW, easements, temporary	
□ No	construction easements planned for the project?	
3.3 Complete the appropriate box below:  ☐ If Section 3.2 contains any "Yes" answers, proceed to Section 4.  ☐ If Section 3.2 contains all "No" answers, proceed to Section 6, Site Survey. Please perform a site survey documenting the results in Section 6 and then mark the appropriate box below. If a Phase I ESA has been prepared for this project, you may use the applicable site survey information from the Phase I ESA.  ☐ The site survey did not identify evidence of any environmental concerns listed in Section 6. The ISA is complete. Complete Sections 9 and 10 and maintain a copy of the ISA and all applicable attachments in the project file.  ☐ The site survey identified evidence of environmental concerns listed in Section 6. Continue with Section 4.		
Section 4: Current and Past Land Use Information		
sources that were	d assess current and past land use (up to 50 years) in the project area. Document and attach reviewed. If one or more Phase I ESAs were prepared for this project, please use applicable e Phase I ESAs to help complete this section of the ISA.	
⊠Ves	4.1 Poviow Current and Past USGS 7.5 Minute Tonographic Mans of the project area: Look	

### 4.1 Review Current and Past USGS 7.5 Minute Topographic Maps of the project area: Look ⊠Yes for oil & gas pipelines, tanks, landfills, or other industrial features. ☐ No Describe any concerns: The regulated and permitted Southeast Municipal Landfill is located ☐ Not Available approximately 0.75 mile south of I-20 and is not considered a concern. ☐ Not Applicable List Topo Maps Reviewed: Dates: Comments: Fort Worth 1955, 1995, No environmental concerns. 2012. 2010, 2019 2016, 1995, 1959, Hurst No environmental concerns. 2012, 2010, 2019 2016, 1981, 1959,

2010,

2016,

2012,

2019

No environmental concerns.

Kennedale

⊠Yes	4.2 Review Current and Past Aerial Photographs of the project area: Look for oil & gas			
□ No	pipelines, tanks, landfills, or other industrial features.			
☐ Not Available	Describe any concerns: The regulated and permitted Southeast Municipal Landfill is located approximately 0.75 mile south of I-20 and is not considered a concern.			
☐ Not Applicable				
	List All Aerial Photos Reviewed:	Photo Dates:	Comments:	
	Google Earth Pro	1995, 2001,		
		2002, 2003,		
		2004, 2005, 2005, 2007,		
		2008, 2009,		
		2011, 2012,		
		2013, 2014, 2015, 2016,		
		2017, 2018		
	historicaerials.com	1956, 1963,	riodanig of Lake familyton bothoon	
		1968, 1970, 1981,	1956 and 1957 aerials. In 1963 historic	
		1990	aerial, construction of I-820 and interchanges with I-30, I-20, 180, 303	
			and Bus 287 underway. US 287 off I-	
			820 contructed by 1968 aerial. I-20	
			east toward Arlington and I-20/US 287 interchange south constructed by 1979	
			erial. Expanded I-30 interchange by	
			1990 aerial.	
		1942,		
	TNRIS	1951,		
		1958		
☐Yes		of-Way Maps/File	es*: Look for oil & gas pipelines, tanks,	
☐ No ☑ Not Available	landfills, or other industrial features.  Describe any concerns:			
Not Available  Not Applicable	List Maps/ Files & Dates Reviewed:	Comments:		
Yes	4.4 Review Sanborn Fire Insurance M	laps/Files: Look	for tanks, oil & gas pipelines, landfills, or	
□ No	other industrial features.		, 311 , ,	
Not Available	Describe any concerns:			
☐ Not Applicable	List Maps/ Files & Dates Reviewed:	Comments:		
□Yes	4.5 Review TxDOT As-Built Plans*:			
☐ No	, 5-5, 5-4-4			
Not Available				
☐ Not Applicable	If known, what is the previous Project C			
☐Yes	4.6 Review TxDOT Geotechnical Soil			
│	Were any concerns noted on the boring logs such as unusual odors, visible contamination, trash, waste or debris?			
Not Available  ☐ Not Applicable				
	j = =, expiaiiii			

□Yes □ No	4.7 Review TxDOT Temporary Use ROW Agreements (permits issued by the district to entities to occupy a portion of the ROW)*:	
⊠ Not Available	Were any concerns such as monitor wells or treatment systems identified within the ROW? For consultants: this information shall be supplied by TxDOT.	
	If yes, explain:	
☐Yes ☐ No ☑ Not Available	<b>4.8 Review Notifications of Contamination to TxDOT*</b> (These are typically letters from TCEC or third parties explaining the presence of contamination on TxDOT ROW): Were any concerns regarding contamination of ROW from off-site sources? If yes, explain:	

### Section 5: Complete a Regulatory Records Review (Database Search)

**Note:** Use the comment field in Section 5.1 to provide a synopsis of the total number of sites identified within the search distances of the regulatory record reviewed. No comments are required when no sites were identified or the regulatory record was not reviewed.

### Select the appropriate box below:

Select the appropriate	box below.		
A Database search	was conducted through a contracted service. Indicate in Section 5.1, and if applicable,		
	ory records searched. Maintain a complete copy of the database search findings (contractor's		
report deliverable) in the project file with the ISA.			
<del></del>	was conducted in-house. For in-house database searches, not all databases need to be		
	mum the databases listed in Section 5.1 marked in <b>bold with a star(*)</b> must be reviewed.		
nclude database records that list potential issues in the project file with the ISA. It is not necessary to include records			
of negative findings.			
Section 5.1 Standard D	atabase Sources of Environmental Information from Government Agency Records		
Findings	Regulatory Record		

Findings	Regulatory Record
	Federal Active NPL or Not NPL list (CERCLIS or SEMS sites)*
☐Sites Identified	https://cumulis.epa.gov/supercpad/CurSites/srchsites.cfm; and/or https://www.epa.gov/cleanups/cleanups-
⊠No Sites Identified	<u>my-community</u>
	(1 mile minimum search distance from project limits)

Comments for Sites Identified:

	F
No Sites Identified	ht

Federal Archived NPL or Not NPL list (CERCLIS or SEMS sites)\*

https://cumulis.epa.gov/supercpad/CurSites/srchsites.cfm (0.5 mile minimum search distance from project limits)

Comments for Sites Identified: One SEMSARCH site (Map ID 114) was identified within the search radius and is discussed in the Southeast Connector Hazardous Materials Project Impact Evaluation.

X	Sites Identified
	No Sites Identified
	Not Reviewed

US EPA Brownfield Properties <a href="https://www.epa.gov/cleanups/cleanups-my-community">https://www.epa.gov/cleanups/cleanups-my-community</a> (0.5 mile minimum search distance from project limits)

Comments for Sites Identified: Five US EPA Brownfiled Properties (Map ID #'s 95, 134, 136, 139 & 190) were identified within the search radius and are discussed in the Southeast Connector Hazardous Materials Project Impact Evaluation.

Sites Identified
⊠No Sites Identified
☐Not Reviewed

Federal RCRA Corrective Action (CORRACTS) list <a href="https://www.epa.gov/cleanups/cleanups-my-community">https://www.epa.gov/cleanups-my-community</a>, and/or <a href="https://www.epa.gov/enviro/">https://www.epa.gov/enviro/</a> (1 mile minimum search distance from project limits)

Comments for Sites Identified:

<sup>\*</sup> For consultants: this information shall be supplied by TxDOT. If no information is supplied by TxDOT, then select Not Available.

☐Sites Identified ☑No Sites Identified ☐Not Reviewed	Federal RCRA non-CORRACTS Treatment Storage Disposal (TSD) facilities list <a href="http://www.envcap.org/statetools/tsdf/">http://www.envcap.org/statetools/tsdf/</a> and/or <a href="http://www.epa.gov/enviro/">http://www.epa.gov/enviro/</a> (0.5 mile minimum search distance from project limits)		
Comments for Sites Idea	ntified:		
Sites Identified ☐No Sites Identified ☐Not Reviewed	Federal RCRA generators <a href="http://www.epa.gov/enviro/">http://www.epa.gov/enviro/</a> (acquired property and adjoining properties)		
the search radius. Two discussed under those li	ntified: Eight RCRAGR06 sites are identified within the database; however, only six are within of the sites (Map IDs 60 & 76) are associated with PST, LPST, or other listings and will be istings in the Southeast Connector Hazardous Materials Impact Evaluation. The remaining 65, 66, & 74) are considered low environmental risks.		
☐Sites Identified ☑No Sites Identified ☐Not Reviewed	Federal ERNS (or Responses) https://www.epa.gov/cleanups/cleanups-my-community (acquired property and adjoining properties)		
Comments for Sites Idea	ntified:		
⊠Sites Identified ☐No Sites Identified	TCEQ Industrial Hazardous Waste Corrective Action (IHWCA) sites only*  http://www15.tceq.texas.gov/crpub/ (1 mile minimum search distance from project limits)		
(Map IDs 138, 164, 173, have had the corrective	ntified: Nine IHWCA sites are identified within the search radius; however, eight of the sites , 179, 187, 197, 198, and 199) range from 0.17 to 0.76 mile away from the proposed project actions completed or are inactive and are not considered an environmental concern. The 123) is discussed in the Southeast Connector Hazardous Materials Project Impact Evaluation.		
☐Sites Identified ☐No Sites Identified	No Sites Identified <a href="https://www.tceq.texas.gov/remediation/superfund/sites/index.html">https://www.tceq.texas.gov/remediation/superfund/sites/index.html</a> (1 mile minimum search distance from project limits)		
Comments for Sites Idea			
Sites Identified ☐No Sites Identified	Closed and abandoned municipal solid waste landfill sites* <a href="http://www.tceq.texas.gov/permitting/waste-permits/msw-permits/msw-data">http://www.tceq.texas.gov/permitting/waste-permits/msw-permits/msw-data</a> (0.5 mile minimum search distance from project limits)		
Comments for Sites Identified: Four CALF sites (Map ID 9, 82, 152, & 189) were identified within the search radius			
and are discussed in the	e attached Southeast Connector Hazardous Materials Project Impact Evaluation. In addition,		
three MSWLF sites (Ma	p ID's 10, 102, & 114) were identified within the search radius and are also discussed in the		
Southeast Connector Hazardous Materials Project Impact Evaluation.			
⊠Sites Identified ☐No Sites Identified	TCEQ leaking petroleum storage tank remediation lists (LPST)* <a href="http://www15.tceq.texas.gov/crpub/">http://www15.tceq.texas.gov/crpub/</a> (0.5 mile minimum search distance from project limits)		
Comments for Sites Identified: Sixty-eight listings at 61 sites were identified in the regulatory database report. All of these sites are within the search radius. Thirty-four sites are discussed in the Southeast Connector Hazardous Materials Project Impact Evaluation. Map IDs 121, 122,130, 139, 142, 148, 156, 167, 174-178, 180-186, 188, 191-193, and 195-196 are not adjacent to project improvements, or are large properties with on-site facilities a significant distance from existing/proposed ROW, and are not considered environmental concerns.			
Sites Identified ☐No Sites Identified	TCEQ registered petroleum storage tank lists (PST)* http://www15.tceq.texas.gov/crpub/ (acquired property and adjoining properties)		
Comments for Sites Identified: One hundred and fifteen listings at 109 sites were identified in the regulatory database report. Sixty-six of these sites are within the search radius and are discussed in the Southeast Connector Hazardous			

Materials Project Impact Evaluation. Five additional PST sites are listed, but outside of the search radius. These sites are associated with other environmental databases, but are also PST sites. The remaining sites are outside of the search radius, are not adjacent to project improvements, or are large properties with on-site facilities a significant distance from existing/proposed ROW and/or project improvements and are not considered environmental concerns.

Sites Identified

TCEQ voluntary cleanup program (VCP) sites\* <a href="http://www15.tceq.texas.gov/crpub/">http://www15.tceq.texas.gov/crpub/</a>
(0.5 mile minimum search distance from project limits)

Comments for Sites Identified: Five sites were identified within the search radius. Three sites (Map IDs 7, 60, & 139) are discussed with the LPSTs in the Southeast Connector Hazardous Materials Impact Evaluation. Two sites (Map ID 47 and Map ID 145) have completed corrective action. Based on the VCP completion, these sites are not considered an environmental concern.

Sites Identified
☐No Sites Identified
☐Not Reviewed

TCEQ Innocent Owner/ Operator (IOP) sites <a href="http://www15.tceq.texas.gov/crpub/">http://www15.tceq.texas.gov/crpub/</a> (0.5 mile minimum search distance from project limits)

Comments for Sites Identified:

One IOP site (Map ID 17) was identified within the search radius and is discussed in the Southeast Connector Hazardous Materials Impact Evaluation.

Sites Identified
☐No Sites Identified

TCEQ Dry Cleaners remediation only Database\* http://www15.tceq.texas.gov/crpub/

(0.5 mile minimum search distance from project limits)

Comments for Sites Identified: Two DCRPS listings at one site (Map ID # 194) were identified within the search radius and is discussed in the Southeast Connector Hazardous Materials Project Impact Evaluation.

☐ Sites Identified ☐ No Sites Identified

**Texas Railroad Commission VCP sites\*** 

http://www.rrc.state.tx.us/oil-gas/environmental-cleanup-programs/site-remediation/voluntary-cleanup-program/ (0.5 mile minimum search distance from project limits)

Comments for Sites Identified:

### Section 5.2 List below other pertinent records reviewed such as local records and/or additional state records Record Source and Comments:

Record Source and Comments: Three SPILLS listings at two sites (two spills at - Map ID #1; Map ID #2 is second site) were identified within the search radius.

### MAP ID #1

Spill incident # 10/17/98009 occurred on 10/17/1998 at the intersection of I-20 east and I-820 intersection. 100 gallons of diesel was spilled; no amount reached water prior to being cleaned up.

Spill incident # 2661 occurred on 06/05/2002 at intersection of I-20 west and I-820 east. 20 gallons of diesel fuel 2-D were spilled. Absorbent material was applied and the materials were collected and staged for disposal.

### MAP ID # 2

Spill incident # 7/18/96003 occurred on 7/18/1996. 40-50 gallons of diesel fuel were spilled. No other information was reported.

MSWLF: Three sites (Map ID #'s 10, 102, & 114) were identified on the regulatory database report and are discussed in Sec 5.1 under CALF.

Texas Railroad Commission Well and Pipeline Viewer (accessed 7-02-19). According to the Viewer, six natural gas pipelines cross the project and one runs closely parallel to the project (south US 287). They are discussed as follows:

- 1. One Flint Hills Resources 14-inch diameter Texas Pipeline refined liquid product transmission line crossing I-20 parallel to the railroad along the border of Forest Hill and Fort Worth, TX. Approximately STA 243+00. Status is "in service" (see the Hazardous Materials Sites Map Figure 4).
- 2. One DFW Midstream Services LLC 16-inch diameter Lenox lateral natural gas gathering line I-20 at Bowman Springs Road in Arlington, TX. Approximately STA 151+50. Status is "in service" (see the Hazardous Material Site Map -Figure 4).
- 3. One Atmos 20-inch diameter O49 natural gas transmission line at I-20 and Park Springs Boulevard in Arlington, TX. Approximately STA. 330+90. Status is "in service" (see the Hazardous Materials Sites Map Figure 4).
- 4. One Energy Transfer Company 20-inch diameter 9004 Line O natural gas transmission line at I-820 and Purselley Avenue in Fort Worth, TX. Approximately STA. 551+00. Status is "in service" (see the Hazardous Materials Sites Map Figure 4).
- 5. One Cowtown Pipeline Partners 12.75-inch diameter Lake Arlington natural gas gathering line at I-820 1,232 feet south of Martin Street in Fort Worth, TX. Approximately STA. 328+10. Status is "in service" (see the Hazardous Materials Sites Map Figure 4).
- 6. One Williams MLP Operating LLC 10.75-inch diameter natural gas gathering line at US 287 495 feet northwest of Erath Road in Fort Worth, TX. Approximately STA. 264+00. Status is "in service" (see the Hazardous Materials Sites Map Figure 4).
- 7. One DFW Midstream Services LLC 10.75-inch diameter SWAPO Lateral natural gas gathering line in Arlington, TX. Approximately STA 168+00 to STA 199+60. Status is "in service" (See the Hazardous Materials Sites Map Figure 4).

Based on the contents of the natural gas pipelines, these features are not considered an environmental concern. Formal utilities location and advance planning would be required to facilitate pipeline and utilities adjustments and to otherwise avoid associated impacts. TxDOT Fort Worth District SUE Coordinator and ROW will be responsible for the adjustments and displacements.

### Section 6: Complete a Project Site Survey

**Note: Do not** document site survey concerns that were previously identified by the regulatory list search, by the Current and Past Land Use review, or both. In Section 6.1, describe the location and size of the concern. Attach site maps and photographs, as appropriate. If a Phase I ESA has been prepared for this project, you may use the applicable site survey information from the Phase I ESA and updated current site conditions, as needed.

**Possible Site Survey Concerns:** The following items are to be used as a guide to help identify potential hazardous material issues during a site survey.

- underground storage tanks
- aboveground storage tanks

- vent pipes, fill pipes, or access ways indicating a fill pipe protruding from the ground
- electrical and transformer equipment storage or

- injection wells, cisterns, sumps, dry wells
- floor drains, walls stained by substances other than water or emitting foul odors
- stockpiling, storage of material
- surface dumping of trash, garbage, refuse, rubbish, debris half exposed/buried, etc.
- stained, discolored, barren, exposed or foreign (fill) soil
- oil sheen or film on surface water, seeps, lagoons, ponds, or drainage basins
- changes in drainage patterns from possible fill areas
- Dead animals (fish, birds, etc.)

### evidence of release

- groundwater monitoring wells and groundwater treatment systems
- vats, 55-gallon drums (labeled/unlabeled), canisters, barrels, bottles, etc.
- evidence of liquid spills
- damaged or discarded automotive or industrial batteries
- dead, damaged, or stressed vegetation
- pits, ponds, or lagoons associated with waste treatment or waste disposal
- security fencing, protected areas, placards, warning signs

### Site Survey Date(s): 4/18/2019 and 7/8/2019

**6.1** Describe Concerns Observed During the Site Survey. **Do not** include concerns previously identified during the regulatory list search, the current and past land use review or both. Indicate if the concern is associated with existing ROW, proposed ROW, adjacent property, or easements. Provide address location (or relative location) and any additional information about the evidence identified; include photographs as an attachment to the ISA.

Comments or Concerns Identified:

Pole-mounted electrical transformers were identified along various sections of I-20, I-820 and US 287. No environmental concerns were observed. These transformers do not pose an environmental concern for the project.

There are numerous auto dealerships, body shops, and auto lube and service facilities along the corridor adjacent to the project improvements, the majority of which are not listed regulatory sites. Evidence of spills or releases was not observed near project improvement areas. The presence of these businesses are considered a low environmental risk to the project.

Section 7: Interviews			
Section 7.1 Were interviews conducted? Yes No Possible interviewees include local residents, TxDOT staff, fire department personnel, city or county department of health/environmental staff, city or county planning staff, TCEQ staff, TRRC staff, and current and former property owners or operators.			
If one or more Phase I ESAs were prepared for this project, please use applicable interview information from the Phase I ESAs to help complete this section of the ISA.			
Section 7.2 Interview Summary: Complete this section if interviews were conducted. Add additional rows as needed. Attach record of communications to the ISA.			
Name:	Title:	Date:	
Describe any potential concerns:			
Name:	Title:	Date:	
Describe any potential concerns:			
Name:	Title:	Date:	

Describe any potential concerns:		
Section 8: Haza	ardous Material Concerns	
On the list below, indicate if a concern is resolved or unresolved. "Unresolved" indicates additional investigation or research is required. "Resolved" indicates the concern has been resolved during the preparation of this ISA. If a concern is "Unresolved" or "Resolved", include a statement explaining the planned next steps to resolve the issue. If no concerns were identified, select "No Issue".		
practices for res	nformation regarding scheduling considerations, internal/external coordination and recommended olving hazmat issues please refer to TxDOT's <i>Environmental Tool Kit</i> web site.	
	ENV Hazardous Material Management (HMM) for additional assistance.  e of Hazardous Material Concerns	
Resolution		
Resolution	Type of Concern	
□Unresolved ☑Resolved □No Issue	<b>Current or Past Land Use Concerns:</b> These concerns are associated with hazardous material issues identified in Section 4 that were not discovered during the database search in Section 5.1 or during the Site Survey in Section 6.1. Note: For ECOS IIR development, the Available Contaminated Media would be "Other".	
	ved or Resolved Issues: Resolved: Pipeline crossings at approximately STA 243+00, STA. 151+50 51+00, 328+10, 264+00, & 168+00 to 196+60.	
□Unresolved ☑Resolved □No Issue	<b>Site Visit Concerns:</b> These concerns are associated with hazardous material issues discovered following the completion of Section 6 that <u>were not previously discovered during the database search in Section 5.1 or during the current and past land use review in Section 4. Note: For ECOS IIR development, the Available Contaminated Media would be "Other".</u>	
Explain Unresolv	ved or Resolved Issues:	
Resolved:		
Pole-mounted electrical transformers were identified along various sections of the project and do not pose an environmental concern for the project.		
The presence of auto dealerships, body shops, and auto lube and service facilities along the project, some not listed as regulatory sites, are considered a low environmental risk to the project.		
☐Unresolved ☐Resolved ☐No Issue	Interview Concerns: These concerns are associated with any hazardous material issues discovered during an interview listed in Section 7, that were not previously discovered during the database search in Section 5.1, during the current and past land use review in Section 4, or during	

the Site Survey in Section 6.1. Note: For ECOS IIR development, the Available Contaminated Media

■No Issue

would be "Other".

Explain Unresolved or Resolved Issues:

 $\boxtimes$ N/A

⊠Unresolved ⊠Resolved □No Issue	Petroleum Storage Tanks (PSTs) Concerns discovered during the database search: PSTs are underground or aboveground storage tanks used to store fuel or other petroleum substances. Typically, these are found at gasoline and diesel refueling facilities. Select below all that apply.		
	⊠Yes □No	ROW acquisition or partial acquisition of a parcel with one or more PSTs.	
	☐Yes ⊠No	Other- Describe:	
Explain Unresol Unresolved: Fourteen sites a 49, 60, 62, and	ire determined	to be a moderate or high environmental risk (Map IDs 5, 13, 24-26, 28, 38, 41, 45, 46,	
Resolved: Fifty-seven sites are determined to be no environmental concern or low environmental risk (Map IDs 4, 6, 7, 11, 12, 14, 16, 17, 19, 22, 23, 29, 30, 32-36, 39, 40, 42, 44, 48, 50, 52, 53, 55-59, 61, 63, 67, 70, 75, 76, 79-81, 85, 87, 94, 104, 105, 111, 112, 116, 123, 126, 139, 141, 147, 155, and 171). Refer to the Southeast Connector Hazardous Materials Project Impact Evaluation for discussions.			
⊠Unresolved ⊠Resolved □No Issue	LPSTs are P	<b>roleum Storage Tanks (LPSTs) Concerns discovered during the database search:</b> PSTs that have caused or are suspected to have caused a release of fuel or other ostances to the environment.	
	⊠Yes □No	Additional Research is needed or uncertain of impacts from one or more LPSTs. Request assistance from ENV.	
	⊠Yes □No	ROW acquisition or partial acquisition of a parcel with one or more LPSTs.	
	⊠Yes □No	One or more LPSTs are located within 0.25 miles of the project.	
	☐Yes ⊠No	Other- Describe:	
Explain Unresol	ved or Resolve	ed Issues:	
Unresolved:			
Seven sites are	determined to	be a moderate or high environmental risk (Map IDs 13, 24, 28, 45, 46, 49, and 60).	
Resolved:			
Twenty-eight sit 16, 21, 30, 32, 3	34, 36, 39, 44,	ned to be no environmental concern or low environmental risk (Map IDs 4, 6, 7, 11, 14, 52, 55, 67, 70, 75, 79, 85, 87, 111, 126, 139, 141, 147, 155, and 171). Refer to the us Materials Project Impact Evaluation for discussions.	
□Unresolved ☑Resolved □No Issue		<b>Activity Concerns</b> : TxDOT is concerned with the acquisition of oil and gas wells (and pment) such as process, piping, production equipment, pipelines, etc. Select below all	
	☐Yes ⊠No	Additional Research needed or uncertain of impacts. Request assistance from ENV.	
	☐Yes ⊠No	Database search identified TRRC VCP Site within 0.5 miles of project.	
	☐Yes ⊠No	Oil/ Gas Wells within future ROW.	
	☐Yes ⊠No	Spills or other Contamination Issues associated with ancillary equipment or pipelines.	
	⊠Yes □No	Other- Describe: Pipeline crossings	
distance. These	features are n	ed Issues:Six natural gas pipelines transect the project and one runs parallel for a short ot considered an environmental concern. Additional information regarding the 5.2. Formal utilities location and advance planning would be required to facilitate	

	e and utilities adjustments and to otherwise avoid associated impacts. TxDOT Fort Worth District SUE nator and ROW will be responsible for the adjustments and displacements.		
□Unresolved ⊠Resolved □No Issue	Non-LPST Source Contamination Concerns discovered during the database search: These are sites or locations that have a potential for soil and groundwater contamination and are not associated with LPST sites. Select below all that apply.		
	☐Yes ⊠No	Additional Research is needed or uncertain of impacts from a Non-LPST site. Request assistance from ENV.	
	☐Yes ⊠No	Database search identified SEMS Active NPL or Not NPL site(s) within 1 mile of the project. This may be identified on a database search as a CERCLIS or NPL site.	
	⊠Yes □No	Database search identified SEMS Archived NPL or Not NPL site(s) within 0.5 miles of the project. This may be identified on a database search as a CERCLIS NFRAP.	
	☐Yes ⊠No	Database search identified RCRA Corrective Action(s) site within 1 mile of project.	
	☐Yes ⊠No	Database search identified RCRA TSD facilities within 0.5 miles of project.	
	⊠Yes □No	Database search identified TCEQ IHW Corrective Action sites within 1 mile of project.	
	☐Yes ⊠No	Database search identified TCEQ Superfund sites within 1 mile of project.	
	⊠Yes □No	Database search identified TCEQ VCP sites within 0.5 miles of project.	
	⊠Yes □No	Database search identified TCEQ IOP sites within 0.5 miles of project.	
	⊠Yes □No	Other- Describe: Brownfields, DCRPS, and RCRAGR06	
Explain Unresol	ved or Resolve	ed Issues:	
Resolved: Thirteen sites are determined to be no environmental concern or low environmental risk (Map IDs 7, 17, 60, 76, 95, 114, 123, 134, 136, 139(2), 190, and 194).  See Section 5.1 and the attached Southeast Connector Hazardous Materials Impact Evaluation for discussions.			
□Unresolved ☑Resolved □No Issue	Resolved suspected (based on visual observations) landfills, dump sites, or waste pits. These concerns may		
	☐Yes ⊠No	Additional research is needed or uncertain of impacts. Request assistance from ENV.	
	⊠Yes □No	Database search identified active/closed/abandoned CALF or MSWLF landfill sites within .5 miles of the project.	
	☐Yes ⊠No	Other- Describe:	
Explain Unresol Resolved:	Explain Unresolved or Resolved Issues: Resolved:		
Four CALF sites (Map IDs 9, 82, 152, 189) and three MSWLF sites (Map IDs 10, 102, and 114), are determined to be no environmental concern or low environmental risk. See Section 5.1 and the Southeast Connector Hazardous Impact Evaluation.			

8.3 Did the ISA identify any Unresolved Hazardous Material concerns?
☐ No, unresolved hazardous materials concerns were identified and/or all potential concerns were resolved within the ISA. No further hazardous materials action is required. The ISA is complete for this project. Any unanticipated hazardous materials impacts encountered during the project construction phase shall be addressed in accordance with regulatory requirements and TxDOT standard specifications. Complete Sections 9 and 10 and maintain a copy of the ISA and all applicable attachments in the project file.
Yes, the ISA identified one or more unresolved hazardous materials concerns requiring additional investigations or assessments. An Issues, Identification, and Resolution (IIR) form shall be completed in ECOS to track the additional investigations and assessments. Complete Sections 9 and 10 and maintain a copy of the ISA and all applicable attachments in the project file.


Section 9: Reference Materials Utilized (Identify any referenced materials and attach them to the ISA or in the			
project file.			
Referenced	⊠ Project Map	□ USGS Topo Maps	
Materials Used	☐ ROW Maps/Files	☐ Sanborn Fire Insurance Maps	☐ Temporary Use Agreements
Useu	□ TxDOT As-Built Plans	☐ Notifications	□ Photographs
		□ Regulatory Database	☐ Record of Interviews
	⊠ Other: Hazardous Materials S	ite Map, Pipeline Information, VCP	Data for Map IDs 66 and 69.
Section 10: 0	Contact/Completed by		
Name:	Jonathan Stewart Tel: 214-703-5151		Tel: 214-703-5151
Title:	Sr. Environmental Scientist		
Firm (District Section):	Civil Associates, Inc.		
Address:	9330 LBJ Freeway, Suite 1150	0, Dallas, TX 75243	
Signature:	Jone Man Allward		Date: July 11, 2019


### Appendix A


The following table shows the revision history for this guidance document.

	Revision History
Effective Date	Reason for and Description of the Change
April 2017	Version 5
	The cover page has additional fields related to specific project information. This is added to personalize the ISA to a project.
	Section 2 was modified to acknowledge that asbestos or lead-in-paint issues might exist on our construction projects, but the identification and resolution to these issues are outside of the ISA process and are handled programmatically by TxDOT (usually in CST or the ROW processes).
	Section 3 was modified by adding an additional screening option. You are now able to screen out of performing a full ISA if your project meets the parameters described.
	Section 6 was reformatted to remove the numerous selections related to the Possible Site Survey Concerns. Additionally, redundant questions were removed to make the section easier to use. Under the new format, the preparer is required to insert the survey dates and a description of what was identified during the survey.
	Minor changes were made to terminology throughout the ISA, this was performed to clarify and streamline the process.
	Section 8.1 has been modified to provide resolution to potential hazardous materials issues that can be resolved easily during the ISA process. Additionally, a comment field was added to provide direction related to issues requiring further action to resolve. This will streamline the process in reducing the amount of IIR entries requires in ECOS and will reduce the time required to review a project.
June 2016	Version 4
	Modifications to Section 5: Web links and database names were modified based on changes made by regulatory agency websites.
October 2014	Version 3
	Modifications to Section 2: Clarified this section to better define what are asbestos and lead-in-paint concerns. Changes were made due to numerous comments from the end-user.
	An additional note was added to this section. This note directs end-users to ENV-HMM for further assistance related to lead-in-paint issues.
	Modifications to Section 3: The question concerning Project Excavations in Section 3.1 was modified to match the definition used in Scoping Procedure for Categorically Excluded TxDOT Projects for Hazardous Materials found in the NEPA and Project Development Toolkit.
	Modifications to Section 5: Web links were modified based on changes made by regulatory agency websites.
	Modifications to 8.2: Clarified the "Yes" answer in 8.2 to remove the need for additional assessments for all identified hazardous materials concerns. The question was modified due to comments by the end-user.


August 2014	Version 2
	Removed introductory note describing ISA threshold criteria. Note was removed because the ISA threshold criteria are located in other TxDOT guidance.
April 2014	Version 1
	Released

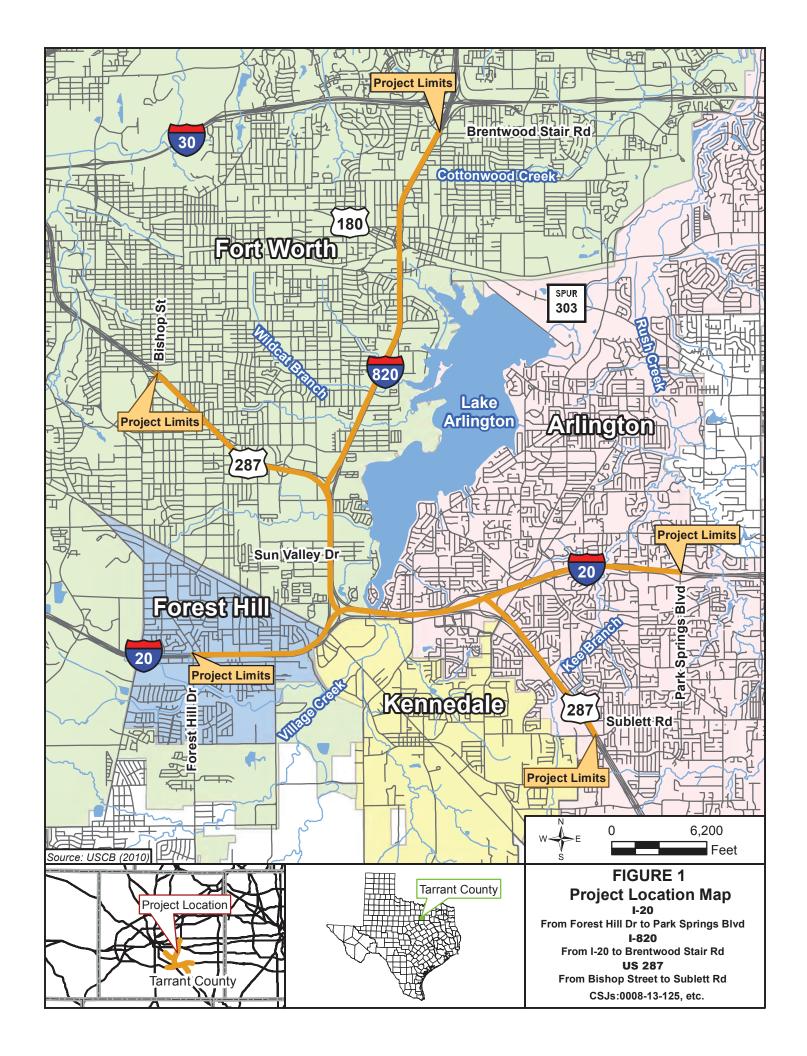

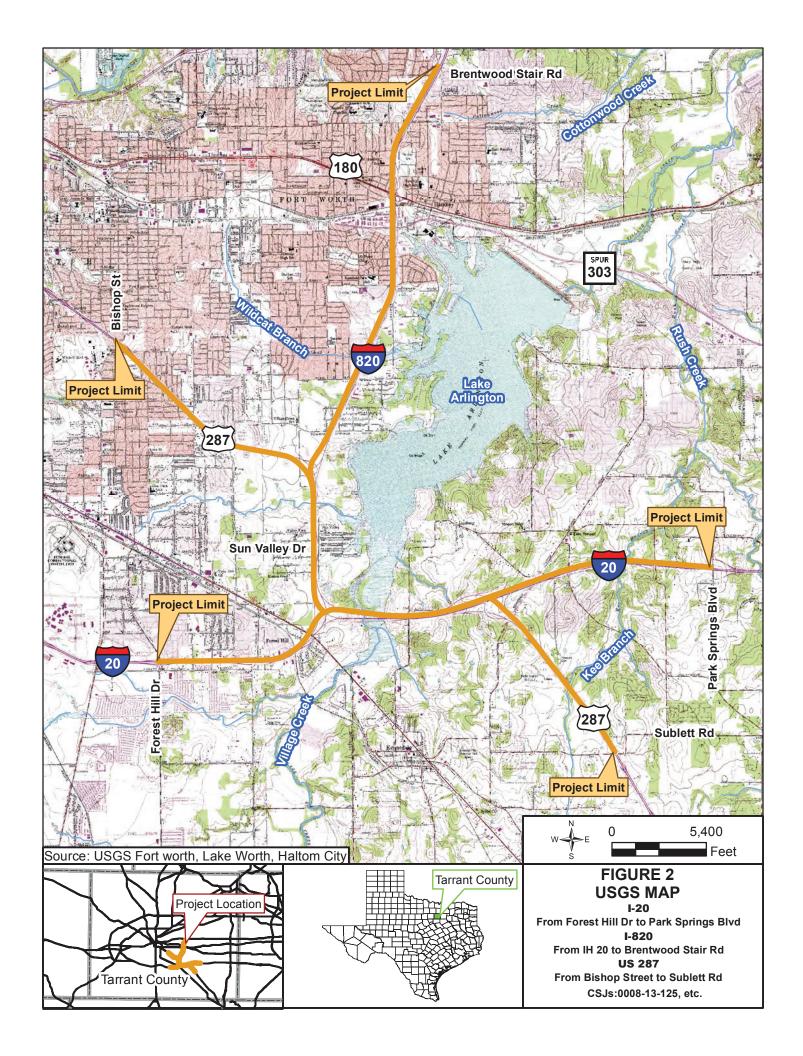

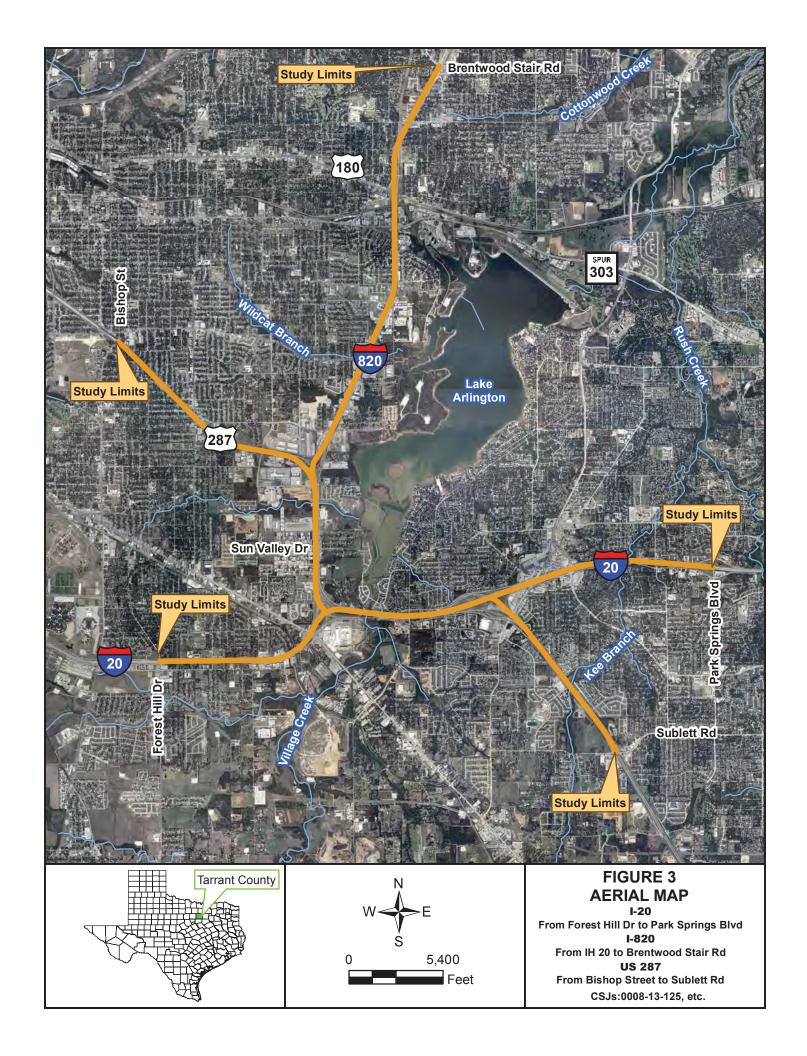

Page 1 of 30 IH 20

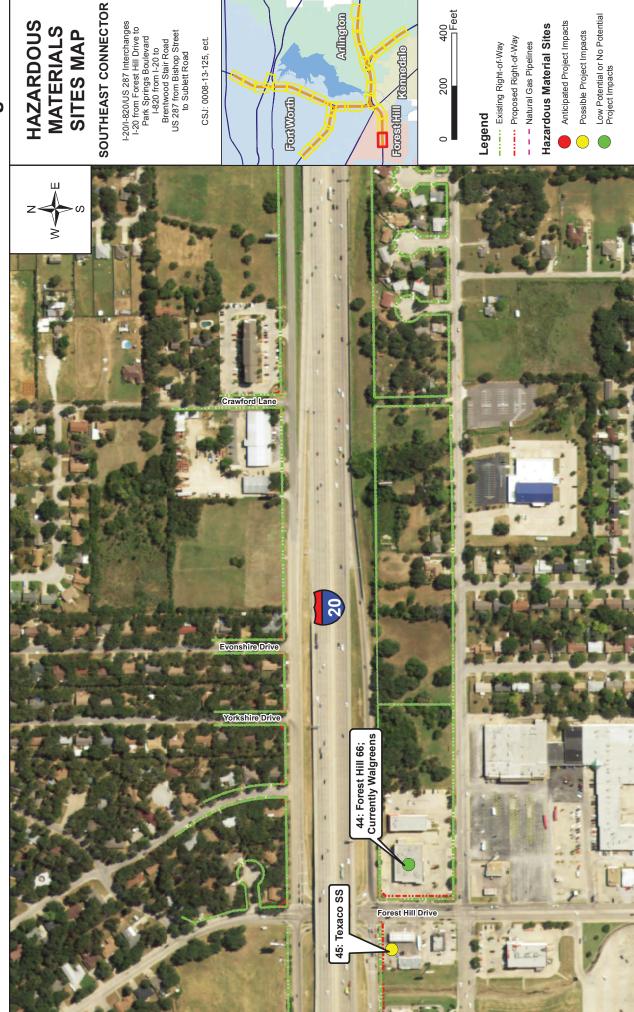

SOUTHEAST CONNECTOR HAZARDOUS MATERIALS SITES MAP Arillngton I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road Low Potential or No Potential Project Impacts Page 2 of 30 Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ---- Proposed Right-of-Way CSJ: 0008-13-125, ect. Natural Gas Pipelines ---- Existing Right-of-Way Forestill Kennedale 200 **FortWorth** Legend THE PERSON щ 40: Dykes Air 13: Former Texaco; Currently Texas Toast Autos Anglin Drive Shady Hill Drive 38: Anglin Food Store IH 20 82


Hartman Road

Hartman Road

IH 20

Page 3 of 30




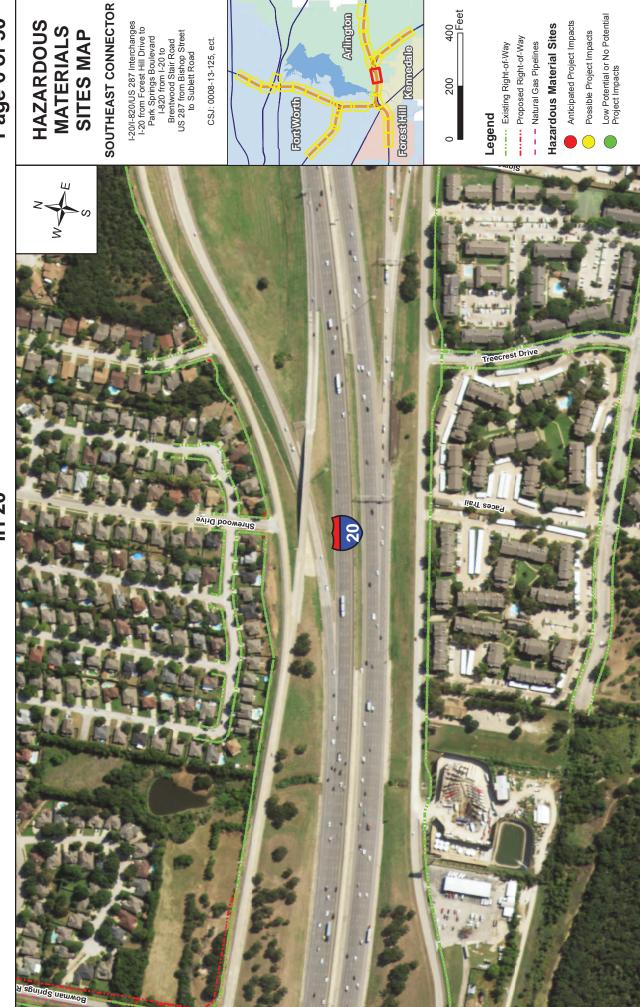



# 400 □ Feet

Page 7 of 30 IH 20

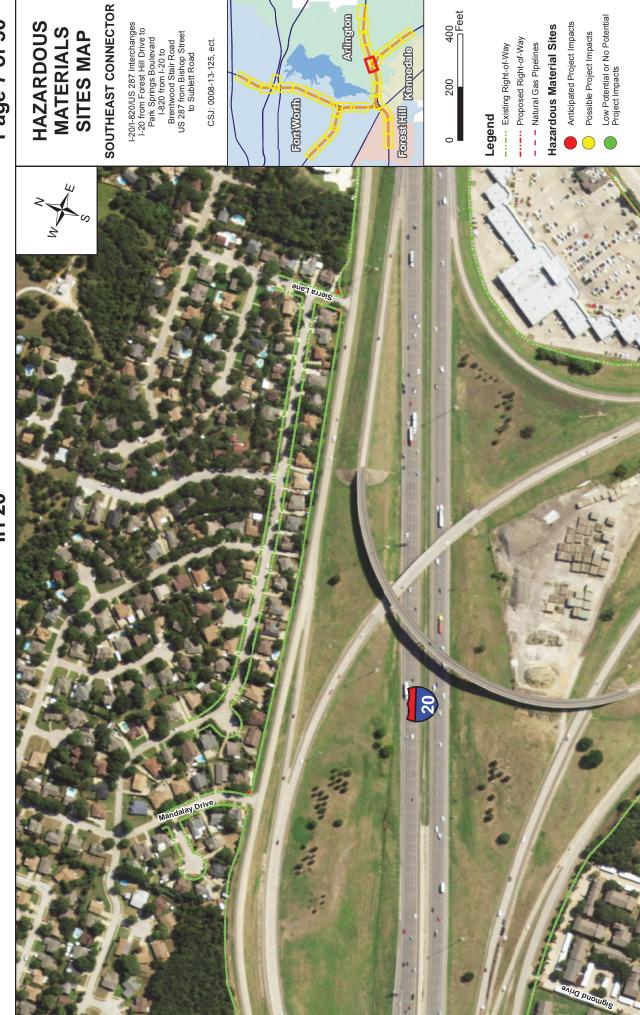

SOUTHEAST CONNECTOR 400 □ Feet Arillngton I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road Low Potential or No Potential Project Impacts Page 9 of 30 MATERIALS SITES MAP **HAZARDOUS** Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ---- Proposed Right-of-Way CSJ: 0008-13-125, ect. Natural Gas Pipelines ---- Existing Right-of-Way Forestill Remodale 200 FortWorth Legend (S) 111: Chevron 60157013; Currently DEKRA Emissions & Safety 55: Texaco 4119100; Currently 7-Eleven 34099 79: Minyard on the Go 4072; Currently Wendy's Restaurant Green Oaks Boulevard

IH 20

SOUTHEAST CONNECTOR Page 10 of 30 Arillngton 400 □ Feet HAZARDOUS MATERIALS SITES MAP I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road Low Potential or No Potential Project Impacts Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ---- Proposed Right-of-Way CSJ: 0008-13-125, ect. Natural Gas Pipelines ---- Existing Right-of-Way Forestill Kennedale 200 FortWorth Legend Щ 63: Fuel Up Mart 76: Tiger Mart 77 Kelly Elliot Road Kelly Elliot Road IH 20 8

Page 11 of 30 IH 20



SOUTHEAST CONNECTOR Page 12 of 30 400 □ Feet HAZARDOUS MATERIALS SITES MAP Arillngton I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road Low Potential or No Potential Project Impacts Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ---- Proposed Right-of-Way CSJ: 0008-13-125, ect. Natural Gas Pipelines ---- Existing Right-of-Way Forestill Kennedale 200 FortWorth Legend 6. Natural Gas Pipeline 10.75" Diameter Operated by Williams MLP Operating LLC **US 287** 287 134: Multicultural Western Heritage Museum Bishop Street

SOUTHEAST CONNECTOR Page 13 of 30 400 □ Feet HAZARDOUS MATERIALS SITES MAP Arillngton I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road Low Potential or No Potential Project Impacts Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ----- Proposed Right-of-Way CSJ: 0008-13-125, ect. Natural Gas Pipelines ---- Existing Right-of-Way Forestill Kennedale 200 FortWorth Legend 68: Z One Grocery & Grill **US 287** 287

SOUTHEAST CONNECTOR Page 14 of 30 400 □ Feet HAZARDOUS MATERIALS SITES MAP Arillngton I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road Low Potential or No Potential Project Impacts Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ---- Proposed Right-of-Way CSJ: 0008-13-125, ect. Natural Gas Pipelines ---- Existing Right-of-Way Forestill Kennedale 200 **FortWorth** Legend **US 287** 287 62: N & N Foodstore 32: Former Service Station; Currently Vacant 26: No Name; Currently Vacant Willbarger Street

Page 15 of 30 **US 287** 



SOUTHEAST CONNECTOR Page 16 of 30 400 □ Feet I-20/I-820/US 287 Interchanges
I-20 from Forest Hill Drive to
Park Springs Boulevard
I-820 from I-20 to
Brentwood Stair Road
US 287 from Bishop Street
to Sublett Road Arillngton MATERIALS SITES MAP **HAZARDOUS** CSJ: 0008-13-125, ect. Forestill Remodale 200 FortWorth **US 287** 7: Consolidated Freightways 287

Carrier and a continue or a continue or

UPLY SS

### Legend

---- Proposed Right-of-Way ---- Existing Right-of-Way

Natural Gas Pipelines

10: City of Fort Worth MLK Drop Off Station

Hazardous Material Sites

Anticipated Project Impacts

Possible Project Impacts

Low Potential or No Potential Project Impacts

SOUTHEAST CONNECTOR Page 17 of 30 HAZARDOUS MATERIALS SITES MAP Arillngton I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road CSJ: 0008-13-125, ect. Forestill Kennedale FortWorth 19: 7-Eleven 27367 5: QuikTrip 856 287 **US 287** 

## 400 □ Feet Low Potential or No Potential Project Impacts Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ---- Proposed Right-of-Way Natural Gas Pipelines ---- Existing Right-of-Way 200 Legend 23: Three Point Cleaners N Little School Rd 104: Wal-Mart Supercenter 3284

SOUTHEAST CONNECTOR Page 18 of 30 Arillngton HAZARDOUS MATERIALS SITES MAP I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road Low Potential or No Potential Project Impacts Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ----- Proposed Right-of-Way CSJ: 0008-13-125, ect. Natural Gas Pipelines ---- Existing Right-of-Way Forestill Kennedale 200 FortWorth Legend **US 287** 287

Page 19 of 30 **US 287** 



SOUTHEAST CONNECTOR Page 20 of 30 Arillngton I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road Low Potential or No Potential Project Impacts MATERIALS SITES MAP **HAZARDOUS** Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ---- Proposed Right-of-Way CSJ: 0008-13-125, ect. Natural Gas Pipelines ---- Existing Right-of-Way Forestill Remedale 200 FortWorth Legend 9: Sublett/287 Land; Currently a Shopping Center Currently Primrose School of Southwest Arlington 136: 4621 W. Sublett; 94: Sublett Shell **US 287** 116: Kroger Fuel Center 592 188× Operated by DFW Midstream Services LLC 7. Natural Gas Pipeline 10.75" Diameter

Page 21 of 30 IH 820



SOUTHEAST CONNECTOR Page 22 of 30 400 □ Feet HAZARDOUS MATERIALS SITES MAP Arillngton I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road Low Potential or No Potential Project Impacts Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ---- Proposed Right-of-Way CSJ: 0008-13-125, ect. Natural Gas Pipelines ---- Existing Right-of-Way Forestill Kennedale 200 **FortWorth** Legend 4. Natural Gas Pipeline
20" Diameter
Operated by
Energy Transfer Company IH 820 42: Tiger Mart 61 820

SOUTHEAST CONNECTOR Page 23 of 30 Arillngton HAZARDOUS MATERIALS SITES MAP I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road Low Potential or No Potential Project Impacts Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ---- Proposed Right-of-Way CSJ: 0008-13-125, ect. Natural Gas Pipelines ---- Existing Right-of-Way Forestill Kennedale 200 **FortWorth** Legend 56: Eastside Center; Currently U-Box of Fort Worth IH 820 **Currently U-Box of Fort Worth** 56: Eastside Center; 820

Page 24 of 30 IH 820




Page 25 of 30 IH 820



SOUTHEAST CONNECTOR Page 26 of 30 Arillngton I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road MATERIALS SITES MAP **HAZARDOUS** CSJ: 0008-13-125, ect. Forestill Kennedale 200 Fort Worth 39: Tex O Kan Transportation Co., Inc. 53: East Side Office Supply IH 820 Fitzhugh Avenue 139: Solvents Solutions Manufacture; 57: Bobcat of Fort Worth 820

Low Potential or No Potential Project Impacts Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ---- Proposed Right-of-Way Natural Gas Pipelines ---- Existing Right-of-Way Legend **Currently Anderson Laboratories** Willard Road

Page 27 of 30 IH 820

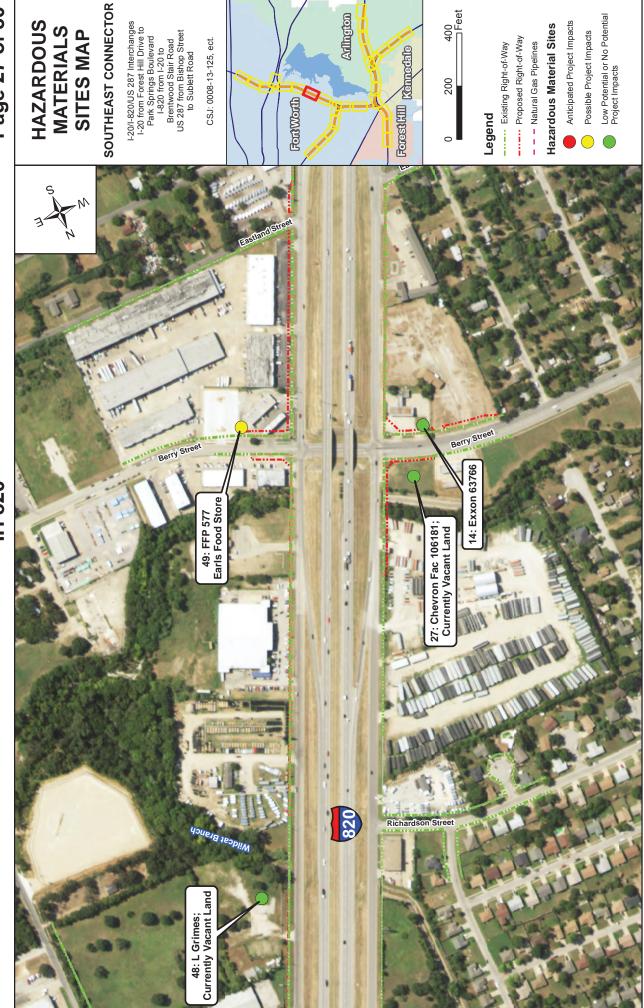


SOUTHEAST CONNECTOR Page 28 of 30 HAZARDOUS MATERIALS SITES MAP Arillngton I-20/I-820/US 287 Interchanges I-20 from Forest Hill Drive to Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road Low Potential or No Potential Project Impacts Anticipated Project Impacts Hazardous Material Sites Possible Project Impacts ---- Proposed Right-of-Way CSJ: 0008-13-125, ect. Natural Gas Pipelines ---- Existing Right-of-Way Forestill Kennedale 200 FortWorth Legend 4: Former Durgha Property 22: Leito Enterprises 23: Larry Riggan IH 820 50: Douglas & Elms; Currently C&S Trailers 33: Bob McCaslin Anchor 820


Page 29 of 30 **HAZARDOUS MATERIALS** IH 820



Page 30 of 30 IH 820




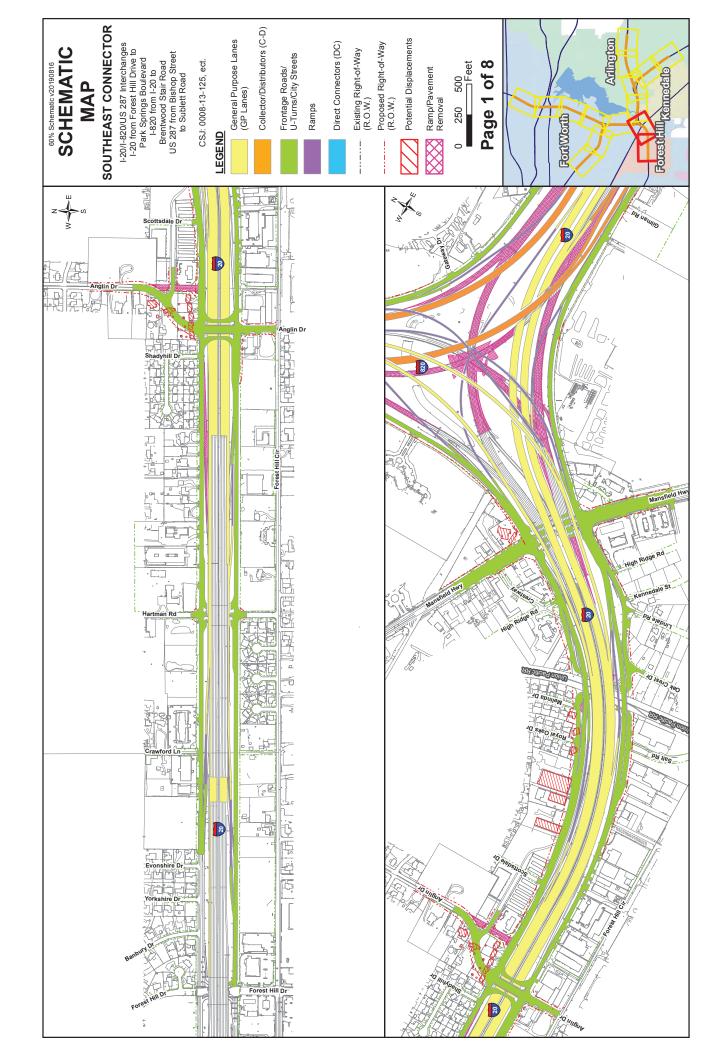


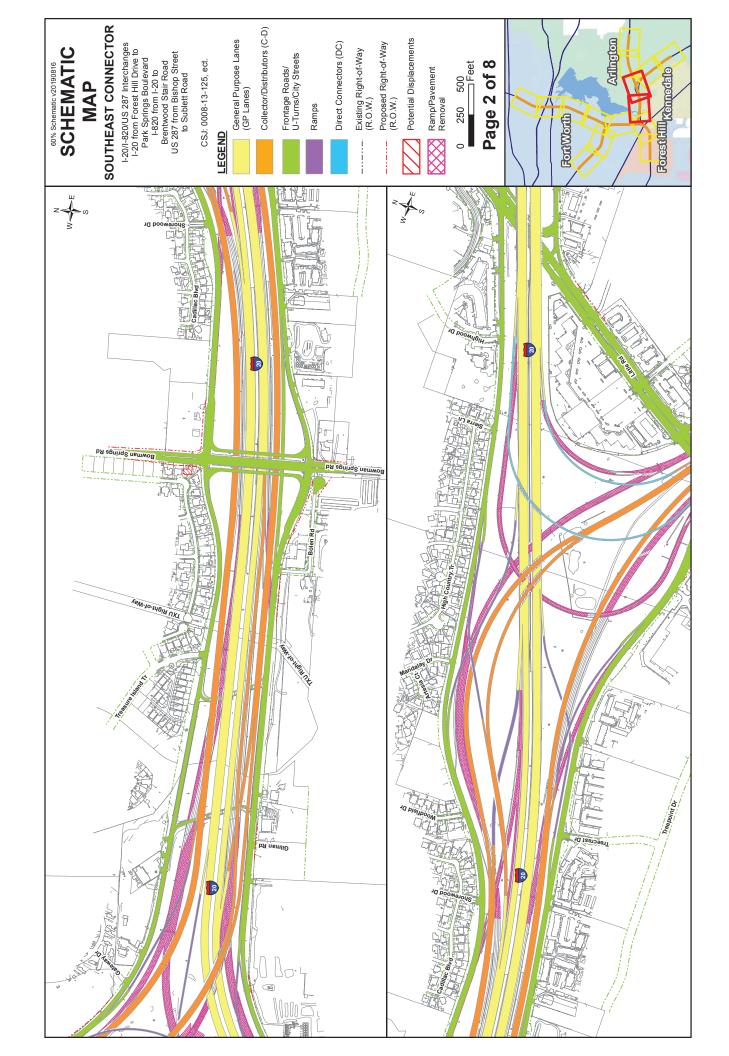






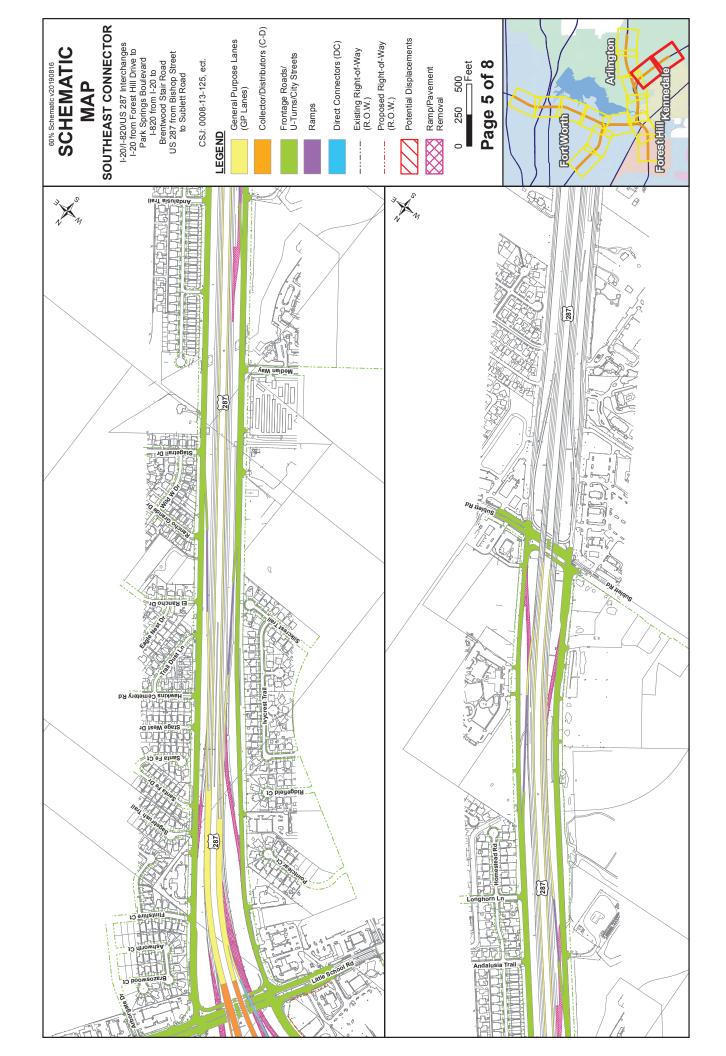

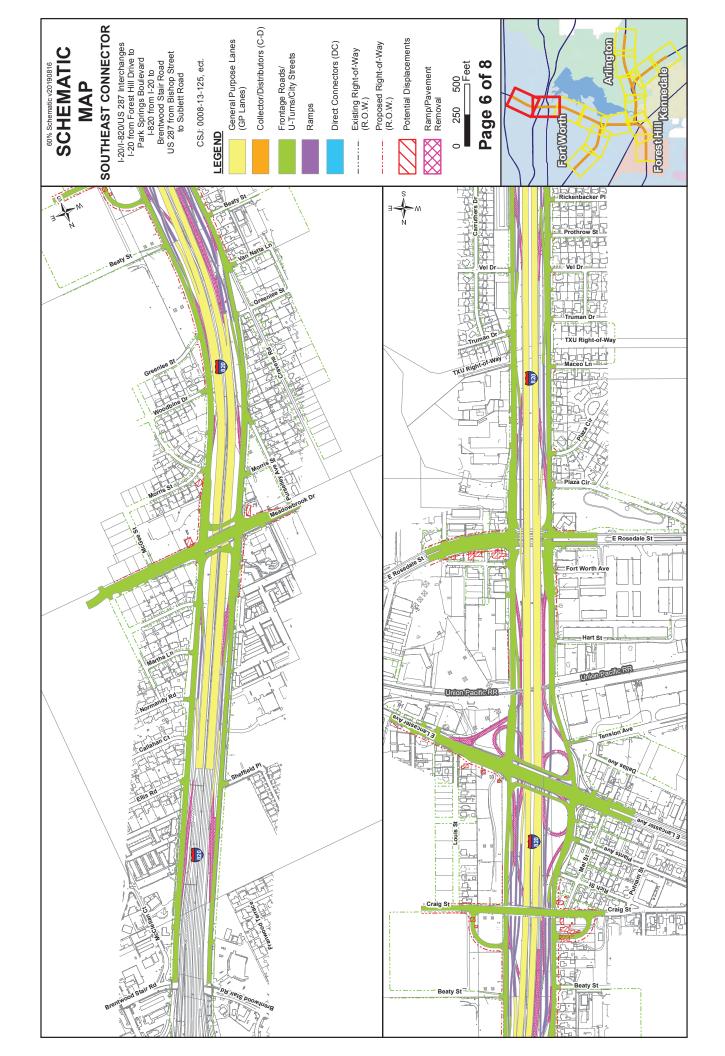

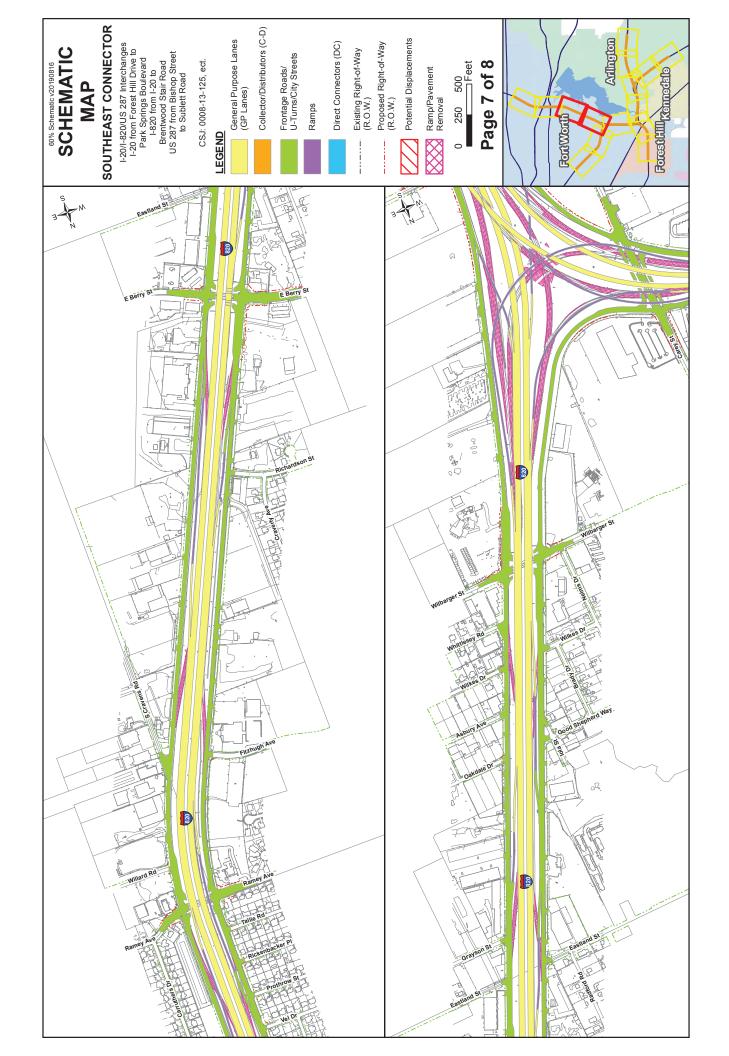





## Project Area Photographs

## Southeast Connector I-20/I-820/US 287 Interchange

I-20 from Forest Hill Drive to east of Park Springs Boulevard I-820 from I-20 to Brentwood Stair Road US 287 from Bishop Street to Sublett Road

CSJ(s):0008-13-125, etc. Tarrant County, Texas

Fort Worth District 7/11/2019





Date Photo Taken: 7/8/2019

**Coordinates:** N 32° 41′ 56.49″

W 97° 14' 13.30"

**Direction of View:** Southwest

Comments: Map ID: 4; Former Durgha Property; 4320 E. Loop 820 S., Fort Worth, TX; Currently

Worth Trailer



Photo ID: 2

Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 08.97"

W 97° 12' 14.64"

**Direction of View:** Northeast

**Comments:** Map ID: 5; QuikTrip 856; 4930 Little Rd., Arlington, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 41' 37.71"

W 97° 14' 53.07"

**Direction of View:** Southeast

**Comments:** Map ID: 6; Southeast Service Center; 5000 Martin Luther King Frwy. (US 287), Fort

Worth, TX



Photo ID: 4

Date Photo Taken: 7/8/2019

**Coordinates:** N 32° 41' 40.06"

W 97° 14' 35.70" **Direction of View:** East

Comments: Map ID: 7;

Consolidated Freightways; 4601

Carey St., Fort Worth, TX



Date Photo Taken: 7/8/2019

**Coordinates:** N 32° 38' 45.75"

W 97° 11' 10.31" **Direction of View:** East

Comments: Map ID: 9; Sublett/287 Land; NW 287 & Sublett Rd. Currently occupied by a shopping center including a

Kroger Fuel Center.



Photo ID: 6

Date Photo Taken: 7/8/2019

Coordinates: N 32° 41' 34.93"

W 97° 14' 43.20" **Direction of View:** South

**Comments:** Map ID: 10; City of Fort Worth MLK Drop Off Station; 5150 Martin Luther King Fwy.

Fort Worth, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 47.29"

W 97° 14' 23.57"

**Direction of View:** Northeast

Comments: Map ID: 11; Clapp Buddy, Inc.; 5301 Laster Rd., Fort Worth, TX; Currently Long

John Silver's



Photo ID: 8

Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 39.81"

W 97° 14′ 56.22″ **Direction of View:** South

**Comments:** Map ID: 12; Arthur Hagar; 5020 SE Loop 820, Fort

Worth, TX 76140



Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 42.59"

W 97° 15' 03.69" **Direction of View:** North

Comments: Map ID: 13; Former Texaco; 4901 E. California Pkwy (I-20); Currently Texas

**Toast Autos** 



Photo ID: 10

Date Photo Taken: 7/8/2019

Coordinates: N 32° 42' 29.77"

W 97° 13′ 56.46″ **Direction of View:** South

Comments: Map ID: 14; Exxon 63766; 5728 E. Berry St., Fort Worth, TX; Currently Vacant



Date Photo Taken: 7/8/2019

**Coordinates:** N 32° 41' 20.58"

W 97° 14' 30.96" **Direction of View:** North

Comments: Map ID: 16; Prime Equipment 115; 4900 E. Loop 820 S., Fort Worth, TX; Currently

Setra Coach



Photo ID: 12

Date Photo Taken: 7/8/2019

Coordinates: N 32° 43' 35.01"

W 97° 13' 28.12"

**Direction of View:** Northeast

Comments: Map ID: 17; Fort Worth Tower, Inc.; 1901 E Loop

820 S., Fort Worth, TX



Date Photo Taken: 7/8/2019

**Coordinates:** N 32° 40' 06.73"

W 97° 12' 11.98"

Direction of View: East

Comments: Map ID: 19; 7-Eleven 27367; 4901 Little Rd., Arlington,

TX



Photo ID: 14

Date Photo Taken: 7/8/2019

**Coordinates:** N 32° 45′ 11.38″

W 97° 13' 00.67"

**Direction of View:** Northeast

Comments: Map ID: 21; Abandoned Service Station; 1717 E. Loop 820, Fort Worth, TX; Currently Joe's Emergency Auto Repair



Date Photo Taken: 7/8/2019

**Coordinates:** N 32° 41' 51.87"

W 97° 14' 12.06"

Direction of View: East

Comments: Map ID: 22; Leito Enterprises; 4333 E. Loop 820 S.,

Fort Worth, TX 76119



Photo ID: 16

Date Photo Taken: 7/8/2019

Coordinates: N 32° 42' 14.71"

W 97° 13' 59.34" **Direction of View:** East

Comments: Map ID: 23; Larry Riggan; 4301 E. Loop 820 S., Fort

Worth, TX



Date Photo Taken: 4/18/2019

Coordinates: N 32° 43' 45.52" W

97° 13' 33.90" Direction of View: East

Comments: Map ID: 24; Zoom In Market 6; 6020 E. Rosedale St.,

Fort Worth, TX



Photo ID: 18

Date Photo Taken: 7/8/2019

**Coordinates:** N 32° 39' 57.87"

W 97° 14' 32.01"

**Direction of View:** Northeast

**Comments:** Map ID: 25; Texaco Food Mart; 5317 Mansfield Hwy,

Ste 101, Forest Hill, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 41' 57.94"

W 97° 15' 41.12"

**Direction of View:** Northeast

**Comments:** Map ID: 26; 4244 Wilbarger St., Fort Worth, TX



Photo ID: 20

Date Photo Taken: 7/8/2019

Coordinates: N 32° 42' 30.67"

W 97° 13' 55.27"

**Direction of View:** Northwest

Comments: Map ID: 27; Chevron Fac 106181; 5729 E. Berry St.,

Fort Worth, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 57.10"

W 97° 14' 34.05"

**Direction of View:** Northwest

Comments: Map ID: 28; Kwik Pik Food Mart; 5304 Mansfield Hwy. (Bus 287) Forest Hill, TX; Formerly 12G01 Mobil Service Station



Photo ID: 22

Date Photo Taken: 7/8/2019

Coordinates: N 32° 41' 51.06"

W 97° 14' 22.34" **Direction of View:** South

**Comments:** Map ID: 29; Reeder Distributors; 5450 Wilbarger St.,

Fort Worth, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 45' 17.20"

W 97° 12' 53.87"

Direction of View: North

Comments: Map ID: 30; Exxon Station 64732 / Fina Station RAS 64732; 6601 Brentwood Stair Rd., Fort Worth, TX; Currently

QuikTrip 861



Photo ID: 24

Date Photo Taken: 7/8/2019

Coordinates: N 32° 42' 00.70"

W 97° 15' 43.15" **Direction of View:** West

**Comments:** Map ID: 32; Former Service Station; 4213 Wilbarger St., Fort Worth, TX; Currently

Vacant



Date Photo Taken: 4/18/2019

Coordinates: N 32° 42' 14.71"

W 97° 13' 59.34" **Direction of View:** East

Comments: Map ID: 33; 3951 E. Loop 820 S., Fort Worth, TX; Currently Steel Construction

Services



Photo ID: 26

Date Photo Taken: 7/8/2019

Coordinates: N 32° 45' 18.57"

W 97° 13' 00.73"

**Direction of View:** Northwest

Comments: Map ID: 34; Shell Oil Co. Retail Facility; 6517 Brentwood Stair Rd., Fort Worth, TX; Currently Metroplex Tax Advisors LLC.



Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 26.76"

W 97° 12' 02.31"

Direction of View: West

Comments: Map ID: 35; Meineke Car Care Center 4169; 5980 W. Pony Webb Rd., Arlington, TX



Photo ID: 28

Date Photo Taken: 7/8/2019

Coordinates: N 32° 45' 10.33"

W 97° 13' 01.24"

**Direction of View:** Northeast

Comments: Map ID: 36;

Workingmans Friend 510; 1801 E. Loop 820 Fort Worth, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 39.24"

W 97° 15' 09.22"

**Direction of View:** Northwest

**Comments:** Map ID: 38; Anglin Food Store; 4724 SE Loop 820,

Forest Hill, TX



Photo ID: 30

Date Photo Taken: 7/8/2019

Coordinates: N 32° 42' 49.97"

W 97° 13' 39.81" **Direction of View:** East

Comments: Map ID: 39; Tex 0 Kan Transportation Co., Inc.; 3301 E. Loop 820 S., Fort Worth,

TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 39.24"

W 97° 15' 09.22" **Direction of View:** East

**Comments:** Map ID: 40; Dykes Air; 4800 SE Loop 820, Fort Worth,

ΤX



Photo ID: 32

Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 45.64"

W 97° 14' 23.34" **Direction of View:** East

**Comments:** Map ID: 41; Paradise Quick Stop 1; 5401 Sun Valley

Dr., Fort Worth, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 44' 46.67"

W 97° 13' 22.81" **Direction of View:** North

Comments: Map ID: 42; Tiger Mart 61; 2250 E. Loop 820, Fort

Worth, TX



Photo ID: 34

Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 37.09"

W 97° 16' 09.82" **Direction of View:** North

Comments: Map ID: 44; Forest Hill 66; 6551 Forest Hill Dr., Forest Hill, TX; Currently

Walgreens



Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 39.21"

W 97° 16' 12.49"

Direction of View: West

**Comments:** Map ID: 45; Texaco SS; 6550 Forest Hill Dr., Forest

Hill, TX



Photo ID: 36

Date Photo Taken: 4/18/2019

Coordinates: N 32° 43' 47.15"

W 97° 13' 26.81" **Direction of View:** North

Comments: Map ID: 46; Chevron 60106192; 6101 E. Rosedale St., Fort Worth, TX; Currently

Texaco



Date Photo Taken: 7/8/2019

Coordinates: N 32° 42' 44.62"

W 97° 13' 42.83" **Direction of View:** East

**Comments:** Map ID: 48; L Grimes; 3401 E. Loop 820 S., Fort Worth,

TX



Photo ID: 38

Date Photo Taken: 7/8/2019

Coordinates: N 32° 42' 27.20"

W 97° 13' 50.19" **Direction of View:** East

**Comments:** Map ID: 49; FFP 577 Earls Food Store; 5800 E Berry

St., Fort Worth, TX



Date Photo Taken: 7/8/2019

Coordinates: Click here to

enter text.

Direction of View: Click here to

enter text.

**Comments:** Map ID: 50; Douglas & Elms; 5733 Good Shepherd

Way, Fort Worth, TX



Photo ID: 40

Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 41.00"

W 97° 14' 49.03"

**Direction of View:** Southeast

Comments: Map ID: 52; Custom Win Dor, Inc.; 5140 S.E. Loop 820, Fort Worth, TX; Currently

Preferred Pump



Date Photo Taken: 7/8/2019

Coordinates: N 32° 43' 01.83"

W 97° 13' 32.14"

**Direction of View:** Northeast

**Comments:** Map ID: 53; East Side Office Supply; 2837 S. Cravens

Rd., Fort Worth, TX



Photo ID: 42

Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 35.81"

W 97° 11' 35.02" **Direction of View:** South

Comments: Map ID: 55; Texaco 4119100; 4401 W. Green Oaks Blvd., Arlington, TX; Currently 7-

Eleven 34099



Date Photo Taken: 7/8/2019

Coordinates: N 32° 44' 01.60"

W 97° 13' 38.19"

**Direction of View:** Southeast

Comments: Map ID: 56; Eastside Center; 6050 Tension Dr., Fort Worth, TX; Currently U-Box of Fort

Worth



Photo ID: 44

Date Photo Taken: 7/8/2019

Coordinates: N 32° 43' 02.91"

W 97° 13' 32.25"

**Direction of View:** Northeast

**Comments:** Map ID: 57; Bobcat of Fort Worth; 2727 E. Loop 820 S.,

Fort Worth, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 47.16"

W 97° 14' 33.57" **Direction of View:** East

**Comments:** Map ID: 58; Renard Blackstock; 6704 Lindale Rd.,

Fort Worth, TX



Photo ID: 46

Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 27.26"

W 97° 12' 01.29" **Direction of View:** South

Comments: Map ID: 59; A & R Food Mart; 5960 W. Poly Webb

Rd., Arlington, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 45' 15.12"

W 97° 12' 56.04" **Direction of View:** South

Comments: Map ID: 60; NCS 2380, 6620 Brentwood Stair Rd.,

Fort Worth, TX



Photo ID: 48

Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 24.59"

W 97° 14' 30.55" **Direction of View:** West

Comments: Map ID: 61; United Equipment Rentals Gulf 537; 5930 E. Loop 820 S., Fort Worth,

TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 41' 57.70"

W 97° 15' 37.12"

Direction of View: West

Comments: Map ID: 62; N & N Foodstore; 4245 Wilbarger St.,

Fort Worth, TX



Photo ID: 50

Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 37.61"

W 97° 10′ 37.39″ **Direction of View:** North

**Comments:** Map ID: 63; Fuel Up Mart; 4331 Kelly Elliott Rd.,

Arlington, TX



Date Photo Taken: 7/8/2019

**Coordinates:** N 32° 39' 53.78"

W 97° 14' 25.92"

Direction of View: North

Comments: Map ID: 67; Royal Market; 1302 Mansfield Hwy., Fort Worth, TX; Currently Nancy's

Liquor



Photo ID: 52

Date Photo Taken: 7/8/2019

Coordinates: N 32° 42' 05.20"

W 97° 15' 46.05"

**Direction of View:** Northeast

Comments: Map ID: 68; Z One Grocery & Grill; 4225 Miller Ave.,

Fort Worth, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 57.96"

W 97° 14' 28.79"

**Direction of View:** Northwest

**Comments:** Map ID: 70; Central Freight Lines, Inc.; 5200 E. Loop

820 S., Fort Worth, TX



Photo ID: 54

Date Photo Taken: 7/8/2019

Coordinates: N 32° 45' 20.83"

W 97° 13' 02.93" **Direction of View:** North

Comments: Map ID: 75; Akranis Conoco; 6509 Brentwood Stair Rd., Fort Worth, TX; Currently RZ Food Mart



Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 29.76"

W 97° 10' 36.27" **Direction of View:** East

Comments: Map ID: 76; Tiger Mart 77; 4401 Kelly Elliott Rd.,

Arlington, TX



Photo ID: 56

Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 36.24"

W 97° 11' 37.77"

**Direction of View:** Southwest

Comments: Map ID: 79; Minyard on the Go 4072; 4420 W. Green Oaks Blvd., Arlington, TX; Currently Wendy's Restaurant



Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 51.40"

W 97° 14' 25.79"

**Direction of View:** Northwest

Comments: Map ID: 80; QuikTrip 874; 1225 W Kennedale Pkwy,

Fort Worth, TX 76140



Photo ID: 58

Date Photo Taken: 7/8/2019

Coordinates: N 32° 43' 46.12"

W 97° 13' 23.81"

**Direction of View:** Southwest

Comments: Map ID: 81; Bill Patterston Motors; 6200 E. Rosedale St., Fort Worth, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 31.90"

W 97° 11' 44.77" **Direction of View:** North

Comments: Map ID: 82; No Name; N. of I-20 Between Tate Springs & Little Rd.; Site # 1383



Photo ID: 60

Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 24.94"

W 97° 11' 37.67" **Direction of View:** South

Comments: Map ID: 87; Former 7-Eleven 163123056; 5704 S.W. Green Oaks Blvd. Arlington, TX;

Currently QuickMart



Date Photo Taken: 7/8/2019

Coordinates: N 32° 38' 45.94"

W 97° 11' 01.79"

Direction of View: West

**Comments:** Map ID: 94; Sublett Shell; 4810 W Sublett Rd. Arlington, TX 76017



Photo ID: 62

Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 46.81"

W 97° 14' 24.85"

**Direction of View:** Southwest

**Comments:** Map ID: 95; 5412, 5414,5420 & 5424 High Ridge

Rd., Kennedale, TX



Date Photo Taken: 7/8/2019

**Coordinates:** N 32° 41' 45.33"

W 97° 14' 53.70" **Direction of View:** South

Comments: Map ID: 102; Commodity Recycling Solutions; 5043 Martin Luther King Fwy.,

Fort Worth, TX



Photo ID: 64

Date Photo Taken: 4/18/2019

Coordinates: N 32°40'0.17"

W 97°12'30.62" **Direction of View:** West

Comments: Map ID: 104; Wal-Mart Supercenter 3284; 4800 Highway 287, Arlington, TX



Date Photo Taken: 4/18/2019

Coordinates: N 32° 39' 52.25"

W 97° 14' 24.45"

**Direction of View:** Northeast

Comments: Map ID: 105; Construction Site; 1298 W. Kennedale Pkwy., Kennedale, TX;

Currently a McDonald's



Photo ID: 66

Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 23.35"

W 97° 11' 34.44"

**Direction of View:** Northeast

Comments: Map ID: 111; Chevron 60157013; 5711 S.W Green Oaks Blvd. Arlington, TX; Currently DEKRA Emissions & Safety



Date Photo Taken: 7/8/2019

**Coordinates:** N 32° 40' 23.72"

W 97° 10' 01.09"

**Direction of View:** Northwest

Comments: Map ID: 112; Quick Way 2; 4400 Park Springs Blvd.,

Arlington TX



Photo ID: 68

Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 36.41"

W 97° 14' 54.91" **Direction of View:** South

Comments: Map ID: 114; Horton Tree Service & The Organic Recycler of Texas; 5100 Forest Hill Circle Forest Hill, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 38' 48.46"

W 97° 11' 15.65"

Direction of View: Northwest

Comments: Map ID: 116; Kroger Fuel Center 592; 5175 W. Sublett

Rd., Arlington, TX



Photo ID: 70

Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 55.48"

W 97° 12' 20.57"

**Direction of View:** Northeast

Comments: Map ID: 123; Three Point Cleaners; 5071 Little Rd., Ste 140 Arlington, TX; Currently

Murphy Express



Date Photo Taken: 7/8/2019

Coordinates: N 32° 43' 46.20"

W 97° 13' 22.29" **Direction of View:** East

Comments: Map ID: 126;

Diamond Shamrock 212; 6400 E. Rosedale St., Fort Worth, TX;

Currently Romeo Liquor



Photo ID: 72

Date Photo Taken: 7/8/2019

Coordinates: N 32° 42' 47.73"

W 97° 16' 28.80" **Direction of View:** East

Comments: Map ID: 134; Multicultural Western Heritage Museum; 3520 E. Berry St., Fort

Worth, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 38' 53.02"

W 97° 10' 55.37"

**Direction of View:** Northwest

Comments: Map ID: 136; 4621 W. Sublett Rd., Arlington, TX; Currently Primrose School of Southwest Arlington



Photo ID: 74

Date Photo Taken: 7/8/2019

Coordinates: N 32° 43' 04.74"

W 97° 13' 44.28"

Direction of View: Northwest

Comments: Map ID: 139; Solvents Solutions Manufacture; 5901 Fitzhugh Ave., Fort Worth, TX; Currently Anderson

Laboratories



Date Photo Taken: 7/8/2019

Coordinates: N 32° 44' 01.45"

W 97° 13' 18.73"

**Direction of View:** Northwest

Comments: Map ID: 141; Worth Oil 9721; 6217 E. Lancaster Ave., Fort Worth, TX; Currently Vacant



Photo ID: 76

Date Photo Taken: 7/8/2019

Coordinates: N 32° 44' 10.51"

W 97° 13' 43.24"

**Direction of View:** Northeast

Comments: Map ID: 147; Eastside Ministries; 5929 E. Lancaster Ave., Fort Worth, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 41' 20.54"

W 97° 14' 16.36" **Direction of View:** South

Comments: Map ID: 152; Photopros; 1000 Feet E of Loop 820 E. on S side of Martin St.; Currently Lake Arlington Ranch

MHP



Photo ID: 78

Date Photo Taken: 7/8/2019

Coordinates: N 32° 43' 58.89"

W 97° 13' 18.43" **Direction of View:** North

Comments: Map ID: 155;

RaceTrac; 6300 E. Lancaster Ave.

Fort Worth, TX



Date Photo Taken: 7/8/2019

Coordinates: N 32° 44' 00.02"

W 97° 13' 15.39" Direction of View: West

Comments: Map ID: 171; Eastside Wrecker; 6401 E. Lancaster Ave., Fort Worth, TX;

Currently Appliance Plus



Photo ID: 80

Date Photo Taken: 7/8/2019

Coordinates: N 32° 39' 43.40"

W 97° 14′ 16.17″ **Direction of View:** West

Comments: Map ID: 189; Abar; 1001 W Kennedale Pkwy, Fort Worth, TX 76140; Currently Apache Iron Metal & Auto Salvage



Date Photo Taken: 7/8/2019

Coordinates: N 32° 40' 53.11"

W 97° 10' 03.43" **Direction of View:** South

Comments: Map ID: 190; Pleasant Ridge Land; 3801 W. Pleasant Ridge Rd. Arlington, TX



Photo ID: 82

Date Photo Taken: 7/8/2019

Coordinates: N 32° 43' 57.28"

W 97° 13' 04.62" **Direction of View:** East

Comments: Map ID: 194; Former Kell Cleaners; 6609 Lancaster

Ave., Fort Worth, TX

COUNTY_FIPS	439
OPERATOR	FLINT HILLS RESOURCES, LC
<b>COMMODITY DESCRIPTION</b>	REFINED LIQUID PRODUCT, TRANSMISSION
SYSTEM NAME	TEXAS PIPELINE
SUBSYSTEM NAME	WACO REMOTE TRAP TO FT. WORTH, 14IN.
DIAMETER	14
P5 NUMBER	273881
T4PERMIT	04956
T4PERMIT MILES	32.85
STATUS	In Service
INTERSTATE	No
CONTACT PHONE NUMBER	(409) 273-9482

COUNTY_FIPS	439
OPERATOR	DFW MIDSTREAM SERVICES LLC
COMMODITY DESCRIPTION	NATURAL GAS, GATHERING
SYSTEM NAME	LENOX 16" LATERAL
DIAMETER	16
P5 NUMBER	216729
T4PERMIT	07750
T4PERMIT MILES	1.01
STATUS	In Service
INTERSTATE	No
CONTACT PHONE NUMBER	(832) 608-6145

COUNTY_FIPS	439
OPERATOR	ATMOS PIPELINE - TEXAS
COMMODITY DESCRIPTION	NATURAL GAS, TRANSMISSION
SYSTEM NAME	O49
SUBSYSTEM NAME	O49
DIAMETER	20
P5 NUMBER	036589
T4PERMIT	00578
T4PERMIT MILES	12.06
STATUS	In Service
INTERSTATE	No
CONTACT PHONE NUMBER	(214) 206-2809

COUNTY_FIPS	439
OPERATOR	ENERGY TRANSFER COMPANY
<b>COMMODITY DESCRIPTION</b>	NATURAL GAS, TRANSMISSION
SYSTEM NAME	9004 LINE O HANDLEY S.E. STAEAGLE MNT.
DIAMETER	20
P5 NUMBER	252017
T4PERMIT	05781
T4PERMIT MILES	23.76
STATUS	In Service
INTERSTATE	No
CONTACT PHONE NUMBER	(713) 989-7232

COUNTY_FIPS	439
OPERATOR	COWTOWN PIPELINE PARTNERS L.P.
COMMODITY DESCRIPTION	NATURAL GAS, GATHERING
SYSTEM NAME	LAKE ARLINGTON
DIAMETER	12.75
P5 NUMBER	183246
T4PERMIT	07854
T4PERMIT MILES	0.61
STATUS	In Service
INTERSTATE	No
CONTACT PHONE NUMBER	(713) 380-3215

COUNTY_FIPS	439
OPERATOR	WILLIAMS MLP OPERATING LLC
COMMODITY DESCRIPTION	NATURAL GAS, GATHERING
SYSTEM NAME	BARNETT NORTH SYSTEM
SUBSYSTEM NAME	COWBOYS TO S&B
DIAMETER	10.75
P5 NUMBER	925429
T4PERMIT	06987
T4PERMIT MILES	1.51
STATUS	In Service
INTERSTATE	No
CONTACT PHONE NUMBER	(918) 573-6724

COUNTY_FIPS	439
OPERATOR	DFW MIDSTREAM SERVICES LLC
COMMODITY DESCRIPTION	NATURAL GAS, GATHERING
SYSTEM NAME	SWAPO LATERAL
DIAMETER	10.75
P5 NUMBER	216729
T4PERMIT	07750
T4PERMIT MILES	0.52
STATUS	In Service
INTERSTATE	No
CONTACT PHONE NUMBER	(832) 608-6145

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 63883

For: PARADISE QUICK STOP 1 (RN102655263)

5401 SUN VALLEY DR, FORT WORTH

Registration Status: ACTIVE

Held by: ALS QUICK STOP INC (CN601571987) View 'Issued To' History

**OWNER OPERATOR** Since 11/13/1992 View Compliance History

Now Known As: Al's Quick Stop, Inc.

Mailing Address: 520 E NORTHWEST HWY STE 100 ACCNT RECV NUM 47895 GRAPEVINE, TX

76051 -6298

### **Investigations**

Investigation Date	Investigation Type
02/04/2014	Compliance Investigation
03/22/2017	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**RE Search Search Results Customer Search ID Search Document Search** 

**TCEO Home Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

> Detail of: **Petroleum Storage Tank Registration 63883** View Registration

View Certificate of Delivery

For: PARADISE QUICK STOP 1 (RN102655263)

5401 SUN VALLEY DR, FORT WORTH

Registration Status: **ACTIVE** 

Held by: ALS QUICK STOP INC (CN601571987) View 'Issued To' History

**OWNER OPERATOR** Since 11/13/1992 View Compliance History

Now Known As: Al's Quick Stop, Inc.

Mailing Address: 520 E NORTHWEST HWY STE 100 ACCNT RECV NUM 47895 GRAPEVINE, TX

76051 -6298

View Earlier Holders

### **Related Information:**

**Complaints** 

**Investigations** 

**Registration Information** 

### There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 63883

For: **PARADISE QUICK STOP 1 (RN102655263)** 5401 SUN VALLEY DR, FORT WORTH

Registration Status: ACTIVE

Held by: ALS QUICK STOP INC (CN601571987) View 'Issued To' History

**OWNER OPERATOR** Since 11/13/1992 View Compliance History

Now Known As: Al's Quick Stop, Inc.

Mailing Address: 520 E NORTHWEST HWY STE 100 ACCNT RECV NUM 47895 GRAPEVINE, TX 76051 -6298

### **Financial Assurance**

1,000,000 Insurance Or Risk Retention, expires 10/21/2019 NAUTILUS INS CO, Agent

### **Self-Certification Status by Compartment**

**Current:** 1A 2A 3A 4A (through last day of 05/2020) View Complete Self-Certification History

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	<b>Date Installed</b>	Status	<b>Substance Stored</b>	Related Information
1	6000	06/01/1984	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
2	5000	06/01/1984	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
3	5000	06/01/1984	In Use	A:Diesel	Tank Details Compartment Piping Vapor Recovery
4	12000	04/20/2005	In Use	A:Gasoline	Tank Details

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Inform
1	1:Double Wall ( FRP)	FRP (Noncorrodible)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve			Tank Tested	Tank Summary Compartment Piping Vapor Recovery
2	1:Single Wall ( Coated Steel Ext Poly Clad )	Coated Steel (Ext Poly Lam)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve			Tank Tested	Tank Summary Compartment Piping Vapor Recovery

### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information
1	A	6000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Flow Restrictor Valve	Tank Summary Tank Details Piping Vapor Recovery
2	A	5000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Flow Restrictor Valve	Tank Summary Tank Details Piping Vapor Recovery
3	Α	5000	Diesel		1 : Auto Tank	1 : Tight Fill Fitting	Tank Summary

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1	Pressurized	Nonmetal Flex Piping	Double Wall	1: Shear Impact Valves 2: Flex Connectors	1: Nonmetallic Flex Piping	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recovei
2	Pressurized	Nonmetal Flex Piping	Double Wall	1: Shear Impact Valves 2: Flex Connectors	1: Nonmetallic Flex Piping	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recove

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	<b>Related Information</b>
1	Two Point System	04/20/2005	Assist System	04/20/2005	Tank Summary Tank Details Compartment Piping
2	Two Point System	04/20/2005	Assist System	04/20/2005	Tank Summary Tank Details Compartment Piping
3	Coaxial System	01/01/1987			Tank Summary Tank Details Compartment Piping
1	Not Reported		Assist System	03/15/2005	Tank Summary

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Search Results **Document Search ID** Search RE Search **Customer Search** Query Home

### Central Registry

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 50164

For: QUICK WAY 2 (RN101536449)

4400 PARK SPRINGS BLVD, ARLINGTON

Registration Status: INACTIVE

Held by: KONDA HOLDINGS LLC (CN602523995) View 'Issued To' History

**OWNER** Since 01/04/2004 View Compliance History

Now Known As: Konda Holdings, L.L.C.

Mailing Address: 4700 MEANDERING WAY COLLEYVILLE, TX 76034 -4596

Held by: KONDA ONE LLC (CN603615907) View 'Issued To' History

**OPERATOR** Since 01/01/2004 View Compliance History

Now Known As: Konda One, L.L.C.

Mailing Address: 4700 MEANDERING WAY COLLEYVILLE, TX 76034 -4596

View Earlier Holders

### Related Information:

**Commissioners' Actions** 

**Investigations** 

Registration Information

There is no information related to this Registration in the following categories:

Correspondence Tracking

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

Complaints

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

**Fish Kills** 

Other Incidents

Periodic Reports

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Registration Detail Search Results **Document Search ID** Search RE Search **Customer Search** 

**Query Home** 

### Central Registry

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 35860

For: WORLD STAR (RN102226750)

4244 WILBARGER ST, FORT WORTH

Registration Status: ACTIVE

Held by: AYSAR GROUP, INC. (CN605665892) View 'Issued To' History

OWNER OPERATOR Since 05/01/2019

Mailing Address: 4244 WILBARGER ST FORT WORTH, TX 76119 -4042

### **Commissioners' Actions**

Item Number Item Type	Item Type	Document Type Status	Status	TCEQ Docket Number	TCEQ Docket Number   SOAH Docket Number
104073	ENFORCEMENT	ORDER	CLOSED	CLOSED 2016-1518-PST-E	N/A
72218	ENFORCEMENT	ORDER	CLOSED	CLOSED 2010-0475-PST-E	N/A
64468	ENFORCEMENT	ORDER	CLOSED	CLOSED 2008-1249-PST-E	N/A
62795	ENFORCEMENT	ORDER	CLOSED	CLOSED 2008-0527-PST-E	582-09-1566
46906	ENFORCEMENT	ORDER	CLOSED	CLOSED 2005-0377-PST-E	N/A

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home	
Registration Detail	
Search Results	
Document Search	
ID Search	
RE Search	
Customer Search	

**Query Home** 

Questions or Comments >>

### Central Registry

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 35860

For: WORLD STAR (RN102226750)

4244 WILBARGER ST, FORT WORTH

Registration Status: ACTIVE

Held by: AYSAR GROUP, INC. (CN605665892) View 'Issued To' History

OWNER OPERATOR Since 05/01/2019

Mailing Address: 4244 WILBARGER ST FORT WORTH, TX 76119 -4042

# Petroleum Storage Tank Complaints at JOHNS QUIK STOP

Tracking Number	Complaint Received	Status	<b>Status Date</b>
159850	09/28/2011	CLOSED	10/07/2011
52902	01/27/2005	CLOSED	03/16/2005

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors **Statewide Links:** Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

Query Home

ID Search

**RE Search** 

**Document Search** 

Registration Detail

Search Results

TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 35860

For: WORLD STAR (RN102226750)

4244 WILBARGER ST, FORT WORTH

Registration Status: ACTIVE

Held by: AYSAR GROUP, INC. (CN605665892) View 'Issued To' History

OWNER OPERATOR Since 05/01/2019

Mailing Address: 4244 WILBARGER ST FORT WORTH, TX 76119 -4042

es	
Ru	
TCEQ	
Current	
Orders (	
ment (	
Enforce	
<b>Effective</b>	

Туре	<b>Effective Date</b>	Effective Date   Docket Number	Citation/Requirement Provision   Violation Allegation   Classification	Violation Allegation	Classification
ADMINISTRATIVE ORDER	08/29/2017	2016-1518- PST-E	2D TWC Chapter 26, SubChapter A 26.3475(c)(2); 30 TAC Chapter 334, SubChapter C 334.51(b)(2) (Not applicable to CH)	Failed to equip the UST system with a spill containment device that will prevent the release of regulated substances to the environment	MODERATE
ADMINISTRATIVE ORDER	08/29/2017	2016-1518- PST-E	2D TWC Chapter 26, SubChapter A 26.3475(a); 30 TAC Chapter 334, SubChapter C 334.50(b)(2) (Not applicable to CH)	Failed to provide release detection for the pressurized piping associated with the UST system. Specifically, the Respondent did	MAJOR

	MAJOR	MODERATE	MINOR
not conduct the annual piping tightness and line leak detector tests.	Failed to monitor the USTs for releases at a frequency of at least once every month (not to exceed 35 days between each monitoring)	Failed to maintain the Stage II vapor recovery system in proper operating condition and free of defects that would impair the effectiveness of the system. Specifically, the nozzle boot attached to Dispenser Number 3 had a slit of more than one inch in length.	Failed to post operating instructions conspicuously on the front of each gasoline dispensing pump equipped with a Stage II vapor recovery system
	2D TWC Chapter 26, SubChapter A 26.3475(c)(1); 30 TAC Chapter 334, SubChapter C 334.50(b)(1) (A) (Not applicable to CH)	30 TAC Chapter 115, SubChapter C 115.242(d)(3)(C)(iii); 5C THSC Chapter 382 382.085(b) (Not applicable to CH)	30 TAC Chapter 115, SubChapter C 115.242(d)(9); 5C THSC Chapter 382 382.085(b) (Not applicable to CH)
	2016-1518- PST-E	2016-1518- PST-E	2016-1518- PST-E
	08/29/2017	08/29/2017	08/29/2017
	ADMINISTRATIVE ORDER	ADMINISTRATIVE ORDER	ADMINISTRATIVE ORDER

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

6/30/2019

TCEQ Home	
Registration Detail	
Search Results	
Document Search	
ID Search	
RE Search	
Customer Search	

Query Home

Questions or Comments >>

### Central Registry

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 35860

For: WORLD STAR (RN102226750)

4244 WILBARGER ST, FORT WORTH

Registration Status: ACTIVE

Held by: AYSAR GROUP, INC. (CN605665892) View 'Issued To' History

OWNER OPERATOR Since 05/01/2019

Mailing Address: 4244 WILBARGER ST FORT WORTH, TX 76119 -4042

### **Investigations**

restigation Date	Investigation Type
09/2016	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Search Results **Document Search ID** Search **RE Search Customer Search** Query Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

View Registration Detail of: Petroleum Storage Tank Registration 35860

View Certificate of Delivery

For: WORLD STAR (RN102226750)

4244 WILBARGER ST, FORT WORTH

Registration Status: ACTIVE

Held by: AYSAR GROUP, INC. (CN605665892) View 'Issued To' History

OWNER OPERATOR Since 05/01/2019

Mailing Address: 4244 WILBARGER ST FORT WORTH, TX 76119 -4042

View Earlier Holders

### Related Information:

Commissioners' Actions

**Effective Enforcement Orders** 

Complaints

**Investigations** 

Registration Information

There is no information related to this Registration in the following categories:

**Correspondence Tracking** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Discharges** 

**Emission Events** 

**Fish Kills** 

Other Incidents

Periodic Reports

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Search Results **ID Search RE Search Customer Search** 

Query Home

Registration Detail

TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 35860

For: WORLD STAR (RN102226750)

4244 WILBARGER ST, FORT WORTH

Registration Status: ACTIVE

Held by: AYSAR GROUP, INC. (CN605665892) View 'Issued To' History

OWNER OPERATOR Since 05/01/2019

Mailing Address: 4244 WILBARGER ST FORT WORTH, TX 76119 -4042

### Financial Assurance

1,000,000 Insurance Or Risk Retention, expires 05/07/2020

MID-CONTINENT INS CO, Agent

## Self-Certification Status by Compartment

**Current:** 1A 2A 2B (through last day of 10/2019)

View Complete Self-Certification History

## Registered Tanks and Their Associated Systems

## Table 1. Underground Storage Tank Summary

Vapor Recovery	Removed from Ground (05/15/1999) A:Gasoline Tank Details	id=732568642002138&re id=722568632002138&lgoy sys cd=PST&program=PETROLEUM STORAGE TANK REGIST 1/4
	01/01/1976 Removed from Gro	n?fuseaction=iwr.pgmdetail&addn_id=732568642002138&
	1A   5000   C	:ps://www15.tceq.texas.gov/crpub/index.cfm?fuseaction=iwr.pgmdetail&addn_id=7

Comparament

ם: סמאחווום

 Tank Capacity (Gallon)	Date Installed	Status	Substance Stored	Related Information Vapor Recovery	
8000	01/01/1976	Removed from Ground (05/15/1999)	A:Gasoline	Tank Details Compartment Piping Vapor Recovery	I
10000	01/01/1979	Removed from Ground (05/15/1999)	A:Gasoline	Tank Details Compartment Piping Vapor Recovery	
8000	05/15/1999	Removed from Ground (05/15/1999)	A:Diesel	Tank Details Compartment Piping Vapor Recovery	<b>)</b>

### **Table 2. Tank Details**

1			<b>)</b>
Related Information	Tank Summary Compartment Piping Vapor Recovery	Tank Summary Compartment Piping Vapor Recovery	Tank Summary Compartment Piping Vapor Recovery
<b>Test</b> Result	Tank Tested		Tank
Installer	MICHAEL GARRISON		MICHAEL
Installation Contractor	PETROSERV, INC. (CRP000622)		PETROSERV, INC. (CRP000622)
Spill Containment and Overfill Prevention	A: 1: Fac Built Spill Cont/Bckt/Sump		A: 1: Fac Built Spill Cont/Bckt/Sump B: 1: Fac Built Spill Cont/Bckt/Sump
Release Detection	A: 4: Auto Tank Gauge & Inv Cntrl		A: 4: Auto Tank Gauge & Inv Cntrl B: 4: Auto
Corrosion Protection	Composite (Steel/FRP)		Composite (Steel/FRP)
Tank Design & Materials Protection	1:Double Wall ( FRP )	( Steel )	1:Double Wall ( FRP )
Tank	H	1A	2

### **Table 3. Compartment Details**

_			ı	<b>+</b>
Related Information	Tank Summary Tank Details Piping Vapor Recovery	Tank Summary Tank Details Piping Vapor Recovery	Tank Summary Tank Details Piping Vapor Recovery	Tank Summary Tank Details
Spill Containment and Overfill Prevention	1 : Fac Built Spill Cont/Bckt/Sump		1 : Fac Built Spill Cont/Bckt/Sump	1 : Fac Built Spill Cont/Bckt/Sump
Release Detection	1 : Auto Tank Gauge & Inv Cntrl		1 : Auto Tank Gauge & Inv Cntrl	1 : Auto Tank Gauge & Inv Cntrl
Other Substance				
Principal Substance Other Substance Release Detection and Ove	Diesel	Gasoline	Gasoline	Gasoline
Capacity (gallons)	8000	5000	8000	4000
Tank Compartment (gallons)	A	A	A	В
Tank		14	2	2

### **Table 4. Piping Systems**

4			<b>&gt;</b>	
Related Infor	Tank Summar Tank Details Compartment Vapor Recove	Tank Summar Tank Details Compartment Vapor Recove		•
Release Detection	A:Ann Pipe Tightness/Electr Mon A:Triennial Tightness Test A:Auto Line Leak Detector			
Corrosion Protection				
Connectors and valves Corrosion Protection Release Detection Related Infor				
Design and External Containment	Double Wall			
Tank Type of Piping Piping Material External Containn		Steel		
Type of Piping	Pressurized			
Tank	П	14		~

3/4

**Table 5. Vapor Recovery Systems** 

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
П		05/15/1999			Tank Summary Tank Details Compartment Piping
14	Not Reported				Tank Summary Tank Details Compartment Piping
2		05/15/1999			Tank Summary Tank Details Compartment Piping
2A	Not Reported				Tank Summary Tank Details Compartment Piping
w *	Not Reported				Tank Summarv

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |
Report Data Errors
Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search

**Customer Search** 

**Query Home** 

### Central Registry

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 85001

For: QUIKTRIP 874 (RN106549009)

1225 W KENNEDALE PKWY, FORT WORTH

Registration Status: ACTIVE

Held by: QUIKTRIP CORPORATION (CN600241673) View 'Issued To' History

OWNER OPERATOR Since 07/18/2012 View Compliance History

Mailing Address: 4705 S 129TH EAST AVE TULSA, OK 74134 -7005

### **Investigations**

<b>Investigation Date</b>	Investigation Date Investigation Type
08/08/2014	Compliance Investigation
11/14/2016	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Search Results **Document Search ID** Search **RE Search Customer Search** Query Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

View Registration Detail of: Petroleum Storage Tank Registration 85001

View Certificate of Delivery

For: QUIKTRIP 874 (RN106549009)

1225 W KENNEDALE PKWY, FORT WORTH

Registration Status: ACTIVE

Held by: QUIKTRIP CORPORATION (CN600241673) View 'Issued To' History

**OWNER OPERATOR** Since 07/18/2012 View Compliance History

Mailing Address: 4705 S 129TH EAST AVE TULSA, OK 74134 -7005

### Related Information:

Investigations

**Registration Information** 

There is no information related to this Registration in the following categories:

Commissioners' Actions

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

Complaints

Discharges

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Periodic Reports** 

Other Incidents

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Registration Detail

Search Results

**ID Search** 

**RE Search** 

**Customer Search** 

Query Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 85001

For: QUIKTRIP 874 (RN106549009)

1225 W KENNEDALE PKWY, FORT WORTH

Registration Status: ACTIVE

Held by: QUIKTRIP CORPORATION (CN600241673) View 'Issued To' History

OWNER OPERATOR Since 07/18/2012 View Compliance History

Mailing Address: 4705 S 129TH EAST AVE TULSA, OK 74134 -7005

### Financial Assurance

2,000,000 Financial Test, expires 11/01/2019

SELF(FIN TEST OR LOCAL GOV FT), Agent

## Self-Certification Status by Compartment

**Current:** 1A 2A 3A 4A (through last day of 04/2020)

View Complete Self-Certification History

## Registered Tanks and Their Associated Systems

## Table 1. Underground Storage Tank Summary

A:Gasoline Tank Details	In Use	07/18/2012	20000	-
-------------------------	--------	------------	-------	---

1/4

		<b>•</b>
Substance Stored Relaited Information Vapor Recovery	Tank Details Compartment Piping Vapor Recovery	Tank Details Compartment Piping Vapor Recovery
Substance Stored	A:Gasoline	A:Gasoline
Status	In Use	In Use
Date Installed	07/18/2012	07/18/2012
Capacity (Gallon)	20000	12000
Tank	2	es es

### Table 2. Tank Details

Tank	Tank Design & Materials Protection	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Infor
H	1:Double Wall ( FRP )	(Noncorrodible)	A: 4: Auto Tank Gauge & Inv Cntrl A: 5: Interstitial Monitoring A: 8: SIR & Inv	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Delivery Shutoff Valve	B&K SERVICE INC. (CRP000052)	MARK	Tank Tested	Tank Summar Compartment Piping Vapor Recover
2	1:Double Wall ( FRP )	FRP (Noncorrodible)	A: 4: Auto Tank	A: 1: Tight Fill Fittina	B&K SERVICE INC. (CRP000052)	MARK	Tank Tested	Tank Summar Compartment

### **Table 3. Compartment Details**

4	
Related Informatior	Tank Summary Tank Details Piping Vapor Recovery
Spill Containment and Overfill Prevention	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Delivery Shutoff Valve
Release Detection	1 : Auto Tank Gauge & Inv Cntrl 2 : Interstitial Monitoring 3 : SIR & Inv Cntrl
Other Substance	
Principal Substance Other Substance Release Detection and Ove	Gasoline
Capacity (gallons)	20000
Tank Compartment (gallons)	4
Tank	н

2/4

JO.	<b>&gt;</b>	•
Related Informatior	Tank Summary Tank Details	
Spill Containment and Overfill Prevention	1 : Auto Tank1 : Tight Fill FittingTank SummaryGauge & Inv Cntrl2 : Fac Built SpillTank Details	
Release Detection	1 : Auto Tank Gauge & Inv Cntrl	
Other Substance		
Principal Substance Other Substance Release Detection and Ove	Gasoline	
Capacity (gallons)	20000	
Tank Compartment	⋖	
Tank	2	_

### Table 4. Piping Systems

Related Infor	Tank Summar Tank Details Compartment Vapor Recove	
Release Detection	A:Interstitial Monitoring A:Monthly Piping Tightness A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector A:SIR & Inv Cntrl	
Corrosion Protection	1: FRP (Noncorrodible) 2: Isolated Open Area/2nd Contai	
Connectors and valves Corrosion Protection Release Detection Related Infor	1: Shear Impact Valves 2: Flex Connectors	
nd	Double Wall	
Tank Type of Piping Piping Material External	FRP	
Type of Piping	Pressurized	
Tank .		(

### Table 5. Vapor Recovery Systems

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
н	Two Point System	10/25/2012			Tank Summary Tank Details Compartment Piping
2	Two Point System	10/25/2012			Tank Summary Tank Details Compartment Piping
м	Two Point System	10/25/2012			Tank Summary Tank Details Compartment Piping
 s://www15.tc	 https://www15.teeg.texas.gov/crpub/index.cfm?fuseaction=iwr.pgmdetail&addn_id=629319102012319&re_id=624319092012319&lgcv_sys_cd=PST&program=PETROLEUM STORAGE TANK REGIST	etail&addn_id=629319102012319	%re id=624319092012319&lgcv_sv	s cd=PST&program=PETROLEUN	A STORAGE TANK REGIST 3/4

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 84009

For: **QUIKTRIP 856 (RN106081508)** 

4930 LITTLE RD, ARLINGTON

Registration Status: ACTIVE

Held by: QUIKTRIP CORPORATION (CN600241673) View 'Issued To' History

**OWNER OPERATOR** Since 12/01/2010 View Compliance History

Mailing Address: 4705 S 129TH EAST AVE TULSA, OK 74134 -7005

### **Investigations**

Investigation Date	Investigation Type
03/11/2014	Compliance Investigation
05/13/2014	Compliance Investigation
06/27/2014	Compliance Investigation
04/29/2016	Compliance Investigation
10/17/2018	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

.....

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

**ID Search** 

**Document Search** 

**Search Results** 

**TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 84009

View Registration

View Certificate of Delivery

For: QUIKTRIP 856 (RN106081508)

4930 LITTLE RD, ARLINGTON

Registration Status: **ACTIVE** 

Held by: QUIKTRIP CORPORATION (CN600241673) View 'Issued To' History

**OWNER OPERATOR** Since 12/01/2010 View Compliance History

Mailing Address: 4705 S 129TH EAST AVE TULSA, OK 74134 -7005

### **Related Information:**

**Investigations** 

**Notice of Violations** 

**Registration Information** 

### There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

RE Search

**ID Search** 

**Document Search** 

**Search Results** 

**Registration Detail** 

TCEQ Home
Query Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 84009

For: **QUIKTRIP 856 (RN106081508)** 

4930 LITTLE RD, ARLINGTON

Registration Status: ACTIVE

Held by: QUIKTRIP CORPORATION (CN600241673) View 'Issued To' History

**OWNER OPERATOR** Since 12/01/2010 View Compliance History

Mailing Address: 4705 S 129TH EAST AVE TULSA, OK 74134 -7005

### **Notice of Violations Current TCEQ Rules**

NOV Date	Status	Citation/Requirement Provision	Allegation	Classification	Self Reporting Indicator
04/11/2014	RESOLVED	30 TAC Chapter 115, SubChapter C 115.242(3)(E)	Failure to maintain the stage II vapor recovery system in proper operating condition, as specified by the manufacturer and/or any applicable California Air Resource Board (CARB) Executive Order(s), and free of defects that would impair the effectiveness of the system, including for booted nozzles in vacuum assist type systems, a flexible cone for which a total of at least one-fourth of the cone is damaged or missing.	MINOR	NO
04/11/2014	RESOLVED	30 TAC Chapter 115, SubChapter C 115.244(3)	Failure to conduct monthly	MINOR	NO

	inspections		- 1
	of the		
	components		
	listed in		
	§115.242(3)		
	(J) of this		
	title.		

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 45710

For: REEDER DISTRIBUTORS (RN100524743)

5450 WILBARGER ST, FORT WORTH

Registration Status: ACTIVE

Held by: REEDER DISTRIBUTORS INC (CN600244339) View 'Issued To' History

**OWNER OPERATOR** Since 11/06/1987 View Compliance History

Now Known As: Reeder Distributors, Inc.

Mailing Address: PO BOX 8237 FORT WORTH, TX 76124 -0237

### **Petroleum Storage Tank Complaints at REEDER DISTRIBUTORS**

Tracking Number	<b>Complaint Received</b>	Status	<b>Status Date</b>
78058	07/03/2006	CLOSED	07/17/2006

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors
Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 45710

For: REEDER DISTRIBUTORS (RN100524743)

5450 WILBARGER ST, FORT WORTH

Registration Status: ACTIVE

Held by: REEDER DISTRIBUTORS INC (CN600244339) View 'Issued To' History

**OWNER OPERATOR** Since 11/06/1987 View Compliance History

Now Known As: Reeder Distributors, Inc.

Mailing Address: PO BOX 8237 FORT WORTH, TX 76124 -0237

### **Investigations**

<b>Investigation Date</b>	Investigation Type
02/05/2014	Compliance Investigation
01/20/2017	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**RE Search Search Results Customer Search ID Search Document Search TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: **Petroleum Storage Tank Registration 45710** View Registration

View Certificate of Delivery

For: REEDER DISTRIBUTORS (RN100524743)

5450 WILBARGER ST, FORT WORTH

Registration Status: **ACTIVE** 

Held by: REEDER DISTRIBUTORS INC (CN600244339) View 'Issued To' History

**OWNER OPERATOR** Since 11/06/1987 View Compliance History

Now Known As: Reeder Distributors, Inc.

Mailing Address: PO BOX 8237 FORT WORTH, TX 76124 -0237

### **Related Information:**

**Complaints** 

**Investigations** 

**Registration Information** 

### There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: **Petroleum Storage Tank Registration 45710**For: **REEDER DISTRIBUTORS (RN100524743)** 

5450 WILBARGER ST, FORT WORTH

Registration Status: ACTIVE

Held by: REEDER DISTRIBUTORS INC (CN600244339) View 'Issued To' History

**OWNER OPERATOR** Since 11/06/1987 View Compliance History

Now Known As: Reeder Distributors, Inc.

Mailing Address: PO BOX 8237 FORT WORTH, TX 76124 -0237

### **Financial Assurance**

1,000,000 Insurance Or Risk Retention, expires 05/20/2019 ACE AMERICAN INS CO, Agent

### **Self-Certification Status by Compartment**

Current: 1A 2A (through last day of 08/2019)

**Expired:** 3A (last day of 08/2006)

View Complete Self-Certification History

### **Registered Tanks and Their Associated Systems**

### Table 1. Underground Storage Tank Summary View Aboveground Storage Tanks

Tank	Capacity (Gallon)	Date Installed	Status	Substance Stored	Related Information
1	8000	01/01/1986	In Use	A:Diesel	Tank Details Compartment Piping Vapor Recovery
2	8000	01/01/1986	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
3	8000	04/01/1987	In Use	A:Kerosene	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	1:Single Wall ( Composite Tank )	Composite (Steel/FRP)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Delivery Shutoff Valve				Tank Summary Compartment Piping Vapor Recovery
2	1:Single Wall ( Composite Tank )	Composite (Steel/FRP)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Delivery Shutoff Valve				Tank Summary Compartment Piping Vapor Recovery

### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information
1	A	8000	Diesel		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Delivery Shutoff Valve	Tank Summary Tank Details Piping Vapor Recovery
2	A	8000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Delivery Shutoff Valve	Tank Summary Tank Details Piping Vapor Recovery
_				İ			_ : _

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1	Pressurized		Single Wall		1: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recovei
2	Pressurized		Single Wall		1: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recove

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Two Point System	03/15/1987			Tank Summary Tank Details Compartment Piping
2	Two Point System	03/15/1987			Tank Summary Tank Details Compartment Piping
3	Two Point System	03/15/1987			Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**RE Search ID Search Search Results Customer Search Document Search TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 63207

For: RENARD BLACKSTOCK (RN102779394)

6704 LINDALE RD, FORT WORTH

Registration Status: INACTIVE

Held by: BLACKSTOCK RENARD (CN601411838) View 'Issued To' History

**OWNER** Since 06/30/1992

Now Known As: Renard Blackstock

Mailing Address: 711 N FIELDER RD ARLINGTON, TX 76012 -4636

### **Related Information:**

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 63207

For: **RENARD BLACKSTOCK (RN102779394)** 6704 LINDALE RD, FORT WORTH

Registration Status: INACTIVE

Held by: BLACKSTOCK RENARD (CN601411838) View 'Issued To' History

**OWNER** Since 06/30/1992

Now Known As: Renard Blackstock

Mailing Address: 711 N FIELDER RD ARLINGTON, TX 76012 -4636

### **Financial Assurance**

None

## **Self-Certification Status by Compartment**

None

## **Registered Tanks and Their Associated Systems**

## **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	750	08/31/1987	Removed from Ground (10/26/2011)	A:Empty	Tank Details Compartment Piping Vapor Recovery

## **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	1:Single Wall ( Steel )							Tank Summary Compartment Piping Vapor Recovery

## **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information	
1	А	750	Empty				Tank Summary Tank Details	•
4							<b>•</b>	

## **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor	
1							Tank Summar Tank Details	<b>-</b>
4							<b>)</b>	

## **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Not Reported				Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 65856

For: SUBLETT SHELL (RN102449667)

4810 W SUBLETT RD, ARLINGTON

Registration Status: **ACTIVE** 

Held by: WALEEDO INC (CN601264328) View 'Issued To' History

**OWNER** Since 03/07/2001 View Compliance History

Now Known As: Waleedo, Inc.

Mailing Address: PO BOX 2599 WAXAHACHIE, TX 75168 -8599

Held by: Yolla Petroleum, Inc. (CN605469113) View 'Issued To' History

**OPERATOR** Since 01/01/2018 View Compliance History

Mailing Address: 2536 SIR TRISTRAM LN LEWISVILLE, TX 75056 -5706

## **Investigations**

Investigation Date	Investigation Type			
03/18/2014	Compliance Investigation			
06/04/2015	Compliance Investigation			
12/16/2015	Compliance Investigation			
06/13/2018	Compliance Investigation			

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**RE Search Customer Search ID Search**  **Document Search** Search Results **TCEO Home** 

**Query Home** 

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

> Detail of: **Petroleum Storage Tank Registration 65856** View Registration

View Certificate of Delivery

For: SUBLETT SHELL (RN102449667)

4810 W SUBLETT RD, ARLINGTON

Registration Status: **ACTIVE** 

Held by: WALEEDO INC (CN601264328) View 'Issued To' History

**OWNER** Since 03/07/2001 View Compliance History

Now Known As: Waleedo, Inc.

Mailing Address: PO BOX 2599 WAXAHACHIE, TX 75168 -8599

Held by: Yolla Petroleum, Inc. (CN605469113) View 'Issued To' History

**OPERATOR** Since 01/01/2018 View Compliance History

Mailing Address: 2536 SIR TRISTRAM LN LEWISVILLE, TX 75056 -5706

View Earlier Holders

## **Related Information:**

**Investigations** 

**Notice of Violations** 

**Registration Information** 

## There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 65856

For: SUBLETT SHELL (RN102449667)

4810 W SUBLETT RD, ARLINGTON

Registration Status: ACTIVE

Held by: WALEEDO INC (CN601264328) View 'Issued To' History

**OWNER** Since 03/07/2001 View Compliance History

Now Known As: Waleedo, Inc.

Mailing Address: PO BOX 2599 WAXAHACHIE, TX 75168 -8599

Held by: Yolla Petroleum, Inc. (CN605469113) View 'Issued To' History

**OPERATOR** Since 01/01/2018 View Compliance History Mailing Address: 2536 SIR TRISTRAM LN LEWISVILLE, TX 75056 -5706

### **Financial Assurance**

1,000,000 Insurance Or Risk Retention, expires 08/25/2019 TANK OWNERS MEMBERS INS CO, Agent

## **Self-Certification Status by Compartment**

**Current:** 1A 2A 2B 3A (through last day of 02/2020) View Complete Self-Certification History

## **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	12000	07/01/1994	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
2	12000	07/01/1994	In Use	A:Gasoline, B:Diesel	Tank Details Compartment Piping Vapor Recovery
3	10000	05/10/2007	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	1:Double Wall ( Composite Tank )	FRP (Noncorrodible)	A: 4: Auto Tank Gauge & Inv Cntrl A: 8: SIR & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve				Tank Summary Compartment Piping Vapor Recovery



## **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information
1	A	12000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl 2 : SIR & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Flow Restrictor Valve	Tank Summary Tank Details Piping Vapor Recovery
2	A	6000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl 2 : SIR & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Flow Restrictor Valve	Tank Summary Tank Details Piping Vapor Recovery
_	_		l   .		l <b>.</b> .	l	l <b>_</b> . <b>_</b>

## **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1	Pressurized	FRP	Single Wall		1: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recover
2	Pressurized	FRP	Single Wall		1: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon B:Ann Pipe Tightness/Electr	Tank Summar Tank Details Compartment Vapor Recover

## **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Not Reported		Assist System		Tank Summary Tank Details Compartment Piping
2	Not Reported				Tank Summary Tank Details Compartment Piping
3	Two Point System	05/12/2007	Balance System	05/12/2007	Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

RE Search

**ID** Search

**Document Search** 

Search Results

**Registration Detail** 

TCEQ Home
Query Home

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 65856

For: **SUBLETT SHELL (RN102449667)** 4810 W SUBLETT RD, ARLINGTON

Registration Status: ACTIVE

Held by: WALEEDO INC (CN601264328) View 'Issued To' History

**OWNER** Since 03/07/2001 View Compliance History

Now Known As: Waleedo, Inc.

Mailing Address: PO BOX 2599 WAXAHACHIE, TX 75168 -8599

Held by: Yolla Petroleum, Inc. (CN605469113) View 'Issued To' History

**OPERATOR** Since 01/01/2018 View Compliance History

Mailing Address: 2536 SIR TRISTRAM LN LEWISVILLE, TX 75056 -5706

## **Notice of Violations Current TCEQ Rules**

NOV Date	Status	Citation/Requirement Provision	Allegation	Classification	Self Reporting Indicator
04/21/2014	RESOLVED	30 TAC Chapter 115, SubChapter C 115.242(3)	Failure to maintain the Stage II vapor recovery system in proper operating condition, as specified by the manufacturer and/or any applicable California Air Resource Board (CARB) Executive Order(s), and free of defects that would impair the effectiveness of the system.	MINOR	NO
04/21/2014	RESOLVED	30 TAC Chapter 115, SubChapter C 115.246(4)	Failure to maintain proof of attendance and completion of training as specified in 115.248 (state approved Stage II training course) and documentation of all Stage II training for facility	MINOR	NO

7/9/2019	TCEQ CR Query - Petroleum Storage Tank Registration 65856	
	representative and each employee (so long as employed).	

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

Query Home

RE Search

ID Search

Search Results

ID Number Detail

TCEQ Home

## Central Registry

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Leaking Petroleum Storage Tanks Remediation ID Number 114484

For: TEX O KAN TRANSPORTATION (RN101555449)

3301 E LOOP 820 S, FORT WORTH

ID Number Status: INACTIVE

Responsible Parties: TEX O KAN TRANSPORTATION (CN604464149) View Compliance History

Mailing Address: Not on file

## Correspondence Tracking

Tracking No.   Received/	Received/Sent	Sent Direction	Type	Subject	Subject   Due Date   End Date	End Date	Document Date Method	Method
6143102	01/19/2000	INCOMING	REL DET			02/26/1999	02/04/1999	
6261401	02/26/1999	DNIODINO	FINAL			02/26/1999	02/26/1999	

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Registration Detail Search Results **Document Search ID** Search RE Search **Customer Search** 

**Query Home** 

Questions or Comments >>

## Central Registry

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 62153

For: **TEXACO FOOD MART (RN100701119)** 

5317 MANSFIELD HWY STE 101, FOREST HILL

Registration Status: ACTIVE

Held by: TEXACO TEXAS ONE INVESTMENTS INC (CN604552802) View 'Issued To' History

**OWNER OPERATOR** Since 01/01/2014 View Compliance History

Mailing Address: 5317 MANSFIELD HWY STE 101 FOREST HILL, TX 76119 -7649

## **Investigations**

Investigation Date	Investigation Date Investigation Type
06/30/2016	Compliance Investigation
10/17/2018	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Registration Detail Search Results **Document Search ID** Search RE Search **Customer Search** 

Query Home

Questions or Comments >>

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 62153

For: TEXACO FOOD MART (RN100701119)

5317 MANSFIELD HWY STE 101, FOREST HILL

Registration Status: ACTIVE

Held by: TEXACO TEXAS ONE INVESTMENTS INC (CN604552802) View 'Issued To' History

**OWNER OPERATOR** Since 01/01/2014 View Compliance History

Mailing Address: 5317 MANSFIELD HWY STE 101 FOREST HILL, TX 76119 -7649

# **Emergency Responses at TEXACO FOOD MART 2011**

Tracking Number	Began	Ended	Status
121799	03/23/2009	03/22/2009	CLOSED

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

Query Home

ID Search

**RE Search** 

**Document Search** 

Search Results

TCEQ Home Registration Detail

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 62153

For: TEXACO FOOD MART (RN100701119)

5317 MANSFIELD HWY STE 101, FOREST HILL

Registration Status: ACTIVE

Held by: TEXACO TEXAS ONE INVESTMENTS INC (CN604552802) View 'Issued To' History

**OWNER OPERATOR** Since 01/01/2014 View Compliance History

Mailing Address: 5317 MANSFIELD HWY STE 101 FOREST HILL, TX 76119 -7649

## Current TCEO Rules Effective Enforcement Orders

		mil 2 - 2 - 2 - 2			
Туре	<b>Effective Date</b>	Docket Number	Effective Date Docket Number Citation/Requirement Provision Violation Allegation Classification	Violation Allegation	Classification
ADMINISTRATIVE 04/18/2014 ORDER	04/18/2014	2013-1614- PST-E	2D TWC Chapter 26, SubChapter A 26.3475(c)(1); 30 TAC Chapter 334, SubChapter C 334.50(b)(1) (A) (Not applicable to CH)	Failed to monitor the UST for releases at a frequency of at least once every month (not to exceed 35 days between each monitoring).	MODERATE

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Search Results **Document Search ID** Search **RE Search Customer Search** Query Home

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

View Registration Detail of: Petroleum Storage Tank Registration 62153

View Certificate of Delivery

For: TEXACO FOOD MART (RN100701119)

5317 MANSFIELD HWY STE 101, FOREST HILL

Registration Status: ACTIVE

Held by: TEXACO TEXAS ONE INVESTMENTS INC (CN604552802) View 'Issued To' History

**OWNER OPERATOR** Since 01/01/2014 View Compliance History

Mailing Address: 5317 MANSFIELD HWY STE 101 FOREST HILL, TX 76119 -7649

View Earlier Holders

## Related Information:

Commissioners' Actions

**Effective Enforcement Orders** 

**Emergency Response Events** 

**Investigations** 

Registration Information

There is no information related to this Registration in the following categories:

**Correspondence Tracking** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

Complaints

Discharges

**Emission Events** 

Fish Kills

Other Incidents

Periodic Reports

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Registration Detail Search Results **ID Search RE Search Customer Search** 

Query Home

TCEQ Home

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 62153

For: TEXACO FOOD MART (RN100701119)

5317 MANSFIELD HWY STE 101, FOREST HILL

Registration Status: ACTIVE

Held by: TEXACO TEXAS ONE INVESTMENTS INC (CN604552802) View 'Issued To' History

OWNER OPERATOR Since 01/01/2014 View Compliance History

Mailing Address: 5317 MANSFIELD HWY STE 101 FOREST HILL, TX 76119 -7649

## Financial Assurance

1,000,000 Insurance Or Risk Retention, expires 11/12/2019

TUDOR INS CO, Agent

# Self-Certification Status by Compartment

**Current:** 1A 1B 1C (through last day of 01/2020)

View Complete Self-Certification History

# Registered Tanks and Their Associated Systems

## View Aboveground Storage Tanks Table 1. Underground Storage Tank Summary

Related Information	
Substance Stored	
Status	
Date Installed	
Capacity (Gallon)	
<b>Fank</b>	

				•
Substance Stored   Related Information	Tank Details Compartment Piping Vapor Recovery	Tank Details Compartment Piping Vapor Recovery	Tank Details Compartment Piping Vapor Recovery	Tank Dataile
<b>Substance Stored</b>	A:Gasoline, B:Gasoline, C:Diesel	A:Unknown	A:Unknown	מיייסמלמוויא
Status	In Use	Removed from Ground (08/31/1987)	Removed from Ground (08/31/1987)	Damaind from Crainal (00/21/1007)
Date Installed	12/01/1999	08/31/1987	08/31/1987	7001/16/00
Tank Capacity (Gallon)	24000			
Tank	н	1A	2	C *

## **Table 2. Tank Details**

4		•	
Related Informatior	Tank Summary Compartment Piping Vapor Recovery	Tank Summary	
Test Result		Tank	
Installer Result			
Installation Contractor			
Spill Containment and Overfill Prevention	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve B: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve C: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve Valve Valve		
Release Detection	A: 4: Auto Tank Gauge & Inv Cntrl B: 4: Auto Tank Gauge & Inv Cntrl C: 4: Auto Tank Gauge		
Corrosion Protection	Composite (Steel/FRP)		
Tank Design & Materials	1:Single Wall ( Composite Tank )		
Tank	1	14	_

## **Table 3. Compartment Details**

2/4

			<b>&gt;</b>
Related Information	Tank Summary Tank Details Piping Vapor Recovery	Tank Summary Tank Details Piping Vapor Recovery	Tank Summary Tank Details Piping Vapor Recovery
Spill Containment and Overfill Prevention	<ol> <li>Tight Fill Fitting</li> <li>Fac Built Spill Cont/Bckt/Sump</li> <li>Flow Restrictor Valve</li> </ol>	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Flow Restrictor Valve	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Flow Restrictor Valve
Release Detection	1 : Auto Tank Gauge & Inv Cntrl	1 : Auto Tank Gauge & Inv Cntrl	1 : Auto Tank Gauge & Inv Cntrl
Other Substance			
Principal Substance Other Substance Release Detection and Ove	Gasoline	Gasoline	Diesel
Capacity (gallons)	12000	0009	0009
Tank Compartment (gallons)	Ф	В	O
Tank	H	1	

## **Table 4. Piping Systems**

4		•	
Related Infor	Tank Summar Tank Details Compartment Vapor Recove		^
Release Detection	C:Ann Pipe Tightness/Electr Mon A:Ann Pipe Tightness/Electr Mon B:Ann Pipe Tightness/Electr Mon C:Auto Line Leak Detector A:Auto Line Leak Detector B:Auto Line Leak Detector Detector		
Corrosion Protection	1: Nonmetallic Flex Piping 2: Isolated Open Area/2nd Contai		
Connectors and valves Corrosion Protection Release Detection Related Infor	1: Shear Impact Valves 2: Flex Connectors	-	
nd nent	Double Wall	-	
Tank Type of Piping Piping Material External Containn	Nonmetal Flex Piping	-	
Type of Piping	Pressurized	-	
Tank	П	_	_

## **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
↔	Two Point System	12/01/1999	Assist System	12/01/1999	Tank Summary Tank Details Compartment Piping
14	Not Reported				Tank Summary Tank Details Compartment Piping
2	Not Reported				Tank Summary Tank Details Compartment Piping
т	Not Reported				Tank Summary Tank Details Compartment Piping
4	Not Reported				Tank Summarv

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |
Report Data Errors
Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

**ID Search** 

**Document Search** 

Search Results

**TCEO Home** 

**Query Home** 

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 28192

For: TEXAS STATE UTILITIES (RN101555449)

3301 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: TEXAS STATE UTILITIES INC (CN603632209) View 'Issued To' History

**OPERATOR** Since 12/10/2009 View Compliance History

Now Known As: Texas State Utilities, Inc.

Mailing Address: 3301 E LOOP 820 S FORT WORTH, TX 76119 -1816

Held by: RANPARR INC (CN600345193) View 'Issued To' History

**OWNER** Since 12/10/2009 View Compliance History

Now Known As: Ranparr, Inc.

Mailing Address: PO BOX 541988 DALLAS, TX 75354 -1988

View Earlier Holders

## **Related Information:**

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: **Petroleum Storage Tank Registration 28192**For: **TEXAS STATE UTILITIES (RN101555449)** 

3301 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: TEXAS STATE UTILITIES INC (CN603632209) View 'Issued To' History

**OPERATOR** Since 12/10/2009 View Compliance History

Now Known As: Texas State Utilities, Inc.

Mailing Address: 3301 E LOOP 820 S FORT WORTH, TX 76119 -1816

Held by: RANPARR INC (CN600345193) View 'Issued To' History

**OWNER** Since 12/10/2009 View Compliance History

Now Known As: Ranparr, Inc.

Mailing Address: PO BOX 541988 DALLAS, TX 75354 -1988

## **Financial Assurance**

None

## **Self-Certification Status by Compartment**

None

## **Registered Tanks and Their Associated Systems**

### Table 1. Underground Storage Tank Summary View Aboveground Storage Tanks

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	<b>Related Information</b>
1	12000	01/01/1974	Removed from Ground (12/01/1998)	A:Empty	Tank Details Compartment Piping Vapor Recovery
2	10000	01/01/1984	Removed from Ground (12/01/1998)	A:Empty	Tank Details Compartment Piping Vapor Recovery
3	6000	01/01/1974	Removed from Ground (12/01/1998)	A:Empty	Tank Details Compartment Piping Vapor Recovery
4	4000	01/01/1974	Removed from Ground (03/02/1992)	Δ·Empty	Tank Details

## **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	( Steel )							Tank Summary Compartment Piping Vapor Recovery
2	( Steel )							Tank Summary Compartment Piping Vapor Recovery



## **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Informat	ior
1	А	12000	Empty				Tank Summary Tank Details Piping Vapor Recovery	
2	А	10000	Empty				Tank Summary Tank Details Piping Vapor Recovery	
3	А	6000	Empty				Tank Summary Tank Details Piping	_
4								-

## **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1		Steel					Tank Summar Tank Details Compartment Vapor Recovel
2		Steel					Tank Summar Tank Details Compartment Vapor Recove
3		Steel					Tank Summar Tank Details Compartment

## **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Not Reported				Tank Summary Tank Details Compartment Piping
2	Not Reported				Tank Summary Tank Details Compartment Piping
3	Not Reported				Tank Summary Tank Details Compartment Piping
4	Not Reported				Tank Summary

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Registration Detail Search Results **Document Search ID** Search RE Search **Customer Search** 

Query Home

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 70122

For: **TIGER MART 77 (RN102649746)** 

4401 KELLY ELLIOTT RD, ARLINGTON

Registration Status: ACTIVE

Held by: RASHWAN INC (CN601616188) View 'Issued To' History

OWNER Since 06/11/2009 View Compliance History

Now Known As: Rashwan, Inc.

Mailing Address: 6030 SHILOH FOREST DR MIDLOTHIAN, TX 76065 -6880

Held by: ASALI INC (CN604258178) View 'Issued To' History

**OPERATOR** Since 01/18/2013 View Compliance History

Now Known As: ASALI INC.

Mailing Address: 4401 KELLY ELLIOTT RD ARLINGTON, TX 76017 -1349

## **Investigations**

Investigation Date	Investigation Type
08/06/2014	Compliance Investigation
12/14/2015	Compliance Investigation
06/13/2018	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Search Results **Document Search ID** Search RE Search **Customer Search** Query Home

## Central Registry

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

View Registration Detail of: Petroleum Storage Tank Registration 70122

View Certificate of Delivery

For: **TIGER MART 77 (RN102649746)** 

4401 KELLY ELLIOTT RD, ARLINGTON

Registration Status: ACTIVE

Held by: RASHWAN INC (CN601616188) View 'Issued To' History

OWNER Since 06/11/2009 View Compliance History

Now Known As: Rashwan, Inc.

Mailing Address: 6030 SHILOH FOREST DR MIDLOTHIAN, TX 76065 -6880

Held by: ASALI INC (CN604258178) View 'Issued To' History

**OPERATOR** Since 01/18/2013 View Compliance History

Now Known As: ASALI INC.

Mailing Address: 4401 KELLY ELLIOTT RD ARLINGTON, TX 76017 -1349

View Earlier Holders

## Related Information:

Investigations

**Registration Information** 

There is no information related to this Registration in the following categories:

Correspondence Tracking

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

Complaints

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

Other Incidents

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Registration Detail Search Results **ID Search RE Search Customer Search Ouery Home** 

## Central Registry

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 70122

For: **TIGER MART 77 (RN102649746)** 

4401 KELLY ELLIOTT RD, ARLINGTON

Registration Status: ACTIVE

Held by: RASHWAN INC (CN601616188) View 'Issued To' History

OWNER Since 06/11/2009 View Compliance History

Now Known As: Rashwan, Inc.

Mailing Address: 6030 SHILOH FOREST DR MIDLOTHIAN, TX 76065 -6880

Held by: ASALI INC (CN604258178) View 'Issued To' History

**OPERATOR** Since 01/18/2013 View Compliance History

Now Known As: ASALI INC.

Mailing Address: 4401 KELLY ELLIOTT RD ARLINGTON, TX 76017 -1349

## **Financial Assurance**

1,000,000 Insurance Or Risk Retention, expires 03/14/2019

TANK OWNERS MEMBERS INS CO, Agent

# Self-Certification Status by Compartment

Current: 1A 2A 3A (through last day of 01/2020)

View Complete Self-Certification History

# Registered Tanks and Their Associated Systems

# Table 1. Underground Storage Tank Summary

Tank	Capacity (Gallon)	Date Installed	Status	Substance Stored	Substance Stored   Related Information
П	12000	06/10/1997	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
2	12000	06/10/1997	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
m	12000	06/10/1997	In Use	A:Diesel	Tank Details Compartment Piping Vapor Recovery

## **Table 2. Tank Details**

st Related I	Tank Tank Sun Tested Comparti Piping Vapor Re	Tank Tank Sun Tested Comparti Piping Vapor Re
Installer Result	DAVID TE	DAVID TE
Installation Contractor	B & M West Construction (CRP001052)	B & M West Construction (CRP001052)
Spill Containment and Overfill Prevention	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump
Release Detection	A: 4: Auto Tank Gauge & Inv Cntrl A: 5: Interstitial Monitoring	A: 4: Auto Tank Gauge & Inv Cntrl
Corrosion Protection	FRP (Noncorrodible)	FRP (Noncorrodible)
Tank Design & Materials	1:Double Wall ( FRP )	1:Double Wall ( FRP )
Tank	П	2

## Table 3. Compartment Details

711	reigled Information
Spill Containment	rfill Pr
	rection
3.04.0	ince Other Substance Release De
	ne ipdi
Capacity	(gallons)
	Comparen
<u> </u>	E E

2/4

Tank	Tank Compartment (gallons)	Capacity (gallons)	Principal Substanc	Other Substance	e Other Substance Release Detection and Ove	Spill Containment and Overfill Prevention	Related Informatior	Ž
H	Þ	12000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl 2 : Interstitial Monitoring	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Flow Restrictor Valve	Tank Summary Tank Details Piping Vapor Recovery	İ
2	A	12000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill	Tank Summary Tank Details	•

## Table 4. Piping Systems

4		<b>&gt;</b>
Related Infor	Tank Summar Tank Details Compartment Vapor Recove	Tank Summar Tank Details Compartment
Release Detection	A:Interstitial Monitoring A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	A:Interstitial Monitoring A:Ann Pipe
Corrosion Protection	1: FRP (Noncorrodible) 2: Nonmetallic Flex Piping	1: FRP (Noncorrodible) 2: Nonmetallic Flex
Connectors and valves Corrosion Protection Release Detection Related Infor	1: Shear Impact Valves 2: Flex Connectors	1: Shear Impact Valves 2: Flex Connectors
ind	Double Wall	Double Wall
Tank Type of Piping Piping Material External Containr	Nonmetal Flex Piping	Nonmetal Flex Piping
Type of Piping	Pressurized	Pressurized
Tank	т.	2

## Table 5. Vapor Recovery Systems

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
П		06/10/1997		06/10/1997	Tank Summary Tank Details Compartment Piping
7		06/10/1997		06/10/1997	Tank Summary Tank Details Compartment Piping

3/4

		•	
hatior		,	•
Related ThroFmai Tank Details	Compartment	Piping	
Date 1/15talled			
Type of Stage 2			
Date 1/13tailed			
Type of Stage 1			
Tank			~

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 79118

For: **TIGER MART 61 (RN105482251)** 

2250 E LOOP 820, FORT WORTH

Registration Status: **ACTIVE** 

Held by: KHWICE PETROLEUM LLC (CN604058065) View 'Issued To' History

**OPERATOR** Since 12/01/2011 View Compliance History

Now Known As: Khwice Petroleum, LLC

Mailing Address: 2250 E LOOP 820 FORT WORTH, TX 76112 -4013

Held by: VICTRON STORES LP (CN602815540) View 'Issued To' History

**OWNER** Since 02/07/2008 View Compliance History

Now Known As: Victron Stores, L.P.

Mailing Address: PO BOX 2599 WAXAHACHIE, TX 75168 -8599

## **Commissioners' Actions**

<b>Item Number</b>	Item Type	<b>Document Type</b>	Status	TCEQ Docket Number	<b>SOAH Docket Number</b>
66585	ENFORCEMENT	ORDER	CLOSED	2009-0025-PST-E	N/A

## Item 66585

## **Activity Actions**

<b>Action Date</b>	<b>Document Type</b>	Action	
05/29/2009	Order	MAILED	
05/20/2009	Commission Agenda	GRANTED	
05/22/2009	Order	SIGNED	
05/20/2009	Commission Agenda	SCHEDULED	

## **Protestant Information**

Request Type	Count
No Protestant information exist for this item	

## **Filings**

<b>Date Received</b>	Title		
04/20/2009 12:00 AM	1 + 7 AGENDA BACKUP		

## **Public Meeting**

<b>Meeting Type</b>	<b>Meeting Date</b>	<b>Meeting Time</b>	Location	<b>Total Attendance</b>
No Public Meeting exist for this Item.				

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 79118

For: TIGER MART 61 (RN105482251)

2250 E LOOP 820, FORT WORTH

Registration Status: ACTIVE

Held by: KHWICE PETROLEUM LLC (CN604058065) View 'Issued To' History

**OPERATOR** Since 12/01/2011 View Compliance History

Now Known As: Khwice Petroleum, LLC

Mailing Address: 2250 E LOOP 820 FORT WORTH, TX 76112 -4013

Held by: VICTRON STORES LP (CN602815540) View 'Issued To' History

**OWNER** Since 02/07/2008 View Compliance History

Now Known As: Victron Stores, L.P.

Mailing Address: PO BOX 2599 WAXAHACHIE, TX 75168 -8599

## **Investigations**

<b>Investigation Date</b>	Investigation Type
11/04/2013	Compliance Investigation
06/24/2015	Compliance Investigation
01/22/2018	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**ID Search RE Search** Search Results **Customer Search Document Search TCEO Home** 

**Query Home** 

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

> Detail of: Petroleum Storage Tank Registration 79118 View Registration

View Certificate of Delivery

For: TIGER MART 61 (RN105482251)

2250 E LOOP 820, FORT WORTH

Registration Status: **ACTIVE** 

Held by: KHWICE PETROLEUM LLC (CN604058065) View 'Issued To' History

**OPERATOR** Since 12/01/2011 View Compliance History

Now Known As: Khwice Petroleum, LLC

Mailing Address: 2250 E LOOP 820 FORT WORTH, TX 76112 -4013

Held by: VICTRON STORES LP (CN602815540) View 'Issued To' History

**OWNER** Since 02/07/2008 View Compliance History

Now Known As: Victron Stores, L.P.

Mailing Address: PO BOX 2599 WAXAHACHIE, TX 75168 -8599

View Earlier Holders

## **Related Information:**

**Commissioners' Actions** 

**Investigations** 

**Registration Information** 

## There is no information related to this Registration in the following categories:

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 79118

For: TIGER MART 61 (RN105482251)

2250 E LOOP 820, FORT WORTH

Registration Status: ACTIVE

Held by: KHWICE PETROLEUM LLC (CN604058065) View 'Issued To' History

**OPERATOR** Since 12/01/2011 View Compliance History

Now Known As: Khwice Petroleum, LLC

Mailing Address: 2250 E LOOP 820 FORT WORTH, TX 76112 -4013

Held by: VICTRON STORES LP (CN602815540) View 'Issued To' History

**OWNER** Since 02/07/2008 View Compliance History

Now Known As: Victron Stores, L.P.

Mailing Address: PO BOX 2599 WAXAHACHIE, TX 75168 -8599

### **Financial Assurance**

1,000,000 Insurance Or Risk Retention, expires 08/25/2019

TANK OWNERS MEMBERS INS CO, Agent

### **Self-Certification Status by Compartment**

**Current:** 1A 2A 2B (through last day of 03/2020) View Complete Self-Certification History

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	20000	02/07/2008	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
2	20000	02/07/2008	In Use	A:Gasoline, B:Diesel	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	1:Double Wall ( Composite Tank )	Composite (Steel/FRP)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve	T&P SERVICE (CRP000264)	EDDIE JOWEL LL	Tank Tested	Tank Summary Compartment Piping Vapor Recovery

### **Table 3. Compartment Details**

1 A 20000 Gasoline 1 : Auto Tank Gauge & Inv Cntrl Cont/Bckt/Sump Tank Summary Tank Details Piping	Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Informati	or
3 · Flow Restrictor   Vanor Recovery	1	A	20000	Gasoline			2 : Fac Built Spill Cont/Bckt/Sump	Tank Details Piping	•

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1	Pressurized	Nonmetal Flex Piping	Double Wall 1: Fac Built Nonmetal Jacket	1: Shear Impact Valves 2: Flex Connectors	1: Nonmetallic Flex Piping	A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recove
2	Pressurized	Nonmetal Flex	Double Wall	1: Shear Impact	1: Nonmetallic Flex	A:Auto Line Leak	Tank Summar ▼

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Two Point System	03/15/2008			Tank Summary Tank Details Compartment Piping
2	Two Point System	03/15/2008			Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors
Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 69863

For: UNITED EQUIPMENT RENTALS GULF 537 (RN102230174)

5930 E LOOP 820 S, FORT WORTH

Registration Status: ACTIVE

Held by: UNITED RENTALS INC (CN600494033) View 'Issued To' History

**OWNER** Since 06/01/2008 View Compliance History

Now Known As: United Rentals, Inc.

Mailing Address: 791 E 64TH AVE DENVER, CO 80229 -7201

Held by: UNITED EQUIPMENT RENTALS GULF LP (CN600302244) View 'Issued To'

History

**OPERATOR** Since 08/08/1997 View Compliance History

Now Known As: United Equipment Rentals Gulf, L.P.

Mailing Address: 5930 E LOOP 820 S FORT WORTH, TX 76119 -7028

### **Investigations**

<b>Investigation Date</b>	Investigation Type
10/04/2016	Compliance Investigation
01/05/2017	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

**ID Search** 

**Document Search** 

Search Results

**TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 69863

For: UNITED EQUIPMENT RENTALS GULF 537 (RN102230174)

5930 E LOOP 820 S, FORT WORTH

Registration Status: **ACTIVE** 

Held by: UNITED RENTALS INC (CN600494033) View 'Issued To' History

**OWNER** Since 06/01/2008 View Compliance History

Now Known As: United Rentals, Inc.

Mailing Address: 791 E 64TH AVE DENVER, CO 80229 -7201

Held by: UNITED EQUIPMENT RENTALS GULF LP (CN600302244) View 'Issued To'

History

**OPERATOR** Since 08/08/1997 View Compliance History

Now Known As: United Equipment Rentals Gulf, L.P.

Mailing Address: 5930 E LOOP 820 S FORT WORTH, TX 76119 -7028

View Earlier Holders

### **Related Information:**

**Investigations** 

**Notice of Violations** 

**Registration Information** 

### There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Periodic Reports** 

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 69863

For: UNITED EQUIPMENT RENTALS GULF 537 (RN102230174)

5930 E LOOP 820 S, FORT WORTH

Registration Status: ACTIVE

Held by: UNITED RENTALS INC (CN600494033) View 'Issued To' History

**OWNER** Since 06/01/2008 View Compliance History

Now Known As: United Rentals, Inc.

Mailing Address: 791 E 64TH AVE DENVER, CO 80229 -7201

Held by: UNITED EQUIPMENT RENTALS GULF LP (CN600302244) View 'Issued To' History

**OPERATOR** Since 08/08/1997 View Compliance History

Now Known As: United Equipment Rentals Gulf, L.P.

Mailing Address: 5930 E LOOP 820 S FORT WORTH, TX 76119 -7028

### **Financial Assurance**

None

### **Self-Certification Status by Compartment**

None

### **Registered Tanks and Their Associated Systems**

I apie T	. Onderground Storage	Talik Sullillary Vie	EW ADOVE	ground Storage	Idliks
Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
No Unde	erground Storage Tank informati	ion exist for the facility			

### Table 6. Aboveground Storage Tanks

Та	nk	Capacity	Status	Date Installed	Date Registered	Out of Use	Substance Stored	Material Of Construction	Containment	Vapor Recovery
1		4000	In Use	08/08/1997	08/11/1997		Diesel Gasoline	Concrete	Concrete	Stage 1: Not Reported

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

**Central Registry** 

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 69863

For: UNITED EQUIPMENT RENTALS GULF 537 (RN102230174)

5930 E LOOP 820 S, FORT WORTH

Registration Status: **ACTIVE** 

Held by: UNITED RENTALS INC (CN600494033) View 'Issued To' History

**OWNER** Since 06/01/2008 View Compliance History

Now Known As: United Rentals, Inc.

Mailing Address: 791 E 64TH AVE DENVER, CO 80229 -7201

Held by: UNITED EQUIPMENT RENTALS GULF LP (CN600302244) View 'Issued To' History

**OPERATOR** Since 08/08/1997 View Compliance History

Now Known As: United Equipment Rentals Gulf, L.P.

Mailing Address: 5930 E LOOP 820 S FORT WORTH, TX 76119 -7028

### **Notice of Violations Current TCEQ Rules**

<b>NOV Date</b>	Status	<b>Citation/Requirement Provision</b>	Allegation	Classification	Self Reporting Indicator
No Notice o	of Violation	ons exist for this Additional Id.			

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

# Detail of: Leaking Petroleum Storage Tanks Remediation ID Number 109721

For: **WORKINGMANS FRIEND 510 (RN104131297)** 1801 E LOOP 820, FORT WORTH

ID Number Status: INACTIVE

ID Mullibel Status. INACIANE

Responsible Parties: WORKING MANS FRIEND OIL CO (CN604452300) View Compliance History

Mailing Address: Not on file

# Correspondence Tracking

Tracking No.	Received/Sent	Direction	Type	Subject	Due Date	End Date	<b>Document Date</b>	Method
5597569	11/30/2000	OUTGOING	NLR			11/30/2000	11/30/2000	
5463033	11/29/2000	INCOMING	FSC			11/30/2000	11/21/2000	
5597566	10/03/2000	OUTGOING	FINAL			10/03/2000	10/03/2000	
5597557	09/27/2000	OUTGOING	RR - CAR			09/27/2000	09/27/2000	
5597565	09/27/2000	OUTGOING	RR			09/27/2000	09/27/2000	
5597567	09/27/2000	OUTGOING	RR - CAR			09/27/2000	09/27/2000	
5597568	09/18/2000	OUTGOING	REF - PRIV			09/18/2000	09/18/2000	
5463030	09/05/2000	INCOMING	MONIT ANNL			09/27/2000	08/30/2000	
5463031	09/05/2000	INCOMING	SCR			10/03/2000	08/30/2000	
5463032	09/05/2000	INCOMING	PROP ACT13			09/27/2000	08/30/2000	
5597563	03/17/2000	OUTGOING	RR - CAR			03/17/2000	03/17/2000	
5597564	03/17/2000	OUTGOING	RR - CAR			03/17/2000	03/17/2000	
5463028	03/07/2000	INCOMING	RBA			03/17/2000	03/01/2000	
5463029	03/07/2000	INCOMING	PROP ACT 8			03/17/2000	03/01/2000	
5597562	09/22/1999	OUTGOING	NLR			09/22/1999	09/22/1999	
5463027	09/20/1999	INCOMING	NTO			09/22/1999	09/20/1999	
5597561	08/13/1999	OUTGOING	RR - CAR			08/13/1999	08/13/1999	
5463026	08/06/1999	INCOMING	PROP ACT 5			08/13/1999	05/05/1999	
5597560	11/10/1998	OUTGOING	NRP			11/10/1998	11/10/1998	
5597559	06/24/1996	OUTGOING	SAR-RPT-OD			06/24/1996	06/24/1996	
5463025	01/24/1996	INCOMING	SAR OPT 1			09/27/2000	01/19/1996	
5597558	01/17/1996	OUTGOING	STARTUP-OD			01/17/1996	01/17/1996	
5597555	12/29/1995	OUTGOING	LAD			12/29/1995	12/29/1995	
5597556	09/29/1995	OUTGOING	STARTUP			09/29/1995	09/29/1995	
5463024	08/25/1995	INCOMING	TANK CLSR			12/29/1995	08/01/1995	

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

**Central Registry** 

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 66381

For: Z ONE GROCERY & GRILL (RN101432268)

4225 MILLER AVE, FORT WORTH

Registration Status: **ACTIVE** 

Held by: H2D GROUP, INC. (CN605452671) View 'Issued To' History

**OPERATOR** Since 12/05/2017 View Compliance History

Mailing Address: 4225 MILLER AVE FORT WORTH, TX 76119 -3646

Held by: Z ONE GROUP, INC. (CN605452663) View 'Issued To' History

**OWNER** Since 12/05/2017 View Compliance History

Mailing Address: 13 DEVON CT MANSFIELD, TX 76063 -4890

### **Commissioners' Actions**

Item Number	Item Type	<b>Document Type</b>	Status	TCEQ Docket Number	<b>SOAH Docket Number</b>
104817	ENFORCEMENT	ORDER	CLOSED	2016-1854-PST-E	N/A
98875	ENFORCEMENT	ORDER	CLOSED	2015-1221-PST-E	582-16-1820
91865	ENFORCEMENT	ORDER	CLOSED	2014-0568-PST-E	N/A
89214	ENFORCEMENT	ORDER	CLOSED	2013-1777-PST-E	N/A
70888	ENFORCEMENT	ORDER	CLOSED	2009-1930-PST-E	N/A
35377	ENFORCEMENT	ORDER	CLOSED	2003-1249-PST-E	582-05-3121
12539	ENFORCEMENT	ORDER	CLOSED	1998-1525-PST-E	582-99-2448

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

**ID Search** 

**Document Search** 

**Search Results** 

**TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 66381

View Registration

View Certificate of Delivery

For: Z ONE GROCERY & GRILL (RN101432268)

4225 MILLER AVE, FORT WORTH

Registration Status: **ACTIVE** 

Held by: H2D GROUP, INC. (CN605452671) View 'Issued To' History

**OPERATOR** Since 12/05/2017 View Compliance History

Mailing Address: 4225 MILLER AVE FORT WORTH, TX 76119 -3646

Held by: Z ONE GROUP, INC. (CN605452663) View 'Issued To' History

**OWNER** Since 12/05/2017 View Compliance History

Mailing Address: 13 DEVON CT MANSFIELD, TX 76063 -4890

View Earlier Holders

### **Related Information:**

**Commissioners' Actions** 

**Effective Enforcement Orders** 

**Investigations** 

**Notice of Violations** 

**Registration Information** 

### There is no information related to this Registration in the following categories:

**Correspondence Tracking** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

Other Incidents

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: **Petroleum Storage Tank Registration 66381**For: **Z ONE GROCERY & GRILL (RN101432268)** 

4225 MILLER AVE, FORT WORTH

Registration Status: ACTIVE

Held by: **H2D GROUP, INC. (CN605452671)** View 'Issued To' History

**OPERATOR** Since 12/05/2017 View Compliance History

Mailing Address: 4225 MILLER AVE FORT WORTH, TX 76119 -3646

Held by: Z ONE GROUP, INC. (CN605452663) View 'Issued To' History

**OWNER** Since 12/05/2017 View Compliance History

Mailing Address: 13 DEVON CT MANSFIELD, TX 76063 -4890

### **Financial Assurance**

1,000,000 Insurance Or Risk Retention, expires 11/20/2018 MID-CONTINENT INS CO, Agent

### **Self-Certification Status by Compartment**

**Expired:** 1A 2A 2B (last day of 04/2019)

View Complete Self-Certification History

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	10000	01/01/1995	In Use	A:Diesel	Tank Details Compartment Piping Vapor Recovery
2	10000	01/01/1995	In Use	A:Gasoline, B:Gasoline	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Info
1	1:Single Wall ( Composite Tank )	Composite (Steel/FRP)	A: 2: Ext Groundwater Monitoring A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve	DAL-TEX FUEL SYSTEMS (CRP000316)	LYNN WILSON	Tank Tested	Tank Summa Compartment Piping Vapor Recove

### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Spill Containment and Overfill Prevention	Related Information	<u> </u>
							-

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance		Spill Containment and Overfill Prevention	Related Information	
4	^	10000	Discol		1 . 5	1 . Tight Fill Fitting	Tomale Commonweal	~
4								

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor			
1	Pressurized	FRP	Single Wall	1: Shear Impact Valves 2: Flex Connectors	1: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recove			
4	<b>)</b>									

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Two Point System	01/01/1995			Tank Summary Tank Details Compartment Piping
2	Two Point System	01/01/1995	Assist System	01/01/1995	Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 44785

For: 7-ELEVEN 27367 (RN102277779)

4901 LITTLE RD, ARLINGTON

Registration Status: ACTIVE

Held by: 7-ELEVEN INC (CN600240329) View 'Issued To' History

**OWNER OPERATOR** Since 09/01/1987 View Compliance History

Now Known As: **7-Eleven, Inc.** 

Mailing Address: PO BOX 711 DALLAS, TX 75221 -0711

### **Investigations**

Investigation Date	Investigation Type		
04/29/2016	Compliance Investigation		
05/23/2016	Compliance Invest File Review		
09/14/2018	Compliance Investigation		

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

**ID Search** 

**Document Search** 

**Search Results** 

**TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 44785

View Registration

View Certificate of Delivery

For: **7-ELEVEN 27367 (RN102277779)** 

4901 LITTLE RD, ARLINGTON

Registration Status: **ACTIVE** 

Held by: **7-ELEVEN INC (CN600240329)** View 'Issued To' History

**OWNER OPERATOR** Since 09/01/1987 View Compliance History

Now Known As: **7-Eleven, Inc.** 

Mailing Address: PO BOX 711 DALLAS, TX 75221 -0711

### **Related Information:**

**Investigations** 

**Notice of Violations** 

**Registration Information** 

### There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 44785

For: 7-ELEVEN 27367 (RN102277779)

4901 LITTLE RD, ARLINGTON

Registration Status: **ACTIVE** 

Held by: 7-ELEVEN INC (CN600240329) View 'Issued To' History

**OWNER OPERATOR** Since 09/01/1987 View Compliance History

Now Known As: 7-Eleven, Inc.

Mailing Address: PO BOX 711 DALLAS, TX 75221 -0711

### **Financial Assurance**

1,000,000 Insurance Or Risk Retention, expires 12/18/2019 IRONSHORE SPECIALTY INS CO, Agent

### **Self-Certification Status by Compartment**

**Current:** 1A 2A 3A (through last day of 01/2020) View Complete Self-Certification History

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	Substance Stored	Related Information
1	12000	04/01/1986	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
2	12000	04/01/1986	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
3	12000	04/01/1986	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Informat	tior
1	1:Single Wall ( FRP )	FRP (Noncorrodible)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve 4: Alarm				Tank Summary Compartment Piping Vapor Recovery	
2	1:Single Wall ( FRP )	FRP (Noncorrodible)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve				Tank Summary Compartment Piping Vapor Recovery	

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information
1	A	12000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Flow Restrictor Valve 4 : Alarm	Tank Summary Tank Details Piping Vapor Recovery
2	A	12000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Flow Restrictor Valve	Tank Summary Tank Details Piping Vapor Recovery

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1	Pressurized	FRP	Single Wall	1: Shear Impact Valves	1: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recovei
2	Pressurized	FRP	Single Wall	1: Shear Impact Valves	1: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recove

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Two Point System	08/01/1994	Assist System	08/01/1994	Tank Summary Tank Details Compartment Piping
2	Two Point System	08/01/1994	Assist System	08/01/1994	Tank Summary Tank Details Compartment Piping
3	Two Point System	08/01/1994	Assist System	08/01/1994	Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

RE Search

ID Search

**Document Search** 

**Search Results** 

**Registration Detail** 

TCEQ Home
Query Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 44785

For: 7-ELEVEN 27367 (RN102277779)

4901 LITTLE RD, ARLINGTON

Registration Status: ACTIVE

Held by: 7-ELEVEN INC (CN600240329) View 'Issued To' History

**OWNER OPERATOR** Since 09/01/1987 View Compliance History

Now Known As: 7-Eleven, Inc.

Mailing Address: PO BOX 711 DALLAS, TX 75221 -0711

### **Notice of Violations Current TCEQ Rules**

NOV Date	Status	Citation/Requirement Provision	Allegation	Classification	Self Reporting Indicator
05/16/2016	RESOLVED	30 TAC Chapter 334, SubChapter C 334.49(a)(4)	Failure to provide corrosion protection to all underground metal components of an UST system which is used to convey or contain regulated substances.	MODERATE	NO
05/16/2016	RESOLVED	30 TAC Chapter 115, SubChapter C 115.246(a)(5)	Failure to maintain a record of the results of testing conducted at the motor vehicle fuel dispensing facility in accordance with the provisions specified in §115.245 of this title (relating to Testing Requirements).	MINOR	NO
05/16/2016	RESOLVED	30 TAC Chapter 115, SubChapter C 115.244(3)	Failure to conduct monthly inspections of the components listed in §115.242(3)(J) of this title.	MODERATE	NO

		, and the second second second second second second second second second second second second second second se	•	•		
05/16/2016	RESOLVED	30 TAC Chapter 115, SubChapter C 115.246(a)(6)	Failure to maintain a record of the results of the daily inspections conducted at the motor vehicle fuel dispensing facility in accordance with the provisions specified in §115.244 of this title (relating to Inspection Requirements).	MODERATE	NO	
1	I		i regan cincinco).	ſ		

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors
Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

Query Home

**Customer Search** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 49441

For: A & R FOOD MART (RN101433290)

5960 W POLY WEBB RD, ARLINGTON

Registration Status: **ACTIVE** 

Held by: NIMAT ENTERPRISE INC (CN604375675) View 'Issued To' History

**OWNER OPERATOR** Since 10/28/2012 View Compliance History

Now Known As: NIMAT ENTERPRISE, INC.

Mailing Address: 5960 W POLY WEBB RD ARLINGTON, TX 76016 -4318

### **Commissioners' Actions**

Item Number	Item Type	<b>Document Type</b>	Status	TCEQ Docket Number	<b>SOAH Docket Number</b>
102143	ENFORCEMENT	ORDER	CLOSED	2016-0584-PST-E	N/A

### Item 102143

### **Activity Actions**

<b>Action Date</b>	<b>Document Type</b>	Action
12/09/2016	Executive Director Order	MAILED
12/06/2016	Executive Director	SIGNED
11/15/2016	Item	REMAND
11/15/2016	Executive Director	SCHEDULED
04/25/2016	TCEQ Docket Number	ISSUED
04/25/2016	TCEQ Docket Number	REQUESTED

### **Protestant Information**

Request Type	Count
No Protestant information exis	st for this item

### **Filings**

Date Received	Title				
11/10/2016 8:00 AM	EX. SUMM., PCW, ORDER				

### **Public Meeting**

<b>Meeting Type</b>	<b>Meeting Date</b>	<b>Meeting Time</b>	Location	<b>Total Attendance</b>			
No Public Meeting exist for this Item.							

..... Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors
Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 49441

For: A & R FOOD MART (RN101433290)

5960 W POLY WEBB RD, ARLINGTON

Registration Status: **ACTIVE** 

Held by: NIMAT ENTERPRISE INC (CN604375675) View 'Issued To' History

**OWNER OPERATOR** Since 10/28/2012 View Compliance History

Now Known As: NIMAT ENTERPRISE, INC.

Mailing Address: 5960 W POLY WEBB RD ARLINGTON, TX 76016 -4318

**Effective Enforcement Orders Current TCEQ Rules** 

Туре	<b>Effective Date</b>	<b>Docket Number</b>	Citation/Requirement Provision	<b>Violation Allegation</b>	Classification
ADMINISTRATIVE ORDER	12/06/2016	2016-0584- PST-E	2D TWC Chapter 26, SubChapter A 26.3475(d); 30 TAC Chapter 334, SubChapter C 334.49(a)(4) (Not applicable to CH)	Failure to maintain corrosion protection on all underground metal components of an underground storage tank system.	MODERATE
ADMINISTRATIVE ORDER	12/06/2016	2016-0584- PST-E	2D TWC Chapter 26, SubChapter A 26.3475(c)(1); 30 TAC Chapter 334, SubChapter C 334.50(b)(1) (A) (Not applicable to CH)	Failed to monitor the USTs for releases at a frequency of at least once every month (not to exceed 35 days between each monitoring).	MODERATE

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**RE Search Search Results Customer Search ID Search Document Search TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

> Detail of: **Petroleum Storage Tank Registration 49441** View Registration

View Certificate of Delivery

For: A & R FOOD MART (RN101433290)

5960 W POLY WEBB RD, ARLINGTON

Registration Status: **ACTIVE** 

Held by: NIMAT ENTERPRISE INC (CN604375675) View 'Issued To' History

**OWNER OPERATOR** Since 10/28/2012 View Compliance History

Now Known As: NIMAT ENTERPRISE, INC.

Mailing Address: 5960 W POLY WEBB RD ARLINGTON, TX 76016 -4318

View Earlier Holders

### **Related Information:**

**Commissioners' Actions** 

**Effective Enforcement Orders** 

**Investigations** 

**Registration Information** 

There is no information related to this Registration in the following categories:

Correspondence Tracking

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 49441

For: A & R FOOD MART (RN101433290)

5960 W POLY WEBB RD, ARLINGTON

Registration Status: ACTIVE

Held by: NIMAT ENTERPRISE INC (CN604375675) View 'Issued To' History

**OWNER OPERATOR** Since 10/28/2012 View Compliance History

Now Known As: NIMAT ENTERPRISE, INC.

Mailing Address: 5960 W POLY WEBB RD ARLINGTON, TX 76016 -4318

### **Financial Assurance**

1,000,000 Insurance Or Risk Retention, expires 10/26/2019 MID-CONTINENT INS CO, Agent

### **Self-Certification Status by Compartment**

**Current:** 1A 2A 3A (through last day of 04/2020) View Complete Self-Certification History

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	Substance Stored	Related Information
1	10000	01/01/1989	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
2	10000	01/01/1989	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
3	10000	01/01/1989	In Use	A:Diesel	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	1:Double Wall ( Composite Tank )	Factory Install Cath Protec	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Delivery Shutoff Valve				Tank Summary Compartment Piping Vapor Recovery
2	1:Double Wall ( Composite Tank )	Factory Install Cath Protec	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Delivery Shutoff Valve				Tank Summary Compartment Piping Vapor Recovery

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information
1	A	10000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Delivery Shutoff Valve	Tank Summary Tank Details Piping Vapor Recovery
2	A	10000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Delivery Shutoff Valve	Tank Summary Tank Details Piping Vapor Recovery
					– .		

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1	Pressurized	FRP	Double Wall		1: FRP (Noncorrodible)	A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recovel
2	Pressurized	FRP	Double Wall		1: FRP (Noncorrodible)	A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recovel
3	Pressurized	FRP	Double Wall		1: FRP (Noncorrodible)	A:Auto Line Leak Detector	Tank Summar Tank Details

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Two Point System	11/06/1989	Assist System	01/01/1994	Tank Summary Tank Details Compartment Piping
2		11/06/1989	Assist System	01/01/1994	Tank Summary Tank Details Compartment Piping
3	Two Point System	11/06/1989			Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 57186

For: ANGLIN FOOD STORE (RN101572212)

4724 SE LOOP 820, FOREST HILL

Registration Status: ACTIVE

Held by: NOORANI CORPORATION (CN600834337) View 'Issued To' History

**OWNER OPERATOR** Since 10/24/1995 View Compliance History

Mailing Address: 4724 SE LOOP 820 FOREST HILL, TX 76140 -1449

### **Investigations**

<b>Investigation Date</b>	Investigation Type
06/01/2016	Compliance Investigation
10/17/2018	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**ID Search RE Search Search Results Customer Search Document Search TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

> Detail of: Petroleum Storage Tank Registration 57186 View Registration

View Certificate of Delivery

For: ANGLIN FOOD STORE (RN101572212)

4724 SE LOOP 820, FOREST HILL

Registration Status: **ACTIVE** 

Held by: NOORANI CORPORATION (CN600834337) View 'Issued To' History

**OWNER OPERATOR** Since 10/24/1995 View Compliance History

Mailing Address: 4724 SE LOOP 820 FOREST HILL, TX 76140 -1449

View Earlier Holders

### **Related Information:**

**Investigations** 

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 57186

For: ANGLIN FOOD STORE (RN101572212)

4724 SE LOOP 820, FOREST HILL

Registration Status: ACTIVE

Held by: NOORANI CORPORATION (CN600834337) View 'Issued To' History

**OWNER OPERATOR** Since 10/24/1995 View Compliance History

Mailing Address: 4724 SE LOOP 820 FOREST HILL, TX 76140 -1449

### **Financial Assurance**

1,000,000 Insurance Or Risk Retention, expires 02/13/2020 MID-CONTINENT INS CO, Agent

### **Self-Certification Status by Compartment**

**Current:** 1A 2A 3A (through last day of 04/2020) View Complete Self-Certification History

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	10000	11/01/1990	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
2	10000	11/01/1990	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
3	10000	11/01/1990	In Use	A:Diesel	Tank Details Compartment Piping Vapor Recovery

### Table 2. Tank Details

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	1:Single Wall ( Composite Tank )	Composite (Steel/FRP)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Delivery Shutoff Valve	S & W CONSTRUCTION INC (CRP000054)	WAYNE TENNISON	Tank Tested	Tank Summary Compartment Piping Vapor Recovery
2	1:Single Wall ( Composite Tank )	Composite (Steel/FRP)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Delivery Shutoff	S & W CONSTRUCTION INC (CRP000054)	WAYNE TENNISON	Tank Tested	Tank Summary Compartment Piping Vapor Recovery

### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information
1	A	10000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Delivery Shutoff Valve	Tank Summary Tank Details Piping Vapor Recovery
2	А	10000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Delivery Shutoff Valve	Tank Summary Tank Details Piping Vapor Recovery

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1	Pressurized	FRP	Single Wall		1: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recove
2	Pressurized	FRP	Single Wall		1: Nonmetallic Flex Piping	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recover

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	<b>Date Installed</b>	Type of Stage 2	Date Installed	Related Information
1	Not Reported				Tank Summary Tank Details Compartment Piping
2	Not Reported				Tank Summary Tank Details Compartment Piping
3	Not Reported				Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Report Data Errors
Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**RE Search ID Search Search Results Customer Search Document Search TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 1275

For: ARTHUR HAGAR (RN101563880)

5020 SE LOOP 820, FORT WORTH

Registration Status: INACTIVE

Held by: ARTHUR HAGAR CORP (CN600828081) View 'Issued To' History

**OWNER** Since 06/03/1986

Now Known As: Arthur Hagar Corporation

Mailing Address: PO BOX 14867 FORT WORTH, TX 76117 -0867

### **Related Information:**

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 1275

For: ARTHUR HAGAR (RN101563880)

5020 SE LOOP 820, FORT WORTH

Registration Status: INACTIVE

Held by: ARTHUR HAGAR CORP (CN600828081) View 'Issued To' History

**OWNER** Since 06/03/1986

Now Known As: Arthur Hagar Corporation

Mailing Address: PO BOX 14867 FORT WORTH, TX 76117 -0867

### **Financial Assurance**

None

### **Self-Certification Status by Compartment**

None

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1		01/01/1974	Removed from Ground (12/04/1995)	A:Gasoline	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tanl	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	( Steel )							Tank Summary Compartment Piping Vapor Recovery

### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information	or
1	А	0	Gasoline				Tank Summary Tank Details	•
4								<b>&gt;</b>

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1		Steel					Tank Summar Tank Details

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Not Reported				Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Search Results **Document Search ID** Search RE Search **Customer Search** Query Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 60843

For: BILL PATTERSTON MOTORS (RN101571008)

6200 E ROSEDALE ST, FORT WORTH

Registration Status: INACTIVE

Held by: DOUGLAS CLIFTON (CN600833412) View 'Issued To' History

**OWNER** Since 10/23/1991

Mailing Address: 6225 RAMEY AVE FORT WORTH, TX 76112 -8056

## Related Information:

**Registration Information** 

There is no information related to this Registration in the following categories:

Commissioners' Actions

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

Complaints

Discharges

**Emergency Response Events** 

**Emission Events** 

Fish Kills

### Other Incidents Investigations Periodic Reports

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**RE Search ID Search Search Results Customer Search Document Search TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 29815

For: BOB MCCASLIN ANCHOR (RN101548188)

3951 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: BOB MCCASLIN ANCHOR CO (CN600816052) View 'Issued To' History

**OWNER** Since 10/30/1986

Now Known As: Bob McCaslin Anchor Company

Mailing Address: 3951 E LOOP 820 S FORT WORTH, TX 76119 -4338

### **Related Information:**

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**RE Search Search Results Customer Search ID Search Document Search TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 63669

For: BOBCAT OF FORT WORTH (RN100602101)

2727 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: BERRY COMPANIES INC (CN603033416) View 'Issued To' History

**OWNER OPERATOR** Since 11/11/2011 View Compliance History

Now Known As: Berry Companies, Inc.

Mailing Address: 2727 E LOOP 820 S FORT WORTH, TX 76119 -1855

View Earlier Holders

### **Related Information:**

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

Correspondence Tracking

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

Other Incidents

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 63669

For: BOBCAT OF FORT WORTH (RN100602101)

2727 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: BERRY COMPANIES INC (CN603033416) View 'Issued To' History

**OWNER OPERATOR** Since 11/11/2011 View Compliance History

Now Known As: Berry Companies, Inc.

Mailing Address: 2727 E LOOP 820 S FORT WORTH, TX 76119 -1855

### **Financial Assurance**

None

### **Self-Certification Status by Compartment**

None

### **Registered Tanks and Their Associated Systems**

### Table 1. Underground Storage Tank Summary View Aboveground Storage Tanks

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information			
No Underground Storage Tank information exist for the facility								

### **Table 6. Aboveground Storage Tanks**

Tank	Capacity	Status	Date Installed	Date Registered	Out of Use	Substance Stored	Material Of Construction	Containment	Vapor Recovery
Α	2000	Out Of Use	01/01/1991	10/29/1992	10/31/2016	Gasoline	Steel	Concrete	Stage 1: Not Reported Stage 2: EXEMPT BY TCEQ RULE
В	2000	Out Of Use	01/01/1991	10/29/1992	10/31/2016	Diesel Diesel	Steel	Concrete	Stage 1: Not Reported

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

**ID Search** 

**Document Search** 

**Search Results** 

**TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 5639

For: CHEVRON FAC 106181 (RN102322450)

5729 E BERRY ST, FORT WORTH

Registration Status: INACTIVE

Held by: CHEVRON USA INC (CN600132484) View 'Issued To' History

**OWNER** Since 09/01/1988

Now Known As: Chevron U.S.A. Inc.

Mailing Address: PO BOX 6004 SAN RAMON, CA 94583 -0904

### **Related Information:**

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 5639

For: CHEVRON FAC 106181 (RN102322450)

5729 E BERRY ST, FORT WORTH

Registration Status: INACTIVE

Held by: CHEVRON USA INC (CN600132484) View 'Issued To' History

**OWNER** Since 09/01/1988

Now Known As: Chevron U.S.A. Inc.

Mailing Address: PO BOX 6004 SAN RAMON, CA 94583 -0904

### **Financial Assurance**

None

### **Self-Certification Status by Compartment**

None

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
104S	10000	07/01/1977	Removed from Ground (12/17/1997)	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
345G	10000	07/01/1977	Removed from Ground (12/17/1997)	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
601C	10000	07/01/1977	Removed from Ground (12/17/1997)	A:Gasoline	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Informat	tior
104S	1:Single Wall ( FRP )	FRP (Noncorrodible)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting			Tank Tested	Tank Summary Compartment Piping Vapor Recovery	
345G	1:Single Wall ( FRP )	FRP (Noncorrodible)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting			Tank Tested	Tank Summary Compartment Piping Vapor Recovery	
601C	1:Single Wall ( FRP )	FRP (Noncorrodible)	A: 4: Auto Tank	A: 1: Tight Fill Fitting			Tank Tested	Tank Summary Compartment	

### **Table 3. Compartment Details**



Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spili Containment and Overfili Prevention	Related Informatio
104S	A	10000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting	Tank Summary Tank Details Piping Vapor Recovery
345G	A	10000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting	Tank Summary Tank Details Piping Vapor Recovery

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Inf
104S		FRP	Single Wall		1: FRP (Noncorrodible)	A:Auto Line Leak Detector	Tank Summ Tank Details Compartme Vapor Recov
345G		FRP	Single Wall		1: FRP (Noncorrodible)	A:Auto Line Leak Detector	Tank Summ Tank Details Compartme Vapor Recov
601C		FRP	Single Wall		1: FRP (Noncorrodible)	A:Auto Line Leak Detector	Tank Summ Tank Details

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	<b>Related Information</b>
104S	Not Reported			02/18/1994	Tank Summary Tank Details Compartment Piping
345G	Not Reported			02/18/1994	Tank Summary Tank Details Compartment Piping
601C	Not Reported			02/18/1994	Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors
Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

**ID Search** 

**Document Search** 

**Search Results** 

**TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 61677

For: **DOUGLAS & ELMS (RN102397262)** 

5733 GOOD SHEPHERD WAY, FORT WORTH

Registration Status: INACTIVE

Held by: DOUGLAS & ELMS INC (CN601246952) View 'Issued To' History

**OWNER** Since 11/18/1991

Now Known As: Douglas & Elms, Inc.

Mailing Address: 16500 SAN PEDRO AVE STE 215 SAN ANTONIO, TX 78232 -2253

### **Related Information:**

### **Registration Information**

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 61677

For: **DOUGLAS & ELMS (RN102397262)** 

5733 GOOD SHEPHERD WAY, FORT WORTH

Registration Status: INACTIVE

Held by: DOUGLAS & ELMS INC (CN601246952) View 'Issued To' History

**OWNER** Since 11/18/1991

Now Known As: Douglas & Elms, Inc.

Mailing Address: 16500 SAN PEDRO AVE STE 215 SAN ANTONIO, TX 78232 -2253

### **Financial Assurance**

None

### **Self-Certification Status by Compartment**

None

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	1000	08/31/1987	Permanently Filled in Place (11/12/1991)	A:Diesel	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1							Tank Tested	Tank Summary Compartment Piping Vapor Recovery

### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information	•
1	А		Diesel				Tank Summary Tank Details	•
4								

### **Table 4. Piping Systems**

Tank <sup>*</sup>	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	<b>Corrosion Protection</b>	Release Detection	Related Infor
1							Tank Summar Tank Details

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Not Reported				Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

**ID Search** 

**Document Search** 

**Search Results** 

**TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 836

For: **DYKES AIR (RN101563591)** 

4800 SE LOOP 820, FORT WORTH

Registration Status: INACTIVE

Held by: DYKES AIR INC (CN600827844) View 'Issued To' History

**OWNER** Since 05/30/1986

Now Known As: Dykes Air, Inc.

Mailing Address: 3200 RIVERFRONT DR STE 100 FORT WORTH, TX 76107 -6560

### **Related Information:**

### **Registration Information**

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 836

For: **DYKES AIR (RN101563591)** 

4800 SE LOOP 820, FORT WORTH

Registration Status: INACTIVE

Held by: DYKES AIR INC (CN600827844) View 'Issued To' History

**OWNER** Since 05/30/1986

Now Known As: Dykes Air, Inc.

Mailing Address: 3200 RIVERFRONT DR STE 100 FORT WORTH, TX 76107 -6560

### **Financial Assurance**

None

### **Self-Certification Status by Compartment**

None

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	5000	01/01/1980	Removed from Ground (09/05/1990)	A:Gasoline	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tanl	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	( Steel )							Tank Summary Compartment Piping Vapor Recovery

### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information	•
1	А	5000	Gasoline				Tank Summary Tank Details	•
4								

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1		Steel					Tank Summar Tank Details
4							Compartment

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Not Reported				Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**RE Search Customer Search** 

**ID Search** 

**Document Search** 

**Search Results** 

**TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 1376

For: EAST SIDE OFFICE SUPPLY (RN101534576)

2837 S CRAVENS RD, FORT WORTH

Registration Status: INACTIVE

Held by: EAST SIDE OFFICE SUPPLY (CN600805626) View 'Issued To' History

**OWNER** Since 06/03/1986

Now Known As: DRC Investments, Inc.

Mailing Address: 9816 CREEKSIDE DR FORT WORTH, TX 76126 -1715

### **Related Information:**

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 1376

For: EAST SIDE OFFICE SUPPLY (RN101534576)

2837 S CRAVENS RD, FORT WORTH

Registration Status: INACTIVE

Held by: EAST SIDE OFFICE SUPPLY (CN600805626) View 'Issued To' History

**OWNER** Since 06/03/1986

Now Known As: **DRC Investments, Inc.** 

Mailing Address: 9816 CREEKSIDE DR FORT WORTH, TX 76126 -1715

### **Financial Assurance**

None

### **Self-Certification Status by Compartment**

None

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	1000	01/01/1983	Removed from Ground (12/01/1997)	A:Gasoline	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	( Steel )							Tank Summary Compartment Piping Vapor Recovery

### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information	•
1	А	1000	Gasoline				Tank Summary Tank Details	<b>•</b>
4								

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1		Steel					Tank Summar Tank Details

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Not Reported				Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**RE Search ID Search Search Results Customer Search Document Search TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 18602

For: EASTSIDE CENTER (RN101550259)

6050 TENSION DR, FORT WORTH

Registration Status: INACTIVE

Held by: U-HAUL CO OF DALLAS (CN600815815) View 'Issued To' History

**OWNER** Since 09/03/1986

Now Known As: U-Haul Co. of Texas

Mailing Address: 920 MACARTHUR BLVD GRAND PRAIRIE, TX 75050 -4447

### **Related Information:**

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 18602

For: EASTSIDE CENTER (RN101550259)

6050 TENSION DR, FORT WORTH

Registration Status: INACTIVE

Held by: U-HAUL CO OF DALLAS (CN600815815) View 'Issued To' History

**OWNER** Since 09/03/1986

Now Known As: U-Haul Co. of Texas

Mailing Address: 920 MACARTHUR BLVD GRAND PRAIRIE, TX 75050 -4447

### **Financial Assurance**

None

### **Self-Certification Status by Compartment**

None

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	2000	08/31/1987	Removed from Ground (12/01/1990)	A:Gasoline	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1							Tank Tested	Tank Summary Compartment Piping Vapor Recovery

### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information	•
1	А	2000	Gasoline				Tank Summary Tank Details	<b>•</b>
4								

### **Table 4. Piping Systems**

Tank <sup>*</sup>	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	<b>Corrosion Protection</b>	Release Detection	Related Infor
1							Tank Summar Tank Details

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Not Reported				Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 73461

For: **FUEL UP MART (RN101435576)** 

4331 KELLY ELLIOTT RD, ARLINGTON

Registration Status: ACTIVE

Held by: Vjp Ventures, LLC (CN605387257) View 'Issued To' History

**OWNER OPERATOR** Since 06/01/2017 View Compliance History

Mailing Address: 4331 KELLY ELLIOTT RD ARLINGTON, TX 76016 -4629

### **Investigations**

<b>Investigation Date</b>	Investigation Type
06/04/2015	Compliance Investigation
11/21/2016	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

**ID Search** 

**Document Search** 

**Search Results** 

**TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: **Petroleum Storage Tank Registration 73461** 

View Registration

View Certificate of Delivery

For: **FUEL UP MART (RN101435576)** 

4331 KELLY ELLIOTT RD, ARLINGTON

Registration Status: **ACTIVE** 

Held by: Vjp Ventures, LLC (CN605387257) View 'Issued To' History

**OWNER OPERATOR** Since 06/01/2017 View Compliance History

Mailing Address: 4331 KELLY ELLIOTT RD ARLINGTON, TX 76016 -4629

View Earlier Holders

### **Related Information:**

**Investigations** 

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 73461

For: **FUEL UP MART (RN101435576)** 

4331 KELLY ELLIOTT RD, ARLINGTON

Registration Status: ACTIVE

Held by: Vjp Ventures, LLC (CN605387257) View 'Issued To' History

**OWNER OPERATOR** Since 06/01/2017 View Compliance History

Mailing Address: 4331 KELLY ELLIOTT RD ARLINGTON, TX 76016 -4629

### **Financial Assurance**

1,000,000 Insurance Or Risk Retention, expires 05/30/2019 MID-CONTINENT INS CO, Agent

### **Self-Certification Status by Compartment**

**Current:** 1A 2A (through last day of 08/2019)

View Complete Self-Certification History

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	12000	01/04/2000	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
2	8000	01/04/2000	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	1:Double Wall ( Composite Tank )	Composite (Steel/FRP)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Delivery Shutoff Valve 4: Flow Restrictor				Tank Summary Compartment Piping Vapor Recovery

### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information

### **Table 4. Piping Systems**

1 Pressurized FRP Double Wall 1: Flex Connectors 1: FRP (Noncorrodible) A: Ann Pipe Tightness/Electr Mon A: Auto Line Leak Detector Tank Details Compartment Vapor Recover	Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
	1	Pressurized	FRP	Double Wall	1: Flex Connectors		Tightness/Electr Mon A:Auto Line Leak	Tank Details Compartment

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Two Point System	01/04/2000	Balance System	04/01/2000	Tank Summary Tank Details Compartment Piping
2	Two Point System	01/04/2000	Balance System	04/01/2000	Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

**ID Search** 

**Document Search** 

**Search Results** 

**TCEO Home** 

**Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 41539

For: FORT WORTH TOWER (RN100521855)

1901 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: FWT INC (CN600242176) View 'Issued To' History

**OWNER** View Compliance History

Now Known As: Tower 50 Family, Inc.

Mailing Address: PO BOX 8597 FORT WORTH, TX 76124 -0597

### **Related Information:**

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 41539

For: FORT WORTH TOWER (RN100521855)

1901 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: FWT INC (CN600242176) View 'Issued To' History

**OWNER** View Compliance History

Now Known As: Tower 50 Family, Inc.

Mailing Address: PO BOX 8597 FORT WORTH, TX 76124 -0597

### **Financial Assurance**

None

### **Self-Certification Status by Compartment**

None

### **Registered Tanks and Their Associated Systems**

### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	<b>Related Information</b>
1	2000	01/01/1975	Removed from Ground (11/30/1998)	A:Gasoline	Tank Details Compartment Piping Vapor Recovery
2	2000	01/01/1975	Removed from Ground (11/30/1998)	A:Diesel	Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Informat	ior
1	( Steel )						Tank Tested	Tank Summary Compartment Piping Vapor Recovery	
2	( Steel )						Tank Tested	Tank Summary Compartment Piping	,

### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information
1	А	2000	Gasoline				Tank Summary Tank Details Piping Vapor Recovery
				•	•		•

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1		Steel					Tank Summar Tank Details Compartment Vapor Recove
2		Steel					Tank Summar Tank Details

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	<b>Date Installed</b>	Type of Stage 2	Date Installed	Related Information
1	Not Reported				Tank Summary Tank Details Compartment Piping
2	Not Reported				Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home	
Registration Detail	
Search Results	
Document Search	
ID Search	
RE Search	
r Search	

Query Home

Questions or Comments >>

## Central Registry

Customer

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 89323

For: KROGER FUEL CENTER 592 (RN109844720)

5175 W SUBLETT RD, ARLINGTON

Registration Status: ACTIVE

Held by: Kroger Texas L.P. (CN601489354) View 'Issued To' History

**OWNER OPERATOR** Since 07/11/2017 View Compliance History

Mailing Address: 751 FREEPORT PKWY COPPELL, TX 75019 -4411

### **Investigations**

Investigation Date	Investigation Type
01/29/2018	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Search Results **Document Search ID** Search **RE Search Customer Search** Query Home

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

View Registration Detail of: Petroleum Storage Tank Registration 89323

View Certificate of Delivery

For: KROGER FUEL CENTER 592 (RN109844720)

5175 W SUBLETT RD, ARLINGTON

Registration Status: ACTIVE

Held by: Kroger Texas L.P. (CN601489354) View 'Issued To' History

**OWNER OPERATOR** Since 07/11/2017 View Compliance History

Mailing Address: 751 FREEPORT PKWY COPPELL, TX 75019 -4411

# Related Information:

Investigations

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

Complaints

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

**Fish Kills** 

Other Incidents

Periodic Reports

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**ID Search RE Search Customer Search** 

Query Home

Registration Detail

Search Results

TCEQ Home

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 89323

For: **KROGER FUEL CENTER 592 (RN109844720)** 

5175 W SUBLETT RD, ARLINGTON

Registration Status: ACTIVE

Held by: Kroger Texas L.P. (CN601489354) View 'Issued To' History

OWNER OPERATOR Since 07/11/2017 View Compliance History

Mailing Address: 751 FREEPORT PKWY COPPELL, TX 75019 -4411

### Financial Assurance

1,000,000 Insurance Or Risk Retention, expires 05/01/2019

ILLINOIS UNION INS CO, Agent

# Self-Certification Status by Compartment

**Current:** 1A 2A 2B (through last day of 04/2020)

View Complete Self-Certification History

# Registered Tanks and Their Associated Systems

# Table 1. Underground Storage Tank Summary

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Substance Stored   Related Information	4
н	20000	11/30/2017	In Use	A:Gasoline	Tank Details Compartment Piping	
ps://www15.tce	ps://www15.tceq.texas.gov/crpub/index.cfm?fuseaction=iwr.pgmdetail&addn_id=4	gmdetail&addn_id=441521772017194	1&re id=43052177201	7194&lgcy sys cd=PST&prog	41521772017194&re id=430521772017194&lgcy sys cd=PST&program=PETROLEUM STORAGE TANK REGIST 1/3	1/3

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Substance Stored Related Triffmation	
7	18000	11/30/2017	In Use	A:Gasoline, B:Diesel	Tank Details Compartment Piping	
					Vapor Recovery	

### **Table 2. Tank Details**

4	<b>&gt;</b>	
Related Inf	Tank Summ Compartme Piping Vapor Reco	•
Test Result	Tank Tested	
Installer		
Installation Contractor Installer	MC SERVICES (CRP001317)	
Spill Containment and Overfill Prevention	A: 1: Tight Fill Fitting 2: Delivery Shutoff Valve 3: Alarm	
Release Detection	A: 3: Monitoring 2nd Contai Barrier A: 4: Auto	
Corrosion Protection	FRP (Noncorrodible)	
Tank Design & Materials	1:Double Wall ( FRP )	
Tank	↔	<b>V</b>

# **Table 3. Compartment Details**

<b>→</b>	<b>•</b>
Related Informatior	Tank Summary Tank Details Piping Vapor Recovery
Spill Containment and Overfill Prevention	1 : Tight Fill Fitting 2 : Delivery Shutoff Valve 3 : Alarm
Release Detection	1: Monitoring 2nd Contai Barrier 2: Auto Tank Gauge & Inv Cntrl 3: Interstitial
Other Substance	
Tank Compartment (gallons) Principal Substance Other Substance Release Detection and Over	Gasoline
Capacity (gallons)	20000
Compartment	4
Tank	

## **Table 4. Piping Systems**

4	7	
	l Info	
	Related In	
	ction Re	_
	etectio	
	Det	
	lease	
	n Re	_
	tection Release D	
	Pro	
	osion	
	Corro	
	lves C	
	Ivalv	
	nnectors and val	
	ctors	
	onne	
_		_
n and		)
esian a	xternal	
	E C	)
	lateria	
	ng M	
	Pipi	_
	of Piping F	
	of Pi	
	Гуре	
	] Jue	_
	ř	

2/3

•	
ion Related Infor	^
n Re	
Release Detectio	
tection	
2	
rosion P	
S Cori	
valve	
s and	
nectors and valves	
Con	
Design and External Containment	
erial	
p Piping Material	
Pipin	
f Piping	
k Type	
Tank	<b>V</b>

# Table 5. Vapor Recovery Systems

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
П	Two Point System				Tank Summary Tank Details Compartment Piping
2	Two Point System				Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**RE Search ID Search Customer Search Document Search** 

**Search Results** 

**TCEO Home Query Home** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 47402

For: L GRIMES & (RN101548402)

3401 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: L GRIMES & CO INC (CN600816227) View 'Issued To' History

**OWNER** Since 03/03/1989

Now Known As: L. Grimes and Company, Inc.

Mailing Address: 6328 NORMA ST FORT WORTH, TX 76112 -5550

### **Related Information:**

### **Registration Information**

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

TCEQ Home Search Results **Document Search ID** Search RE Search **Customer Search** Query Home

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 53700

For: LARRY RIGGAN (RN101537561)

4301 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: RIGGAN, LARRY (CN603835216) View 'Issued To' History

**OWNER** Since 01/01/2006 View Compliance History

Now Known As:

Mailing Address: 9510 RAVENSWOOD RD GRANBURY, TX 76049 -4524

View Earlier Holders

# Related Information:

**Registration Information** 

There is no information related to this Registration in the following categories:

Commissioners' Actions

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

Complaints

Discharges

**Emergency Response Events** 

Emission Events

Fish Kills Other Incidents Investigations Periodic Reports Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Report Data Errors Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Search Results **ID Search RE Search** 

**Customer Search** 

Query Home

TCEQ Home

Registration Detail

**Central Registry** 

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 53700

For: LARRY RIGGAN (RN101537561)

4301 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: RIGGAN, LARRY (CN603835216) View 'Issued To' History

**OWNER** Since 01/01/2006 View Compliance History

Now Known As:

Mailing Address: 9510 RAVENSWOOD RD GRANBURY, TX 76049 -4524

### Financial Assurance

None

# Self-Certification Status by Compartment

None

# Registered Tanks and Their Associated Systems

# Table 1. Underground Storage Tank Summary

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Substance Stored Related Information
DIESEL	2000	02/01/1990	Removed from Ground (12/02/2014)		Tank Details Compartment Piping Vapor Recovery

### **Table 2. Tank Details**

4	<b></b>
Related Information	Tank Summary Compartment Dining
Test Result	Tank Tested
Installer Result R	
<b>Installation</b> <b>Contractor</b>	
Spill Containment and Overfill Prevention	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Robt/Sumn
Release Detection	
Corrosion Protection	Composite (Steel/FRP)
Design & Materials	1:Single Wall ( Composite Tank )
Tank	DIESEL

# **Table 3. Compartment Details**

4	<b>+</b>
Related Informat	Tank Summary Tank Details Pining
Spill Containment and Overfill Prevention	1 : Tight Fill Fitting Tank Summary 2 : Fac Built Spill Tank Details Cont/Rckt/Sumn
Release Detection	
Other Substance	
Principal Substance Other Substance Release Detection and Ove	
Capacity (gallons)	
Compartment	۷.
Tank	DIESEL

## Table 4. Piping Systems

4	<b>)</b>
Related I	Tank Sum Tank Deta Compartin
Release Detection	A:Ann Pipe Tightness/Electr Mon
Corrosion Protection	1: Field Install Cath Protec
Connectors and valves Corrosion Protection Release Detection Related I	
Design and External Containment	Single Wall
Type of Piping Piping Material External Containm	FRP
Type of Piping	Pressurized
Tank	DIESEL

# Table 5. Vapor Recovery Systems

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 20228

For: LEITO ENTERPRISES (RN101544534)

4333 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: LEITO ENTERPRISES LP (CN602563264) View 'Issued To' History

**OWNER OPERATOR** Since 07/01/2003 View Compliance History

Now Known As: Leito Enterprises, LP

Mailing Address: 4333 E LOOP 820 S FORT WORTH, TX 76119 -4467

### **Investigations**

Investigation Date	Investigation Type
02/04/2014	Compliance Investigation
01/17/2017	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

**ID Search** 

**Document Search** 

**Search Results** 

**TCEO Home** 

**Query Home** 

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 20228

View Certificate of Delivery

For: LEITO ENTERPRISES (RN101544534)

4333 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: LEITO ENTERPRISES LP (CN602563264) View 'Issued To' History

**OWNER OPERATOR** Since 07/01/2003 View Compliance History

Now Known As: Leito Enterprises, LP

Mailing Address: 4333 E LOOP 820 S FORT WORTH, TX 76119 -4467

View Earlier Holders

### **Related Information:**

**Investigations** 

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 20228

For: LEITO ENTERPRISES (RN101544534)

4333 E LOOP 820 S, FORT WORTH

Registration Status: INACTIVE

Held by: LEITO ENTERPRISES LP (CN602563264) View 'Issued To' History

**OWNER OPERATOR** Since 07/01/2003 View Compliance History

Now Known As: Leito Enterprises, LP

Mailing Address: 4333 E LOOP 820 S FORT WORTH, TX 76119 -4467

#### **Financial Assurance**

1,000,000 Insurance Or Risk Retention, expires 03/26/2017 COLONY INS CO, Agent

#### **Self-Certification Status by Compartment**

**Expired:** 1A 2A (last day of 07/2017)

View Complete Self-Certification History

### **Registered Tanks and Their Associated Systems**

#### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	6000	10/01/1985	Removed from Ground (08/07/2018)		Tank Details Compartment Piping Vapor Recovery
2	8000	10/01/1985	Removed from Ground (08/07/2018)		Tank Details Compartment Piping Vapor Recovery

#### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	1:Single Wall ( FRP )	FRP (Noncorrodible)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Delivery Shutoff Valve			Tank Tested	Tank Summary Compartment Piping Vapor Recovery

#### **Table 3. Compartment Details**

Та	nk	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information
1		A	6000			1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Delivery Shutoff Valve	Tank Summary Tank Details Piping Vapor Recovery

## Snill Containment

### **Table 4. Piping Systems**

Valves Coat/Wrap/Tape Tightness/Electr Tank Details 2: Steel Swing Joints 2: FRP Mon Compartment	Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
	1	Pressurized	FRP	Single Wall	Valves 2: Steel Swing Joints	Coat/Wrap/Tape 2: FRP (Noncorrodible) 3: Nonmetallic Flex	Tightness/Electr Mon A:Auto Line Leak	Tank Summar Tank Details Compartment Vapor Recover

#### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	<b>Date Installed</b>	Related Information
1	Two Point System		Exempt by TCEQ Rule		Tank Summary Tank Details Compartment Piping
2	Two Point System				Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 48700

For: MEINEKE CAR CARE CENTER 4169 (RN101854180)

5980 W POLY WEBB RD, ARLINGTON

Registration Status: ACTIVE

Held by: Landis Properties, LLC (CN605237635) View 'Issued To' History

**OWNER** Since 08/23/2012 View Compliance History

Mailing Address: 980 N FEDERAL HWY STE 302 BOCA RATON, FL 33432 -2704

Held by: Cipercen LLC (CN604733170) View 'Issued To' History

**OPERATOR** Since 04/01/2015 View Compliance History

Mailing Address: 3273 W PIONEER PKWY PANTEGO, TX 76013 -4620

## Petroleum Storage Tank Complaints at MEINEKE CAR CARE CENTER 4169

Tracking Number	<b>Complaint Received</b>	Status	<b>Status Date</b>	
22410	06/12/2003	CLOSED	07/18/2003	

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 48700

For: MEINEKE CAR CARE CENTER 4169 (RN101854180)

5980 W POLY WEBB RD, ARLINGTON

Registration Status: ACTIVE

Held by: Landis Properties, LLC (CN605237635) View 'Issued To' History

**OWNER** Since 08/23/2012 View Compliance History

Mailing Address: 980 N FEDERAL HWY STE 302 BOCA RATON, FL 33432 -2704

Held by: Cipercen LLC (CN604733170) View 'Issued To' History

**OPERATOR** Since 04/01/2015 View Compliance History

Mailing Address: 3273 W PIONEER PKWY PANTEGO, TX 76013 -4620

## **Investigations**

Investigation Date	Investigation Type
07/13/2016	Compliance Investigation
12/19/2018	Compliance Investigation

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

**ID Search** 

**Document Search** 

**Search Results** 

**TCEO Home** 

**Query Home** 

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

> Detail of: **Petroleum Storage Tank Registration 48700** View Registration

For: MEINEKE CAR CARE CENTER 4169 (RN101854180)

5980 W POLY WEBB RD, ARLINGTON

Registration Status: **ACTIVE** 

Held by: Landis Properties, LLC (CN605237635) View 'Issued To' History

**OWNER** Since 08/23/2012 View Compliance History

Mailing Address: 980 N FEDERAL HWY STE 302 BOCA RATON, FL 33432 -2704

Held by: Cipercen LLC (CN604733170) View 'Issued To' History

**OPERATOR** Since 04/01/2015 View Compliance History

Mailing Address: 3273 W PIONEER PKWY PANTEGO, TX 76013 -4620

View Earlier Holders

### **Related Information:**

**Complaints** 

**Investigations** 

**Notice of Violations** 

**Registration Information** 

### There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**Customer Search** 

**RE Search** 

ID Search

**Document Search** 

Search Results

**Registration Detail** 

TCEQ Home
Query Home

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 48700

For: MEINEKE CAR CARE CENTER 4169 (RN101854180)

5980 W POLY WEBB RD, ARLINGTON

Registration Status: ACTIVE

Held by: Landis Properties, LLC (CN605237635) View 'Issued To' History

**OWNER** Since 08/23/2012 View Compliance History

Mailing Address: 980 N FEDERAL HWY STE 302 BOCA RATON, FL 33432 -2704

Held by: Cipercen LLC (CN604733170) View 'Issued To' History

**OPERATOR** Since 04/01/2015 View Compliance History

Mailing Address: 3273 W PIONEER PKWY PANTEGO, TX 76013 -4620

### Notice of Violations Current TCEQ Rules

NOV Date	Status	Citation/Requirement Provision	Allegation	Classification	Self Reporting Indicator
01/15/2019	RESOLVED	30 TAC Chapter 334, SubChapter A 334.7(d)(3); 30 TAC Chapter 334, SubChapter A 334.7(e)(2)	Failure to amend the TCEQ UST Registration within 30-days of change.	MODERATE	NO
08/12/2016	RESOLVED	30 TAC Chapter 334, SubChapter C 334.54(b)(2)	Failure to secure all USTs to prevent tampering.	MINOR	NO
08/12/2016	RESOLVED	30 TAC Chapter 334, SubChapter A 334.7(d)(3); 30 TAC Chapter 334, SubChapter A 334.7(e)(2)	Failure to amend the TCEQ UST Registration/Self- Certification form within 30-days of change.	MODERATE	NO

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints |

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

**ID Search RE Search Search Results Customer Search Document Search TCEO Home** 

**Query Home** 

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

> Detail of: Petroleum Storage Tank Registration 57967 View Registration

For: N & N FOODSTORE (RN101570943)

4245 WILBARGER ST, FORT WORTH

Registration Status: **ACTIVE** 

Held by: CITY OF FORT WORTH (CN600128862) View 'Issued To' History

**OWNER** Since 11/13/2001 View Compliance History

Mailing Address: 927 TAYLOR ST FORT WORTH, TX 76102 -4605

View Earlier Holders

### **Related Information:**

**Registration Information** 

There is no information related to this Registration in the following categories:

**Commissioners' Actions** 

**Correspondence Tracking** 

**Effective Enforcement Orders** 

**Criminal Convictions** 

**Proposed Enforcement Orders** 

**Complaints** 

**Discharges** 

**Emergency Response Events** 

**Emission Events** 

Fish Kills

**Other Incidents** 

**Investigations** 

**Periodic Reports** 

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors

Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

Query Home Customer Search RE Search ID Search Search Results Registration Detail TCEQ Home

### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 57967

For: **N & N FOODSTORE (RN101570943)** 

4245 WILBARGER ST, FORT WORTH

Registration Status: ACTIVE

Held by: CITY OF FORT WORTH (CN600128862) View 'Issued To' History

**OWNER** Since 11/13/2001 View Compliance History

Mailing Address: 927 TAYLOR ST FORT WORTH, TX 76102 -4605

#### **Financial Assurance**

0 Insurance Or Risk Retention, expires 01/01/1901

, Agent

#### **Self-Certification Status by Compartment**

None

#### **Registered Tanks and Their Associated Systems**

#### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	8000	08/31/1987	Temporarily Out of Service (07/14/1998)	A:Empty	Tank Details Compartment Piping Vapor Recovery
2	8000	08/31/1987	Temporarily Out of Service (07/14/1998)	A:Empty	Tank Details Compartment Piping Vapor Recovery
3	8000	08/31/1987	Temporarily Out of Service (07/14/1998)	A:Empty	Tank Details Compartment Piping Vapor Recovery

#### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Information
1	1:Single Wall ( Composite Tank )	Composite (Steel/FRP)		A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Delivery Shutoff Valve 4: Flow Restrictor Valve			Tank Tested	Tank Summary Compartment Piping Vapor Recovery
2	1:Single Wall ( Composite Tank )	Composite (Steel/FRP)		A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Delivery Shutoff Valve			Tank Tested	Tank Summary Compartment Piping Vapor Recovery

#### **Table 3. Compartment Details**



Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information
1	A		Empty			1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Delivery Shutoff Valve 4 : Flow Restrictor Valve	Tank Summary Tank Details Piping Vapor Recovery
2	А		Empty			1 : Tight Fill Fitting	Tank Summary

### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1		FRP	Single Wall			A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recove
2		FRP	Single Wall			A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recove
3		FRP	Single Wall			A:Auto Line Leak Detector	Tank Summar Tank Details

### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	<b>Related Information</b>
1	Not Reported				Tank Summary Tank Details Compartment Piping
2	Not Reported				Tank Summary Tank Details Compartment Piping
3	Not Reported				Tank Summary Tank Details Compartment Piping

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors
Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

RE Search ID Search Document Search Search Results Registration Detail TCEQ Home

**Query Home** 

**Customer Search** 

## **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 63883

For: PARADISE QUICK STOP 1 (RN102655263)

5401 SUN VALLEY DR, FORT WORTH

Registration Status: ACTIVE

Held by: ALS QUICK STOP INC (CN601571987) View 'Issued To' History

**OWNER OPERATOR** Since 11/13/1992 View Compliance History

Now Known As: Al's Quick Stop, Inc.

Mailing Address: 520 E NORTHWEST HWY STE 100 ACCNT RECV NUM 47895 GRAPEVINE, TX

76051 -6298

## Petroleum Storage Tank Complaints at ALS QUICK STOP & STOP

Tracking Number	<b>Complaint Received</b>	Status	<b>Status Date</b>
181830	03/22/2013	CLOSED	04/18/2013

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors
Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal



# Radius Report

GeoLens by GeoSearch

Target Property: IH 820 Fort Worth, Tarrant County, Texas 76140

Prepared For:

Civil Associates

Order #: 121435 Job #: 277689

Date: 02/11/2019

## **Table of Contents**

Target Property Summary
Database Summary
Database Radius Summary
Radius Map
Ortho Map
Topographic Map
Located Sites Summary
Unlocated Sites Summary
Environmental Records Definitions
Unlocatable Report
Zin Report See Attachment

#### Disclaimer

This report was designed by GeoSearch to meet or exceed the records search requirements of the All Appropriate Inquiries Rule (40 CFR  $i \ge 1/2$ 312.26) and the current version of the ASTM International E1527, Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process or, if applicable, the custom requirements requested by the entity that ordered this report. The records and databases of records used to compile this report were collected from various federal, state and local governmental entities. It is the goal of GeoSearch to meet or exceed the 40 CFR  $i \ge 1/2$ 312.26 and E1527 requirements for updating records by using the best available technology. GeoSearch contacts the appropriate governmental entities on a recurring basis. Depending on the frequency with which a record source or database of records is updated by the governmental entity, the data used to prepare this report may be updated monthly, quarterly, semi-annually, or annually.

The information provided in this report was obtained from a variety of public sources. GeoSearch cannot ensure and makes no warranty or representation as to the accuracy, reliability, quality, errors occurring from data conversion or the customer's interpretation of this report. This report was made by GeoSearch for exclusive use by its clients only. Therefore, this report may not contain sufficient information for other purposes or parties. GeoSearch and its partners, employees, officers And independent contractors cannot be held liable For actual, incidental, consequential, special or exemplary damages suffered by a customer resulting directly or indirectly from any information provided by GeoSearch.

## **Target Property Summary**

## **Target Property Information**

IH 820

Fort Worth, Texas 76140

### Coordinates

Corridor

### **USGS Quadrangle**

Fort Worth, TX Kennedale, TX Hurst, TX

## **Geographic Coverage Information**

County/Parish: Tarrant (TX)

ZipCode(s):

Arlington TX: 76001, 76013, 76015, 76016, 76017

Kennedale TX: 76060

Fort Worth TX: 76105, 76112, 76119, 76120, 76140

## **FEDERAL LISTING**

### **Standard Environmental Records**

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
EMERGENCY RESPONSE NOTIFICATION SYSTEM	<u>ERNSTX</u>	0	0	TP/AP
FEDERAL ENGINEERING INSTITUTIONAL CONTROL SITES	<u>EC</u>	0	0	TP/AP
LAND USE CONTROL INFORMATION SYSTEM	<u>LUCIS</u>	0	0	TP/AP
RCRA SITES WITH CONTROLS	<u>RCRASC</u>	0	0	TP/AP
RESOURCE CONSERVATION & RECOVERY ACT - GENERATOR	RCRAGR06	8	0	0.1250
RESOURCE CONSERVATION & RECOVERY ACT - NON- GENERATOR	RCRANGR06	24	0	0.1250
BROWNFIELDS MANAGEMENT SYSTEM	<u>BF</u>	5	0	0.5000
DELISTED NATIONAL PRIORITIES LIST	<u>DNPL</u>	0	0	0.5000
NO LONGER REGULATED RCRA NON-CORRACTS TSD FACILITIES	<u>NLRRCRAT</u>	0	0	0.5000
RESOURCE CONSERVATION & RECOVERY ACT - NON-CORRACTS TREATMENT, STORAGE & DISPOSAL FACILITIES	<u>RCRAT</u>	0	0	0.5000
SUPERFUND ENTERPRISE MANAGEMENT SYSTEM	<u>SEMS</u>	1	0	0.5000
SUPERFUND ENTERPRISE MANAGEMENT SYSTEM ARCHIVED SITE INVENTORY	<u>SEMSARCH</u>	0	0	0.5000
NATIONAL PRIORITIES LIST	<u>NPL</u>	0	0	1.0000
NO LONGER REGULATED RCRA CORRECTIVE ACTION FACILITIES	<u>NLRRCRAC</u>	0	0	1.0000
PROPOSED NATIONAL PRIORITIES LIST	<u>PNPL</u>	0	0	1.0000
RESOURCE CONSERVATION & RECOVERY ACT - CORRECTIVE ACTION FACILITIES	RCRAC	0	0	1.0000
RESOURCE CONSERVATION & RECOVERY ACT - SUBJECT TO CORRECTIVE ACTION FACILITIES	<u>RCRASUBC</u>	0	0	1.0000
0.00 7.07.4	T			
SUB-TOTAL		38	0	

### Additional Environmental Records

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
AEROMETRIC INFORMATION RETRIEVAL SYSTEM / AIR FACILITY SUBSYSTEM	<u>AIRSAFS</u>	0	0	TP/AP
BIENNIAL REPORTING SYSTEM	<u>BRS</u>	0	0	TP/AP
CERCLIS LIENS	<u>SFLIENS</u>	0	0	TP/AP
CLANDESTINE DRUG LABORATORY LOCATIONS	<u>CDL</u>	0	0	TP/AP
EPA DOCKET DATA	<u>DOCKETS</u>	0	0	TP/AP
ENFORCEMENT AND COMPLIANCE HISTORY INFORMATION	ECHOR06	0	0	TP/AP
FACILITY REGISTRY SYSTEM	<u>FRSTX</u>	1	0	TP/AP

				Search Radius
Database	Acronym	Locatable	Unlocatable	(miles)
HAZARDOUS MATERIALS INCIDENT REPORTING SYSTEM	HMIRSR06	1	0	TP/AP
INTEGRATED COMPLIANCE INFORMATION SYSTEM (FORMERLY DOCKETS)	<u>ICIS</u>	0	0	TP/AP
INTEGRATED COMPLIANCE INFORMATION SYSTEM NATIONAL POLLUTANT DISCHARGE ELIMINATION SYSTEM	<u>ICISNPDES</u>	0	0	TP/AP
MATERIAL LICENSING TRACKING SYSTEM	<u>MLTS</u>	0	0	TP/AP
NATIONAL POLLUTANT DISCHARGE ELIMINATION SYSTEM	NPDESR06	0	0	TP/AP
PCB ACTIVITY DATABASE SYSTEM	<u>PADS</u>	0	0	TP/AP
PERMIT COMPLIANCE SYSTEM	PCSR06	0	0	TP/AP
SEMS LIEN ON PROPERTY	<u>SEMSLIENS</u>	0	0	TP/AP
SECTION SEVEN TRACKING SYSTEM	<u>SSTS</u>	0	0	TP/AP
TOXIC SUBSTANCE CONTROL ACT INVENTORY	<u>TSCA</u>	0	0	TP/AP
TOXICS RELEASE INVENTORY	<u>TRI</u>	0	0	TP/AP
ALTERNATIVE FUELING STATIONS	<u>ALTFUELS</u>	1	0	0.2500
FEMA OWNED STORAGE TANKS	<u>FEMAUST</u>	0	0	0.2500
HISTORICAL GAS STATIONS	<u>HISTPST</u>	0	0	0.2500
INTEGRATED COMPLIANCE INFORMATION SYSTEM DRYCLEANERS	ICISCLEANERS	0	0	0.2500
MINE SAFETY AND HEALTH ADMINISTRATION MASTER INDEX FILE	<u>MSHA</u>	0	0	0.2500
MINERAL RESOURCE DATA SYSTEM	<u>MRDS</u>	0	0	0.2500
OPEN DUMP INVENTORY	<u>ODI</u>	0	0	0.5000
SURFACE MINING CONTROL AND RECLAMATION ACT SITES	<u>SMCRA</u>	0	0	0.5000
URANIUM MILL TAILINGS RADIATION CONTROL ACT SITES	<u>USUMTRCA</u>	0	0	0.5000
DEPARTMENT OF DEFENSE SITES	<u>DOD</u>	0	0	1.0000
FORMER MILITARY NIKE MISSILE SITES	<u>NMS</u>	0	0	1.0000
FORMERLY USED DEFENSE SITES	<u>FUDS</u>	0	0	1.0000
FORMERLY UTILIZED SITES REMEDIAL ACTION PROGRAM	<u>FUSRAP</u>	0	0	1.0000
RECORD OF DECISION SYSTEM	RODS	0	0	1.0000
SUB-TOTAL		3	0	

## STATE (TX) LISTING

### **Standard Environmental Records**

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
STATE INSTITUTIONAL/ENGINEERING CONTROL SITES	SIEC01	0	0	TP/AP
PETROLEUM STORAGE TANKS	<u>PST</u>	115	2	0.2500
BROWNFIELDS SITE ASSESSMENTS	<u>BSA</u>	0	0	0.5000
CLOSED & ABANDONED LANDFILL INVENTORY	<u>CALF</u>	4	0	0.5000
LEAKING PETROLEUM STORAGE TANKS	<u>LPST</u>	68	0	0.5000
MUNICIPAL SOLID WASTE LANDFILL SITES	MSWLF	3	0	0.5000
RAILROAD COMMISSION VCP AND BROWNFIELD SITES	RRCVCP	0	0	0.5000
VOLUNTARY CLEANUP PROGRAM SITES	<u>VCP</u>	5	0	0.5000
STATE SUPERFUND SITES	<u>SF</u>	0	0	1.0000
SUB-TOTAL		195	2	

### **Additional Environmental Records**

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
GROUNDWATER CONTAMINATION CASES	<u>GWCC</u>	0	0	TP/AP
HISTORIC GROUNDWATER CONTAMINATION CASES	<u>HISTGWCC</u>	0	0	TP/AP
LAND APPLICATION PERMITS	<u>LANDAPP</u>	0	0	TP/AP
MUNICIPAL SETTING DESIGNATIONS	<u>MSD</u>	0	0	TP/AP
NOTICE OF VIOLATIONS	<u>NOV</u>	0	0	TP/AP
SPILLS LISTING	<u>SPILLS</u>	3	0	TP/AP
TCEQ LIENS	<u>LIENS</u>	0	0	TP/AP
TIER I I CHEMICAL REPORTING PROGRAM FACILITIES	<u>TIERII</u>	0	0	TP/AP
DRY CLEANER REGISTRATION DATABASE	<u>DCR</u>	14	0	0.2500
INDUSTRIAL AND HAZARDOUS WASTE SITES	<u>IHW</u>	70	0	0.2500
PERMITTED INDUSTRIAL HAZARDOUS WASTE SITES	<u>PIHW</u>	0	0	0.2500
AFFECTED PROPERTY ASSESSMENT REPORTS	<u>APAR</u>	3	0	0.5000
DRY CLEANER REMEDIATION PROGRAM SITES	<u>DCRPS</u>	2	0	0.5000
INNOCENT OWNER / OPERATOR DATABASE	<u>IOP</u>	1	0	0.5000
RADIOACTIVE WASTE SITES	<u>RWS</u>	0	0	0.5000
RECYCLING FACILITIES	<u>WMRF</u>	0	0	0.5000
SALT CAVERNS FOR PETROLEUM STORAGE	<u>STCV</u>	0	0	0.5000
INDUSTRIAL AND HAZARDOUS WASTE CORRECTIVE ACTION SITES	<u>IHWCA</u>	9	0	1.0000

SUB-TOTAL	102	0	

## TRIBAL LISTING

### **Standard Environmental Records**

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
UNDERGROUND STORAGE TANKS ON TRIBAL LANDS	<u>USTR06</u>	0	0	0.2500
LEAKING UNDERGROUND STORAGE TANKS ON TRIBAL LANDS	<u>LUSTR06</u>	0	0	0.5000
OPEN DUMP INVENTORY ON TRIBAL LANDS	<u>ODINDIAN</u>	0	0	0.5000
SUB-TOTAL		0	0	

### **Additional Environmental Records**

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
INDIAN RESERVATIONS	INDIANRES	0	0	1.0000
SUB-TOTAL		0	0	
		_	_	
TOTAL		338	2	

## **FEDERAL LISTING**

Standard environmental records are displayed in **bold**.

Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
AIRSAFS	0.0200	0	NS	NS	NS	NS	NS	0
BRS	0.0200	0	NS	NS	NS	NS	NS	0
CDL	0.0200	0	NS	NS	NS	NS	NS	0
DOCKETS	0.0200	0	NS	NS	NS	NS	NS	0
EC	0.0200	0	NS	NS	NS	NS	NS	0
ECHOR06	0.0200	0	NS	NS	NS	NS	NS	0
ERNSTX	0.0200	0	NS	NS	NS	NS	NS	0
FRSTX	0.0200	1	NS	NS	NS	NS	NS	1
HMIRSR06	0.0200	1	NS	NS	NS	NS	NS	1
ICIS	0.0200	0	NS	NS	NS	NS	NS	0
ICISNPDES	0.0200	0	NS	NS	NS	NS	NS	0
LUCIS	0.0200	0	NS	NS	NS	NS	NS	0
MLTS	0.0200	0	NS	NS	NS	NS	NS	0
NPDESR06	0.0200	0	NS	NS	NS	NS	NS	0
PADS	0.0200	0	NS	NS	NS	NS	NS	0
PCSR06	0.0200	0	NS	NS	NS	NS	NS	0
RCRASC	0.0200	0	NS	NS	NS	NS	NS	0
SEMSLIENS	0.0200	0	NS	NS	NS	NS	NS	0
SFLIENS	0.0200	0	NS	NS	NS	NS	NS	0
SSTS	0.0200	0	NS	NS	NS	NS	NS	0
TRI	0.0200	0	NS	NS	NS	NS	NS	0
TSCA	0.0200	0	NS	NS	NS	NS	NS	0
RCRAGR06	0.1250	0	8	NS	NS	NS	NS	8
RCRANGR06	0.1250	0	24	NS	NS	NS	NS	24
ALTFUELS	0.2500	0	1	0	NS	NS	NS	1
FEMAUST	0.2500	0	0	0	NS	NS	NS	0
HISTPST	0.2500	0	0	0	NS	NS	NS	0
ICISCLEANERS	0.2500	0	0	0	NS	NS	NS	0
MRDS	0.2500	0	0	0	NS	NS	NS	0
MSHA	0.2500	0	0	0	NS	NS	NS	0
BF	0.5000	0	1	3	1	NS	NS	5
DNPL	0.5000	0	О	О	О	NS	NS	o
NLRRCRAT	0.5000	0	О	О	О	NS	NS	o
ODI	0.5000	0	0	0	0	NS	NS	0
RCRAT	0.5000	0	o	o	o	NS	NS	0

Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
SEMS	0.5000	0	0	1	0	NS	NS	1
SEMSARCH	0.5000	0	0	0	О	NS	NS	0
SMCRA	0.5000	0	0	0	0	NS	NS	0
USUMTRCA	0.5000	0	0	0	0	NS	NS	0
DOD	1.0000	0	0	0	0	0	NS	0
FUDS	1.0000	0	0	0	0	0	NS	0
FUSRAP	1.0000	0	0	0	0	0	NS	0
NLRRCRAC	1.0000	0	0	0	О	o	NS	0
NMS	1.0000	0	0	0	0	0	NS	0
NPL	1.0000	0	0	0	О	o	NS	0
PNPL	1.0000	0	0	0	О	o	NS	0
RCRAC	1.0000	0	0	0	О	o	NS	0
RCRASUBC	1.0000	0	0	0	О	0	NS	0
RODS	1.0000	0	0	0	0	0	NS	0
SUB-TOTAL		2	34	4	1	0	0	41

## STATE (TX) LISTING

Standard environmental records are displayed in bold.

Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
GWCC	0.0200	0	NS	NS	NS	NS	NS	0
HISTGWCC	0.0200	0	NS	NS	NS	NS	NS	0
LANDAPP	0.0200	0	NS	NS	NS	NS	NS	0
LIENS	0.0200	0	NS	NS	NS	NS	NS	0
MSD	0.0200	0	NS	NS	NS	NS	NS	0
NOV	0.0200	0	NS	NS	NS	NS	NS	0
SIEC01	0.0200	0	NS	NS	NS	NS	NS	0
SPILLS	0.0200	3	NS	NS	NS	NS	NS	3
TIERII	0.0200	0	NS	NS	NS	NS	NS	0
DCR	0.2500	0	3	11	NS	NS	NS	14
IHW	0.2500	0	36	34	NS	NS	NS	70
PIHW	0.2500	0	0	0	NS	NS	NS	0
PST	0.2500	0	70	45	NS	NS	NS	115
APAR	0.5000	0	1	2	0	NS	NS	3
BSA	0.5000	0	0	О	o	NS	NS	0
CALF	0.5000	0	2	1	1	NS	NS	4
DCRPS	0.5000	0	0	0	2	NS	NS	2
IOP	0.5000	0	1	0	0	NS	NS	1
LPST	0.5000	0	32	15	21	NS	NS	68
MSWLF	0.5000	0	1	2	o	NS	NS	3
RRCVCP	0.5000	0	0	О	o	NS	NS	0
RWS	0.5000	0	0	0	0	NS	NS	0
STCV	0.5000	0	0	0	0	NS	NS	0
VCP	0.5000	0	3	2	o	NS	NS	5
WMRF	0.5000	0	0	0	0	NS	NS	0
IHWCA	1.0000	0	0	3	3	3	NS	9
SF	1.0000	0	0	0	0	0	NS	0
SUB-TOTAL		3	149	115	27	3	0	297

## TRIBAL LISTING

Standard environmental records are displayed in bold.


Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
USTR06	0.2500	0	0	0	NS	NS	NS	0
LUSTR06	0.5000	0	0	0	О	NS	NS	o
ODINDIAN	0.5000	0	0	0	О	NS	NS	o
INDIANRES	1.0000	0	0	0	0	0	NS	0
SUB-TOTAL		0	0	0	0	0	0	0


TOTAL	5	183	119	28	3	0	338


NOTES:


NS = NOT SEARCHED

TP/AP = TARGET PROPERTY/ADJACENT PROPERTY

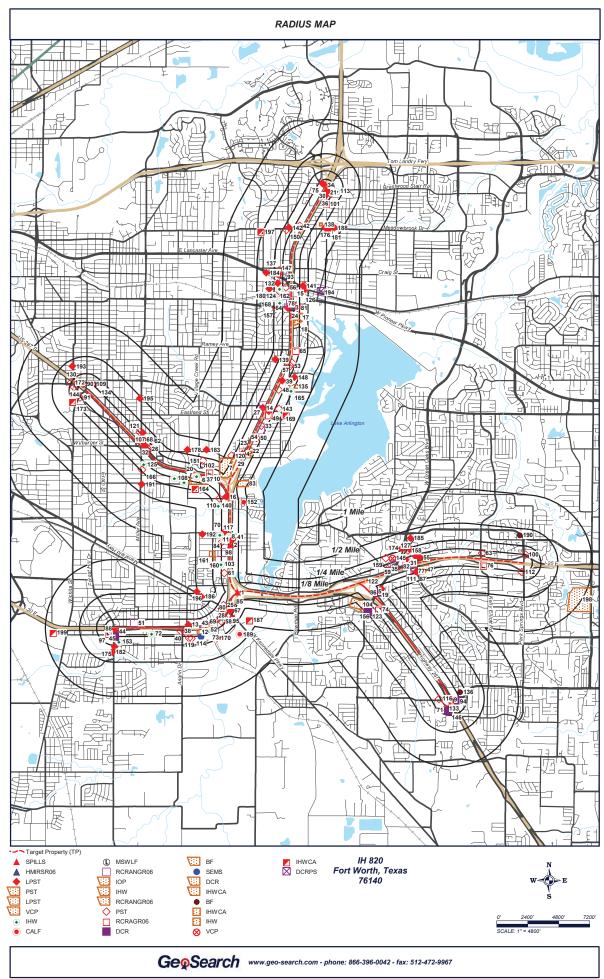

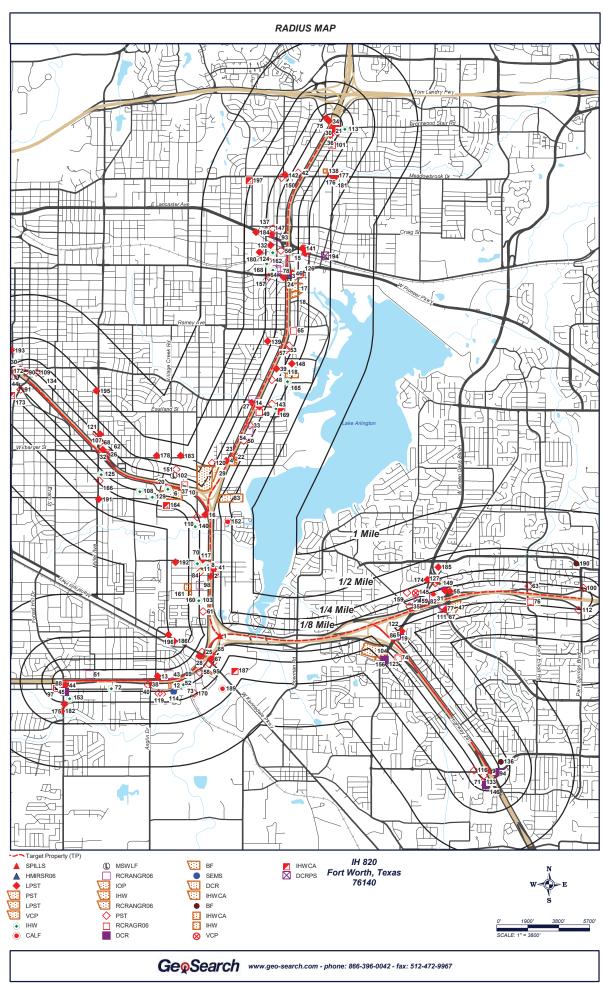

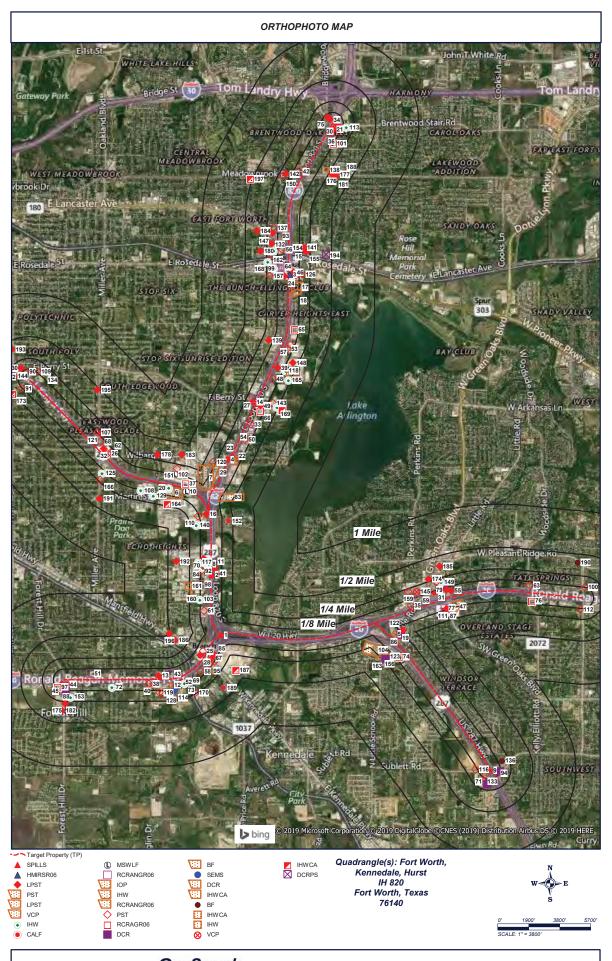

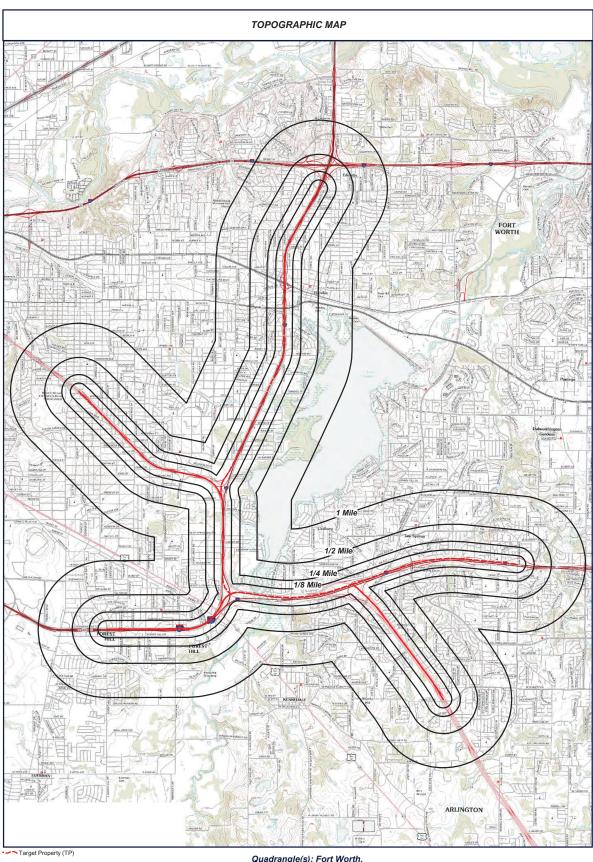

Quadrangle(s): Fort Worth, Kennedale, Hurst Source: USGS, 11/21/2012 IH 820 Fort Worth, Texas 76140



NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
1	SPILLS	10/17/98009	591 ft.	0.001 mi. NNW (5 ft.)		I20 EAST @ I820 INTERSECTION, FORT WORTH, TX	<u>32</u>
<u>1</u>	SPILLS	2661	591 ft.	0.001 mi. NNW (5 ft.)		INTERSECTION OF IH20 WEST AT IH820 EASTFORT WORTH, TX 76119, FORT WORTH, TX 76119	<u>33</u>
2	FRSTX	110059613805	592 ft.	0.007 mi. E (37 ft.)	UDI DRILLING	LOOP 820 & SUN VALLEY, FORT WORTH, TX 76113	<u>34</u>
2	SPILLS	7/18/96003	592 ft.	0.007 mi. E (37 ft.)		HWY 820 & SUN VALLEY, FORT WORTH, TX	<u>35</u>
3	HMIRSR06	I-2014120547	578 ft.	0.015 mi. E (79 ft.)		IH 820 AND ROASE DALE STREET, FORT WORTH, TX 76112	<u>36</u>
<u>4</u>	LPST	096695	590 ft.	0.021 mi. WNW (111 ft.)	FORMER DURGHA PROPERTY	4320 E LOOP 820 S, FORT WORTH, TX	<u>37</u>
<u>4</u>	PST	57269	590 ft.	0.021 mi. WNW (111 ft.)	DURHGA FRB FORT WORTH EAST	4320 E LOOP 820 S, FORT WORTH, TX 76119	<u>38</u>
<u>5</u>	PST	84009	643 ft.	0.024 mi. NE (127 ft.)	QUIKTRIP 856	4930 LITTLE RD, ARLINGTON, TX 76017	<u>41</u>
<u>6</u>	LPST	105249	613 ft.	0.025 mi. SSW (132 ft.)	SOUTHEAST SERVICE CENTER	5000 MARTIN LUTHER KING FWY, FORT WORTH, TX	<u>47</u>
<u>6</u>	LPST	106882	613 ft.	0.025 mi. SSW (132 ft.)	FORT WORTH SOUTHEAST SERVICE CENTER	5000 MARTIN LUTHER KING FWY, FORT WORTH, TX	<u>62</u>
<u>6</u>	PST	7523	613 ft.	0.025 mi. SSW (132 ft.)	SOUTHEAST SERVICE CENTER	5000 MARTIN LUTHER KING FWY, FORT WORTH, TX 76119	<u>77</u>
<u>7</u>	LPST	108691	594 ft.	0.025 mi. WNW (132 ft.)	CONSOLIDATED FREIGHTWAYS	4601 CAREY ST, FORT WORTH, TX	<u>95</u>
<u>7</u>	PST	13649	594 ft.	0.025 mi. WNW (132 ft.)	CENTRAL TRANSPORT	4601 CAREY ST, FORT WORTH, TX 76119	<u>101</u>
<u>7</u>	VCP	0369	594 ft.	0.025 mi. WNW (132 ft.)	MERCHANTS TRANSPORTATION - FT WORTH TERMINAL	4601 CAREY STREET, FORT WORTH, TX	<u>110</u>
<u>8</u>	IHW	82516	594 ft.	0.026 mi. W (137 ft.)	POWER LINE	5344 E LOOP 820 S, FORT WORTH, TX 76119	<u>111</u>
<u>9</u>	CALF	1272	656 ft.	0.028 mi. SSE (148 ft.)	SUBLETT/287 LAND	NWY 287 & SUBLETT RD, TX	<u>112</u>
<u>10</u>	MSWLF	120136	606 ft.	0.032 mi. SSW (169 ft.)	CITY OF FORT WORTH MLK DROP OFF STATION	5150 MARTIN LUTHER KING FWY, FORT WORTH, TX 76119	<u>113</u>
<u>11</u>	LPST	102027	592 ft.	0.038 mi. E (201 ft.)	CLAPP BUDDY INC	5301 LASTER, FT WORTH, TX	<u>114</u>
<u>11</u>	PST	29998	592 ft.	0.038 mi. E (201 ft.)	BUDDY CLAPP FACILITY	5301 LASTER, FT WORTH, TX 76119	<u>118</u>
<u>12</u>	PST	1275	631 ft.	0.038 mi. S (201 ft.)	ARTHUR HAGAR	5020 SE LOOP 820, FORT WORTH, TX 76140	<u>122</u>

NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>13</u>	IHW	75575	639 ft.	0.04 mi. N (211 ft.)	STAR ENTERPRISES	4901 E CALIFORNIA PKWY, FOREST HILL, TX 76119	<u>124</u>
<u>13</u>	LPST	115946	639 ft.	0.04 mi. N (211 ft.)	FORMER TEXACO	4901 E CALIFORNIA PKWY, FOREST HILL, TX	<u>125</u>
<u>13</u>	PST	13507	639 ft.	0.04 mi. N (211 ft.)	TEXACO	4901 E CALIFORNIA PKWY, FOREST HILL, TX 76119	<u>129</u>
<u>13</u>	RCRANGR06	TXD987995057	639 ft.	0.038 mi. N (201 ft.)	STAR ENTERPRISES LLC	4901 E CALIFORNIA PKWY, FOREST HILL, TX 76119	<u>135</u>
<u>14</u>	IHW	77555	579 ft.	0.039 mi. WNW (206 ft.)	EXXON MOBIL NO 63766	5728 E BERRY ST, FORT WORTH, TX 76119	<u>137</u>
<u>14</u>	LPST	095032	579 ft.	0.039 mi. WNW (206 ft.)	EXXON 63766	5728 E BERRY ST, FORT WORTH, TX	<u>138</u>
<u>14</u>	PST	26291	579 ft.	0.039 mi. WNW (206 ft.)	EXXON RS 63766	5728 E BERRY ST, FORT WORTH, TX 76119	<u>139</u>
<u>14</u>	RCRANGR06	TXD988029310	579 ft.	0.039 mi. WNW (206 ft.)	EXXON MOBIL CORPORATION	5728 E BERRY, FORT WORTH, TX 76115	<u>145</u>
<u>15</u>	IHW	33966	596 ft.	0.039 mi. E (206 ft.)	TRIANGLE HOME PRODUCTS	1039 E LOOP 820 S, FORT WORTH, TX 76112	<u>147</u>
<u>15</u>	RCRANGR06	TXD068381151	596 ft.	0.039 mi. E (206 ft.)	TRIANGLE HOME PRODUCTS INC	1039 E LOOP 820 S, FORT WORTH, TX 76112	<u>148</u>
<u>16</u>	IHW	81880	593 ft.	0.04 mi. WSW (211 ft.)	RENTAL SERVICE 755	4900 E LOOP 820 S, FORT WORTH, TX 76119	<u>150</u>
<u>16</u>	LPST	111459	593 ft.	0.04 mi. WSW (211 ft.)	PRIME EQUIPMENT 115	4900 E LOOP 820 S, FORT WORTH, TX	<u>151</u>
<u>16</u>	PST	24598	593 ft.	0.04 mi. WSW (211 ft.)	PRIME EQUIPMENT 115	4900 E LOOP 820 S, FORT WORTH, TX 76119	<u>154</u>
<u>16</u>	RCRANGR06	TXD988087508	593 ft.	0.04 mi. WSW (211 ft.)	RENTAL SERVICE CORPORATION NO 755	4900 E LOOP 820 S, FORT WORTH, TX 76119	<u>157</u>
<u>17</u>	IHW	34366	573 ft.	0.04 mi. E (211 ft.)	FORT WORTH TOWER	1901 E LOOP 820 S, FORT WORTH, TX 76112	<u>159</u>
<u>17</u>	IOP	0217	573 ft.	0.04 mi. E (211 ft.)	FWTC UNDEVELOPED PROPERTY	1901 EAST LOOP 820 SOUTH, FORT WORTH, TX 76112	<u>160</u>
<u>17</u>	PST	41539	573 ft.	0.04 mi. E (211 ft.)	FORT WORTH TOWER	1901 E LOOP 820 S, FORT WORTH, TX 76112	<u>161</u>
<u>17</u>	RCRANGR06	TXD981511652	573 ft.	0.04 mi. E (211 ft.)	FORT WORTH TOWER INC	1901 E LOOP 820 S, FORT WORTH, TX 76112	<u>164</u>
<u>18</u>	IHW	32812	582 ft.	0.04 mi. E (211 ft.)	CLIFTON METAL PRODUCTS	2001 E LOOP 820 S STE A, FORT WORTH, TX 76112	<u>165</u>
<u>18</u>	IHW	79021	582 ft.	0.04 mi. E (211 ft.)	ARMADILLO TRANSMISSION SERVICE	2001 E LOOP 820 S, FORT WORTH, TX 76112	<u>167</u>
<u>18</u>	RCRANGR06	TXD046934436	582 ft.	0.04 mi. E (211 ft.)	CLIFTON METAL PRODUCTS INC	2001 E LOOP 820 S STE A, FORT WORTH, TX 76112	<u>168</u>



Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>18</u>	RCRANGR06	TXD988070835	582 ft.	0.04 mi. E (211 ft.)	ARMADILLO TRANSMISSION SERVICE	2001 E LOOP 820, FORT WORTH, TX 76112	<u>170</u>
<u>19</u>	PST	44785	643 ft.	0.041 mi. NE (216 ft.)	7-ELEVEN 27367	4901 LITTLE RD, ARLINGTON, TX 76017	<u>171</u>
<u>20</u>	IHW	65029	613 ft.	0.041 mi. SSW (216 ft.)	WASTE MANAGEMENT FORT WORTH HAULING	5012 MARTIN LUTHER KING FWY, FORT WORTH, TX 76119	<u>177</u>
<u>21</u>	LPST	112860	644 ft.	0.042 mi. ESE (222 ft.)	ABANDONED STATION	1717 E LOOP 820, FORT WORTH, TX	<u>178</u>
<u>21</u>	PST	71029	644 ft.	0.042 mi. ESE (222 ft.)	ABANDONED STATION	1717 E LOOP 820, FORT WORTH, TX 76112	<u>182</u>
<u>22</u>	PST	20228	587 ft.	0.042 mi. ESE (222 ft.)	LEITO ENTERPRISES	4333 E LOOP 820 S, FORT WORTH, TX 76119	<u>187</u>
<u>23</u>	PST	53700	587 ft.	0.056 mi. ESE (296 ft.)	LARRY RIGGAN	4301 E LOOP 820 S, FORT WORTH, TX 76119	<u>196</u>
<u>24</u>	LPST	110365	578 ft.	0.043 mi. W (227 ft.)	ZOOM IN MARKET 6	6020 E ROSEDALE ST, FORT WORTH, TX	<u>199</u>
<u>24</u>	PST	34297	578 ft.	0.043 mi. W (227 ft.)	ZOOM-IN MARKET 6	6020 E ROSEDALE ST, FORT WORTH, TX 76112	<u>205</u>
<u>25</u>	IHW	66834	598 ft.	0.044 mi. WNW (232 ft.)	NATIONWIDE	5317 MANSFIELD HWY, FOREST HILL, TX 76119	214
<u>25</u>	PST	62153	598 ft.	0.044 mi. WNW (232 ft.)	TEXACO FOOD MART	5317 MANSFIELD HWY STE 101, FOREST HILL, TX 76119	<u>215</u>
<u>26</u>	PST	35860	636 ft.	0.045 mi. NE (238 ft.)	JOHNS QUIK STOP	4244 WILBARGER ST, FORT WORTH, TX 76119	<u>225</u>
<u>27</u>	IHW	79280	579 ft.	0.046 mi. WNW (243 ft.)	CHEVRON FAC 106181	5729 E BERRY ST, FORT WORTH, TX 76119	<u>235</u>
<u>27</u>	PST	5639	579 ft.	0.046 mi. WNW (243 ft.)	CHEVRON FAC 106181	5729 E BERRY ST, FORT WORTH, TX 76119	<u>236</u>
<u>27</u>	RCRANGR06	TXD988046009	579 ft.	0.046 mi. WNW (243 ft.)	CHEVRON USA INC	5729 E BERRY ST, FORT WORTH, TX 76119	<u>240</u>
<u>28</u>	LPST	115079	598 ft.	0.046 mi. WNW (243 ft.)	KWIK PIK FOOD MART	5304 MANSFIELD HWY, FOREST HILL, TX	242
<u>28</u>	PST	17462	598 ft.	0.046 mi. WNW (243 ft.)	12G01 MOBIL SERVICE STATION	5316 MANSFIELD HWY, FOREST HILL, TX 76119	<u>246</u>
<u>28</u>	PST	45787	598 ft.	0.046 mi. WNW (243 ft.)	KWIK PIK FOOD MART	5304 MANSFIELD HWY, FOREST HILL, TX 76119	<u>250</u>
<u>29</u>	IHW	84952	586 ft.	0.047 mi. WNW (248 ft.)	REEDER DISTRIBUTOR	5450 WILBARGER ST, FORT WORTH, TX 76119	<u>256</u>



NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>29</u>	PST	45710	586 ft.	0.047 mi. WNW (248 ft.)	REEDER DISTRIBUTORS	5450 WILBARGER ST, FORT WORTH, TX 76119	<u>257</u>
<u>29</u>	PST	78246	586 ft.	0.047 mi. WNW (248 ft.)	REEDER DISTRIBUTORS	5450A WILBARGER ST, FORT WORTH, TX 76119	<u>322</u>
<u>30</u>	LPST	091229	644 ft.	0.048 mi. E (253 ft.)	EXXON STATION 64732	6601 BRENTWOOD STAIR RD, FORT WORTH, TX	<u>324</u>
<u>30</u>	LPST	113780	644 ft.	0.048 mi. E (253 ft.)	FINA STATION RAS 64732	6601 BRENTWOOD STAIR RD, FORT WORTH, TX	<u>325</u>
<u>30</u>	PST	26619	644 ft.	0.048 mi. E (253 ft.)	QUIKTRIP 861	6601 BRENTWOOD STAIR RD, FORT WORTH, TX 76112	333
<u>31</u>	DCR	RN103951778	617 ft.	0.049 mi. NNW (259 ft.)	BOSS CLEANERS	5817 W INTERSTATE 20 STE 410, ARLINGTON, TX 76017	<u>345</u>
<u>31</u>	IHW	72629	617 ft.	0.049 mi. NNW (259 ft.)	CENTRE CLEANERS INTERSTATE 20 W	5817 W INTERSTATE 20 STE 410, ARLINGTON, TX 76017	<u>347</u>
<u>31</u>	RCRANGR06	TXD130160526	617 ft.	0.049 mi. NNW (259 ft.)	CENTRE CLEANERS	5817 INTERSTATE 20 W STE 410, ARLINGTON, TX 76017	<u>349</u>
<u>32</u>	LPST	114841	636 ft.	0.049 mi. NE (259 ft.)	FORMER SERVICE STATION	4213 WILBARGER ST, FORT WORTH, TX	<u>351</u>
<u>32</u>	PST	72639	636 ft.	0.049 mi. NE (259 ft.)	VACANT STATION	4213 WILBARGER ST, FORT WORTH, TX 76119	<u>355</u>
33	PST	29815	582 ft.	0.05 mi. ESE (264 ft.)	BOB MCCASLIN ANCHOR	3951 E LOOP 820 S, FORT WORTH, TX 76119	<u>360</u>
<u>34</u>	LPST	109967	647 ft.	0.05 mi. NW (264 ft.)	SHELL OIL CO RETAIL FACILITY	6517 BRENTWOOD STAIR RD, FORT WORTH, TX	<u>363</u>
<u>34</u>	PST	33155	647 ft.	0.05 mi. NW (264 ft.)	SHELL OILCO RETAIL FACILITY	6517 BRENTWOOD STAIR RD, FORT WORTH, TX 76112	<u>369</u>
<u>35</u>	IHW	76133	630 ft.	0.051 mi. NNW (269 ft.)	ECONO LUBE N TUNE 169	5890 W POLY WEBB RD, ARLINGTON, TX 76016	<u>375</u>
<u>35</u>	PST	48700	630 ft.	0.051 mi. NNW (269 ft.)	MEINEKE CARE CARE CENTER 4169	5980 W PONY WEBB RD, ARLINGTON, TX 76016	<u>376</u>
<u>36</u>	LPST	109721	644 ft.	0.051 mi. ESE (269 ft.)	WORKINGMANS FRIEND 510	1801 E LOOP 820, FORT WORTH, TX	<u>379</u>
<u>36</u>	PST	3612	644 ft.	0.051 mi. ESE (269 ft.)	WORKINGMANS FRIEND 510	1801 E LOOP 820, FORT WORTH, TX 76112	<u>383</u>
<u>37</u>	RCRAGR06	TX0000276121	606 ft.	0.052 mi. NNE (275 ft.)	NICHOLS FORD COLLISION CENTER	5105 MARTIN LUTHER KING FWY, FORT WORTH, TX 76119	<u>387</u>
38	PST	57186	653 ft.	0.052 mi. S (275 ft.)	ANGLIN FOOD STORE	4724 SE LOOP 820, FOREST HILL, TX 76140	389
39	LPST	114484	581 ft.	0.054 mi. ESE (285 ft.)	TEX O KAN TRANSPORTATION CO INC	3301 E LOOP 820 S, FORT WORTH, TX	<u>395</u>

NOTE: Standard environ	mental records are	displayed in <b>bold</b>

Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>39</u>	PST	28192	581 ft.	0.054 mi. ESE (285 ft.)	TEXAS STATE UTILITIES	3301 E LOOP 820 S, FORT WORTH, TX 76119	<u>400</u>
<u>40</u>	PST	836	653 ft.	0.056 mi. S (296 ft.)	DYKES AIR	4800 SE LOOP 820, FORT WORTH, TX 76140	<u>405</u>
<u>11</u>	PST	63883	592 ft.	0.057 mi. E (301 ft.)	PARADISE QUICK STOP 1	5401 SUN VALLEY DR, FORT WORTH, TX 76119	<u>407</u>
<u>12</u>	PST	79118	649 ft.	0.058 mi. WNW (306 ft.)	TIGER MART 61	2250 E LOOP 820, FORT WORTH, TX 76112	<u>414</u>
<u>13</u>	RCRANGR06	TXR000028597	620 ft.	0.059 mi. NNW (312 ft.)	AMERICAN POWDER COATING	5105 E CALIFORNIA, FORT WORTH, TX 76119	<u>419</u>
14	LPST	112259	650 ft.	0.059 mi. S (312 ft.)	FOREST HILL 66	6551 FOREST HILL DR, FOREST HILL, TX	<u>421</u>
<u>14</u>	PST	11379	650 ft.	0.059 mi. S (312 ft.)	WR CHILDRESS OIL	6551 FOREST HILL DR, FOREST HILL, TX 76140	<u>425</u>
<u>5</u>	IHW	83994	650 ft.	0.059 mi. SSW (312 ft.)	MOTIVA ENTERPRISE	6550 FOREST HILL DR, FOREST HILL, TX 76140	429
<u>15</u>	LPST	091185	650 ft.	0.059 mi. SSW (312 ft.)	TEXACO SS	6550 FOREST HILL DR, FOREST HILL, TX	<u>430</u>
<u>15</u>	PST	13505	650 ft.	0.059 mi. SSW (312 ft.)	7-ELEVEN 34098	6550 FOREST HILL DR, FOREST HILL, TX 76140	<u>431</u>
<u>15</u>	RCRANGR06	TX0000995068	650 ft.	0.059 mi. SSW (312 ft.)	STAR ENTERPRISE	6550 FORREST HILL DR, FORT WORTH, TX 76140	<u>443</u>
16	LPST	103151	578 ft.	0.059 mi. E (312 ft.)	CHEVRON 60106192	6101 E ROSEDALE ST, FORT WORTH, TX	<u>445</u>
16	LPST	118273	578 ft.	0.059 mi. E (312 ft.)	ROSEDALE TEXACO	6101 E ROSEDALE ST, FORT WORTH, TX	<u>452</u>
<u>16</u>	PST	5590	578 ft.	0.059 mi. E (312 ft.)	QUICKWAY FOOD STORE 1	6101 E ROSEDALE ST, FORT WORTH, TX 76112	<u>459</u>
<u>17</u>	VCP	1128	624 ft.	0.06 mi. SSE (317 ft.)	OVERLAND STAGE SHOPPING CENTER	5705 - 5791 SOUTHWEST GREEN OAKS BLVD., ARLINGTON, TX 76017	<u>469</u>
18	PST	47402	559 ft.	0.06 mi. ESE (317 ft.)	L GRIMES &	3401 E LOOP 820 S, FORT WORTH, TX 76119	<u>470</u>
! <u>9</u>	LPST	103644	580 ft.	0.061 mi. ESE (322 ft.)	FFP 577 EARLS FOOD STORE	5800 E BERRY ST, FORT WORTH, TX	<u>473</u>
! <u>9</u>	PST	18525	580 ft.	0.061 mi. ESE (322 ft.)	FFP 577	5800 E BERRY ST, FORT WORTH, TX 76119	<u>476</u>
<u>19</u>	PST	73021	580 ft.	0.061 mi. ESE (322 ft.)	TRIPLE SEVEN CONOCO	5800 E BERRY ST, FORT WORTH, TX 76119	<u>479</u>
<u>50</u>	PST	61677	568 ft.	0.062 mi. ESE (327 ft.)	DOUGLAS & ELMS	5733 GOOD SHEPHERD WAY, FORT WORTH, TX 76119	<u>485</u>

NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>51</u>	IHW	87605	650 ft.	0.064 mi. N (338 ft.)	TAS ENVIRONMENTAL SERVICES	1110 W HARRIS RD STE 118, ARLINGTON, TX 76001	487
<u>51</u>	RCRANGR06	TXR000061283	650 ft.	0.067 mi. N (354 ft.)	TAS ENVIRONMENTAL SERVICES LP	3929 CALIFORNIA PKWY E, FORT WORTH, TX 76119	<u>488</u>
<u>52</u>	IHW	36033	628 ft.	0.066 mi. SSE (348 ft.)	WIN-DOR SUPPLY	5140 SE LOOP 820, FORT WORTH, TX 76140	<u>490</u>
<u>52</u>	LPST	104880	628 ft.	0.066 mi. SSE (348 ft.)	CUSTOM WIN DOR INC	5140 SE LOOP 820, FORT WORTH, TX	<u>491</u>
<u>52</u>	PST	14425	628 ft.	0.066 mi. SSE (348 ft.)	CUSTOM WIN-DOR	5140 SE LOOP 820, FORT WORTH, TX 76140	<u>493</u>
<u>52</u>	RCRANGR06	TXD008415218	628 ft.	0.067 mi. SSE (354 ft.)	WIN-DOR SUPPLY INC	5140 SE LOOP 820, FORT WORTH, TX 76140	<u>495</u>
<u>53</u>	PST	1376	587 ft.	0.068 mi. ESE (359 ft.)	EAST SIDE OFFICE SUPPLY	2837 S CRAVENS RD, FORT WORTH, TX 76119	<u>497</u>
<u>54</u>	IHW	38450	582 ft.	0.068 mi. ESE (359 ft.)	TUBENFIN COILS	4009 E LOOP 820 S STE C, FORT WORTH, TX 76119	<u>499</u>
<u>54</u>	RCRANGR06	TXD085781367	582 ft.	0.068 mi. ESE (359 ft.)	TUBENFIN COILS INC	4009 E LOOP 820 S STE C, FORT WORTH, TX 76119	<u>500</u>
<u>55</u>	IHW	75631	613 ft.	0.071 mi. NNW (375 ft.)	TEXACO SERVICE STATION 2304	4401 W GREEN OAKS BLVD, ARLINGTON, TX 76016	<u>502</u>
<u>55</u>	LPST	100091	613 ft.	0.071 mi. NNW (375 ft.)	TEXACO 4119100	4401 W GREEN OAKS BLVD, ARLINGTON, TX	<u>503</u>
<u>55</u>	PST	13520	613 ft.	0.071 mi. NNW (375 ft.)	7-ELEVEN 34099	4401 W GREEN OAKS BLVD, ARLINGTON, TX 76016	<u>511</u>
<u>55</u>	RCRANGR06	TXD987993524	613 ft.	0.071 mi. NNW (375 ft.)	STAR ENTERPRISES INC	4401 W GREEN OAKS BLVD, ARLINGTON, TX 76016	<u>522</u>
<u>56</u>	PST	18602	609 ft.	0.072 mi. W (380 ft.)	EASTSIDE CENTER	6050 TENSION DR, FORT WORTH, TX 76112	<u>524</u>
<u>57</u>	IHW	84933	587 ft.	0.074 mi. ESE (391 ft.)	HAYS LEASING	2727 E LOOP 820 S, FORT WORTH, TX 76119	<u>526</u>
<u>57</u>	PST	63669	587 ft.	0.074 mi. ESE (391 ft.)	BOBCAT OF FORT WORTH	2727 E LOOP 820 S, FORT WORTH, TX 76119	<u>528</u>
<u>58</u>	PST	63207	615 ft.	0.076 mi. SE (401 ft.)	RENARD BLACKSTOCK	6704 LINDALE RD, FORT WORTH, TX 76140	<u>531</u>
<u>59</u>	PST	49441	621 ft.	0.077 mi. NNW (407 ft.)	A & R FOOD MART	5960 W POLY WEBB RD, ARLINGTON, TX 76016	<u>534</u>



NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>59</u>	RCRANGR06	TXD987983681	621 ft.	0.079 mi. NNW (417 ft.)	ECONO LUBE N TUNE INC	5890 POLYWEB ROAD, ARLINGTON, TX 76016	<u>540</u>
<u>60</u>	APAR	1030	650 ft.	0.078 mi. ESE (412 ft.)	BRENTWOOD STAIR RETAIL CENTER	6612 BRENTWOOD STAIR RD, FORT WORTH, TX 76112	<u>541</u>
<u>60</u>	IHW	75314	650 ft.	0.078 mi. ESE (412 ft.)	ONE HOUR MARTINIZING	6612 BRENTWOOD STAIR RD STE A, FORT WORTH, TX 76112	<u>542</u>
<u>60</u>	LPST	101351	650 ft.	0.097 mi. ESE (512 ft.)	NCS 2380	6620 BRENTWOOD STAIR RD, FORT WORTH, TX	<u>543</u>
<u>60</u>	PST	44704	650 ft.	0.097 mi. ESE (512 ft.)	BRENTWOOD C STORE	6620 BRENTWOOD STAIR RD, FORT WORTH, TX 76112	<u>551</u>
<u>60</u>	RCRAGR06	TXR000048314	650 ft.	0.078 mi. ESE (412 ft.)	LARRY HASSELL ONE HOUR	6612A BRENTWOOD STAIR RD, FORT WORTH, TX 76112	<u>563</u>
<u>60</u>	VCP	1030	650 ft.	0.078 mi. ESE (412 ft.)	BRENTWOOD STAIR RETAIL CENTER	6612 BRENTWOOD STAIR ROAD, FORT WORTH, TX 76112	<u>565</u>
<u>61</u>	PST	69863	596 ft.	0.078 mi. W (412 ft.)	UNITED EQUIPMENT RENTALS GULF 537	5930 E LOOP 820 S, FORT WORTH, TX 76119	<u>566</u>
<u>62</u>	PST	57967	636 ft.	0.078 mi. NE (412 ft.)	N & N FOODSTORE	4245 WILBARGER ST, FORT WORTH, TX 76119	<u>568</u>
<u>63</u>	PST	73461	593 ft.	0.082 mi. N (433 ft.)	FUEL UP MART	4331 KELLY ELLIOTT RD, ARLINGTON, TX 76016	<u>572</u>
<u>64</u>	IHW	33784	600 ft.	0.082 mi. W (433 ft.)	AEROSPACE TECHNOLOGIES	5965 E ROSEDALE ST, FORT WORTH, TX 76112	<u>578</u>
<u>64</u>	RCRANGR06	TXD980699573	600 ft.	0.082 mi. W (433 ft.)	AEROSPACE TECHNOLOGIES INC	5965 E ROSEDALE ST, FORT WORTH, TX 76112	<u>580</u>
<u>65</u>	RCRAGR06	TXR000082996	590 ft.	0.083 mi. E (438 ft.)	FAMILY DOLLAR #5915	6156 RAMEY AVE., FORT WOTH, TX 76112	<u>582</u>
<u>66</u>	IHW	33056	580 ft.	0.083 mi. ESE (438 ft.)	BORDEN FOODS	3853 E LOOP 820 S STE 59, FORT WORTH, TX 76119	<u>584</u>
<u>66</u>	IHW	83788	580 ft.	0.083 mi. ESE (438 ft.)	TEXAS ULTRA GLOSS	3825 E LOOP 820 S, FORT WORTH, TX 76119	<u>585</u>
<u>66</u>	RCRAGR06	TX0001010990	580 ft.	0.083 mi. ESE (438 ft.)	TEXAS ULTRA GLOSS INC	3895 E LOOP 820 SOUTH, FORT WORTH, TX 76119	<u>586</u>
<u>67</u>	LPST	118079	610 ft.	0.084 mi. ESE (444 ft.)	ROYAL MARKET	1302 MANSFIELD HWY, FORT WORTH, TX	<u>588</u>
<u>67</u>	PST	55625	610 ft.	0.084 mi. ESE (444 ft.)	ROYAL MARKET	1302 MANSFIELD HWY, FORT WORTH, TX 76140	<u>592</u>
<u>68</u>	PST	66381	636 ft.	0.085 mi. NE (449 ft.)	Z ONE GROCERY & GRILL	4225 MILLER AVE, FORT WORTH, TX 76119	<u>599</u>
<u>69</u>	IHW	38211	620 ft.	0.086 mi. SE (454 ft.)	MASTER BUILDERS	5230 SE LOOP 820, FORT WORTH, TX 76140	606



NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>70</u>	ALTFUELS	53774	597 ft.	0.086 mi. W (454 ft.)	TRILLIUM - EVO CENTRAL FREIGHT	5200 E LOOP 820 S, FORT WORTH, TX 76119	<u>607</u>
<u>70</u>	IHW	69609	597 ft.	0.086 mi. W (454 ft.)	CENTRAL FREIGHT LINES	5200 E LOOP 820 S, FORT WORTH, TX 76119	608
<u>70</u>	LPST	113463	597 ft.	0.086 mi. W (454 ft.)	CENTRAL FREIGHT LINES INC	5200 E LOOP 820 S, FORT WORTH, TX	<u>612</u>
<u>70</u>	PST	34154	597 ft.	0.086 mi. W (454 ft.)	CENTRAL FREIGHT LINES	5200 E LOOP 820 S, FORT WORTH, TX 76119	<u>621</u>
<u>70</u>	RCRANGR06	TXD026418111	597 ft.	0.086 mi. W (454 ft.)	CENTRAL FREIGHT LINES INC	5200 E LOOP 820 S, FORT WORTH, TX 76101	<u>631</u>
<u>71</u>	PST	75460	656 ft.	0.087 mi. SW (459 ft.)	CORNER STORE 1738	4900 W SUBLETT RD, ARLINGTON, TX 76001	<u>633</u>
<u>72</u>	IHW	88210	636 ft.	0.087 mi. S (459 ft.)	LO-RICH TRUCKING	6512 HARTMAN RD, FORT WORTH, TX 76140	<u>638</u>
<u>73</u>	IHW	66419	628 ft.	0.088 mi. SSE (465 ft.)	BELL PETROLEUM SYSTEMS	5144 SE LOOP 820, FORT WORTH, TX 76140	<u>639</u>
<u>74</u>	RCRAGR06	TXR000080091	697 ft.	0.088 mi. SW (465 ft.)	NTW, LLC NO 810	5030 HWY 287, ARLINGTON, TX 76017	<u>640</u>
<u>75</u>	LPST	113078	647 ft.	0.089 mi. NW (470 ft.)	AKRANIS CONOCO	6509 BRENTWOOD STAIR RD, FORT WORTH, TX	<u>642</u>
<u>75</u>	PST	13506	647 ft.	0.089 mi. NW (470 ft.)	RZ FOOD MART	6509 BRENTWOOD STAIR RD, FORT WORTH, TX 76112	<u>646</u>
<u>76</u>	PST	70122	618 ft.	0.092 mi. S (486 ft.)	TIGER MART 77	4401 KELLY ELLIOTT RD, ARLINGTON, TX 76017	<u>654</u>
<u>76</u>	RCRAGR06	TXR000034785	618 ft.	0.094 mi. S (496 ft.)	EXXON RAS NO 60364	4401 KELLY ELLIOT ROAD, ARLINGTON, TX 76017	<u>660</u>
<u>77</u>	DCR	RN103962072	642 ft.	0.093 mi. SSE (491 ft.)	COMET CLEANERS	5712 SW GREEN OAKS BLVD, ARLINGTON, TX 76017	<u>661</u>
<u>77</u>	IHW	55345	642 ft.	0.103 mi. SSE (544 ft.)	COMET ONE-HOUR CLEANERS	5708 SW GREEN OAKS BLVD, ARLINGTON, TX 76017	<u>663</u>
<u>77</u>	RCRANGR06	TXD981605926	642 ft.	0.103 mi. SSE (544 ft.)	COMET ONE-HOUR CLEANERS	5708 SW GREEN OAKS BLVD, ARLINGTON, TX 76017	<u>664</u>
<u>78</u>	RCRANGR06	TXD980796353	600 ft.	0.093 mi. W (491 ft.)	ROBERTSON MANAGEMENT	FORT WORTH, TX, FORT WORTH, TX 76179	<u>666</u>
<u>79</u>	LPST	118162	613 ft.	0.094 mi. NNW (496 ft.)	MINYARD ON THE GO 4072	4420 W GREEN OAKS BLVD, ARLINGTON, TX	<u>668</u>
<u>79</u>	PST	73292	613 ft.	0.094 mi. NNW (496 ft.)	MINYARD ON THE GO FUEL CENTER 4072	4420 W GREEN OAKS BLVD, ARLINGTON, TX 76016	<u>672</u>
<u>80</u>	PST	85001	610 ft.	0.094 mi. ESE (496 ft.)	QUIKTRIP 874	1225 W KENNEDALE PKWY, FORT WORTH, TX 76140	<u>678</u>
<u>81</u>	PST	60843	578 ft.	0.095 mi. E (502 ft.)	BILL PATTERSTON MOTORS	6200 E ROSEDALE ST, FORT WORTH, TX 76112	<u>684</u>
<u>82</u>	CALF	1383	617 ft.	0.095 mi. NNW (502 ft.)	NO NAME	ARLINGTON: N. OF 20 BETWEEN TATE SPRINGS & LITTLE RD., TX	<u>687</u>



Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>83</u>	IHW	38935	586 ft.	0.096 mi. ESE (507 ft.)	OAK CREEK HOMES	4805 E LOOP 820 S, FORT WORTH, TX 76119	<u>688</u>
<u>83</u>	RCRANGR06	TXD139220560	586 ft.	0.096 mi. ESE (507 ft.)	OAK CREEK HOMES INC	4805 E LOOP 820 S, FORT WORTH, TX 76119	<u>689</u>
<u>84</u>	IHW	37477	595 ft.	0.096 mi. W (507 ft.)	FUTURE MARBLE	5300 VESTA FARLEY RD, FORT WORTH, TX 76119	<u>691</u>
<u>85</u>	LPST	103857	610 ft.	0.098 mi. ESE (517 ft.)	MAJESTIC LIQUOR	5400 KENNEDALE PKWY, FORT WORTH, TX	<u>692</u>
<u>85</u>	PST	34412	610 ft.	0.098 mi. ESE (517 ft.)	MAJESTIC LIQUOR	5400 KENNEDALE PKWY, FORT WORTH, TX 76140	<u>696</u>
<u>85</u>	PST	34413	610 ft.	0.098 mi. ESE (517 ft.)	MAJESTIC LIQUOR 16	HWY 199 & FM 730, AZLE, TX 76020	<u>700</u>
<u>86</u>	DCR	RN104095807	647 ft.	0.101 mi. NE (533 ft.)	STANTON II CLEANERS	4801 LITTLE RD STE 135, ARLINGTON, TX 76017	<u>704</u>
<u>87</u>	LPST	091255	642 ft.	0.118 mi. SSE (623 ft.)	7 ELEVEN 163123056	5704 SW GREEN OAKS BLVD, ARLINGTON, TX	<u>705</u>
<u>87</u>	LPST	115942	642 ft.	0.118 mi. SSE (623 ft.)	FORMER 7 ELEVEN 23056	5704 SW GREEN OAKS BLVD, ARLINGTON, TX	<u>706</u>
<u>87</u>	PST	7309	642 ft.	0.118 mi. SSE (623 ft.)	7-ELEVEN 23056	5704 SW GREEN OAKS BLVD, ARLINGTON, TX 76017	<u>710</u>
<u>88</u>	PST	54616	650 ft.	0.103 mi. S (544 ft.)	SMOKERS PARADISE	6601 FOREST HILL DR, FOREST HILL, TX 76140	<u>715</u>
<u>89</u>	DCR	RN103950846	639 ft.	0.132 mi. S (697 ft.)	ANNS CLEANERS	6611 FOREST HILL DR, FOREST HILL, TX 76140	<u>721</u>
<u>90</u>	PST	72268	644 ft.	0.104 mi. NNW (549 ft.)	BERRY STREET FOOD MART	3300 E BERRY ST, FORT WORTH, TX 76105	<u>723</u>
<u>91</u>	PST	60856	671 ft.	0.135 mi. SW (713 ft.)	POLY RENTAL	3600 VAUGHN BLVD, FORT WORTH, TX 76119	<u>730</u>
<u>91</u>	PST	9032	671 ft.	0.107 mi. SW (565 ft.)	MI TIERRA FOOD STORE	3521 VAUGHN BLVD, FORT WORTH, TX 76119	<u>733</u>
92	PST	78854	595 ft.	0.109 mi. W (576 ft.)	EMPIRE ROOFING	5301 SUN VALLEY DR, FORT WORTH, TX 76119	<u>737</u>
93	IHW	65523	618 ft.	0.114 mi. W (602 ft.)	CITY PRINTING	6025 E LANCASTER AVE, FORT WORTH, TX 76112	<u>739</u>
<u>93</u>	RCRANGR06	TXD054641618	618 ft.	0.11 mi. W (581 ft.)	CITY PRINTING CO	6025 E LANCASTER AVE, FORT WORTH, TX 76103	<u>740</u>
<u>94</u>	PST	65856	665 ft.	0.111 mi. ESE (586 ft.)	SUBLETT SHELL	4810 W SUBLETT RD, ARLINGTON, TX 76017	<u>741</u>
<u>95</u>	BF	174723	619 ft.	0.111 mi. ESE (586 ft.)	5412 HIGH RIDGE ROAD	5412, 5414, 5420, AND 5424 HIGH RIDGE ROAD, KENNEDALE, TX 76140	<u>749</u>



NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>96</u>	PST	64001	650 ft.	0.111 mi. ESE (586 ft.)	VACANT GOODYEAR TIRE CENTER	1800 HANDLEY DR, FORT WORTH, TX 76112	<u>751</u>
<u>97</u>	IHW	91374	638 ft.	0.113 mi. SW (597 ft.)	CVS PHARMACY 6903	3350 FOREST HILL CIR, FOREST HILL, TX 76140	<u>753</u>
<u>97</u>	RCRAGR06	TXR000081000	638 ft.	0.113 mi. SW (597 ft.)	CVS PHARMACY 6903	3350 FOREST HILL CIR, FOREST HILL, TX 76140	<u>756</u>
<u>98</u>	IHW	41335	583 ft.	0.116 mi. W (612 ft.)	LEAK-TEC	5228 KALTENBRUN RD, FORT WORTH, TX 76119	<u>758</u>
<u>98</u>	RCRANGR06	TXD982558363	583 ft.	0.116 mi. W (612 ft.)	LEAK-TEC CORP	5228 KALTENBRUN, FORT WORTH, TX 76119	<u>759</u>
<u>99</u>	IHW	31818	600 ft.	0.119 mi. W (628 ft.)	ALCON LABORATORIES	5927 E ROSEDALE ST, FORT WORTH, TX 76112	<u>761</u>
<u>99</u>	IHW	65503	600 ft.	0.119 mi. W (628 ft.)	ALCON LABORATORIES	5927 E ROSEDALE ST, FORT WORTH, TX 76112	<u>762</u>
<u>99</u>	RCRANGR06	TXD980624704	600 ft.	0.119 mi. W (628 ft.)	ALCON LABORATORIES INC	5927 E ROSEDALE ST, FORT WORTH, TX 76112	<u>763</u>
<u>100</u>	PST	75637	600 ft.	0.123 mi. NNE (649 ft.)	7-ELEVEN 33125	4225 PARK SPRINGS BLVD, ARLINGTON, TX 76016	<u>764</u>
<u>101</u>	RCRAGR06	TXD988089058	623 ft.	0.125 mi. ESE (660 ft.)	WAL-MART STORE #1455	6750 MANDY LN/E LOOP 820, FORT WORTH, TX 76112	<u>769</u>
<u>102</u>	MSWLF	100449	619 ft.	0.126 mi. NNE (665 ft.)	COMMODITY RECYCLING SOLUTIONS	5043 MARTIN LUTHER KING FWY, FORT WORTH, TX 76119	<u>770</u>
<u>103</u>	IHW	41483	591 ft.	0.128 mi. W (676 ft.)	HAZ TANK	5224 MOSSON RD STE B, FORT WORTH, TX 76119	<u>771</u>
<u>103</u>	IHW	70327	591 ft.	0.156 mi. W (824 ft.)	R & R CONCRETE PUMPING SERVICE	5212 MOSSON RD STE B, FORT WORTH, TX 76119	<u>772</u>
<u>104</u>	IHW	89175	700 ft.	0.13 mi. SW (686 ft.)	WALMART SUPERCENTER 3284	4800 HIGHWAY 287, ARLINGTON, TX 76017	<u>773</u>
<u>104</u>	PST	87744	700 ft.	0.13 mi. SW (686 ft.)	WAL-MART SUPERCENTER 3284	4800 HIGHWAY 287, ARLINGTON, TX 76017	<u>776</u>
<u>105</u>	PST	88708	610 ft.	0.13 mi. ESE (686 ft.)	CONSTRUCTION SITE	1298 W KENNEDALE PKWY, KENNEDALE, TX 76060	<u>778</u>
<u>106</u>	DCR	RN104247598	665 ft.	0.13 mi. ESE (686 ft.)	SUBLETT CLEANERS	4720 W SUBLETT RD STE 100, ARLINGTON, TX 76017	<u>780</u>
<u>107</u>	DCR	RN102011244	639 ft.	0.131 mi. NE (692 ft.)	COWBOY CLEANERS	4148 MILLER AVE, FORT WORTH, TX 76119	<u>782</u>
<u>107</u>	PST	22339	639 ft.	0.131 mi. NE (692 ft.)	COWBOY CLEANERS	4148 MILLER AVE, FORT WORTH, TX 76119	<u>784</u>
108	IHW	82899	635 ft.	0.133 mi. SSW (702 ft.)	POWERLINE	4616 FAIRLANE AVE, FORT WORTH, TX 76119	<u>788</u>
<u>109</u>	PST	42889	651 ft.	0.133 mi. NE (702 ft.)	J MC 205	3428 E BERRY ST, FORT WORTH, TX 76105	<u>789</u>
<u>110</u>	PST	61304	592 ft.	0.135 mi. WSW (713 ft.)	BROWN EXCAVATING	5216 CAREY, FT WORTH, TX 76119	<u>793</u>



Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>111</u>	DCR	RN100656719	632 ft.	0.158 mi. SSE (834 ft.)	BOSS CLEANERS	5735 SW GREEN OAKS BLVD, ARLINGTON, TX 76017	<u>795</u>
<u>111</u>	DCR	RN105308316	632 ft.	0.153 mi. SSE (808 ft.)		5755 SW GREEN OAKS BLVD, ARLINGTON, TX 76017	<u>796</u>
<u>111</u>	IHW	65465	632 ft.	0.158 mi. SSE (834 ft.)	BOSS CLEANERS	5735 SW GREEN OAKS BLVD, ARLINGTON, TX 76017	<u>798</u>
<u>111</u>	IHW	79217	632 ft.	0.136 mi. SSE (718 ft.)	CHEVRON FAC 157013	5711 SW GREEN OAKS BLVD, ARLINGTON, TX 76017	<u>799</u>
<u>111</u>	LPST	107484	632 ft.	0.136 mi. SSE (718 ft.)	CHEVRON 60157013	5711 SW GREEN OAKS BLVD, ARLINGTON, TX	<u>800</u>
<u>111</u>	PST	5679	632 ft.	0.136 mi. SSE (718 ft.)	CHEVRON FAC 157013	5711 SW GREEN OAKS BLVD, ARLINGTON, TX 76017	<u>804</u>
<u>112</u>	PST	50164	612 ft.	0.139 mi. S (734 ft.)	QUICK WAY 2	4400 PARK SPRINGS BLVD, ARLINGTON, TX 76017	<u>809</u>
113	DCR	RN104428107	651 ft.	0.139 mi. ESE (734 ft.)	HASSELL CLEANERS	6700 BRENTWOOD STAIR RD, FORT WORTH, TX 76112	819
<u>113</u>	IHW	55113	651 ft.	0.164 mi. ESE (866 ft.)	IMAGE PLUS CLEANERS BRENTWOOD STAIR ROAD	6712 BRENTWOOD STAIR RD, FORT WORTH, TX 76112	<u>820</u>
<u>114</u>	IHW	73583	631 ft.	0.14 mi. S (739 ft.)	HORTON TREE SERVICE	5100 GLENN CT, FOREST HILL, TX 76140	<u>821</u>
<u>114</u>	MSWLF	100395	631 ft.	0.14 mi. SSE (739 ft.)	THE ORGANIC RECYCLER OF TEXAS	5100 FOREST HILL CIR, FOREST HILL, TX 76140	<u>822</u>
<u>114</u>	SEMS	TXN000606672	631 ft.	0.14 mi. S (739 ft.)	HORTON TREE SERVICES DUMP FIRE	5100 GLENN COURT, FOREST HILLS, TX	<u>823</u>
<u>115</u>	IHW	82335	642 ft.	0.143 mi. SSE (755 ft.)	JIFFY LUBE 1150	5710 FOREST BEND DR, ARLINGTON, TX 76017	824
<u>115</u>	PST	66509	642 ft.	0.143 mi. SSE (755 ft.)	JIFFY LUBE STORE 1150	5710 FOREST BEND DR, ARLINGTON, TX 76017	<u>825</u>
<u>116</u>	PST	89323	648 ft.	0.147 mi. WSW (776 ft.)	KROGER FUEL CENTER 592	5175 W SUBLETT RD, ARLINGTON, TX 76017	<u>827</u>
<u>117</u>	IHW	38158	595 ft.	0.148 mi. W (781 ft.)	FUTURE MARBLE	5216 DAVID STRICKLAND RD, FORT WORTH, TX 76119	832
<u>118</u>	IHW	37130	579 ft.	0.15 mi. ESE (792 ft.)	CRAFTMARK PRODUCTS	3212 S CRAVENS RD, FORT WORTH, TX 76119	833
<u>119</u>	PST	79403	641 ft.	0.153 mi. S (808 ft.)	VANDERRA TRUCKING	6629 ANGLIN DR, FOREST HILL, TX 76140	<u>835</u>
<u>120</u>	PST	78823	593 ft.	0.154 mi. WNW (813 ft.)	HAYES WELDING	5401 WILBARGER ST, FORT WORTH, TX 76119	<u>837</u>

Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>121</u>	LPST	112949	639 ft.	0.154 mi. NE (813 ft.)	KINDLES FOOD STORE FFP 576	4113 MILLER AVE, FORT WORTH, TX	<u>839</u>
<u>121</u>	PST	18392	639 ft.	0.154 mi. NE (813 ft.)	KINDLES FOOD STORE FFP 576	4113 MILLER AVE, FORT WORTH, TX 76119	<u>843</u>
<u>122</u>	LPST	116293	647 ft.	0.155 mi. NE (818 ft.)	DIAMOND SHAMROCK 1200	4747 LITTLE RD, ARLINGTON, TX	<u>847</u>
<u>122</u>	PST	53594	647 ft.	0.155 mi. NE (818 ft.)	SAMS FOOD MART	4747 LITTLE RD, ARLINGTON, TX 76017	<u>853</u>
<u>123</u>	DCR	RN104002746	700 ft.	0.155 mi. SW (818 ft.)	TREE POINT CLEANERS	5071 LITTLE RD STE 140, ARLINGTON, TX 76017	<u>862</u>
<u>123</u>	IHWCA	T1963	700 ft.	0.155 mi. SW (818 ft.)	TREEPOINT PLAZA SHOPPING CENTER ARLINGTON	5071 LITTLE RD, ARLINGTON, TX 76017	<u>863</u>
<u>123</u>	PST	80048	700 ft.	0.155 mi. SW (818 ft.)	MURPHY EXPRESS 8525	5071 LITTLE SCHOOL RD, ARLINGTON, TX 76017	<u>864</u>
<u>124</u>	IHW	20637	617 ft.	0.156 mi. W (824 ft.)	FRANKE FILLING	5960 TENSION DR, FORT WORTH, TX 76112	<u>870</u>
<u>124</u>	IHW	32091	617 ft.	0.171 mi. W (903 ft.)	TENSION ENVELOPE	5900 TENSION DR, FORT WORTH, TX 76112	<u>872</u>
<u>125</u>	IHW	72261	645 ft.	0.16 mi. SW (845 ft.)	GRAHAMS GARAGE	4609 MILLER AVE, FORT WORTH, TX 76119	<u>874</u>
<u>126</u>	LPST	115944	580 ft.	0.16 mi. E (845 ft.)	DIAMOND SHAMROCK 212	6400 E ROSEDALE ST, FORT WORTH, TX	<u>875</u>
<u>126</u>	PST	40256	580 ft.	0.16 mi. E (845 ft.)	DIAMOND SHAMROCK 0212	6400 E ROSEDALE ST, FORT WORTH, TX 76112	<u>883</u>
<u>127</u>	DCR	RN103054722	598 ft.	0.161 mi. NNW (850 ft.)	FAMOUS CLEANERS	4388 W GREEN OAKS BLVD STE 109, ARLINGTON, TX 76016	<u>892</u>
<u>128</u>	PST	63795	641 ft.	0.162 mi. S (855 ft.)	LAND SPAN	6629 ANGLIN DR, FOREST HILL, TX 76140	<u>894</u>
<u>129</u>	IHW	39688	615 ft.	0.163 mi. SSW (861 ft.)	ARLINGTON OIL TOOLS	4705 MARTIN ST, FORT WORTH, TX 76119	<u>896</u>
<u>129</u>	IHW	76571	615 ft.	0.163 mi. SSW (861 ft.)	ARLINGTON OIL TOOLS	4705 MARTIN ST, FORT WORTH, TX 76119	<u>899</u>
<u>129</u>	IHW	78266	615 ft.	0.163 mi. SSW (861 ft.)	YELLOW ENGINE SERVICE	4705 MARTIN ST, FORT WORTH, TX 76119	901
<u>130</u>	LPST	099171	644 ft.	0.165 mi. NW (871 ft.)	STOP SHOP GROCERY 3	3303 E BERRY ST, FORT WORTH, TX	<u>904</u>
<u>130</u>	PST	67449	644 ft.	0.165 mi. NW (871 ft.)	STOP & SHOP	3303 E BERRY ST, FORT WORTH, TX 76105	<u>905</u>
<u>131</u>	IHW	35951	597 ft.	0.167 mi. W (882 ft.)	ACQUISITIONS UNLIMITED	5839 E ROSEDALE ST, FORT WORTH, TX 76112	<u>911</u>
<u>132</u>	IHW	23709	632 ft.	0.167 mi. W (882 ft.)	AMERIA TECH	6024 DALLAS AVE, FORT WORTH, TX 76112	912
<u>132</u>	IHW	31120	632 ft.	0.194 mi. W (1024 ft.)	MACHINED PARTS	5929 S HAMPSHIRE BLVD, FORT WORTH, TX 76112	913
<u>132</u>	IHW	80003	632 ft.	0.167 mi. W (882 ft.)	AMERIA TECH	6024 DALLAS AVE, FORT WORTH, TX 76112	<u>914</u>



Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>132</u>	LPST	099459	632 ft.	0.194 mi. W (1024 ft.)	MACHINED PARTS CORP	5929 S HAMPSHIRE BLVD, FORT WORTH, TX	<u>915</u>
<u>132</u>	PST	25478	632 ft.	0.194 mi. W (1024 ft.)	MACHINED PARTS	5929 S HAMPSHIRE BLVD, FORT WORTH, TX 76112	<u>916</u>
<u>133</u>	PST	81353	650 ft.	0.168 mi. SSW (887 ft.)	ALBERTSONS	HWY 287, ARLINGTON, TX 76001	<u>919</u>
<u>134</u>	BF	164381	654 ft.	0.168 mi. NE (887 ft.)	MULTICULTURAL WESTERN HERITAGE MUSEUM	3520 E. BERRY ST., FORT WORTH, TX 76105	<u>921</u>
<u>135</u>	PST	3117	571 ft.	0.169 mi. ESE (892 ft.)	SHIELDS SIGNS	3201 S CRAVENS RD, FORT WORTH, TX 76119	<u>922</u>
<u>136</u>	BF	133409	664 ft.	0.17 mi. ENE (898 ft.)	4621 W SUBLETT	4621 W SUBLETT RD, ARLINGTON, TX 76017	924
<u>137</u>	PST	19413	630 ft.	0.171 mi. W (903 ft.)	451 CENTRAL OFFICE GLENDALE	6000 CRAIG ST, FORT WORTH, TX 76112	<u>925</u>
<u>138</u>	IHW	90913	608 ft.	0.171 mi. ESE (903 ft.)	WALMART NEIGHBORHOOD MARKET 5181	6513 MEADOWBROOK DR, FORT WORTH, TX 76112	929
<u>138</u>	IHWCA	90913	608 ft.	0.171 mi. ESE (903 ft.)	WAL-MART STORE 5181	6513 MEADOWBROOK DR, FORT WORTH, TX 76112	933
139	APAR	1265	598 ft.	0.172 mi. WNW (908 ft.)	SOLVENTS SOLUTIONS MANUFACTURE	5901 FITZHUGH AVE, FORT WORTH, TX 76119	934
<u>139</u>	BF	15747	598 ft.	0.172 mi. WNW (908 ft.)	UNNAMED	5901 FITZHUGH AVENUE, FORT WORTH, TX 76119	<u>935</u>
<u>139</u>	IHW	30856	598 ft.	0.172 mi. WNW (908 ft.)	ANDERSON LABORATORIES	5901 FITZHUGH AVE, FORT WORTH, TX 76119	<u>936</u>
<u>139</u>	LPST	111978	598 ft.	0.172 mi. WNW (908 ft.)	ANDERSON LABORATORY	5901 FITZHUGH AVE, FORT WORTH, TX	<u>938</u>
<u>139</u>	PST	24937	598 ft.	0.172 mi. WNW (908 ft.)	ANDERSON LABORATORIES	5901 FITZHUGH AVE, FORT WORTH, TX 76119	<u>944</u>
<u>139</u>	VCP	1265	598 ft.	0.172 mi. WNW (908 ft.)	ANDERSON LABORATORIES FACILITY	5901 FITZHUGH AVENUE, FORT WORTH, TX 76119	<u>951</u>
<u>140</u>	IHW	95269	582 ft.	0.174 mi. W (919 ft.)	SOUTHEASTERN FREIGHT LINES FORT WORTH	5300 MARTIN ST, FORT WORTH, TX 76119	<u>952</u>
<u>141</u>	LPST	109705	593 ft.	0.175 mi. E (924 ft.)	WORTH OIL 9721	6217 E LANCASTER AVE, FORT WORTH, TX	<u>957</u>
<u>141</u>	PST	8812	593 ft.	0.175 mi. E (924 ft.)	WORTH OIL 9721	6217 E LANCASTER AVE, FORT WORTH, TX 76112	<u>961</u>
142	LPST	113495	641 ft.	0.18 mi. WNW (950 ft.)	B H SERVICE FINA	6101 MEADOWBROOK DR, FORT WORTH, TX	<u>966</u>

NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>142</u>	PST	31092	641 ft.	0.18 mi. WNW (950 ft.)	B & H SERVICE FINA	6101 MEADOWBROOK DR, FORT WORTH, TX 76112	<u>970</u>
<u>143</u>	PST	50180	566 ft.	0.18 mi. ESE (950 ft.)	TEXAS WATER PRODUCTS	5825 E BERRY ST, FORT WORTH, TX 76119	<u>975</u>
<u>144</u>	PST	85398	657 ft.	0.184 mi. WNW (972 ft.)	7-ELEVEN 36095	3300 VAUGHN BLVD, FORT WORTH, TX 76105	<u>977</u>
<u>145</u>	APAR	2595	625 ft.	0.185 mi. NNW (977 ft.)	PROPOSED CHICK FIL-A-RESTAURANT 2809	4410 LITTLE RD, ARLINGTON, TX 76016	<u>982</u>
<u>145</u>	VCP	2595	625 ft.	0.185 mi. NNW (977 ft.)	PROPOSED CHICK- FIL-A RESTAURANT #2809	4410 LITTLE RD, ARLINGTON, TX 76016	<u>983</u>
<u>146</u>	DCR	RN103951653	650 ft.	0.187 mi. S (987 ft.)	CENTRE CLEANERS SUBLETT	6320 US 287 HWY STE 132, ARLINGTON, TX 76001	984
<u>147</u>	LPST	108342	630 ft.	0.188 mi. W (993 ft.)	EASTSIDE MINISTRIES	5929 E LANCASTER AVE, FORT WORTH, TX	<u>985</u>
<u>147</u>	PST	60837	630 ft.	0.188 mi. W (993 ft.)	WAREHOUSE	5929 E LANCASTER AVE, FORT WORTH, TX 76112	<u>988</u>
<u>148</u>	LPST	101657	579 ft.	0.192 mi. ESE (1014 ft.)	ABC UTILITIES SER	3025 S CRAVENS RD, FORT WORTH, TX	<u>991</u>
<u>148</u>	PST	18635	579 ft.	0.192 mi. ESE (1014 ft.)	F B MCINTIRE EQUIPMENT	3025 S CRAVENS RD, FORT WORTH, TX 76119	<u>995</u>
<u>149</u>	IHW	68828	598 ft.	0.196 mi. NNW (1035 ft.)	PARK AVENUE CLEANERS	4388 W GREEN OAKS BLVD, ARLINGTON, TX 76016	999
<u>150</u>	PST	40265	641 ft.	0.198 mi. WNW (1045 ft.)	DIAMOND SHAMROCK 224	6036 MEADOWBROOK DR, FORT WORTH, TX 76112	<u>1000</u>
<u>151</u>	PST	87896	619 ft.	0.198 mi. NNE (1045 ft.)	REEDER DISTRIBUTORS	4535 VILLAGE CREEK RD, FORT WORTH, TX 76119	<u>1004</u>
<u>152</u>	CALF	2419	589 ft.	0.201 mi. E (1061 ft.)	PHOTOTROPOS	1000 FT E OF LOOP 820 E ON S SIDE MARTIN ST IN FT WORTH, TX	<u>1007</u>
<u>153</u>	DCR	RN104431119	633 ft.	0.201 mi. S (1061 ft.)	COMET ONE-HOUR CLEANERS	6619 FOREST HILL DR STE 50, FOREST HILL, TX 76140	1008
<u>153</u>	IHW	41615	633 ft.	0.201 mi. S (1061 ft.)	COMET ONE-HOUR CLEANERS	6619 FOREST HILL DR, FOREST HILL, TX 76140	<u>1010</u>
<u>153</u>	IHW	76174	633 ft.	0.201 mi. S (1061 ft.)	COMET ONE-HOUR CLEANERS	6619 FOREST HILL DR STE 50, FOREST HILL, TX 76140	<u>1011</u>
<u>154</u>	PST	32774	593 ft.	0.204 mi. E (1077 ft.)	WICKHAM SUPPLY	6301 E LANCASTER AVE, FORT WORTH, TX 76112	<u>1012</u>
<u>155</u>	LPST	101001	593 ft.	0.205 mi. E (1082 ft.)	RACETRAC	6300 E LANCASTER AVE, FORT WORTH, TX	<u>1014</u>
<u>155</u>	PST	62245	593 ft.	0.205 mi. E (1082 ft.)	MUMMES PEARSALL	6300 E LANCASTER AVE, FORT WORTH, TX 76112	<u>1018</u>
<u>155</u>	PST	62265	593 ft.	0.205 mi. E (1082 ft.)	RACEWAY 6761	6300 E LANCASTER AVE, FORT WORTH, TX 76112	<u>1020</u>

NOTE: Standard environmental records are displayed in **bold**.

Мар	Database	Site ID#	Elevation	Distance	Site Name	Address	PAGE
ID#	Name			From Site			#
<u>156</u>	LPST	119520	695 ft.	0.209 mi. SW (1104 ft.)	CORNER STORE 2241	1201 N LITTLE SCHOOL RD, ARLINGTON, TX	<u>1027</u>
<u>156</u>	PST	39384	695 ft.	0.209 mi. SW (1104 ft.)	CORNER STORE 2241	1201 N LITTLE SCHOOL RD, ARLINGTON, TX 76017	<u>1028</u>
<u>157</u>	PST	41987	588 ft.	0.211 mi. W (1114 ft.)	CRITES OIL	5800 E ROSEDALE ST, FORT WORTH, TX 76112	<u>1037</u>
<u>158</u>	PST	1404	609 ft.	0.212 mi. NNW (1119 ft.)	FIRESTONE STORE 24W4	4319 LITTLE RD, ARLINGTON, TX 76016	<u>1041</u>
<u>159</u>	PST	15720	644 ft.	0.213 mi. NNW (1125 ft.)	KMART 3566	401 SOUTHWEST PLZ, ARLINGTON, TX 76016	<u>1043</u>
<u>160</u>	IHW	70379	593 ft.	0.216 mi. W (1140 ft.)	SPECIAL EFFECTS	5136 SAUNDERS RD, FORT WORTH, TX 76119	<u>1045</u>
<u>161</u>	IHW	85774	593 ft.	0.218 mi. W (1151 ft.)	AERO COMPONENTS	5124 KALTENBRUN RD, FORT WORTH, TX 76119	<u>1046</u>
<u>162</u>	PST	40494	608 ft.	0.218 mi. W (1151 ft.)	PARISH ELECTRIC	5725 HART ST, FORT WORTH, TX 76112	<u>1051</u>
<u>163</u>	DCR	RN104747563	695 ft.	0.22 mi. SW (1162 ft.)	TREE POINT CLEANERS & TAILOR	5081 LITTLE RD STE 103, ARLINGTON, TX 76017	<u>1053</u>
<u>164</u>	IHW	82925	605 ft.	0.226 mi. SSW (1193 ft.)	FEDEX GROUND PACKAGE SYSTEM	4901 VILLAGE CREEK RD, FORT WORTH, TX 76119	<u>1055</u>
<u>164</u>	IHWCA	82925	605 ft.	0.226 mi. SSW (1193 ft.)	FEDEX GROUND	4901 VILLAGE CREEK RD, FORT WORTH, TX 76119	<u>1058</u>
<u>164</u>	PST	59824	605 ft.	0.226 mi. SSW (1193 ft.)	FEDEX GROUND	4901 VILLAGE CREEK RD, FORT WORTH, TX 76119	<u>1059</u>
<u>165</u>	IHW	96516	571 ft.	0.228 mi. ESE (1204 ft.)	JAYCO STAMPING COMPANY OF TEXAS	6109 DOWDELL RD, FORT WORTH, TX 76119	<u>1070</u>
<u>166</u>	PST	75665	640 ft.	0.23 mi. SW (1214 ft.)	KELLY TOURS	4625 MILLER AVE, FORT WORTH, TX 76119	<u>1071</u>
<u>167</u>	IHW	80333	609 ft.	0.233 mi. NNW (1230 ft.)	MOBIL OIL	4380 W GREEN OAKS BLVD, ARLINGTON, TX 76016	<u>1073</u>
<u>167</u>	LPST	102477	609 ft.	0.233 mi. NNW (1230 ft.)	MOBIL 12 138	4380 W GREEN OAKS BLVD, ARLINGTON, TX	<u>1074</u>
<u>167</u>	PST	17627	609 ft.	0.233 mi. NNW (1230 ft.)	GREEN OAKS MOBIL	4380 W GREEN OAKS BLVD, ARLINGTON, TX 76016	<u>1079</u>
<u>168</u>	IHW	35623	608 ft.	0.239 mi. W (1262 ft.)	RESEARCH CHEMICALS	5717 HART ST, FORT WORTH, TX 76112	<u>1086</u>
<u>169</u>	IHW	81780	566 ft.	0.239 mi. ESE (1262 ft.)	RITE-WAY EQUIPMENT SALES & SERVICE	5900 E BERRY ST STE F, FORT WORTH, TX 76119	1087
<u>170</u>	PST	79586	600 ft.	0.24 mi. SE (1267 ft.)	ACTION EXCAVATING	6824 OAK CREST DR W, FORT WORTH, TX 76140	<u>1088</u>
<u>171</u>	LPST	113562	595 ft.	0.242 mi. E (1278 ft.)	EASTSIDE WRECHER	6401 E LANCASTER AVE, FORT WORTH, TX	<u>1090</u>



Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>171</u>	PST	71088	595 ft.	0.242 mi. E (1278 ft.)	EASTSIDE WRECHER	6401 E LANCASTER AVE, FORT WORTH, TX 76112	<u>1096</u>
<u>172</u>	PST	26596	658 ft.	0.248 mi. WNW (1309 ft.)	RAS 6 3690	3229 E BERRY ST, FORT WORTH, TX 76105	<u>1102</u>
<u>173</u>	IHWCA	T2216	688 ft.	0.255 mi. SW (1346 ft.)	MASONIC HOME AND SCHOOL OF TEXAS	3600 WICHITA ST, FORT WORTH, TX 76119	<u>1107</u>
<u>174</u>	LPST	104817	620 ft.	0.276 mi. NNW (1457 ft.)	CHEVRON 164475	4340 LITTLE RD, ARLINGTON, TX	<u>1108</u>
<u>175</u>	LPST	096154	627 ft.	0.278 mi. S (1468 ft.)	MR M FOOD STORE 77	6701 FOREST HILL DR, FOREST HILL, TX	<u>1112</u>
<u>176</u>	LPST	102171	612 ft.	0.281 mi. ESE (1484 ft.)	JIM CROWS TEXACO STATION	6545 MEADOWBROOK DR, FORT WORTH, TX	<u>1113</u>
<u>177</u>	LPST	107237	612 ft.	0.332 mi. ESE (1753 ft.)	7 ELEVEN STORE 12506	6611 MEADOWBROOK DR, FORT WORTH, TX	<u>1117</u>
<u>177</u>	LPST	115425	612 ft.	0.309 mi. ESE (1632 ft.)	CONOCO 43041	6601 MEADOWBROOK DR, FORT WORTH, TX	<u>1121</u>
<u>178</u>	LPST	094900	634 ft.	0.31 mi. NNE (1637 ft.)	FIRE STATION 22	4849 WILBARGER ST, FORT WORTH, TX	<u>1126</u>
<u>178</u>	LPST	106295	634 ft.	0.31 mi. NNE (1637 ft.)	FIRE STATION 22	4849 WILBARGER ST, FORT WORTH, TX	<u>1127</u>
<u>179</u>	IHWCA	34995	573 ft.	0.311 mi. ESE (1642 ft.)	HYDRA RIG	6000 E BERRY ST, FORT WORTH, TX 76119	1129
<u>180</u>	LPST	103859	612 ft.	0.321 mi. W (1695 ft.)	AT T	1000 S CANTON DR, FORT WORTH, TX	<u>1130</u>
<u>181</u>	LPST	110496	612 ft.	0.333 mi. ESE (1758 ft.)	CHEVRON FAC 106136	6600 MEADOWBROOK DR, FORT WORTH, TX	<u>1132</u>
<u>182</u>	LPST	110392	624 ft.	0.36 mi. S (1901 ft.)	FOREST HILLS MUNICIPAL GARAGE	3415 HORTON RD, FOREST HILL, TX	<u>1136</u>
<u>183</u>	LPST	114579	605 ft.	0.362 mi. NNE (1911 ft.)	STOP N SHOP	5037 WILBARGER ST, FORT WORTH, TX	<u>1139</u>
<u>183</u>	LPST	119448	605 ft.	0.362 mi. NNE (1911 ft.)	STOP & SHOP	5037 WILBARGER ST, FORT WORTH, TX	<u>1143</u>
<u>184</u>	LPST	113025	640 ft.	0.364 mi. W (1922 ft.)	ВНОС 9	5734 E LANCASTER AVE, FORT WORTH, TX	<u>1144</u>
<u>185</u>	LPST	118909	631 ft.	0.377 mi. NNW (1991 ft.)	COLONIAL CAR WASH 3	5780 W PLEASANT RIDGE RD, ARLINGTON, TX	<u>1148</u>
<u>186</u>	LPST	107390	620 ft.	0.386 mi. WNW (2038 ft.)	SLEEPYS LIQUOR	5110 MANSFIELD HWY, FOREST HILL, TX	<u>1152</u>
187	IHWCA	85914	581 ft.	0.394 mi. ESE (2080 ft.)	AZZ GALVANIZING KENNEDALE	1530 GILMAN RD, FORT WORTH, TX 76140	<u>1155</u>



NOTE: Standard environmental records are displayed in **bold**.

Map ID#	Database Name	Site ID#	Elevation	Distance From Site	Site Name	Address	PAGE #
<u>188</u>	LPST	108913	602 ft.	0.394 mi. ESE (2080 ft.)	TEXACO	6705 MEADOWBROOK DR, FORT WORTH, TX	<u>1156</u>
<u>189</u>	CALF	1382	565 ft.	0.397 mi. SE (2096 ft.)	ABAR	OAK CREST & HWY. 287 & VILLAGE CREEK., TX	<u>1160</u>
<u>190</u>	BF	143121	599 ft.	0.399 mi. N (2107 ft.)	PLEASANT RIDGE LAND	3801 W. PLEASANT RIDGE ROAD, ARLINGTON, TX 76016	<u>1161</u>
<u>191</u>	LPST	119285	630 ft.	0.401 mi. SW (2117 ft.)	AMERICAN FOOD STORE	4801 MILLER AVE, FORT WORTH, TX	<u>1162</u>
<u>192</u>	LPST	102439	609 ft.	0.402 mi. W (2123 ft.)	T R FRICKS INC	5012 DAVID STRICKLAND RD, FORT WORTH, TX	<u>1163</u>
<u>193</u>	LPST	113624	649 ft.	0.405 mi. NW (2138 ft.)	S A FOOD STORE	2912 VAUGHN BLVD, FORT WORTH, TX	<u>1167</u>
<u>194</u>	DCRPS	DC0289	591 ft.	0.439 mi. E (2318 ft.)	FORMER KELL CLEANERS	6609 LANCASTER AVENUE, FORT WORTH, TX	<u>1171</u>
<u>194</u>	DCRPS	DCO289	591 ft.	0.439 mi. E (2318 ft.)	FORMER KELL CLEANERS	6609 LANCASTER AVENUE, FORT WORTH, TX	<u>1172</u>
<u>195</u>	LPST	112225	637 ft.	0.475 mi. NE (2508 ft.)	FORMER SERVICE STATION	3536 MILLER AVE, FORT WORTH, TX	<u>1173</u>
<u>196</u>	LPST	116327	632 ft.	0.481 mi. WNW (2540 ft.)	M N FOOD MART	5201 MANSFIELD HWY, FOREST HILL, TX	<u>1178</u>
<u>197</u>	IHWCA	T1786	642 ft.	0.525 mi. WNW (2772 ft.)	COMET CLEANERS FORT WORTH	5656 MEADOWBROOK DR, FORT WORTH, TX 76112	<u>1182</u>
<u>198</u>	IHWCA	T0672	561 ft.	0.8 mi. ESE (4224 ft.)	ATOS IT SOLUTIONS AND SERVICES	5000 S BOWEN RD, ARLINGTON, TX 76017	<u>1183</u>
<u>199</u>	IHWCA	T0544	658 ft.	0.885 mi. W (4673 ft.)	NORTHWESTERN MUTUAL LIFE INSURANCE 820 BUSINESS PARK	FORT WORTH, TX	1184

31 of 1203

## Spills Listing (SPILLS)

**MAP ID# 1** 

Distance from Property: 0.001 mi. (5 ft.) NNW

Elevation: 591 ft.

#### **INCIDENT INFORMATION**

GEOSEARCH ID: 10/17/98009
INCIDENT #: 10/17/98009
SPILL DATE: 10/17/98
SPILL LOCATION / COUNTY:

I20 EAST @ I820 INTERSECTION, FORT WORTH / TX

RESPONSIBLE PARTY: RYDER INTEGRATED LOGISTICS

MATERIAL SPILLED / AMOUNT: DIESEL / 100 GAL

AFFECTED WATERWAY: STORMWATER DRAINAGE

AMOUNT IN WATER: 0 GAL

BASIN: TRINITY
COMMENTS:
NOT REPORTED

**Back to Report Summary** 

## Spills Listing (SPILLS)

**MAP ID# 1** 

Distance from Property: 0.001 mi. (5 ft.) NNW

Elevation: 591 ft.

#### **INCIDENT INFORMATION**

GEOSEARCH ID: 2661
INCIDENT #: 2661
SPILL DATE: 06/05/02
SPILL LOCATION / COUNTY:

INTERSECTION OF IH20 WEST AT IH820 EASTFORT WORTH, TX 76119 / TX 76119

RESPONSIBLE PARTY: IH20 AT IH820 E FORT WORTH

REGULATED ENTITY #: RN102494135

CUSTOMER: CHALLENGER MOTOR FREIGHT

MATERIAL SPILLED / AMOUNT: DIESEL FUEL 2-D / 20 GALLONS

MEDIA: WASTE

NATURE: MUNICIPAL

WATER BODY: STORMWATER DRAINAGE

AIR SOURCE: TRACTOR-TRAILER
DISPUTED STATUS: PUBLIC AUTO
DISPUTED DATE: NOT REPORTED
INCIDENT STATUS: CLOSED

CLASS: 003 - OIL MINOR <24B/1,000G

COMMENTS:

 ${\tt GARNER\ ENVIRONMENTAL\ CONDUCTED\ RESPONSE.\ ABSORBENT\ APPLIED,\ CONTAMINATED\ MATERIALS\ COLLECTED}$ 

AND STAGED FOR DISPOSAL.

**Back to Report Summary** 

## Facility Registry System (FRSTX)

**MAP ID# 2** 

Distance from Property: 0.007 mi. (37 ft.) E

Elevation: 592 ft.

FACILITY INFORMATION
REGISTRY ID: 110059613805

NAME: UDI DRILLING

LOCATION ADDRESS: LOOP 820 & SUN VALLEY

FORT WORTH, TX 76113

COUNTY: TARRANT EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NO ALTERNATIVE NAME(S) LISTED FOR THIS FACILITY

PROGRAM/S LISTED FOR THIS FACILITY

**OSHA-OIS - OSHA-OIS** 

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

211111 - CRUDE PETROLEUM AND NATURAL GAS EXTRACTION.

**Back to Report Summary** 

## Spills Listing (SPILLS)

**MAP ID# 2** 

Distance from Property: 0.007 mi. (37 ft.) E

Elevation: 592 ft.

#### **INCIDENT INFORMATION**

GEOSEARCH ID: 7/18/96003
INCIDENT #: 7/18/96003
SPILL DATE: 07/18/96
SPILL LOCATION / COUNTY:

HWY 820 & SUN VALLEY, FORT WORTH / TX
RESPONSIBLE PARTY: BESTWAY TRUCKING

MATERIAL SPILLED / AMOUNT: DIESEL FUEL / 40-50 GAL

AFFECTED WATERWAY: NOT REPORTED

AMOUNT IN WATER: NOT REPORTED

BASIN: NOT REPORTED

COMMENTS: NOT REPORTED

**Back to Report Summary** 

### Hazardous Materials Incident Reporting System (HMIRSR06)

**MAP ID# 3** 

Distance from Property: 0.015 mi. (79 ft.) E

Elevation: 578 ft.

#### **INCIDENT INFORMATION**

REPORT #: I-2014120547

DATE: 12/18/2014
INCIDENT LOCATION:

**IH 820 AND ROASE DALE STREET** 

FORT WORTH, TX 76112

**TARRANT** 

#### **CARRIER INFORMATION**

NAME: UPS FREIGHT SERVICES INC.

ADDRESS: 1000 SEMMES AVE

**RICHMOND, VA 23224-2246** 

MODE OF TRANSPORTATION: **HIGHWAY** TRANSPORTATION PHASE: **IN TRANSIT** 

#### **COMMODITY DETAILS**

IDENTIFICATION NUMBER: UN2699

COMMODITY SHIPPING NAME: TRIFLUOROACETIC ACID

TRADE NAME: TRIFLUOROACETIC ACID

QUANTITY RELEASED: 0.046875 LIQUID - GALLON

PACKAGING: NON-BULK FAILURE DESCRIPTION

WHAT FAILED: 109 CLOSURE (E.G. CAP TOP OR PLUG)

HOW FAILED: **304 - CRACKED** FAILURE CAUSE DESCRIPTION:

**508 - DEFECTIVE COMPONENT OR DEVICE** 

**DESCRIPTION OF EVENTS:** 

WHEN THE DRIVER WAS MAKING A DELIVERY HE NOTICED A PACKAGE SMOKING. THE LID ON THE INNER CONTAINER WAS CRACKED CAUSED ABOUT 6 OUNCES TO LEAK OUT. CONTRACTOR WAS CALLED TO CLEAN UP THE SPILL.

RECOMMENDATIONS/ACTIONS TAKEN:

**NEED BETTER PACKAGING.** 

**Back to Report Summary** 

**MAP ID# 4** 

Distance from Property: 0.021 mi. (111 ft.) WNW

Elevation: 590 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 096695

LPST ID: 096695

FACILITY ID: 0057269

NAME: FORMER DURGHA PROPERTY

ADDRESS: 4320 E LOOP 820 S

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 096695

NAME: FORMER DURGHA PROPERTY FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 9/14/90

REPORTED DATE: 9/4/1990 ENTERED DATE: 9/14/1990

PRP INFORMATION

NAME: TRUCK TRAILER SERVICES INC
ADDRESS: ADDRESS NOT REPORTED
FORT WORTH TX 76119

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 4** 

Distance from Property: 0.021 mi. (111 ft.) WNW

Elevation: 590 ft.

#### **FACILITY INFORMATION**

ID#: 57269

NAME: DURHGA FRB FORT WORTH EAST

ADDRESS: 4320 E LOOP 820 S

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: INDUST/MFG/CHEM PLANT

BEGIN DATE: 08/31/1987 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 01/10/1991 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 01/08/1991 SIGNATURE NAME & TITLE: JEFF MCLAUGHLIN, ENV. ANALYST

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603698077

NAME: FDIC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: FEDERAL GOVERNMENT

BEGIN DATE: 09/01/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OWNER NUMBER: CN601260581

NAME: FDIC LIQ FIRST REPUBLIC BANK

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: FEDERAL GOVERNMENT

BEGIN DATE: 09/01/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: NOT REPORTED
TITLE: NOT REPORTED

ORGANIZATION: DURHGA FRB FORT WORTH EAST
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (214) 5085361 0

GeoSearch www.geo-search.com 888-396-0042

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 01/10/1991

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/23/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL: **NOT REPORTED** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 159512

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 39 of 1203

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 01/10/1991

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/23/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 159513

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 5** 

Distance from Property: 0.024 mi. (127 ft.) NE

Elevation: 643 ft.

**FACILITY INFORMATION** 

ID#: **84009** 

NAME: QUIKTRIP 856
ADDRESS: 4930 LITTLE RD

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 12/03/2010

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 4 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 03/15/2011 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/14/2011

SIGNATURE NAME & TITLE:  $\,$  MOLLY WRATZ, ENV ENGR  $\,$ 

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600241673
NAME: QUIKTRIP CORPORATION

CONTACT ADDRESS: 4705 S 129TH EAST AVE

**TULSA OK 74134** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/03/2010 CONTACT ROLE: OWNCON

CONTACT NAME: LAURA THOMPSON CONTACT TITLE: ENV ENGINEER

ORGANIZATION: QUIKTRIP CORPORATION

PHONE: (918) 6157990 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN600241673
NAME: QUIKTRIP CORPORATION

CONTACT ADDRESS: 14450 TRINITY BLVD

FORT WORTH TX 76155

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/03/2010 CONTACT ROLE: OPRCON

CONTACT NAME: **BILL D ARKISON** CONTACT TITLE: **NOT REPORTED** 

CONTACT INFORMATION

NAME: **JEN YATES** 

TITLE: NOT REPORTED

ORGANIZATION: QUIKTRIP 856

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 3681606 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: QUIKTRIP CORPORATION

PHONE: **(817) 3587694 0** FAX: **(817) 8580213** 

EMAIL: WMCMENNA@QUICKTRIP.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 300503 SIGNATURE DATE: 03/05/2018

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENV COMPLIANCE MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 283997
SIGNATURE DATE: 03/21/2017

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENV. COMPLIANCE MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 268285
SIGNATURE DATE: 04/15/2016

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENV. COMPLI. MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 250651
SIGNATURE DATE: 03/18/2015

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENV COMPL ADMIN

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 234986
SIGNATURE DATE: 03/17/2014

SIGNATURE NAME & TITLE: LAURA THOMPSON, ENV COMP ADM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 215694
SIGNATURE DATE: 03/18/2013

SIGNATURE NAME & TITLE: LAURA THOMPSON, ENVIRO COMP ADMIN

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 215693
SIGNATURE DATE: 03/14/2012

SIGNATURE NAME & TITLE: MOLLY WRATE, ENV-EM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 215692
SIGNATURE DATE: 03/15/2011

SIGNATURE NAME & TITLE: MOLLY WRATZ, ENV ENGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 215691
SIGNATURE DATE: 03/14/2011



Order# 121435 Job# 277689 42 of 1203

SIGNATURE NAME & TITLE: MOLLY WRATZ, ENV ENGR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 23159

APPLICATION RECEIVED DATE: 09/13/2010

SCHEDULE CONSTRUCTION DATE: 09/13/2010

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

NEW CONSTRUCTION - INSTALLATION OF (2) 20K GALLON UST AND (2) 12K GALLON UST

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/03/2010 REGISTRATION DATE: 03/15/2011

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 12/03/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 179466

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINMEN/BUCKET/SUMP, FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH), ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) &

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 43 of 1203

#### **INVENTORY CONTROL**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/03/2010 REGISTRATION DATE: 03/15/2011

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 12/03/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 179467

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1

Order# 121435 Job# 277689 44 of 1203

INSTALLATION DATE: 12/03/2010 REGISTRATION DATE: 03/15/2011

TANK CAPACITY (GAL): 12000 **EMPTY TANK: NOT EMPTY** 

STATUS: IN USE STATUS BEGIN DATE: 12/03/2010

REGULATORY STATUS: FULLY REGULATED INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN DOUBLE WALL: YES TANK DESIGN SINGLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** UST COMPARTMENT ID: 179468

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH), ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 12/03/2010 REGISTRATION DATE: 03/15/2011

TANK CAPACITY (GAL): 12000 **EMPTY TANK: NOT EMPTY** 

STATUS: IN USE STATUS BEGIN DATE: 12/03/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

Order# 121435 Job# 277689 45 of 1203

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 179469

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP.DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 6** 

Distance from Property: 0.025 mi. (132 ft.) SSW

Elevation: 613 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 105249

LPST ID: 105249

FACILITY ID: 0007523

NAME: SOUTHEAST SERVICE CENTER
ADDRESS: 5000 MARTIN LUTHER KING FWY

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 105249

NAME: **SOUTHEAST SERVICE CENTER** FACILITY LOCATION: **NOT REPORTED** 

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 1/12/93

REPORTED DATE: 11/10/1992 ENTERED DATE: 1/12/1993

PRP INFORMATION

NAME: CITY OF FORT WORTH

ADDRESS: ADDRESS NOT REPORTED
FORT WORTH TX 76102

CONTACT: NOT REPORTED

PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/02/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114409

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: **TEMP OUT OF SERVICE** STATUS BEGIN DATE: **04/03/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 114409

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

Order# 121435 Job# 277689 48 of 1203

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114409

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/02/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:
FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114412

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 



Order# 121435 Job# 277689 50 of 1203

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114412

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

Order# 121435 Job# 277689 51 of 1203

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114412

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/02/2015** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114410

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 114410

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

Order# 121435 Job# 277689 53 of 1203

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114410

TANK ID: 3

COMPARTMENT LETTER: A
SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/02/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 54 of 1203

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114411

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES

Order# 121435 Job# 277689 55 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114411

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: **TEMP OUT OF SERVICE** STATUS BEGIN DATE: **04/03/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114411

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

Order# 121435 Job# 277689 56 of 1203

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3031 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 11500 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 114405

TANK ID: 3031

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 11500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

Order# 121435 Job# 277689 57 of 1203

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3032 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114404

TANK ID: 3032

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 3033 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 11500 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

Order# 121435 Job# 277689 58 of 1203

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114408

TANK ID: 3033

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 11500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3034 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/05/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 59 of 1203

UST COMPARTMENT ID: 114407

TANK ID: 3034

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3035 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/05/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114406

TANK ID: 3035

COMPARTMENT LETTER: A
SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

Order# 121435 Job# 277689 60 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

AST ID #: 221802 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 07/06/2016

INSTALLATION DATE: 04/22/2016 STATUS BEGIN DATE: 04/22/2016

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221803 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 2 REGISTRATION DATE: 07/06/2016

INSTALLATION DATE: 04/22/2016 STATUS BEGIN DATE: 04/22/2016

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: TWO POINT SYSTEM

STAGE I INSTALLATION DATE: 04/22/2016

**Back to Report Summary** 

**MAP ID# 6** 

Distance from Property: 0.025 mi. (132 ft.) SSW

Elevation: 613 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 106882

LPST ID: 106882

FACILITY ID: 0007523

NAME: FORT WORTH SOUTHEAST SERVICE CENTER

ADDRESS: 5000 MARTIN LUTHER KING FWY

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 106882

NAME: FORT WORTH SOUTHEAST SERVICE CENTER

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 10/14/93

REPORTED DATE: 6/25/1993 ENTERED DATE: 10/14/1993

PRP INFORMATION

NAME: CITY OF FORT WORTH

ADDRESS: ADDRESS NOT REPORTED

FORT WORTH TX 76119

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/02/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 62 of 1203

UST COMPARTMENT ID: 114409

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: **TEMP OUT OF SERVICE** STATUS BEGIN DATE: **04/03/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114409

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

Order# 121435 Job# 277689 63 of 1203

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: **TEMP OUT OF SERVICE** STATUS BEGIN DATE: **04/03/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114409

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES

Order# 121435 Job# 277689 64 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/02/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:
FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114412

TANK ID: 2

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 



Order# 121435 Job# 277689 65 of 1203

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114412

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

Order# 121435 Job# 277689 66 of 1203

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114412

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/02/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114410

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

Order# 121435 Job# 277689 67 of 1203

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: **TEMP OUT OF SERVICE** STATUS BEGIN DATE: **04/03/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 114410

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

Order# 121435 Job# 277689 68 of 1203

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114410

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/02/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

Order# 121435 Job# 277689 69 of 1203

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114411

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: **TEMP OUT OF SERVICE** STATUS BEGIN DATE: **04/03/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES

GeoSearch www.geo-search.com 888-396-0042

CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114411

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: **TEMP OUT OF SERVICE** STATUS BEGIN DATE: **04/03/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114411

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

Order# 121435 Job# 277689 71 of 1203

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3031 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 11500 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114405

TANK ID: 3031

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 11500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3032 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114404

TANK ID: 3032

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 3033 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 11500 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO

**TANK DETAILS** 



Order# 121435 Job# 277689 73 of 1203

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114408

TANK ID: 3033

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 11500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3034 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/05/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114407

TANK ID: 3034

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3035 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/05/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114406

TANK ID: 3035

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

AST ID #: 221802 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 07/06/2016

INSTALLATION DATE: 04/22/2016 STATUS BEGIN DATE: 04/22/2016

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221803 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 2 REGISTRATION DATE: 07/06/2016

INSTALLATION DATE: 04/22/2016 STATUS BEGIN DATE: 04/22/2016

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: TWO POINT SYSTEM

STAGE I INSTALLATION DATE: 04/22/2016

**Back to Report Summary** 

**MAP ID# 6** 

Distance from Property: 0.025 mi. (132 ft.) SSW

Elevation: 613 ft.

**FACILITY INFORMATION** 

ID#: 7523

NAME: SOUTHEAST SERVICE CENTER ADDRESS: 5000 MARTIN LUTHER KING FWY

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING BEGIN DATE: 09/01/1988 STATUS: ACTIVE

EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 2

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 07/06/2016 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 06/24/2016

SIGNATURE NAME & TITLE: CODY WHITTENBURG, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600128862 NAME: CITY OF FORT WORTH

CONTACT ADDRESS: 217 AVIATION WAY

FORT WORTH TX 76106

TYPE: CITY GOVERNMENT BEGIN DATE: 09/01/1988 CONTACT ROLE: OWNCON CONTACT NAME: LISA A PYLES CONTACT TITLE: NOT REPORTED ORGANIZATION: CITY OF FORT WORTH

PHONE: (817) 8715400 0 FAX: (817) 8715413 **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600128862 NAME: CITY OF FORT WORTH

CONTACT ADDRESS: 1000 THROCKMORTON ST

FORT WORTH TX 76102

TYPF: CITY GOVERNMENT BEGIN DATE: 09/01/1988 CONTACT ROLE: OPRCON

CONTACT NAME: GERALD DON MCCHESNEY

CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: RANDY RENDON TITLE: NOT REPORTED

ORGANIZATION: SOUTHEAST SERVICE CENTER MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 3925112 0

77 of 1203

ORGANIZATION: CITY OF FORT WORTH

PHONE: **(817) 3927601 0** FAX: **(817) 3928092** 

EMAIL: GERALD.MCCHESNEY@FORTWORTHGOV.ORG

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 226983 SIGNATURE DATE: 09/03/2013

SIGNATURE NAME & TITLE: MICHAEL A GANGE, ASST DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126695
SIGNATURE DATE: 09/18/2012

SIGNATURE NAME & TITLE: MICHAEL A GANGE, ASSIST DIRECTOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126694
SIGNATURE DATE: 08/30/2011

SIGNATURE NAME & TITLE: MICHAEL A GANGE, ASST DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126693
SIGNATURE DATE: 08/27/2010

SIGNATURE NAME & TITLE: BRIAN K BOERNER, DIR ENV MGMT DEPT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126692
SIGNATURE DATE: 09/01/2009

SIGNATURE NAME & TITLE: BRIAN K BOERNER, DIR OF ENV MNDT DEPT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126691
SIGNATURE DATE: 09/15/2008

SIGNATURE NAME & TITLE:  $\,$  BRIAN K BOERNER, DIR OF EMD  $\,$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126690
SIGNATURE DATE: 09/18/2007

SIGNATURE NAME & TITLE:  $\,$  BRIAN K BOERNER, DIR ENV  $\,$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126689
SIGNATURE DATE: 09/18/2006

SIGNATURE NAME & TITLE: BRIAN K BOERNER, DIR OF ENV MNGT DEPT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126688
SIGNATURE DATE: 09/22/2005



SIGNATURE NAME & TITLE: BRIAN K BOERNER, DIR ENV MANAGEMENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126687
SIGNATURE DATE: 09/30/2004

SIGNATURE NAME & TITLE: BRIAN K BOERNER, DIR ENV MANG

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126686
SIGNATURE DATE: 10/02/2003

SIGNATURE NAME & TITLE: BRIAN K BOERNER, DIR OF DEPT OF ENV

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126685
SIGNATURE DATE: 09/19/2002

SIGNATURE NAME & TITLE: BRIAN K BOERNER, DIR OF DEPT OF ENV

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126684
SIGNATURE DATE: 01/13/2001

SIGNATURE NAME & TITLE: BRIAN K BOERNER, CHMM, DIR OF DEM

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 29625
APPLICATION RECEIVED DATE: 05/26/2016
SCHEDULE CONSTRUCTION DATE: 10/12/2015

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REMOVAL OF (4) 8000 GAL UST'S.

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/02/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 79 of 1203

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114409

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: **TEMP OUT OF SERVICE** STATUS BEGIN DATE: **04/03/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114409

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

Order# 121435 Job# 277689 80 of 1203

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH)

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114409

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

Order# 121435 Job# 277689 81 of 1203

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/02/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114412

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:
FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114412

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES

GeoSearch www.geo-search.com 888-396-0042

PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114412

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/02/2015** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)



Order# 121435 Job# 277689 84 of 1203

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114410

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: **TEMP OUT OF SERVICE** STATUS BEGIN DATE: **04/03/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114410

Order# 121435 Job# 277689 85 of 1203

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114410

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/02/2015** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114411

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 



PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: **TEMP OUT OF SERVICE** STATUS BEGIN DATE: **04/03/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114411

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1



INSTALLATION DATE: 11/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/03/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114411

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH)

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3031 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 11500 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO



**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114405

TANK ID: 3031

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 11500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3032 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/01/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO.

TANK DESIGN DOLIBLE WALL: NO.

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO

Order# 121435 Job# 277689 90 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114404

TANK ID: 3032

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3033 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 11500 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114408

TANK ID: 3033

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 11500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

Order# 121435 Job# 277689 91 of 1203

SPILL CONTAINMENT AND OVERFILL PREVENTION: DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3034 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/05/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114407

TANK ID: 3034

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

Order# 121435 Job# 277689 92 of 1203

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3035 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/05/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114406

TANK ID: 3035

COMPARTMENT LETTER: A SUBSTANCES: **USED OIL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 221802 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 07/06/2016

INSTALLATION DATE: 04/22/2016 STATUS BEGIN DATE: 04/22/2016

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

Order# 121435 Job# 277689 93 of 1203

#### **MATERIAL OF CONSTRUCTION**

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221803 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 2 REGISTRATION DATE: 07/06/2016

INSTALLATION DATE: 04/22/2016 STATUS BEGIN DATE: 04/22/2016

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: TWO POINT SYSTEM

STAGE I INSTALLATION DATE: 04/22/2016

**Back to Report Summary** 

**MAP ID# 7** 

Distance from Property: 0.025 mi. (132 ft.) WNW

Elevation: 594 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 108691

LPST ID: 108691

FACILITY ID: 0013649

NAME: CONSOLIDATED FREIGHTWAYS

ADDRESS: 4601 CAREY ST

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 108691

NAME: CONSOLIDATED FREIGHTWAYS
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 11/15/94

REPORTED DATE: 9/30/1994 ENTERED DATE: 11/15/1994

PRP INFORMATION

NAME: MERCHANTS FAST MOTOR LINES INC ADDRESS: ADDRESS NOT REPORTED

DALLAS TX 75214

CONTACT: **NOT REPORTED**PHONE: **NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1978

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 95 of 1203

UST COMPARTMENT ID: 50078

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1978

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 50078

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

Order# 121435 Job# 277689 96 of 1203

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 10/28/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 50077

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 



Order# 121435 Job# 277689 97 of 1203

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 10/26/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 50077

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 10/26/2011

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 98 of 1203

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 50076

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/11/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 99 of 1203

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 50075

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

#### **PIPING SYSTEMS**

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 7** 

Distance from Property: 0.025 mi. (132 ft.) WNW

Elevation: 594 ft.

**FACILITY INFORMATION** 

ID#: 13649

NAME: CENTRAL TRANSPORT ADDRESS: 4601 CAREY ST

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING BEGIN DATE: 01/01/1978

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 02/20/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/15/2018

SIGNATURE NAME & TITLE: CHRISTOPHER LEE, DIR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600539621 NAME: CROWN ENTERPRISES INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/01/2016

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

OWNER NUMBER: CN600539621 NAME: CROWN ENTERPRISES INC

CONTACT ADDRESS: 12225 STEPHENS RD WARREN MI 48089

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/16/2004 CONTACT ROLE: OWNCON

CONTACT NAME: CRAIG STAMPER CONTACT TITLE: NOT REPORTED

ORGANIZATION: CROWN ENTERPRISES INC

PHONE: 5869397000 0

#### **CONTACT INFORMATION**

NAME: MARK BAILEY TITLE: NOT REPORTED

ORGANIZATION: CENTRAL TRANSPORT

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (325) 6688721 0

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN603965732 NAME: CENTRAL TRANSPORT LLC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/01/2016

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OPERATOR NUMBER: CN600539621
NAME: CROWN ENTERPRISES INC

CONTACT ADDRESS: 12225 STEPHENS RD

WARREN MI 48089

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/16/2004 CONTACT ROLE: OPRCON CONTACT NAME: TODD GOSS

CONTACT TITLE: **DIRECTOR OF CONSTRUCTION**ORGANIZATION: **CROWN ENTERPRISES INC** 

PHONE: (586) 4671706 0 FAX: (586) 4671848

EMAIL: TGOSS@CROWNENTERPRISESINC.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 301206 SIGNATURE DATE: 02/15/2018

SIGNATURE NAME & TITLE: CHRISTOPHER LEE, DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 284285
SIGNATURE DATE: 02/09/2017

SIGNATURE NAME & TITLE: CHRISTOPHER LEE, DIR OF FUEL

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 254859
SIGNATURE DATE: 06/19/2015

SIGNATURE NAME & TITLE: CRAIG STAMPER, PROJ MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 233451
SIGNATURE DATE: 02/01/2014

SIGNATURE NAME & TITLE: CRAIG STAMPER, PROJECT MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50593
SIGNATURE DATE: 12/27/2012

SIGNATURE NAME & TITLE: CRAIG STAMPER, PROJ MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50592
SIGNATURE DATE: 03/13/2012

SIGNATURE NAME & TITLE: CRAIG STAMPER, PROJECT MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50591
SIGNATURE DATE: 02/24/2011

SIGNATURE NAME & TITLE: CRAIG STAMPER, PROJ MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50590
SIGNATURE DATE: 02/23/2011

SIGNATURE NAME & TITLE: CRAIG STAMPER, PROJ MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50589
SIGNATURE DATE: 02/24/2009

SIGNATURE NAME & TITLE: RACHEL LANG, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50588
SIGNATURE DATE: 05/07/2008

SIGNATURE NAME & TITLE: JUDE M BERES, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50587
SIGNATURE DATE: 03/13/2007

SIGNATURE NAME & TITLE: JOHN DICKERSON, DIR OF FACILITIES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50586
SIGNATURE DATE: 12/15/2005

SIGNATURE NAME & TITLE: RICHARD A DOMENICK, DIR OF MAINT & CONST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50585
SIGNATURE DATE: 03/09/2005

SIGNATURE NAME & TITLE: RICHARD A DOMENICK, DIRECTOR OF MAINT

FILING STATUS: RENEWAL

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50584
SIGNATURE DATE: 07/16/2004

SIGNATURE NAME & TITLE: RICHARD A DOMANICK, DIR OF MAINT CONST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50583
SIGNATURE DATE: 02/11/2002

SIGNATURE NAME & TITLE: ROUSHDI GUIRGUIS, DIR CORP REAL ESTATE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50582
SIGNATURE DATE: 10/23/2000

SIGNATURE NAME & TITLE: ROUSHADI GUIRGUIS, DIR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 01/01/1978

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 50078

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE



Order# 121435 Job# 277689 104 of 1203

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1978

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 50078

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 



Order# 121435 Job# 277689 105 of 1203

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 10/28/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 50077

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 10/26/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 50077

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 10/26/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

Order# 121435 Job# 277689 107 of 1203

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 50076

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/11/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL



Order# 121435 Job# 277689 108 of 1203

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 50075

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

# Voluntary Cleanup Program Sites (VCP)

**MAP ID# 7** 

Distance from Property: 0.025 mi. (132 ft.) WNW

Elevation: 594 ft.

**SITE INFORMATION** 

**APPLICANT INFORMATION** 

ID#: 0369

ORGANIZATION: MERCHANTS FAST MOTOR LINES, INC.

NAME: MERCHANTS TRANSPORTATION - FT WORTH

RON, BREDEMEYER, VICE PRESIDENT

**TERMINAL** 

P.O. BOX 591

ADDRESS: 4601 CAREY STREET

**ABILENE, TX, 79604** 

ACRES: 30

PHONE: 915-677-1881

FACILITY TYPE: FREIGHT TERMINAL

FAX: 915-675-4701

APPLICATION DATE: 10/8/1996

DATE OF AGREEMENT: 10/8/1996

CERTIFICATE OF COMPLETION DATE: 12/10/1996

TYPE OF CERTIFICATE ISSUED: FINAL

**FORT WORTH TX** 

TYPE LEAD: OWNER PHASE: COMPLETED

ORGANIZATION: ENPROTEC, INC.

MEDIA AFFECTED: SOILS

EARNEST, REYNOLDS, P.E., VICE PRESID

**CONSULTANT/ATTORNEY INFORMATION** 

TNRCC SOLID WASTE REGISTRATION #: NOT REPORTED

17 WINDMILL CIRCLE

REMEDY: EXCAVATION/REMOVAL TO OFF-SITE LANDFILL

**ABILENE, TX, 79606** PHONE: 915-698-5560

FAX: 915-695-3299

INSTITUTIONAL CONTROL: NOT REPORTED LPST #: 108691

EPA CERCLIS #: 0013649 EPA RCRIS #: NOT REPORTED

CONTAMINANT/S: TPH

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 8** 

Distance from Property: 0.026 mi. (137 ft.) W

Elevation: 594 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 82516 EPA ID: NOT REPORTED NAME: POWER LINE INC

TNRCC ID #: 98498 ADDRESS: 4616 FAIRLANE AVE

NAME: POWER LINE FORT WORTH, TX 76119

ADDRESS: 5344 E LOOP 820 S PHONE: NOT REPORTED

FORT WORTH, TX 76119

CONTACT: MARION JETT PHONE: 817-5350284

BUSINESS DESCRIPTION: MANUFACTURE ALTERNATORS.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/16/2004

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 92059

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: SPENT SOLVENT PARTS CLEANING 1993.

**Back to Report Summary** 

### Closed & Abandoned Landfill Inventory (CALF)

**MAP ID# 9** 

Distance from Property: 0.028 mi. (148 ft.) SSE

Elevation: 656 ft.

**SITE INFORMATION** 

SITE NUMBER: 1272

SITE NAME: SUBLETT/287 LAND

LOCATION:

NWY 287 & SUBLETT RD COUNTY: TARRANT

COMMENTS:

REPORTED IN 09/01/92 LIST OF RESOLUTION TRUST CORPORATION SITES IN TEXAS; RESPONSIBLE ENTITY LISTED BY RTC IS SUNBELT FEDERAL SAVINGS; RTC REOMS PROPERTY NO.791589692; RTC LISTED ENVIRONMENTAL HAZARDS: HISTORIC DISPOSAL/CONTAMINATION;

INSPECTION:

???

OWNER NAME: RESOLUTION TRUST CORP

DATE OPEN: 0

DATE CLOSE: 0

SIZE (ACRES): 0.00

SIZE (CUBIC YARDS): 0.00

PARTIES: ARLINGTON

LANDFILL CONTENTS

HOUSEHOLD: NR CONSTRUCTION DEMOLITION: NR

INDUSTRIAL: NR TIRES: NR

AGRICULTURE: NR

OTHER: NR

LEGAL: NR

UNAUTHORIZED: NR HAZARD UNLIKELY: NR HAZARD PROBABLY: NR HAZARD CERTAINLY: NR DEPTH CD: NR MINIMUM THICKNESS: NR

MAXIMUM DEPTH: 0.00 USE: UK

OTHER DESCRIPTION: NOT REPORTED

REVIEWER: NOT REPORTED

**Back to Report Summary** 

# Municipal Solid Waste Landfill Sites (MSWLF)

**MAP ID# 10** 

Distance from Property: 0.032 mi. (169 ft.) SSW

Elevation: 606 ft.

#### **FACILITY INFORMATION**

PERMIT#: 120136

NAME: CITY OF FORT WORTH MLK DROP OFF STATION

ADDRESS: 5150 MARTIN LUTHER KING FWY

FORT WORTH, TX 76119-4161

COUNTY: TARRANT FACILITY DETAILS

FACILITY TYPE #: MISCELLANEOUS SOLID WASTE PROCESSING FACILITY

PHYSICAL FACILITY STATUS: ACTIVE
LEGAL STATUS: ACKNOWLEDGED
REFERENCE NUMBER(RN): RN109229526
REGION: REGION 04 - DFW METROPLEX

**Back to Report Summary** 

**MAP ID# 11** 

Distance from Property: 0.038 mi. (201 ft.) E

Elevation: 592 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 102027

LPST ID: 102027

FACILITY ID: 0029998

NAME: CLAPP BUDDY INC

ADDRESS: 5301 LASTER

FT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 102027

NAME: CLAPP BUDDY INC

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 5 - MINOR SOIL CONTAMINATION - DOES NOT REQUIRE A RAP CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 3/30/92

REPORTED DATE: 12/4/1991 ENTERED DATE: 3/30/1992

PRP INFORMATION

NAME: MEADOWBROOK NATIONAL BANK
ADDRESS: ADDRESS NOT REPORTED
FORT WORTH TX 76112

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/09/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/30/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 114 of 1203

UST COMPARTMENT ID: 144205

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/09/1986

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/30/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 144204

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

Order# 121435 Job# 277689 115 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/09/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/30/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 144203

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY



Order# 121435 Job# 277689 116 of 1203

**Back to Report Summary** 

**CONTACT INFORMATION** 

PHONE: (817) 5721678 0

ORGANIZATION: BUDDY CLAPP FACILITY

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: T SMITH

TITLE: MGR

**MAP ID# 11** 

Distance from Property: 0.038 mi. (201 ft.) E

Elevation: 592 ft.

**FACILITY INFORMATION** 

NAME: BUDDY CLAPP FACILITY

ADDRESS: 5301 LASTER

\_\_\_\_\_\_

FT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

ID#: 29998

TYPE: UNKNOWN
BEGIN DATE: 10/31/1986
STATUS: INACTIVE
EXEMPT STATUS: NO

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS:  $oldsymbol{0}$  NUMBER OF ACTIVE ABOVEGROUND TANKS:  $oldsymbol{0}$ 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/09/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/08/1986

SIGNATURE NAME & TITLE: **G CLAPP**, **PRESIDENT** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600936512
NAME: BANK OF NORTH TEXAS

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 10/31/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/09/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 118 of 1203

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/30/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 144205

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/09/1986

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/30/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 119 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 144204

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/09/1986

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/30/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 144203

TANK ID: 3

Order# 121435 Job# 277689 120 of 1203

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

NAME: BARBARA BEARDEN

ORGANIZATION: ARTHUR HAGAR CORP

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TITLE: NOT REPORTED

PHONE: (817) 2843332 0

**MAP ID# 12** 

Distance from Property: 0.038 mi. (201 ft.) S

Elevation: 631 ft.

**FACILITY INFORMATION** 

ID#: **1275** 

NAME: ARTHUR HAGAR

ADDRESS: 5020 SE LOOP 820

FORT WORTH, TX 76140

COUNTY: TARRANT

REGION: 4

TYPE: UNKNOWN
BEGIN DATE: 06/03/1986
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/13/1986

SIGNATURE NAME & TITLE: C TANGNEY, VP ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600828081

NAME: ARTHUR HAGAR CORPORATION

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 06/03/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 122 of 1203

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/04/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 4535

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 123 of 1203

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 13** 

Distance from Property: 0.04 mi. (211 ft.) N

Elevation: 639 ft.

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 75575 EPA ID: TXD987995057 NAME: MOTIVA ENTERPRISES LLC

TNRCC ID #: 29922 ADDRESS: NOT REPORTED

NAME: STAR ENTERPRISES

ADDRESS: 4901 E CALIFORNIA PKWY PHONE: NOT REPORTED

**FOREST HILL, TX 76119** 

CONTACT: DAVID GUMBLEY

PHONE: **214-6500200** 

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/22/2007

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: **58100** 

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 124 of 1203

**MAP ID# 13** 

Distance from Property: 0.04 mi. (211 ft.) N

Elevation: 639 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 115946

LPST ID: 115946

FACILITY ID: 0013507 NAME: FORMER TEXACO

ADDRESS: 4901 E CALIFORNIA PKWY

**FOREST HILL, TX** 

#### **LEAKING TANK DETAILS**

LPST ID: 115946

NAME: FORMER TEXACO

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 3.5 - A DESIGNATED MAJOR OR MINOR AQUIFER IS IMPACTED CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 4/20/04

REPORTED DATE: 10/30/2003 ENTERED DATE: 4/20/2004

PRP INFORMATION

NAME: MOTIVA ENTERPRISES LLC
ADDRESS: ADDRESS NOT REPORTED

IRVING TX 75063

CONTACT: NOT REPORTED

PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/29/2003

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 125 of 1203

UST COMPARTMENT ID: 117934

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/29/2003

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 117936

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 126 of 1203

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/29/2003

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 117935

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES



Order# 121435 Job# 277689 127 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/29/2003

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 117937

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 13** 

Distance from Property: 0.04 mi. (211 ft.) N

Elevation: 639 ft.

**FACILITY INFORMATION** 

ID#: 13507 NAME: TEXACO

ADDRESS: 4901 E CALIFORNIA PKWY

FOREST HILL, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 08/07/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/07/1986

SIGNATURE NAME & TITLE: **F H VAN DYKE, DIV. MGR.** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600124051

NAME: MOTIVA ENTERPRISES LLC

CONTACT ADDRESS: 510 PETROLEUM

**SAN ANTONIO TX 78218** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/20/1999
CONTACT ROLE: OWNCON
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED

ORGANIZATION: MOTIVA ENTERPRISES LLC

PHONE: (210) 2240361 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN600124051
NAME: MOTIVA ENTERPRISES LLC
CONTACT ADDRESS: PO BOX 2099

**HOUSTON TX 77252** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/20/1999 CONTACT ROLE: OPRCON

CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: SCOTT HAGGERTON
TITLE: NOT REPORTED
ORGANIZATION: TEXACO

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 9948009 0

ORGANIZATION: MOTIVA ENTERPRISES LLC

PHONE: (713) 2410236 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 125778 SIGNATURE DATE: 03/04/2003

SIGNATURE NAME & TITLE: SCOTT HAGGERTON, HSE COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125777
SIGNATURE DATE: 03/18/2002

SIGNATURE NAME & TITLE: RIRENEAU, SH & E COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125776
SIGNATURE DATE: 11/27/2000

SIGNATURE NAME & TITLE: RIRENEAU, SH & E COMP COOR

FILING STATUS: **INITIAL** REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 13514

APPLICATION RECEIVED DATE: 10/24/2003

SCHEDULE CONSTRUCTION DATE: 10/29/2003

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

#### **NOT REPORTED**

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/29/2003

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 117934

TANK ID: 1



Order# 121435 Job# 277689 130 of 1203

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/29/2003

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 117936

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 131 of 1203

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/29/2003** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 117935

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:



Order# 121435 Job# 277689 132 of 1203

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/29/2003

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 117937

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH), ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 133 of 1203

**Back to Report Summary** 

**MAP ID# 13** 

Distance from Property: 0.038 mi. (201 ft.) N

Elevation: 639 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD987995057 OWNER TYPE: OTHER

NAME: STAR ENTERPRISES LLC OWNER NAME: STAR ENTERPRISE

ADDRESS: 4901 E CALIFORNIA PKWY OPERATOR TYPE: OTHER

FOREST HILL, TX 76119 OPERATOR NAME: STAR ENTERPRISE

CONTACT NAME: DAVID GUMBLEY

CONTACT ADDRESS: 4901 E CALIFORNIA PKWY

**FOREST HILL TX 76119** 

CONTACT PHONE: 214-650-0200

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 03/22/2007

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

DAVID GUMBLEY ENVIRONMENTAL M 03/22/2007 SONDRA BIENVENU RDC SUPERVISOR 06/03/2002

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 04/12/2007

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: **NO**UNIVERSAL WASTE DESTINATION FACILITY: **NO** 

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS - NO ENFORCEMENTS REPORTED -**

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D018 BENZENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 135 of 1203

CORRECTIVE ACTION EVENT
NO CORRECTIVE ACTION EVENT(S) REPORTED

Back to Report Summary

# Industrial and Hazardous Waste Sites (IHW)

OWNER INFORMATION

**MAP ID# 14** 

Distance from Property: 0.039 mi. (206 ft.) WNW

Elevation: 579 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 77555 EPA ID: TXD988029310 NAME: EXXON MOBIL CORPORATION

TNRCC ID #: 31781 ADDRESS: **PO BOX 4415** 

NAME: **EXXON MOBIL NO 63766**ADDRESS: **5728 E BERRY ST**PHONE: **1-713-6567709** 

FORT WORTH, TX 76119

CONTACT: ALDA S POOL PHONE: 713-6567709

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 12/01/2005

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 147792

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 14** 

Distance from Property: 0.039 mi. (206 ft.) WNW

Elevation: 579 ft.

## **FACILITY INFORMATION**

GEOSEARCH ID: 095032

LPST ID: 095032

FACILITY ID: 0026291

NAME: **EXXON** 63766

ADDRESS: 5728 E BERRY ST

FORT WORTH, TX

## **LEAKING TANK DETAILS**

LPST ID: 095032 NAME: EXXON 63766

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 2.6 - IMPACTED GW DISCHARGE TO SW USED BY HUMANENDGR SPEC LT 500F

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 3/27/90

REPORTED DATE: 2/3/1990 ENTERED DATE: 3/27/1990

#### PRP INFORMATION

NAME: EXXON COMPANY USA

ADDRESS: ADDRESS NOT REPORTED

**HOUSTON TX 77252** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 14** 

Distance from Property: 0.039 mi. (206 ft.) WNW

Elevation: 579 ft.

**FACILITY INFORMATION** 

ID#: 26291

NAME: EXXON RS 63766 ADDRESS: 5728 E BERRY ST

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 10/10/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/01/1986

SIGNATURE NAME & TITLE: R ATHERTON, SUPERVISOR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600123939 NAME: EXXON MOBIL CORPORATION

CONTACT ADDRESS: 601 JEFFERSON ST STE 1600

**HOUSTON TX 77002** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/10/1986 CONTACT ROLE: OWNCON CONTACT NAME: NOT REPORTED

CONTACT TITLE: NOT REPORTED

ORGANIZATION: EXXON MOBIL CORPORATION

PHONE: (713) 6569075 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600123939 NAME: EXXON MOBIL CORPORATION CONTACT ADDRESS: 5011 W BAKER RD

**BAYTOWN TX 77520** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/10/1986 CONTACT ROLE: OPRCON

CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED **CONTACT INFORMATION** 

NAME: NOT REPORTED TITLE: NOT REPORTED

ORGANIZATION: EXXON RS 63766

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4464127 0

GeoSearch www.geo-search.com 888-396-0042

139 of 1203 

ORGANIZATION: EXXON MOBIL CORPORATION

PHONE: (713) 4243521 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 34037 SIGNATURE DATE: 03/15/2005

SIGNATURE NAME & TITLE: ERIC M MCPHEE, PERMITTING MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 34036
SIGNATURE DATE: 03/12/2004

SIGNATURE NAME & TITLE: ERIC M. MCPHEE, CMS PERMITTING MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 34035
SIGNATURE DATE: 03/05/2003

SIGNATURE NAME & TITLE: ERIC M. MCPHEE, PERMIT TEAM LEAD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 34034
SIGNATURE DATE: 03/12/2002

SIGNATURE NAME & TITLE: WENDY SALAS, PERMIT TEAM LEAD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 34033
SIGNATURE DATE: 01/20/2001

SIGNATURE NAME & TITLE: DAPHYNE JENKINS, PROG MGR

FILING STATUS: **INITIAL** REGISTRATION FLAG: **YES** 

## **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 3270
APPLICATION RECEIVED DATE: 05/02/2005
SCHEDULE CONSTRUCTION DATE: 06/02/2005

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

NOT REPORTED

## **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/02/2005** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:
FRP

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 140 of 1203

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 26268

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

**CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

GROUNDWATER MONITORING, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO.

LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/02/2005** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES

Order# 121435 Job# 277689 141 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 26265

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

 ${\tt GROUNDWATER\ MONITORING, ANNUAL\ PIPING\ TIGHTNESS\ TEST\ /\ ANNUAL\ ELECTRONIC\ MONITORING\ (@\ 0.1\ GPH), AUTO.}$ 

LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/02/2005

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 26267

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL



Order# 121435 Job# 277689 142 of 1203

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

 $\textbf{GROUNDWATER MONITORING,} \textbf{ANNUAL PIPING TIGHTNESS TEST} \ / \ \textbf{ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),} \textbf{AUTO}.$ 

LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/02/2005** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 26266

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

Order# 121435 Job# 277689 143 of 1203

### **PIPING SYSTEMS**

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

GROUNDWATER MONITORING, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO.

LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

## **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

Order# 121435 Job# 277689 144 of 1203

**MAP ID# 14** 

Distance from Property: 0.039 mi. (206 ft.) WNW

Elevation: 579 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD988029310 OWNER TYPE: PRIVATE

NAME: EXXON MOBIL CORPORATION OWNER NAME: EXXON MOBIL CORPORATION

ADDRESS: 5728 E BERRY OPERATOR TYPE: PRIVATE

FORT WORTH, TX 76115 OPERATOR NAME: EXXON MOBIL CORPORATION

CONTACT NAME: ALDA S POOL
CONTACT ADDRESS: PO BOX 4415

**HOUSTON TX 77210** 

CONTACT PHONE: 713-656-7709

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 11/29/2005

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

ALDA S POOL UNKNOWN 11/29/2005

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 12/06/2005

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D000

D001 IGNITABLE WASTE

D018 BENZENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 145 of 1203

CORRECTIVE ACTION EVENT
NO CORRECTIVE ACTION EVENT(S) REPORTED

Back to Report Summary

# Industrial and Hazardous Waste Sites (IHW)

OWNER INFORMATION

PHONE: 1-817-4574670

ADDRESS: 1039 E LOOP 820 S

NAME: TRIANGLE HOME PRODUCTS INC

FORT WORTH, TX 76112

**MAP ID# 15** 

Distance from Property: 0.039 mi. (206 ft.) E

Elevation: 596 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 33966 EPA ID: TXD068381151

TNRCC ID #: 11433

NAME: TRIANGLE HOME PRODUCTS

ADDRESS: 1039 E LOOP 820 S

FORT WORTH, TX 76112

CONTACT: ALAN KENNEDY

PHONE: 817-4574670

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: LARGE QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/22/2003

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 30186

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 30187

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 147 of 1203

MAP ID# 15

Distance from Property: 0.039 mi. (206 ft.) E

Elevation: 596 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD068381151 OWNER TYPE: PRIVATE

NAME: TRIANGLE HOME PRODUCTS INC OWNER NAME: TRIANGLE HOME PRODUCTS INC

ADDRESS: 1039 E LOOP 820 S OPERATOR TYPE: PRIVATE

FORT WORTH, TX 76112 OPERATOR NAME: TRIANGLE HOME PRODUCTS INC

CONTACT NAME: ALAN KENNEDY
CONTACT ADDRESS: 1039 E LOOP 820 S

FORT WORTH TX 76112

CONTACT PHONE: 817-457-4670

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/28/2002

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

335121 - RESIDENTIAL ELECTRIC LIGHTING FIXTURE MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** 

07/03/1986 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE

**VIOLATIONS** - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D000

D001 IGNITABLE WASTE

Order# 121435 Job# 277689 148 of 1203

F002 THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE

 $\textbf{CHLORIDE,TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE,CHLOROBENZENE, 1,1,2-TRICHLORO-1,2-TRICHLORO-1,2-TRICHLO$ 

TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2,

TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT

SOLVENTS AND SPENT SOLVENT MIXTURES.

F003 THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL

BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL;

ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT

NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS

FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

CORRECTIVE ACTION EVENT

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 16** 

Distance from Property: 0.04 mi. (211 ft.) WSW

Elevation: 593 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 81880 EPA ID: TXD988087508 NAME: RSC EQUIPMENT RENTAL INC

TNRCC ID #: 36966 ADDRESS: 6929 E GREENWAY PKWY STE 200

NAME: RENTAL SERVICE 755 SCOTTSDALE, AZ 85254

ADDRESS: 4900 E LOOP 820 S PHONE: 1-863-6072892

FORT WORTH, TX 76119

CONTACT: ROBERT E WHITACRE

PHONE: **863-6072892** 

BUSINESS DESCRIPTION: RENTAL, SALES & SERVICE OF VARIOUS TYPES OF CONSTRUCTION RELATED EQUIPMENT AND

MATERIAL.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 11/07/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 78572

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: SPENT SOLVENT FROM DEGREASING OF AUTOMOTIVE PARTS.

WASTE ID: 78573

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: WASTE CLEANING LIQUID COMPOUNDS.

**Back to Report Summary** 

Order# 121435 Job# 277689 150 of 1203

**MAP ID# 16** 

Distance from Property: 0.04 mi. (211 ft.) WSW

Elevation: 593 ft.

## **FACILITY INFORMATION**

GEOSEARCH ID: 111459

LPST ID: 111459

FACILITY ID: 0024598

NAME: PRIME EQUIPMENT 115
ADDRESS: 4900 E LOOP 820 S
FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 111459

NAME: PRIME EQUIPMENT 115
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 8/21/96

REPORTED DATE: 12/31/3000 ENTERED DATE: 8/21/1996

PRP INFORMATION
NAME: PRIMECO INC

ADDRESS: ADDRESS NOT REPORTED

**HOUSTON TX 77084** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/24/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 151 of 1203

UST COMPARTMENT ID: 131111

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/24/1996** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 131110

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

Order# 121435 Job# 277689 152 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

## ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: PRIME EQUIPMENT 115

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: KEN MASSA

TITLE: NOT REPORTED

PHONE: (817) 4784201 0

**MAP ID# 16** 

Distance from Property: 0.04 mi. (211 ft.) WSW

Elevation: 593 ft.

**FACILITY INFORMATION** 

ID#: 24598

NAME: **PRIME EQUIPMENT 115**ADDRESS: **4900 E LOOP 820 S** 

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: UNKNOWN
BEGIN DATE: 09/01/1988
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/02/1986

SIGNATURE NAME & TITLE: DAVID MANTEY, FINAN ANAL

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601275183
NAME: PRIME SERVICE INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: **ORGANIZATION**BEGIN DATE: **12/10/1997** 

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/24/1996** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 131111

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/24/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 155 of 1203

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

## **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

## COMPARTMENT DETAILS

UST COMPARTMENT ID: 131110

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

## **PIPING SYSTEMS**

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

## **NOT REPORTED**

PIPING RELEASE DETECTION:

#### **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

## **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 16** 

Distance from Property: 0.04 mi. (211 ft.) WSW

Elevation: 593 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD988087508 OWNER TYPE: PRIVATE

NAME: RENTAL SERVICE CORPORATION NO 755 OWNER NAME: RENTAL SERVICE CORPORATION

ADDRESS: 4900 E LOOP 820 S OPERATOR TYPE: NOT REPORTED

FORT WORTH, TX 76119 OPERATOR NAME: NOT REPORTED

CONTACT NAME: ROBERT E WHITACRE

CONTACT ADDRESS: 6929 E GREENWAY PARKWAY STE 200

**SCOTTSDALE AZ 85254** 

CONTACT PHONE: 480-905-3342

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 08/19/2002

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

532412 - CONSTRUCTION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 04/14/2015

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: YES
USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - **NO EVALUATIONS REPORTED** - <u>VIOLATIONS</u> - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D006 CADMIUM
D007 CHROMIUM
D018 BENZENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 157 of 1203

NO CORRECTIVE ACTION EVENT(S) REPORTED

Back to Report Summary

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 17** 

Distance from Property: 0.04 mi. (211 ft.) E

Elevation: 573 ft.

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 34366 EPA ID: TXD981511652 NAME: FORT WORTH TOWER INC

TNRCC ID #: 11810 ADDRESS: NOT REPORTED

NAME: FORT WORTH TOWER

ADDRESS: 1901 E LOOP 820 S PHONE: NOT REPORTED

FORT WORTH, TX 76112

CONTACT: FRED MOORE PHONE: 817-4573060

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/23/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 32539

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

Back to Report Summary

Order# 121435 Job# 277689 159 of 1203

# Innocent Owner / Operator Database (IOP)

**MAP ID# 17** 

Distance from Property: 0.04 mi. (211 ft.) E

Elevation: 573 ft.

**FACILITY INFORMATION** 

ID#: 0217

DATE IOP RECIEVED: 1/25/2001 CERTIFICATE ISSUED: 7/5/2001

NAME: FWTC UNDEVELOPED PROPERTY ADDRESS: 1901 EAST LOOP 820 SOUTH FORT WORTH, TX 76112

CONTAMINANTS: VOCS, TPH

MEDIA AFFECTED: SOILS/GROUNDWATER

PHASE: COMPLETED

PROPERTY USE: UNDEVELOPED PROPERTY

ACRES: 4.4

**OTHER CONTACTS (CONSULTANT/ATTORNEY)** 

ORGANIZATION: HAYNES & BOONE, LLP

**ELIZABETH J. KOHN ATTORNEY** 201 MAIN STREET, SUITE 2200 **FORT WORTH TX 76102** 

PHONE: **817-347-6645** FAX: 817-348-2354

## **APPLICANT INFORMATION**

ORGANIZATION: FWT, INC.

INTEREST IN SITE: OWNER

**ELIZABETH J. KOHN, ATTORNEY** 

ADDRESS: 201 MAIN STREET, SUITE 2200

FORT WORTH, TX, 76102-3126

PHONE: **817-347-6645** FAX: 817-348-2354

**Back to Report Summary** 

160 of 1203

**MAP ID# 17** 

Distance from Property: 0.04 mi. (211 ft.) E

Elevation: 573 ft.

**FACILITY INFORMATION** 

ID#: 41539

NAME: FORT WORTH TOWER

ADDRESS: 1901 E LOOP 820 S

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING
BEGIN DATE: 01/23/1987
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/30/1986

SIGNATURE NAME & TITLE: **T F MOORE, VP**ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600242176
NAME: TOWER 50 FAMILY INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/23/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

CONTACT INFORMATION

NAME: DON JOHNSON
TITLE: NOT REPORTED

ORGANIZATION: FORT WORTH TOWER

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 3073769 0

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/30/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 88761

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **11/30/1998**INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED** 

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 162 of 1203

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

## **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 88760

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

# PIPING SYSTEMS MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

## **NOT REPORTED**

PIPING RELEASE DETECTION:

#### **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

## **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 17** 

Distance from Property: 0.04 mi. (211 ft.) E

Elevation: 573 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD981511652 OWNER TYPE: PRIVATE

NAME: FORT WORTH TOWER INC OWNER NAME: FORT WORTH TOWER INC

ADDRESS: 1901 E LOOP 820 S OPERATOR TYPE: PRIVATE

FORT WORTH, TX 76112 OPERATOR NAME: FORT WORTH TOWER INC

CONTACT NAME: FRED MOORE
CONTACT ADDRESS: PO BOX 8597

**FORT WORTH TX 76124** 

CONTACT PHONE: 817-457-3060

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/04/2002

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - **NO EVALUATIONS REPORTED** - <u>VIOLATIONS</u> - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

UNIVERSAL WASTE - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 164 of 1203

# Industrial and Hazardous Waste Sites (IHW)

OWNER INFORMATION

PHONE: 1-817-4515228

NAME: CLIFTON METAL PRODUCTS INC

FORT WORTH, TX 76112

ADDRESS: 2001 E LOOP 820 S STE A

**MAP ID# 18** 

Distance from Property: 0.04 mi. (211 ft.) E

Elevation: 582 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 32812 EPA ID: TXD046934436

TNRCC ID #: **10343** 

NAME: CLIFTON METAL PRODUCTS
ADDRESS: 2001 E LOOP 820 S STE A

FORT WORTH, TX 76112

CONTACT: H J CLIFTON PHONE: 817-4515228

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/23/2003

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 150030

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: SPENT SOLVENT

WASTE ID: 150031

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: PAINT WASTE

WASTE ID: 262469

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 165 of 1203

# Industrial and Hazardous Waste Sites (IHW)

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 261564

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 261974

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 26902

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 26903

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 18** 

Distance from Property: 0.04 mi. (211 ft.) E

Elevation: 582 ft.

**FACILITY INFORMATION** 

**OWNER INFORMATION** 

REGISTRATION#: 79021 EPA ID: TXD988070835 NAME: ARMADILLO TRANSMISSION SERVICE

TNRCC ID #: 32575 ADDRESS: PO BOX 1393

NAME: ARMADILLO TRANSMISSION SERVICE EULESS, TX 76039

ADDRESS: 2001 E LOOP 820 S PHONE: 1-817-4295253

FORT WORTH, TX 76112

CONTACT: JOHN COMEAU
PHONE: 817-4295253

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED

WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/23/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 62480

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

Back to Report Summary

Order# 121435 Job# 277689 167 of 1203

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

OWNER TYPE: PRIVATE

OPERATOR TYPE: PRIVATE

OWNER NAME: CLIFTON METAL PRODUCTS INC

OPERATOR NAME: CLIFTON METAL PRODUCTS INC

**MAP ID# 18** 

Distance from Property: 0.04 mi. (211 ft.) E

Elevation: 582 ft.

**FACILITY INFORMATION** 

EPA ID#: **TXD046934436** 

NAME: CLIFTON METAL PRODUCTS INC

ADDRESS: 2001 E LOOP 820 S STE A

FORT WORTH, TX 76112

CONTACT NAME: HJ CLIFTON SR

CONTACT ADDRESS: 2001 E LOOP 820 S STE A

**FORT WORTH TX 76112** 

CONTACT PHONE: **817-451-5228** 

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/09/1998

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

336212 - TRUCK TRAILER MANUFACTURING

336214 - TRAVEL TRAILER AND CAMPER MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** 

02/15/1993 FCI FOCUSED COMPLIANCE INSPECTION

02/15/1993 SNY SIGNIFICANT NON-COMPLIER
06/17/1993 NRR NON-FINANCIAL RECORD REVIEW
06/17/1993 SNN NOT A SIGNIFICANT NON-COMPLIER

09/09/1986 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE

**VIOLATIONS** 

02/15/1993 262.A GENERATORS - GENERAL 02/15/1993 262.B GENERATORS - MANIFEST

02/15/1993 268.A LDR - GENERAL

09/09/1986 262.A GENERATORS - GENERAL

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 168 of 1203

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

#### **ENFORCEMENTS**

04/29/1993 141 NOT REPORTED 05/12/1993 120 WRITTEN INFORMAL 06/24/1993 141 NOT REPORTED 09/22/1986 120 WRITTEN INFORMAL

#### HAZARDOUS WASTE

D001 IGNITABLE WASTE

 D006
 CADMIUM

 D007
 CHROMIUM

 D008
 LEAD

 D018
 BENZENE

D039 TETRACHLOROETHYLENE

F003 THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL

BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL;

ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT

NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS

FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON

DISULFIDE, ISOBUTANOL, PYRIDINE,BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

#### UNKN

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 18** 

Distance from Property: 0.04 mi. (211 ft.) E

Elevation: 582 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD988070835 OWNER TYPE: NOT REPORTED

NAME: ARMADILLO TRANSMISSION SERVICE OWNER NAME: ARMADILLO TRANSMISSION SERVICE

ADDRESS: 2001 E LOOP 820 OPERATOR TYPE: NOT REPORTED

FORT WORTH, TX 76112 OPERATOR NAME: ARMADILLO TRANSMISSION

**SERVICE** 

CONTACT NAME: **JOHN COMEAU**CONTACT ADDRESS: **PO BOX 1393** 

**EULESS TX 76039** 

CONTACT PHONE: 817-429-5253

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 08/23/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - **NO EVALUATIONS REPORTED** - <u>VIOLATIONS</u> - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

Back to Report Summary

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 170 of 1203

**MAP ID# 19** 

Distance from Property: 0.041 mi. (216 ft.) NE

Elevation: 643 ft.

**FACILITY INFORMATION** 

ID#: 44785

NAME: 7-ELEVEN 27367 ADDRESS: 4901 LITTLE RD

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 09/01/1987

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 04/13/1987 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/10/1987 SIGNATURE NAME & TITLE: STEVE WHITNEY, GAS MKT MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: 1500 CORSICANA HWY HILLSBORO TX 76645

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1987

CONTACT ROLE: OWNOPRCON CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: 7-ELEVEN INC PHONE: NOT REPORTED FAX: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN600240329

NAME: 7-ELEVEN INC

**EMAIL: NOT REPORTED** 

CONTACT ADDRESS: 1202 RICHARDSON DR

**RICHARDSON TX 75080** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1987 CONTACT ROLE: OPRCON

CONTACT NAME: CRAIG ZIMMER CONTACT TITLE: NOT REPORTED **CONTACT INFORMATION** 

NAME: SHANE PARTRIDGE TITLE: NOT REPORTED

ORGANIZATION: 7-ELEVEN 27367

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (214) 8611277 0

GeoSearch www.geo-search.com 888-396-0042

171 of 1203

ORGANIZATION: 7-ELEVEN INC PHONE: (214) 8611274 0

FAX: (214) 8611270
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 296327 SIGNATURE DATE: 12/24/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENV. MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 280760
SIGNATURE DATE: 01/19/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MANAGE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 263547
SIGNATURE DATE: 01/19/2016

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 247079
SIGNATURE DATE: 01/16/2015

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 229644
SIGNATURE DATE: 01/06/2014

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27981
SIGNATURE DATE: 12/19/2012

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27980
SIGNATURE DATE: 12/16/2011

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27979
SIGNATURE DATE: 01/05/2011

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27978
SIGNATURE DATE: 01/07/2010

Order# 121435 Job# 277689 172 of 1203

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27977
SIGNATURE DATE: 01/05/2009

SIGNATURE NAME & TITLE: SHANE PARTRIDGE, GAS COMPLIANCE MGR.

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27976
SIGNATURE DATE: 12/18/2007

SIGNATURE NAME & TITLE: SHANE PARTRIDGE, GAS COMPLIANCE MGR.

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27975
SIGNATURE DATE: 11/21/2006

SIGNATURE NAME & TITLE: SHANE PARTRIDGE, GAS & ENV COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27974
SIGNATURE DATE: 12/12/2005

SIGNATURE NAME & TITLE: RON FULENCHEK, GAS & ENV COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27973
SIGNATURE DATE: 12/10/2004

SIGNATURE NAME & TITLE: RON FULENCHEK, ENV COMP MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27972
SIGNATURE DATE: 11/03/2003

SIGNATURE NAME & TITLE: WILLO A SMITH, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27971
SIGNATURE DATE: 11/14/2002

SIGNATURE NAME & TITLE: WILLO A SMITH, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27970
SIGNATURE DATE: 11/28/2001

SIGNATURE NAME & TITLE: WILLO A SMITH, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 27969
SIGNATURE DATE: 01/10/2001

SIGNATURE NAME & TITLE: WILLOW A SMITH, ENVIR MGR

FILING STATUS: INITIAL

Order# 121435 Job# 277689 173 of 1203

REGISTRATION FLAG: YES

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 2942

APPLICATION RECEIVED DATE: 03/20/2006

SCHEDULE CONSTRUCTION DATE: 04/10/2006

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1986 REGISTRATION DATE: 04/13/1987

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 04/01/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 34619

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH  $^{\circ}$ 

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1986 REGISTRATION DATE: 04/13/1987

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 04/01/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 34620

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1986 REGISTRATION DATE: 04/13/1987

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 04/01/

STATUS: IN USE STATUS BEGIN DATE: 04/01/1986
INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 175 of 1203

PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 34621

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 176 of 1203

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 20** 

Distance from Property: 0.041 mi. (216 ft.) SSW

Elevation: 613 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 65029 EPA ID: NOT REPORTED

TNRCC ID #: 20543

NAME: WASTE MANAGEMENT FORT WORTH HAULING

ADDRESS: 5012 MARTIN LUTHER KING FWY

FORT WORTH, TX 76119

CONTACT: HOUSTON CHAMPBLISS

PHONE: 817-3482670

BUSINESS DESCRIPTION: NOT REPORTED INDUSTRIAL WASTE PERMIT #: NOT REPORTED MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: NO WASTE RECEIVER: NO WASTE TRANSPORTER: YES TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 01/22/2018

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE NO RECORDS** 

**Back to Report Summary** 

OWNER INFORMATION

NAME: WASTE MANAGEMENT OF TEXAS INC

ADDRESS: PO BOX 400

**FERRIS, TX 75125** 

PHONE: 1-972-8425881

177 of 1203

**MAP ID# 21** 

Distance from Property: 0.042 mi. (222 ft.) ESE

Elevation: 644 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 112860

LPST ID: 112860

FACILITY ID: 0071029

NAME: ABANDONED STATION
ADDRESS: 1717 E LOOP 820
FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 112860

NAME: ABANDONED STATION

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.0 - ASSESSMENT INCOMPLETE NO APPARENT RECEPTORS IMPACTED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 1/21/98

REPORTED DATE: 12/22/1997 ENTERED DATE: 1/21/1998

PRP INFORMATION

NAME: LADY LUCK PARTNERSHIP
ADDRESS: ADDRESS NOT REPORTED

DALLAS TX 75230

CONTACT: NOT REPORTED

PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 09/28/1998

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/16/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 178 of 1203

UST COMPARTMENT ID: 176592

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 09/28/1998

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/16/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176593

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

Order# 121435 Job# 277689 179 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 09/28/1998

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/16/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176594

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 09/28/1998

Order# 121435 Job# 277689 180 of 1203

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/16/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176595

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

NAME: DENNIS LONERGAN

PHONE: (214) 5204003 0

ORGANIZATION: ABANDONED STATION

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

TITLE: REP.

**MAP ID# 21** 

Distance from Property: 0.042 mi. (222 ft.) ESE

Elevation: 644 ft.

**FACILITY INFORMATION** 

ID#: **71029** 

NAME: ABANDONED STATION

ADDRESS: 1717 E LOOP 820

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 08/31/1987 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 09/28/1998 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 09/25/1998

SIGNATURE NAME & TITLE: **DENNIS LONERGAN, REP** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600803746
NAME: LADY LUCK ASSOCIATES

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: **ORGANIZATION**BEGIN DATE: **12/15/1993** 

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 09/28/1998
TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/16/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176592

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 09/28/1998

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/16/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 183 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176593

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 09/28/1998

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/16/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176594

TANK ID: 3

Order# 121435 Job# 277689 184 of 1203

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 09/28/1998

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/16/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 176595

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 22** 

Distance from Property: 0.042 mi. (222 ft.) ESE

Elevation: 587 ft.

**FACILITY INFORMATION** 

ID#: 20228

NAME: LEITO ENTERPRISES
ADDRESS: 4333 E LOOP 820 S

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING
BEGIN DATE: 01/01/1985
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 09/19/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 09/19/2018

SIGNATURE NAME & TITLE: JACK KOSLOW, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN602563264
NAME: LEITO ENTERPRISES LP

CONTACT ADDRESS: 4333 E LOOP 820 S

FORT WORTH TX 76119

TYPE: ORGANIZATION
BEGIN DATE: 07/01/2003
CONTACT ROLE: OWNCON
CONTACT NAME: JACK KOSLOW
CONTACT TITLE: GENERAL PARTNER
ORGANIZATION: LEITO ENTERPRISES LP

PHONE: (817) 4518032 0 FAX: NOT REPORTED EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN602563264
NAME: LEITO ENTERPRISES LP

CONTACT ADDRESS: 4333 E LOOP 820 S

FORT WORTH TX 76119

TYPE: ORGANIZATION
BEGIN DATE: 07/01/2003
CONTACT ROLE: OPRCON
CONTACT NAME: JACK KOSLOW
CONTACT TITLE: GENERAL PARTNER

CONTACT INFORMATION

NAME: JACK KOSLOW

TITLE: GENERAL PARTNER

ORGANIZATION: LEITO ENTERPRISES

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 4518032 0

ORGANIZATION: LEITO ENTERPRISES LP

PHONE: (817) 4518032 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 272794 SIGNATURE DATE: 06/02/2016

SIGNATURE NAME & TITLE: JACK KOLSON, PARTNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 255721
SIGNATURE DATE: 07/18/2015

SIGNATURE NAME & TITLE: JACK KOSLOW, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 238931
SIGNATURE DATE: 05/22/2014

SIGNATURE NAME & TITLE: JACK KOSLOW, GEN PAR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 222759
SIGNATURE DATE: 07/11/2013

SIGNATURE NAME & TITLE: JACK KOSLOW, GEN PAR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 51147
SIGNATURE DATE: 07/23/2012

SIGNATURE NAME & TITLE: JACK KOSLOW, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 51146
SIGNATURE DATE: 07/25/2011

SIGNATURE NAME & TITLE: JACK KOSLOW, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 51145
SIGNATURE DATE: 08/03/2010

SIGNATURE NAME & TITLE: JACK KOSLOW, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 51144
SIGNATURE DATE: 06/29/2009

SIGNATURE NAME & TITLE: JACK KOSLOW, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 51143
SIGNATURE DATE: 08/28/2008

SIGNATURE NAME & TITLE: JACK KOSLOW, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 51142
SIGNATURE DATE: 06/23/2007

SIGNATURE NAME & TITLE: JACK KOSLOW, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 51141
SIGNATURE DATE: 07/10/2006

SIGNATURE NAME & TITLE: JACK KOSLOW, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 51140
SIGNATURE DATE: 06/08/2005

SIGNATURE NAME & TITLE: JACK KOSLOW, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 51139
SIGNATURE DATE: 07/28/2004

SIGNATURE NAME & TITLE: JACK KOSLOW, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 51138
SIGNATURE DATE: 08/27/2003

SIGNATURE NAME & TITLE: JACK KOSLOW, PRESIDENT

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 51137
SIGNATURE DATE: 07/30/2002

SIGNATURE NAME & TITLE: JACK KOSCOCO, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 51136
SIGNATURE DATE: 01/17/2001

SIGNATURE NAME & TITLE: FRED ANDERBERG, GEN MGR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 32939

APPLICATION RECEIVED DATE: 04/30/2018

SCHEDULE CONSTRUCTION DATE: 06/01/2018

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**REMOVE USTS** 

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/01/1985 REGISTRATION DATE: 05/08/1986

Order# 121435 Job# 277689 189 of 1203

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/07/2018

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 55656

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING

(NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 11/01/2017

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO



#### **TANK DETAILS**

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 55656

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING

(NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 10/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

Order# 121435 Job# 277689 191 of 1203

#### **NOT REPORTED**

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 55656

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING

(NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/07/2018** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 55657

Order# 121435 Job# 277689 192 of 1203

TANK ID: 2

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING

(NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

CONNECTORS & VALVES:

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 11/01/2017

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 55657

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

Order# 121435 Job# 277689 193 of 1203

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING

(NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 10/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 55657

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING

(NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

Order# 121435 Job# 277689 194 of 1203

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: LARRY RIGGAN

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: LARRY RIGGAN

TITLE: NOT REPORTED

PHONE: (817) 6751672 0

**MAP ID# 23** 

Distance from Property: 0.056 mi. (296 ft.) ESE

Elevation: 587 ft.

**FACILITY INFORMATION** 

ID#: **53700** 

NAME: LARRY RIGGAN

ADDRESS: 4301 E LOOP 820 S

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: WHOLESALE
BEGIN DATE: 02/01/1990
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS:  $oldsymbol{0}$  NUMBER OF ACTIVE ABOVEGROUND TANKS:  $oldsymbol{0}$ 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/11/1990 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/16/1990

SIGNATURE NAME & TITLE: **JAMES D WRIGHT, PRES** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN603835216

NAME: RIGGAN

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: INDIVIDUAL
BEGIN DATE: 01/01/2006

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: DIESEL NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/01/1990 REGISTRATION DATE: 05/11/1990
TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/02/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 126457

TANK ID: DIESEL

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED
OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: **DIESEL** NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: **02/01/1990** REGISTRATION DATE: **05/11/1990** 

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/02/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

Order# 121435 Job# 277689 197 of 1203

#### **COMPOSITE**

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 126457

TANK ID: DIESEL

COMPARTMENT LETTER: A
SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 198 of 1203

**MAP ID# 24** 

Distance from Property: 0.043 mi. (227 ft.) W

Elevation: 578 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 110365

LPST ID: 110365

FACILITY ID: 0034297

NAME: ZOOM IN MARKET 6

ADDRESS: 6020 E ROSEDALE ST

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 110365

NAME: **ZOOM IN MARKET 6** 

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 3/4/96

REPORTED DATE: 12/31/3000 ENTERED DATE: 3/4/1996

PRP INFORMATION
NAME: KHALIL ABDAL

ADDRESS: ADDRESS NOT REPORTED

**FORT WORTH TX 76115** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/26/1996 REGISTRATION DATE: 03/11/1998

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 02/26/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FACTORY INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

TANK SYNTHETIC TANK-PIT/PIPING-TRENCH LINER

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 199 of 1203

UST COMPARTMENT ID: 146083

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **01/23/1996** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 146080

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

Order# 121435 Job# 277689 200 of 1203

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 02/26/1996 REGISTRATION DATE: 03/11/1998

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 02/26/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL: COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FACTORY INSTALLATION** 

EXTERNAL CONTAINMENT:

TANK SYNTHETIC TANK-PIT/PIPING-TRENCH LINER

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 146084

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES

Order# 121435 Job# 277689 201 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 02/26/1996 REGISTRATION DATE: 03/11/1998

TANK CAPACITY (GAL): 10000 **EMPTY TANK: NOT EMPTY** STATUS: IN USE STATUS BEGIN DATE: 02/26/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** MATERIAL: **COMPOSITE** 

CORROSION PROTECTION:

**CATHODIC PROTECTION - FACTORY INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

TANK SYNTHETIC TANK-PIT/PIPING-TRENCH LINER

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** UST COMPARTMENT ID: 146085

TANK ID: 2

COMPARTMENT LETTER: B SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY **RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/23/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO



Order# 121435 Job# 277689 202 of 1203

### Leaking Petroleum Storage Tanks (LPST)

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 146082

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **01/23/1996** 

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# Leaking Petroleum Storage Tanks (LPST)

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 146081

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 24** 

Distance from Property: 0.043 mi. (227 ft.) W

Elevation: 578 ft.

**FACILITY INFORMATION** 

ID#: 34297

NAME: ZOOM-IN MARKET 6

ADDRESS: 6020 E ROSEDALE ST

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 12/08/1986

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 07/30/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 07/24/2018 SIGNATURE NAME & TITLE: ABDUL K WAFAYEE, PRESIDENT

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601557119 NAME: KHALIL ZOOM IN MARKET INC CONTACT ADDRESS: 6020 E ROSEDALE ST

FORT WORTH TX 76112

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/08/1986 CONTACT ROLE: OWNCON

CONTACT NAME: ABDUL WAFAYEE CONTACT TITLE: PRESIDENT

ORGANIZATION: KHALIL ZOOM IN MARKET INC

PHONE: (817) 4579227 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN601557119 NAME: KHALIL ZOOM IN MARKET INC CONTACT ADDRESS: 6020 E ROSEDALE ST FORT WORTH TX 76112

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/08/1986 CONTACT ROLE: OPRCON

CONTACT NAME: ABDUL WAFAYEE CONTACT TITLE: PRESIDENT

**CONTACT INFORMATION** 

NAME: ABDUL WAFAYEE

TITLE: PRESIDENT

ORGANIZATION: ZOOM-IN MARKET 6

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4579227 0

GeoSearch www.geo-search.com 888-396-0042

205 of 1203 

ORGANIZATION: KHALIL ZOOM IN MARKET INC

PHONE: (817) 4579227 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 307258 SIGNATURE DATE: 07/24/2018

SIGNATURE NAME & TITLE: ABDUL K WAFAYEE, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 289360
SIGNATURE DATE: 07/12/2017

SIGNATURE NAME & TITLE: ABDUL WAFAYEE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 274864
SIGNATURE DATE: 08/03/2016

SIGNATURE NAME & TITLE: ABDUL K WAFAYEE, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 256087
SIGNATURE DATE: 06/30/2015

SIGNATURE NAME & TITLE: ABDUL WAFAYEE, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 240204
SIGNATURE DATE: 07/21/2014

SIGNATURE NAME & TITLE: ABDUL K WAFAYEE, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 223050
SIGNATURE DATE: 07/03/2013

SIGNATURE NAME & TITLE: ABDUL K WAFAYEE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142314
SIGNATURE DATE: 07/18/2012

SIGNATURE NAME & TITLE: ABDUL K WAFAYEE, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142313
SIGNATURE DATE: 07/13/2011

SIGNATURE NAME & TITLE:  ${f ABDUL} \ {f K} \ {f WAFYEE}, \ {f PRES}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142312
SIGNATURE DATE: 07/20/2010

SIGNATURE NAME & TITLE: ABDUL WAFAYEE, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142311
SIGNATURE DATE: 06/29/2009

SIGNATURE NAME & TITLE: ABDUL K WAFAYEE, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142310
SIGNATURE DATE: 07/21/2008

SIGNATURE NAME & TITLE: ABDUL K WAFAYYE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142309
SIGNATURE DATE: 06/27/2007

SIGNATURE NAME & TITLE: LARRY HOFFMAN, CONSULTANT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142308
SIGNATURE DATE: 07/07/2006

SIGNATURE NAME & TITLE: ABDUL WAFAYEE, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142307
SIGNATURE DATE: 06/21/2005

SIGNATURE NAME & TITLE: ABDUL WAFAYEE, PRESIDENT OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142306
SIGNATURE DATE: 08/01/2004

SIGNATURE NAME & TITLE: JOHN RAHIMI, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142305
SIGNATURE DATE: 08/03/2003

SIGNATURE NAME & TITLE: ABDUL WAFAYEE, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142304
SIGNATURE DATE: 09/27/2002

SIGNATURE NAME & TITLE: ABDUL WAFAYEE, OWNER

FILING STATUS: AMENDMENT
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142303
SIGNATURE DATE: 09/26/2002

SIGNATURE NAME & TITLE: ABDUL WAFAYEE, OWNER

FILING STATUS: RENEWAL

Order# 121435 Job# 277689 207 of 1203

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 142302
SIGNATURE DATE: 06/13/2001

SIGNATURE NAME & TITLE: ABDUL WAFAYEE, PRES

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/26/1996 REGISTRATION DATE: 03/11/1998

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 02/26/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FACTORY INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

TANK SYNTHETIC TANK-PIT/PIPING-TRENCH LINER

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 146083

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES



Order# 121435 Job# 277689 208 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/23/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 146080

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 02/26/1996 REGISTRATION DATE: 03/11/1998

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 02/26/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**COMPOSITE** 

CORROSION PROTECTION:

**CATHODIC PROTECTION - FACTORY INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

TANK SYNTHETIC TANK-PIT/PIPING-TRENCH LINER

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 146084

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 02/26/1996 REGISTRATION DATE: 03/11/1998

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 02/26/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FACTORY INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

TANK SYNTHETIC TANK-PIT/PIPING-TRENCH LINER



Order# 121435 Job# 277689 210 of 1203

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 146085

TANK ID: 2

COMPARTMENT LETTER: **B** SUBSTANCES: **DIESEL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/23/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 146082

TANK ID: 2A

Order# 121435 Job# 277689 211 of 1203

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **01/23/1996** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 146081

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 25** 

Distance from Property: 0.044 mi. (232 ft.) WNW

Elevation: 598 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

ADDRESS: 330 N BELT NO 101

REGISTRATION#: 66834 EPA ID: NOT REPORTED NAME: I

NAME: NATIONWIDE EQUIPMENT RENTALS

TNRCC ID #: 22086
NAME: NATIONWIDE

HOUSTON, TX 77060

ADDRESS: 5317 MANSFIELD HWY PHONE: NOT REPORTED

110001011, 12 11000

**FOREST HILL, TX 76119** 

CONTACT: GREG FORBESS

PHONE: NOT REPORTED

BUSINESS DESCRIPTION: 04/12/2002 REGISTRATION MADE INACTIVE DUE TO REGISTRATION STATUS OF MAILING

ADDRESS INCORRECT. EG

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/24/2010

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE NO RECORDS

**Back to Report Summary** 

Order# 121435 Job# 277689 214 of 1203

**MAP ID# 25** 

Distance from Property: 0.044 mi. (232 ft.) WNW

Elevation: 598 ft.

**FACILITY INFORMATION** 

ID#: **62153** 

NAME: TEXACO FOOD MART

ADDRESS: 5317 MANSFIELD HWY STE 101

FOREST HILL, TX 76119

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 01/06/1992

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 1 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 02/01/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 11/24/2017

SIGNATURE NAME & TITLE: MARWAY QADDURA, GM ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN604552802

NAME: TEXACO TEXAS ONE INVESTMENTS INC CONTACT ADDRESS: 5317 MANSFIELD HWY STE 101

**FOREST HILL TX 76119** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/2014

CONTACT ROLE: OWNOPRCON

CONTACT NAME: PRINCE RICHMAN

CONTACT TITLE: NOT REPORTED

ORGANIZATION: TEXACO TEXAS ONE INVESTMENTS INC

PHONE: (817) 3746335 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OWNER NUMBER: CN604046391
NAME: AKT INVESTMENTS INC

CONTACT ADDRESS: 5317 MANSFIELD HWY
FOREST HILL TX 76119

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/16/2011 CONTACT ROLE: OWNCON

CONTACT NAME: KEYVAN MOSLEMI
CONTACT TITLE: NOT REPORTED
ORGANIZATION: AKT INVESTMENTS INC

PHONE: (214) 2935993

CONTACT INFORMATION

NAME: PRINCE RICHMAN
TITLE: NOT REPORTED

ORGANIZATION: TEXACO FOOD MART

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 3746335 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 215 of 1203

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN604552802

NAME: TEXACO TEXAS ONE INVESTMENTS INC
CONTACT ADDRESS: 5317 MANSFIELD HWY STE 101

**FOREST HILL TX 76119** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/2014

CONTACT ROLE: OWNOPRCON
CONTACT NAME: PRINCE RICHMAN
CONTACT TITLE: NOT REPORTED

ORGANIZATION: TEXACO TEXAS ONE INVESTMENTS INC

PHONE: (817) 3746335 0 FAX: NOT REPORTED EMAIL: NOT REPORTED

OPERATOR NUMBER: CN604046391
NAME: AKT INVESTMENTS INC

CONTACT ADDRESS: 5317 MANSFIELD HWY
FOREST HILL TX 76119

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/16/11
CONTACT ROLE: OPRCON

CONTACT NAME: KEYVAN MOSLEMI
CONTACT TITLE: NOT REPORTED
ORGANIZATION: AKT INVESTMENTS INC

PHONE: **(214) 2935993** FAX: **NOT REPORTED** EMAIL: **NOT REPORTED** 

SELF-CERTIFICATION

SELF-CERTIFICATION ID: 298651 SIGNATURE DATE: 11/24/2017

SIGNATURE NAME & TITLE: MARWAY QADDURA, GM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 282100
SIGNATURE DATE: 11/30/2016

SIGNATURE NAME & TITLE: PRINCE RICHMAN, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 262971
SIGNATURE DATE: 11/24/2015

SIGNATURE NAME & TITLE: PRINCE RICHMAN, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 246713
SIGNATURE DATE: 12/10/2014

SIGNATURE NAME & TITLE: PRINCE RICHMAN, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 234743
SIGNATURE DATE: 01/03/2014

SIGNATURE NAME & TITLE: PRINCE RICHMAN, OWNER

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 222212
SIGNATURE DATE: 04/28/2013

SIGNATURE NAME & TITLE: KEYVAN MOSLEMI, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 17400
SIGNATURE DATE: 12/23/2011

SIGNATURE NAME & TITLE: KEYVAN MOSLEMI, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 17399
SIGNATURE DATE: 12/22/2011

SIGNATURE NAME & TITLE: KEYVAN MOSLEMI, NOT REPORTED

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 17398
SIGNATURE DATE: 05/14/2007

SIGNATURE NAME & TITLE: TOM JORDAN, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 17397
SIGNATURE DATE: 04/21/2006

SIGNATURE NAME & TITLE: TOM JORDAN, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 17396
SIGNATURE DATE: 04/20/2005

SIGNATURE NAME & TITLE: ROM JORDAN, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 17395
SIGNATURE DATE: 04/22/2004

SIGNATURE NAME & TITLE: ALI ALDIAB, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 17394
SIGNATURE DATE: 03/23/2003

SIGNATURE NAME & TITLE: ALI ALDIAB, MGR

FILING STATUS: RENEWAL

Order# 121435 Job# 277689 217 of 1203

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 17393
SIGNATURE DATE: 04/22/2002

SIGNATURE NAME & TITLE: ALI ALDISB, MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 17392
SIGNATURE DATE: 04/17/2001

SIGNATURE NAME & TITLE: ALI ALDINB, MANAGER

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 1265
APPLICATION RECEIVED DATE: 12/01/1999
SCHEDULE CONSTRUCTION DATE: 12/06/1999

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

NOTIFICATION CONSTRUCTION ID: 1264
APPLICATION RECEIVED DATE: 06/18/2008
SCHEDULE CONSTRUCTION DATE: 07/18/2008

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 3 INSTALLATION DATE: 12/01/1999 REGISTRATION DATE: 04/20/2001

TANK CAPACITY (GAL): 24000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 12/01/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 13390

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000



Order# 121435 Job# 277689 218 of 1203

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND

CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 3
INSTALLATION DATE: 12/01/1999 REGISTRATION DATE: 04/20/2001

TANK CAPACITY (GAL): 24000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 12/01/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 13391

TANK ID: 1

COMPARTMENT LETTER: **B** SUBSTANCES: **GASOLINE** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND

CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 3
INSTALLATION DATE: 12/01/1999 REGISTRATION DATE: 04/20/2001

TANK CAPACITY (GAL): 24000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 12/01/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 13392

TANK ID: 1

COMPARTMENT LETTER: C
SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND

CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

GeoSearch www.geo-search.com 888-396-0042

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 01/02/1992

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/31/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**NOT REPORTED** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 13389

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 01/02/1992

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/31/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

Order# 121435 Job# 277689 221 of 1203

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 13387

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 01/02/1992

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/31/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

Order# 121435 Job# 277689 222 of 1203

#### **NOT REPORTED**

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 13386

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 01/02/1992

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/31/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 13388

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

Order# 121435 Job# 277689 223 of 1203

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 165780 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 01/02/1992

INSTALLATION DATE: 01/01/1994 STATUS BEGIN DATE: 10/08/1997

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 224 of 1203

**MAP ID# 26** 

Distance from Property: 0.045 mi. (238 ft.) NE

Elevation: 636 ft.

**FACILITY INFORMATION** 

ID#: 35860

NAME: JOHNS QUIK STOP

ADDRESS: 4244 WILBARGER ST

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 12/11/1986

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 01/19/2016 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 12/30/2015 SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRESIDENT

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603931734

NAME: SAI BBD INC

CONTACT ADDRESS: PO BOX 541895

**GRAND PRAIRIE TX 75054** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 07/01/2011

CONTACT ROLE: OWNOPRCON

CONTACT NAME: DEEPESH SHRESTHA

CONTACT TITLE: PRES
ORGANIZATION: SAI BBD INC
PHONE: (214) 8028943 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN603931734

NAME: SAI BBD INC

CONTACT ADDRESS: PO BOX 541895

**GRAND PRAIRIE TX 75054** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 07/01/2011

CONTACT ROLE: OWNOPRCON

CONTACT NAME: DEEPESH SHRESTHA

CONTACT TITLE: PRES

CONTACT INFORMATION

NAME: DEEPESH SHRESTHA

TITLE: PRES

ORGANIZATION: JOHNS QUIK STOP

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (214) 8028943 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: SAI BBD INC
PHONE: (214) 8028943 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 264370 SIGNATURE DATE: 12/30/2015

SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 248423
SIGNATURE DATE: 01/16/2015

SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 229361
SIGNATURE DATE: 12/18/2013

SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85396
SIGNATURE DATE: 12/27/2012

SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85395
SIGNATURE DATE: 12/08/2011

SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85394
SIGNATURE DATE: 06/30/2011

SIGNATURE NAME & TITLE: **DEEPESH SHRESTHA, PRES** 

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85393
SIGNATURE DATE: 07/25/2010

SIGNATURE NAME & TITLE: QUINN HUYNH, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85392
SIGNATURE DATE: 07/25/2009

SIGNATURE NAME & TITLE: QUINN HUYNH, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85391
SIGNATURE DATE: 08/11/2008

Order# 121435 Job# 277689 226 of 1203

SIGNATURE NAME & TITLE: QUINN HUYNH, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85390
SIGNATURE DATE: 07/01/2006

SIGNATURE NAME & TITLE: KEVIN BORTLE, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85389
SIGNATURE DATE: 06/19/2005

SIGNATURE NAME & TITLE: KEVIN BORTLE, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85388
SIGNATURE DATE: 06/01/2004

SIGNATURE NAME & TITLE: KEVIN BORTLE, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85387
SIGNATURE DATE: 06/14/2003

SIGNATURE NAME & TITLE: QUANG HUYNG, PST OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85386
SIGNATURE DATE: 06/10/2002

SIGNATURE NAME & TITLE: QUANG HUYNH, OWENR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85385
SIGNATURE DATE: 01/30/2001

SIGNATURE NAME & TITLE: T NGUYEN AND QUANG HUYNH, OWNER

FILING STATUS: **INITIAL** REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/15/1999 REGISTRATION DATE: 02/02/2000

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 05/15/1999

INTERNAL PROTECTION DATE: 05/15/1999 REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:



Order# 121435 Job# 277689 227 of 1203

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

TANK VAULT/RIGID TRENCH LINER

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 93347

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL
SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),TRIENNIAL TIGHTNESS TEST (FOR SUCTION/GRAVITY PIPING),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/15/1999** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 93343

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 05/15/1999 REGISTRATION DATE: 02/02/2000

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 05/15/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

TANK VAULT/RIGID TRENCH LINER

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 93348

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL
SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED



CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),TRIENNIAL TIGHTNESS TEST (FOR SUCTION/GRAVITY PIPING),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 05/15/1999 REGISTRATION DATE: 02/02/2000

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 05/15/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

TANK VAULT/RIGID TRENCH LINER

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 93349

TANK ID: 2

COMPARTMENT LETTER: B
SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL
SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),TRIENNIAL TIGHTNESS TEST (FOR SUCTION/GRAVITY PIPING),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG



Order# 121435 Job# 277689 230 of 1203

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/15/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 93346

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/15/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

Order# 121435 Job# 277689 231 of 1203

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 93345

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/15/1999 REGISTRATION DATE: 02/02/2000

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/15/1999** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES

PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**COMPOSITE** 

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES

Order# 121435 Job# 277689 232 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 93350

TANK ID: 3A

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/01/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 93344

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 27** 

Distance from Property: 0.046 mi. (243 ft.) WNW

Elevation: 579 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 79280

EPA ID: TXD988046009 NAME: CHEVRON USA INC

OWNER INFORMATION

TNRCC ID #: 32834 ADDRESS: PO BOX 5004

NAME: CHEVRON FAC 106181 SAN RAMON, CA 94583
ADDRESS: 5729 E BERRY ST PHONE: 1-713-7543500

FORT WORTH, TX 76119

CONTACT: KATHRYN MINTER

PHONE: 713-7543500

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 12/01/2005

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 62850

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 235 of 1203

**MAP ID# 27** 

Distance from Property: 0.046 mi. (243 ft.) WNW

Elevation: 579 ft.

**FACILITY INFORMATION** 

ID#: 5639

NAME: CHEVRON FAC 106181 ADDRESS: 5729 E BERRY ST

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 09/01/1988 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/22/1986

SIGNATURE NAME & TITLE: JUDI L HICKERSON, ENGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600132484 NAME: CHEVRON USA INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1988

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600132484

NAME: CHEVRON USA INC

CONTACT ADDRESS: PO BOX 4256

**HOUSTON TX 77210** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1988 CONTACT ROLE: OPRCON

CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED **CONTACT INFORMATION** 

NAME: JUDI HICKERSON TITLE: NOT REPORTED

ORGANIZATION: CHEVRON FAC 106181

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (214) 6996623 0

236 of 1203 

ORGANIZATION: CHEVRON USA INC

PHONE: (713) 7543500 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

#### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

#### **UNDERGROUND STORAGE TANK**

TANK ID: 104S NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/01/1977 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/17/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 81436

TANK ID: 104S

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 237 of 1203

TANK ID: 345G NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/01/1977 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/17/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 81435

TANK ID: 345G

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL
SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 601C NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/01/1977 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/17/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



Order# 121435 Job# 277689 238 of 1203

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 81437

TANK ID: 601C

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL
SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 239 of 1203

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 27** 

Distance from Property: 0.046 mi. (243 ft.) WNW

Elevation: 579 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD988046009 OWNER TYPE: PRIVATE

NAME: CHEVRON USA INC OWNER NAME: CHEVRON USA INC

ADDRESS: 5729 E BERRY ST OPERATOR TYPE: PRIVATE

FORT WORTH, TX 76119 OPERATOR NAME: CHEVRON USA INC

CONTACT NAME: KATHRYN MINTER
CONTACT ADDRESS: PO BOX 5004

**SAN RAMON CA 94583** 

CONTACT PHONE: 713-754-3500

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 11/29/2005

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

KATHRYN MINTER UNKNOWN 11/29/2005

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 12/06/2005

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D000

D001 IGNITABLE WASTE

D018 BENZENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 240 of 1203

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

CORRECTIVE ACTION EVENT
NO CORRECTIVE ACTION EVENT(S) REPORTED

Back to Report Summary

**MAP ID# 28** 

Distance from Property: 0.046 mi. (243 ft.) WNW

Elevation: 598 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 115079

LPST ID: 115079

FACILITY ID: 0045787

NAME: KWIK PIK FOOD MART ADDRESS: 5304 MANSFIELD HWY

FOREST HILL, TX

#### **LEAKING TANK DETAILS**

LPST ID: 115079

NAME: KWIK PIK FOOD MART

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6P - FINAL PENDING WELL PLUG

CORRECTIVE ACTION START DATE: 6/26/08

REPORTED DATE: 9/18/2000 ENTERED DATE: 10/8/2000

PRP INFORMATION

NAME: **NEW SIND ENTERPRISES** 

ADDRESS: ADDRESS NOT REPORTED

EULESS TX 76039

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1988 REGISTRATION DATE: 03/16/1988

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1988

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

**UST COMPARTMENT ID: 11867** 

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1988 REGISTRATION DATE: 03/16/1988

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1988

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL: COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 11869

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

Order# 121435 Job# 277689 243 of 1203

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1988 REGISTRATION DATE: 03/16/1988

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1988

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 11868

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES



Order# 121435 Job# 277689 244 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION
NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 28** 

Distance from Property: 0.046 mi. (243 ft.) WNW

Elevation: 598 ft.

**FACILITY INFORMATION** 

ID#: **17462** 

NAME: 12G01 MOBIL SERVICE STATION

ADDRESS: 5316 MANSFIELD HWY

FOREST HILL, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 08/28/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/21/1986 SIGNATURE NAME & TITLE: T B NEWMAN, MKTG RETAIL MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600920748

NAME: EXXONMOBIL OIL CORPORATION

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/28/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OWNER NUMBER: CN603874918
NAME: MOBIL OIL CORPORATION

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

CITY NOT REPORTED

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/28/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED

CONTACT INFORMATION

NAME: J SEITZ TITLE: DEALER

ORGANIZATION: 12G01 MOBIL SERVICE STATION
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 5723196 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 246 of 1203

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1973 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/06/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114204

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 247 of 1203

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1973 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/06/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 114205

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1973 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/06/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



Order# 121435 Job# 277689 248 of 1203

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 114206

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 28** 

Distance from Property: 0.046 mi. (243 ft.) WNW

Elevation: 598 ft.

**FACILITY INFORMATION** 

ID#: 45787

NAME: KWIK PIK FOOD MART

ADDRESS: 5304 MANSFIELD HWY

FOREST HILL, TX 76119

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 03/22/1988

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 09/07/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 09/07/2018

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600805774 NAME: BIANCA ENTERPRISES INC

CONTACT ADDRESS: 5304 MANSFIELD HWY

**FOREST HILL TX 76119** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/20/2000 CONTACT ROLE: OWNCON

CONTACT NAME: BIPIN B ADHIKARY

CONTACT TITLE: PRES

ORGANIZATION: BIANCA ENTERPRISES INC

PHONE: (817) 7146502 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600805774 NAME: BIANCA ENTERPRISES INC

CONTACT ADDRESS: 5304 MANSFIELD HWY

**FOREST HILL TX 76119** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/20/2000 CONTACT ROLE: OPRCON

CONTACT NAME: BIPIN B ADHIKARY

CONTACT TITLE: PRESIDENT

**CONTACT INFORMATION** 

NAME: BIPIN B ADHIKARY

TITLE: PRESIDENT

ORGANIZATION: KWIK PIK FOOD MART

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 7146502 0

GeoSearch www.geo-search.com 888-396-0042

250 of 1203 

ORGANIZATION: BIANCA ENTERPRISES INC

PHONE: (817) 7146502 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 309590 SIGNATURE DATE: 09/07/2018

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 292913
SIGNATURE DATE: 09/01/2017

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 274893
SIGNATURE DATE: 08/01/2016

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 260029
SIGNATURE DATE: 08/31/2015

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 242023
SIGNATURE DATE: 07/22/2014

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 225308
SIGNATURE DATE: 08/29/2013

SIGNATURE NAME & TITLE: **BIPIN ADHIKARY, PRESIDENT** 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 13662
SIGNATURE DATE: 08/09/2012

SIGNATURE NAME & TITLE: BIPIN ADIHKARY, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 13661
SIGNATURE DATE: 08/30/2011

 ${\tt SIGNATURE\ NAME\ \&\ TITLE:\ } \textbf{BIDIN\ ADHIKARY,\ PRESIDENT}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 13660
SIGNATURE DATE: 09/09/2010

Order# 121435 Job# 277689 251 of 1203

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 13659
SIGNATURE DATE: 08/01/2009

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 13658
SIGNATURE DATE: 09/12/2008

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 13657
SIGNATURE DATE: 08/27/2007

SIGNATURE NAME & TITLE: BIPIN ADHIKARU, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 13656
SIGNATURE DATE: 08/18/2006

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 13655
SIGNATURE DATE: 09/01/2005

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 13654
SIGNATURE DATE: 08/18/2004

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 13653
SIGNATURE DATE: 09/26/2003

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 13652
SIGNATURE DATE: 08/28/2002

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 13651
SIGNATURE DATE: 05/01/2001

SIGNATURE NAME & TITLE: BIPIN ADHIKARY, NOT REPORTED

FILING STATUS: INITIAL

REGISTRATION FLAG: YES

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 32077
APPLICATION RECEIVED DATE: 10/25/2017
SCHEDULE CONSTRUCTION DATE: 10/23/2017

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**LINE REPAIR AT DISPENSER 3/4** 

NOTIFICATION CONSTRUCTION ID: 1328

APPLICATION RECEIVED DATE: 01/11/2012

SCHEDULE CONSTRUCTION DATE: 01/11/2012

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**EMERGENCY REPAIR VENT LINE BROKEN** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1988 REGISTRATION DATE: 03/16/1988

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1988

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 11867

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

WATERIAL. FRF

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:



Order# 121435 Job# 277689 253 of 1203

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1988 REGISTRATION DATE: 03/16/1988

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1988

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 11869

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1988 REGISTRATION DATE: 03/16/1988

Order# 121435 Job# 277689 254 of 1203

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1988

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 11868

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 29** 

Distance from Property: 0.047 mi. (248 ft.) WNW

Elevation: 586 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 84952 EPA ID: NOT REPORTED

TNRCC ID #: 105092

NAME: REEDER DISTRIBUTOR ADDRESS: 5450 WILBARGER ST

FORT WORTH, TX 76119

CONTACT: JIMMY D NORMAN

PHONE: 817-4295957

BUSINESS DESCRIPTION: NOT REPORTED INDUSTRIAL WASTE PERMIT #: NOT REPORTED MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: NO WASTE RECEIVER: NO WASTE TRANSPORTER: YES TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/10/2003

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE **NO RECORDS** 

**Back to Report Summary** 

ADDRESS: PO BOX 8237

OWNER INFORMATION

FORT WORTH, TX 76124

NAME: REEDER DISTRIBUTORS INC

PHONE: 1-817-4295957

256 of 1203

**MAP ID# 29** 

Distance from Property: 0.047 mi. (248 ft.) WNW

Elevation: 586 ft.

**FACILITY INFORMATION** 

ID#: **45710** 

NAME: REEDER DISTRIBUTORS
ADDRESS: 5450 WILBARGER ST

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING BEGIN DATE: 01/01/1986

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 3
NUMBER OF ACTIVE ABOVEGROUND TANKS: 186

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/08/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 07/24/2018 SIGNATURE NAME & TITLE: JIMMIE WINTER, HR/COMPLIANCE MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600244339

NAME: REEDER DISTRIBUTORS INC

CONTACT ADDRESS: PO BOX 8237

FORT WORTH TX 76124

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/10/1987

CONTACT ROLE: **OWNOPRCON**CONTACT NAME: **NOT REPORTED**CONTACT TITLE: **NOT REPORTED** 

ORGANIZATION: REEDER DISTRIBUTOR INC

PHONE: (817) 4295957 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN600244339

NAME: REEDER DISTRIBUTORS INC

CONTACT ADDRESS: PO BOX 8237

FORT WORTH TX 76124

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/10/1987

CONTACT ROLE: OWNOPRCON
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION

NAME: KATHY JOHNSON TITLE: NOT REPORTED

ORGANIZATION: REEDER DISTRIBUTORS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4295957 216

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: REEDER DISTRIBUTOR INC

PHONE: (817) 4295957 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 307522 SIGNATURE DATE: 07/24/2018

SIGNATURE NAME & TITLE: JIMMIE WINTER, HR/COMPLIANCE MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 292590
SIGNATURE DATE: 08/05/2017

SIGNATURE NAME & TITLE: JIMMIE WINTER, HR/COMP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 273947
SIGNATURE DATE: 08/05/2016

SIGNATURE NAME & TITLE: JIMMY WINTER, COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 256875
SIGNATURE DATE: 07/14/2015

SIGNATURE NAME & TITLE: JIMMIE WINTER, COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 241221
SIGNATURE DATE: 07/22/2014

SIGNATURE NAME & TITLE: JIMMIE WINTER, COMPLIANCE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 224113
SIGNATURE DATE: 07/08/2013

SIGNATURE NAME & TITLE: JIMMIE WINTER, COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 10750
SIGNATURE DATE: 06/28/2012

SIGNATURE NAME & TITLE: JIMMIE WINTER, COMP DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 10749
SIGNATURE DATE: 06/21/2011

SIGNATURE NAME & TITLE: GINNY KAMPER, CORP COMP DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 10748
SIGNATURE DATE: 07/15/2010

Order# 121435 Job# 277689 258 of 1203

SIGNATURE NAME & TITLE: GINNY KAMPER, CORP COMP DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 10747
SIGNATURE DATE: 07/01/2009

SIGNATURE NAME & TITLE: GINNY KAMPER, CORP DOMP DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 10746
SIGNATURE DATE: 06/24/2008

SIGNATURE NAME & TITLE: GINNY KAMPER, CORP COMP DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 10745
SIGNATURE DATE: 06/27/2007

SIGNATURE NAME & TITLE: GINNY KAMPER, COMP DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 10744
SIGNATURE DATE: 06/26/2006

SIGNATURE NAME & TITLE: GINNY KAMPER, COMPLIANCE DIRECTOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 10743
SIGNATURE DATE: 06/24/2005

SIGNATURE NAME & TITLE: GINNY KAMPER, SAFETY MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 10742
SIGNATURE DATE: 06/22/2004

SIGNATURE NAME & TITLE: GINNY KAMPER, SAFETY DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 10741
SIGNATURE DATE: 06/23/2003

SIGNATURE NAME & TITLE: GINNY KAMPER, SAFETY MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 10740
SIGNATURE DATE: 06/10/2002

SIGNATURE NAME & TITLE: GINNY KAMPER, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 10739
SIGNATURE DATE: 07/20/2000

SIGNATURE NAME & TITLE: GINNY KAMPER, SAFETY MGR

FILING STATUS: INITIAL

Order# 121435 Job# 277689 259 of 1203

REGISTRATION FLAG: YES

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 31940
APPLICATION RECEIVED DATE: 09/22/2017
SCHEDULE CONSTRUCTION DATE: 10/30/2017

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION: INSTALLATION OF (1) 6000 GAL 2085 FIREGUARD HALL TANK.

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1986 REGISTRATION DATE: 11/06/1987

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 10502

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1986 REGISTRATION DATE: 11/06/1987

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 10501

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1987 REGISTRATION DATE: 11/06/1987

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 04/01/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO

Order# 121435 Job# 277689 261 of 1203

PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL: COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 10503

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: **KEROSENE** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 215647 MULTIPLE COMPARTMENT FLAG: NO TANK ID: EXPORTER REGISTRATION DATE: 10/19/2011

INSTALLATION DATE: 10/19/2011 STATUS BEGIN DATE: 10/19/2011

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO



CONTAINMENT LINER: **NO** NONE: **YES**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 218978 MULTIPLE COMPARTMENT FLAG: NO TANK ID: VT200071 REGISTRATION DATE: 10/01/2013

INSTALLATION DATE: 09/24/2013 STATUS BEGIN DATE: 09/24/2013

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 154597 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 11/06/1987

INSTALLATION DATE: 01/01/1987 STATUS BEGIN DATE: 01/01/1987

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: KEROSENE

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 182511 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 2 REGISTRATION DATE: 01/29/1997

INSTALLATION DATE: 01/25/1997 STATUS BEGIN DATE: 01/25/1997

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 191392 MULTIPLE COMPARTMENT FLAG: NO

Order# 121435 Job# 277689 263 of 1203

TANK ID: 3 REGISTRATION DATE: 06/24/1999

INSTALLATION DATE: 06/22/1999 STATUS BEGIN DATE: 06/22/1999

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: YES
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 191393 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 4 REGISTRATION DATE: 06/24/1999

INSTALLATION DATE: 06/22/1999 STATUS BEGIN DATE: 11/25/2003

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: YES
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 198805 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 5 REGISTRATION DATE: 11/15/2001

INSTALLATION DATE: 11/09/2001 STATUS BEGIN DATE: 11/09/2001

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 223581 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 63 REGISTRATION DATE: 09/10/2018

INSTALLATION DATE: 08/16/2018 STATUS BEGIN DATE: 08/16/2018
TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

Order# 121435 Job# 277689 264 of 1203

#### **MATERIAL OF CONSTRUCTION**

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223587 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 111 REGISTRATION DATE: 09/05/2018

INSTALLATION DATE: 08/31/2018 STATUS BEGIN DATE: 08/31/2018
TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223742 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 132 REGISTRATION DATE: 10/18/2018

INSTALLATION DATE: 09/13/2018 STATUS BEGIN DATE: 09/13/2018

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223582 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 181 REGISTRATION DATE: 09/11/2018

INSTALLATION DATE: 08/31/2018 STATUS BEGIN DATE: 08/31/2018

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO

Order# 121435 Job# 277689 265 of 1203

**CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223530 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 182 REGISTRATION DATE: 08/20/2018

INSTALLATION DATE: 07/30/2018 STATUS BEGIN DATE: 07/30/2018

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223588 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 183 REGISTRATION DATE: 09/06/2018

INSTALLATION DATE: 08/24/2018 STATUS BEGIN DATE: 08/24/2018

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219305 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 20031 REGISTRATION DATE: 01/29/2014

INSTALLATION DATE: 01/22/2014 STATUS BEGIN DATE: 01/22/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

MATERIAL OF CONSTRUCTION

STEEL: **NO** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED



Order# 121435 Job# 277689 266 of 1203

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221087 MULTIPLE COMPARTMENT FLAG: NC

TANK ID: 122152 REGISTRATION DATE: 09/03/2015

INSTALLATION DATE: 08/26/2015 STATUS BEGIN DATE: 08/26/2015

TANK CAPACITY (GAL): 1200 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216797 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200011 REGISTRATION DATE: 07/02/2012

INSTALLATION DATE: 06/18/2012 STATUS BEGIN DATE: 06/18/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 220114 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200041 REGISTRATION DATE: 07/30/2014

INSTALLATION DATE: 07/18/2014 STATUS BEGIN DATE: 07/18/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **NO** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 218603 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200043 REGISTRATION DATE: 06/13/2013

INSTALLATION DATE: 06/12/2013 STATUS BEGIN DATE: 06/12/2013

Order# 121435 Job# 277689 267 of 1203

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216402 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200044 REGISTRATION DATE: 04/10/2012

INSTALLATION DATE: 04/05/2012 STATUS BEGIN DATE: 04/05/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **YES**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 220115 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200047 REGISTRATION DATE: 07/30/2014

INSTALLATION DATE: 07/18/2014 STATUS BEGIN DATE: 07/18/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 218147 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200049 REGISTRATION DATE: 02/18/2013

INSTALLATION DATE: 02/04/2013 STATUS BEGIN DATE: 02/04/2013

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO



Order# 121435 Job# 277689 268 of 1203

FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: YES
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 218670 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200054 REGISTRATION DATE: 07/03/2013

INSTALLATION DATE: 06/26/2013 STATUS BEGIN DATE: 06/26/2013

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219371 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200064 REGISTRATION DATE: 02/27/2014

INSTALLATION DATE: 02/27/2014 STATUS BEGIN DATE: 02/27/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221657 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200065 REGISTRATION DATE: 05/18/2016

INSTALLATION DATE: 04/20/2016 STATUS BEGIN DATE: 04/20/2016

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO

Order# 121435 Job# 277689 269 of 1203

NONE: NO CONTAINMENT LINER: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216688 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 200071

REGISTRATION DATE: 06/11/2012

INSTALLATION DATE: 06/01/2012 STATUS BEGIN DATE: 06/01/2012 REGULATORY STATUS: FULLY REGULATED TANK CAPACITY (GAL): 2000

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: YES NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216004 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200072 REGISTRATION DATE: 01/18/2012

INSTALLATION DATE: 01/11/2012 STATUS BEGIN DATE: 01/11/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

SUBSTANCES: DIESEL STATUS: IN USE

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO **CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: YES NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216291 MULTIPLE COMPARTMENT FLAG:

TANK ID: 200074 REGISTRATION DATE: 03/19/2012

INSTALLATION DATE: 03/14/2012 STATUS BEGIN DATE: 03/14/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

CORRUGATED METAL: NO STEEL: YES CONCRETE: NO FIBERGLASS: NO

ALUMINIUM: NO **CONTAINMENT** 

CONCRETE: NO EARTHEN DIKE: NO CONTAINMENT LINER: NO NONE: YES STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219310 MULTIPLE COMPARTMENT FLAG: NO

Order# 121435 Job# 277689 270 of 1203

TANK ID: 200077 REGISTRATION DATE: 01/29/2014

INSTALLATION DATE: 01/08/2014 STATUS BEGIN DATE: 01/27/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219336 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200079 REGISTRATION DATE: 02/13/2014

INSTALLATION DATE: 02/13/2014 STATUS BEGIN DATE: 02/13/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222346 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200081 REGISTRATION DATE: 05/02/2017

INSTALLATION DATE: 04/20/2017 STATUS BEGIN DATE: 04/20/2017

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216195 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200084 REGISTRATION DATE: 03/07/2012

INSTALLATION DATE: 03/01/2012 STATUS BEGIN DATE: 03/01/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

Order# 121435 Job# 277689 271 of 1203

#### **MATERIAL OF CONSTRUCTION**

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 216129 MULTIPLE COMPARTMENT FLAG: NC
TANK ID: 200085 REGISTRATION DATE: 02/22/2012

INSTALLATION DATE: 02/14/2012 STATUS BEGIN DATE: 02/14/2012
TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO** CONTAINMENT LINER: **NO** NONE: **YES** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216795 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 200087 REGISTRATION DATE: 07/02/2012

INSTALLATION DATE: 06/25/2012 STATUS BEGIN DATE: 06/25/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 217757 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200088 REGISTRATION DATE: 12/20/2012

INSTALLATION DATE: 12/04/2012 STATUS BEGIN DATE: 12/04/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO

Order# 121435 Job# 277689 272 of 1203

**CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: YES NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 217161 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200095 REGISTRATION DATE: 09/12/2012

INSTALLATION DATE: 09/10/2012 STATUS BEGIN DATE: 09/10/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: YES NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 217634 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200125 REGISTRATION DATE: 11/20/2012

INSTALLATION DATE: 11/19/2012 STATUS BEGIN DATE: 11/19/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: YES NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222265 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 200171 REGISTRATION DATE: 03/21/2017

INSTALLATION DATE: 03/20/2017 STATUS BEGIN DATE: 03/20/2017

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

MATERIAL OF CONSTRUCTION

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

Order# 121435 Job# 277689 273 of 1203

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216796 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 300061 REGISTRATION DATE: 07/02/2012

INSTALLATION DATE: 06/18/2012 STATUS BEGIN DATE: 06/18/2012

TANK CAPACITY (GAL): 3000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219163 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 316304 REGISTRATION DATE: 11/12/2013

INSTALLATION DATE: 11/07/2013 STATUS BEGIN DATE: 11/07/2013

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 220869 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400021 REGISTRATION DATE: 05/04/2015

INSTALLATION DATE: 04/24/2015 STATUS BEGIN DATE: 04/24/2015

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **NO** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220967 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400021 REGISTRATION DATE: 06/23/2015

INSTALLATION DATE: 05/22/2015 STATUS BEGIN DATE: 05/22/2015

Order# 121435 Job# 277689 274 of 1203

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220968 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400022 REGISTRATION DATE: 06/23/2015

INSTALLATION DATE: 05/11/2015 STATUS BEGIN DATE: 05/11/2015

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216005 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400063 REGISTRATION DATE: 01/18/2012

INSTALLATION DATE: 01/11/2012 STATUS BEGIN DATE: 01/11/2012

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **YES**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 222590 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400065 REGISTRATION DATE: 08/22/2017

INSTALLATION DATE: 08/11/2017 STATUS BEGIN DATE: 08/11/2017

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO



Order# 121435 Job# 277689 275 of 1203

FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216657 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400067 REGISTRATION DATE: 06/04/2012

INSTALLATION DATE: 05/31/2012 STATUS BEGIN DATE: 05/31/2012

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **YES**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 217164 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400068 REGISTRATION DATE: 09/13/2012

INSTALLATION DATE: 09/12/2012 STATUS BEGIN DATE: 09/12/2012

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219221 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400069 REGISTRATION DATE: 12/17/2013

INSTALLATION DATE: 12/04/2013 STATUS BEGIN DATE: 12/04/2013

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO



Order# 121435 Job# 277689 276 of 1203

CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 220913 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: **400071** REGISTRATION DATE: **05/22/2015** 

INSTALLATION DATE: 05/19/2015 STATUS BEGIN DATE: 05/19/2015

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222388 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400072 REGISTRATION DATE: 05/23/2017

INSTALLATION DATE: 05/09/2017 STATUS BEGIN DATE: 05/09/2017

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 217602 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400083 REGISTRATION DATE: 11/13/2012

INSTALLATION DATE: 11/08/2012 STATUS BEGIN DATE: 11/08/2012

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 216196 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400084 REGISTRATION DATE: 03/07/2012

INSTALLATION DATE: 03/02/2012 STATUS BEGIN DATE: 03/02/2012

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 223528 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400085 REGISTRATION DATE: 08/17/2018

INSTALLATION DATE: 07/17/2018 STATUS BEGIN DATE: 07/17/2018

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220308 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400091 REGISTRATION DATE: 11/13/2014

INSTALLATION DATE: 11/03/2014 STATUS BEGIN DATE: 11/03/2014

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 221079 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 400092 REGISTRATION DATE: 08/26/2015

INSTALLATION DATE: 08/07/2015 STATUS BEGIN DATE: 08/07/2015

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

Order# 121435 Job# 277689 278 of 1203

#### **MATERIAL OF CONSTRUCTION**

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216049 MULTIPLE COMPARTMENT FLAG: NC
TANK ID: 500051 REGISTRATION DATE: 01/31/2012

INSTALLATION DATE: 01/23/2012 STATUS BEGIN DATE: 01/23/2012

TANK CAPACITY (GAL): 5000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: YES
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219309 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: **500052** REGISTRATION DATE: **01/30/2014** 

INSTALLATION DATE: 01/27/2014 STATUS BEGIN DATE: 01/27/2014

TANK CAPACITY (GAL): 5000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 218221 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 500061 REGISTRATION DATE: 02/26/2013

INSTALLATION DATE: 02/15/2013 STATUS BEGIN DATE: 02/15/2013

TANK CAPACITY (GAL): 5000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO

Order# 121435 Job# 277689 279 of 1203

**CONTAINMENT** 

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 221456 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 600051 REGISTRATION DATE: 03/18/2016

INSTALLATION DATE: 03/04/2016 STATUS BEGIN DATE: 03/04/2016

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219415 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 600052 REGISTRATION DATE: 03/19/2014

INSTALLATION DATE: 01/29/2014 STATUS BEGIN DATE: 01/29/2014

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221907 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 600053 REGISTRATION DATE: 09/06/2016

INSTALLATION DATE: 08/30/2016 STATUS BEGIN DATE: 08/30/2016

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED



Order# 121435 Job# 277689 280 of 1203

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216128 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 600064 REGISTRATION DATE: 02/22/2012

INSTALLATION DATE: 02/14/2012 STATUS BEGIN DATE: 02/14/2012

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **YES**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219033 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 600072 REGISTRATION DATE: 10/16/2013

INSTALLATION DATE: 10/10/2013 STATUS BEGIN DATE: 10/10/2013

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219714 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 600074 REGISTRATION DATE: 06/10/2014

INSTALLATION DATE: 06/10/2014 STATUS BEGIN DATE: 06/10/2014

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223526 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 600076 REGISTRATION DATE: 08/16/2018

INSTALLATION DATE: 08/02/2018 STATUS BEGIN DATE: 08/02/2018

Order# 121435 Job# 277689 281 of 1203

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219389 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 600081 REGISTRATION DATE: 03/05/2014

INSTALLATION DATE: 02/05/2014 STATUS BEGIN DATE: 02/05/2014

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219390 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 600082 REGISTRATION DATE: 03/05/2014

INSTALLATION DATE: 02/05/2014 STATUS BEGIN DATE: 02/05/2014

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219188 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 600085 REGISTRATION DATE: 11/19/2013

INSTALLATION DATE: 11/14/2013 STATUS BEGIN DATE: 11/14/2013

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO



Order# 121435 Job# 277689 282 of 1203

FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216853 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 600091 REGISTRATION DATE: 07/11/2012

INSTALLATION DATE: 07/10/2012 STATUS BEGIN DATE: 07/10/2012
TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **YES**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 217435 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 600092 REGISTRATION DATE: 10/16/2012

INSTALLATION DATE: 10/16/2012 STATUS BEGIN DATE: 10/16/2012

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219189 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: **800062** REGISTRATION DATE: **11/19/2013** 

INSTALLATION DATE: 11/19/2013 STATUS BEGIN DATE: 11/19/2013

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO

Order# 121435 Job# 277689 283 of 1203

CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 221537 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 800071 REGISTRATION DATE: 04/05/2016

INSTALLATION DATE: 04/22/2015 STATUS BEGIN DATE: 04/05/2016

TANK CAPACITY (GAL): NOT REPORTED REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219416 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 800082 REGISTRATION DATE: 03/19/2014

INSTALLATION DATE: 01/29/2014 STATUS BEGIN DATE: 01/29/2014

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216533 MULTIPLE COMPARTMENT FLAG: NC

TANK ID: 800083 REGISTRATION DATE: 05/08/2012

INSTALLATION DATE: 05/07/2012 STATUS BEGIN DATE: 05/07/2012

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: YES
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220243 MULTIPLE COMPARTMENT FLAG: NO

Order# 121435 Job# 277689 284 of 1203

REGISTRATION DATE: 10/08/2014 TANK ID: 800085

INSTALLATION DATE: 08/01/2014 STATUS BEGIN DATE: 08/01/2014

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO **CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 218737 MULTIPLE COMPARTMENT FLAG:

TANK ID: 800095 REGISTRATION DATE: 07/22/2013

INSTALLATION DATE: 07/16/2013 STATUS BEGIN DATE: 07/16/2013

REGULATORY STATUS: FULLY REGULATED TANK CAPACITY (GAL): 8000

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO CONCRETE: NO FIBERGLASS: NO

ALUMINIUM: NO **CONTAINMENT** 

CONCRETE: NO EARTHEN DIKE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220868 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 1000021 REGISTRATION DATE: 05/04/2015

INSTALLATION DATE: 04/24/2015 STATUS BEGIN DATE: 04/24/2015

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO **CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220294 MULTIPLE COMPARTMENT FLAG: TANK ID: 1000051 REGISTRATION DATE: 11/06/2014

INSTALLATION DATE: 10/31/2014 STATUS BEGIN DATE: 10/31/2014

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

Order# 121435 Job# 277689 285 of 1203

#### **MATERIAL OF CONSTRUCTION**

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 220450 MULTIPLE COMPARTMENT FLAG: NC
TANK ID: 1000061 REGISTRATION DATE: 12/18/2014

INSTALLATION DATE: 12/01/2014 STATUS BEGIN DATE: 12/01/2014

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216366 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 1000063 REGISTRATION DATE: 04/02/2012

INSTALLATION DATE: 03/27/2012 STATUS BEGIN DATE: 03/27/2012

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 216499 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 1000065 REGISTRATION DATE: 05/01/2012

INSTALLATION DATE: 04/28/2012 STATUS BEGIN DATE: 04/28/2012

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO

Order# 121435 Job# 277689 286 of 1203

#### **CONTAINMENT**

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219414 MULTIPLE COMPARTMENT FLAG: NC TANK ID: 1000071 REGISTRATION DATE: 03/19/2014

INSTALLATION DATE: 01/29/2014 STATUS BEGIN DATE: 01/29/2014

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221710 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 1000081 REGISTRATION DATE: 06/02/2016

INSTALLATION DATE: 05/31/2016 STATUS BEGIN DATE: 05/31/2016

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221779 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 1000082 REGISTRATION DATE: 07/01/2016

INSTALLATION DATE: 06/02/2016 STATUS BEGIN DATE: 06/02/2016

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED



Order# 121435 Job# 277689 287 of 1203

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222105 MULTIPLE COMPARTMENT FLAG: NC TANK ID: 1000163 REGISTRATION DATE: 01/03/2017

INSTALLATION DATE: 12/27/2016 STATUS BEGIN DATE: 12/27/2016

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221538 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 1200051 REGISTRATION DATE: 04/05/2016

INSTALLATION DATE: 04/22/2015 STATUS BEGIN DATE: NOT REPORTED

TANK CAPACITY (GAL): NOT REPORTED REGULATORY STATUS: FULLY REGULATED

STATUS: NOT REPORTED SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 217292 MULTIPLE COMPARTMENT FLAG: NO
TANK ID: 1200052 REGISTRATION DATE: 09/21/2012

INSTALLATION DATE: 09/13/2012 STATUS BEGIN DATE: 09/13/2012

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **YES**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219308 MULTIPLE COMPARTMENT FLAG: NO
TANK ID: 1200061 REGISTRATION DATE: 01/30/2014

INSTALLATION DATE: 01/27/2014 STATUS BEGIN DATE: 01/27/2014

Order# 121435 Job# 277689 288 of 1203

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220251 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 1200083 REGISTRATION DATE: 10/13/2014

INSTALLATION DATE: 10/02/2014 STATUS BEGIN DATE: 10/02/2014

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219187 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 1200086 REGISTRATION DATE: 11/19/2013

INSTALLATION DATE: 11/14/2013 STATUS BEGIN DATE: 11/14/2013

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221677 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 1200091 REGISTRATION DATE: 05/25/2016

INSTALLATION DATE: 05/06/2016 STATUS BEGIN DATE: 05/06/2016

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO



Order# 121435 Job# 277689 289 of 1203

FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221086 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 1200151 REGISTRATION DATE: 09/03/2015

INSTALLATION DATE: 08/26/2015 STATUS BEGIN DATE: 08/26/2015
TANK CAPACITY (GAL): 1200 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 218357 MULTIPLE COMPARTMENT FLAG: NC
TANK ID: 2000101 REGISTRATION DATE: 03/28/2013

INSTALLATION DATE: 03/25/2013 STATUS BEGIN DATE: 03/25/2013

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 220543 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000102 REGISTRATION DATE: 01/15/2015

INSTALLATION DATE: 12/26/2014 STATUS BEGIN DATE: 12/26/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO

Order# 121435 Job# 277689 290 of 1203

CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 216403 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000111 REGISTRATION DATE: 04/10/2012

INSTALLATION DATE: 04/05/2012 STATUS BEGIN DATE: 04/05/2012
TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: YES STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216758 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000113 REGISTRATION DATE: 06/26/2012

INSTALLATION DATE: 06/15/2012 STATUS BEGIN DATE: 06/15/2012
TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 216854 MULTIPLE COMPARTMENT FLAG: NC
TANK ID: 2000114 REGISTRATION DATE: 07/11/2012

INSTALLATION DATE: 07/10/2012 STATUS BEGIN DATE: 07/10/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: YES
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222486 MULTIPLE COMPARTMENT FLAG: NO

Order# 121435 Job# 277689 291 of 1203

TANK ID: 2000115 REGISTRATION DATE: 07/05/2017

INSTALLATION DATE: 06/23/2017 STATUS BEGIN DATE: 06/23/2017

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216445 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000121 REGISTRATION DATE: 04/17/2012

INSTALLATION DATE: 04/17/2012 STATUS BEGIN DATE: 04/17/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: YES NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216446 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000122 REGISTRATION DATE: 04/17/2012

INSTALLATION DATE: 04/17/2012 STATUS BEGIN DATE: 04/17/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 216580 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000123 REGISTRATION DATE: 05/21/2012

INSTALLATION DATE: 05/17/2012 STATUS BEGIN DATE: 05/17/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

Order# 121435 Job# 277689 292 of 1203

#### **MATERIAL OF CONSTRUCTION**

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 217633 MULTIPLE COMPARTMENT FLAG: NC
TANK ID: 2000126 REGISTRATION DATE: 11/20/2012

INSTALLATION DATE: 11/19/2012 STATUS BEGIN DATE: 11/19/2012
TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: YES NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 217635 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000127 REGISTRATION DATE: 11/20/2012

INSTALLATION DATE: 11/19/2012 STATUS BEGIN DATE: 11/19/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 218266 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000131 REGISTRATION DATE: 03/07/2013

INSTALLATION DATE: 03/04/2013 STATUS BEGIN DATE: 03/04/2013

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: **NO** 

Order# 121435 Job# 277689 293 of 1203

#### **CONTAINMENT**

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 218681 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000132 REGISTRATION DATE: 07/10/2013

INSTALLATION DATE: 07/01/2013 STATUS BEGIN DATE: 07/01/2013

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

#### **MATERIAL OF CONSTRUCTION**

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 218473 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000134 REGISTRATION DATE: 04/30/2013

INSTALLATION DATE: 04/09/2013 STATUS BEGIN DATE: 04/09/2013

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

#### **MATERIAL OF CONSTRUCTION**

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223325 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000136 REGISTRATION DATE: 06/08/2018

INSTALLATION DATE: 06/08/2018 STATUS BEGIN DATE: 06/08/2018

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

#### MATERIAL OF CONSTRUCTION

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

Order# 121435 Job# 277689 294 of 1203

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223322 MULTIPLE COMPARTMENT FLAG: NC TANK ID: 2000137 REGISTRATION DATE: 06/04/2018

INSTALLATION DATE: 05/31/2018 STATUS BEGIN DATE: 05/31/2018

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219306 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000141 REGISTRATION DATE: 01/29/2014

INSTALLATION DATE: 01/22/2014 STATUS BEGIN DATE: 01/22/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219307 MULTIPLE COMPARTMENT FLAG: NO
TANK ID: 2000142 REGISTRATION DATE: 01/30/2014

INSTALLATION DATE: 01/30/2014 STATUS BEGIN DATE: 01/30/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219388 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000143 REGISTRATION DATE: 03/05/2014

INSTALLATION DATE: 02/05/2014 STATUS BEGIN DATE: 02/05/2014

Order# 121435 Job# 277689 295 of 1203

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219350 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000144 REGISTRATION DATE: 02/19/2014

INSTALLATION DATE: 02/07/2014 STATUS BEGIN DATE: 02/07/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219424 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000145 REGISTRATION DATE: 03/20/2014

INSTALLATION DATE: 03/13/2014 STATUS BEGIN DATE: 03/13/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219615 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000146 REGISTRATION DATE: 05/13/2014

INSTALLATION DATE: 05/02/2014 STATUS BEGIN DATE: 05/02/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO

Order# 121435 Job# 277689 296 of 1203

FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219647 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000147 REGISTRATION DATE: 05/20/2014

INSTALLATION DATE: 05/16/2014 STATUS BEGIN DATE: 05/16/2014
TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 220004 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000148 REGISTRATION DATE: 06/23/2014

INSTALLATION DATE: 06/17/2014 STATUS BEGIN DATE: 06/17/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220249 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000149 REGISTRATION DATE: 10/13/2014

INSTALLATION DATE: 10/01/2014 STATUS BEGIN DATE: 10/01/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO



Order# 121435 Job# 277689 297 of 1203

CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 220734 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000151 REGISTRATION DATE: 04/03/2015

INSTALLATION DATE: 03/25/2015 STATUS BEGIN DATE: 03/25/2015
TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 220991 MULTIPLE COMPARTMENT FLAG: NO
TANK ID: 2000152 REGISTRATION DATE: 07/14/2015

INSTALLATION DATE: 07/06/2015 STATUS BEGIN DATE: 07/06/2015

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221019 MULTIPLE COMPARTMENT FLAG: NC
TANK ID: 2000153 REGISTRATION DATE: 07/31/2015

INSTALLATION DATE: 07/24/2015 STATUS BEGIN DATE: 07/24/2015

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221217 MULTIPLE COMPARTMENT FLAG: NO

Order# 121435 Job# 277689 298 of 1203

TANK ID: 2000154 REGISTRATION DATE: 11/04/2015

INSTALLATION DATE: 10/26/2015 STATUS BEGIN DATE: 10/26/2015

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223220 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000161 REGISTRATION DATE: 04/19/2018

INSTALLATION DATE: 04/10/2018 STATUS BEGIN DATE: 04/10/2018

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222987 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000173 REGISTRATION DATE: 02/12/2018

INSTALLATION DATE: 01/18/2018 STATUS BEGIN DATE: 01/18/2018

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216798 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000711 REGISTRATION DATE: 07/02/2012

INSTALLATION DATE: 06/15/2012 STATUS BEGIN DATE: 06/15/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

Order# 121435 Job# 277689 299 of 1203

#### **MATERIAL OF CONSTRUCTION**

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 216857 MULTIPLE COMPARTMENT FLAG: NC
TANK ID: 2000713 REGISTRATION DATE: 07/16/2013

INSTALLATION DATE: 07/16/2012 STATUS BEGIN DATE: 07/16/2012
TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: YES NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219131 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000810 REGISTRATION DATE: 10/30/2013

INSTALLATION DATE: 10/28/2013 STATUS BEGIN DATE: 10/28/2013

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 219037 MULTIPLE COMPARTMENT FLAG: NO
TANK ID: 2000811 REGISTRATION DATE: 10/18/2013

INSTALLATION DATE: 10/17/2013 STATUS BEGIN DATE: 10/17/2013

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO

#### **CONTAINMENT**

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223285 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000816 REGISTRATION DATE: 05/22/2018

INSTALLATION DATE: 05/07/2018 STATUS BEGIN DATE: 05/07/2018

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 218429 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000820 REGISTRATION DATE: 04/18/2013

INSTALLATION DATE: 04/17/2013 STATUS BEGIN DATE: 04/17/2013

TANK CAPACITY (GAL): NOT REPORTED REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220003 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 2000914 REGISTRATION DATE: 06/23/2014

INSTALLATION DATE: 06/13/2014 STATUS BEGIN DATE: 06/13/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED



STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 219351 MULTIPLE COMPARTMENT FLAG: NC TANK ID: 2000915 REGISTRATION DATE: 02/19/2014

INSTALLATION DATE: 02/12/2014 STATUS BEGIN DATE: 02/12/2014

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220992 MULTIPLE COMPARTMENT FLAG: NO
TANK ID: 3000151 REGISTRATION DATE: 07/15/2015

INSTALLATION DATE: 07/08/2015 STATUS BEGIN DATE: 07/08/2015

TANK CAPACITY (GAL): 3000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 223527 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 4000103 REGISTRATION DATE: 08/17/2018

INSTALLATION DATE: 08/12/2018 STATUS BEGIN DATE: 08/12/2018

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO** CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220542 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 4000112 REGISTRATION DATE: 01/15/2015

INSTALLATION DATE: 12/15/2014 STATUS BEGIN DATE: 12/15/2014

Order# 121435 Job# 277689 302 of 1203

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221252 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 4000113 REGISTRATION DATE: 11/30/2015

INSTALLATION DATE: 11/23/2015 STATUS BEGIN DATE: 11/23/2015
TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 222487 MULTIPLE COMPARTMENT FLAG: NC
TANK ID: 4000114 REGISTRATION DATE: 07/05/2017

INSTALLATION DATE: 06/16/2017 STATUS BEGIN DATE: 06/16/2017

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 217610 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 4000121 REGISTRATION DATE: 11/16/2012

INSTALLATION DATE: 11/06/2012 STATUS BEGIN DATE: 11/06/2012

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO



Order# 121435 Job# 277689 303 of 1203

FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 218637 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 4000131 REGISTRATION DATE: 06/25/2013

INSTALLATION DATE: 06/21/2013 STATUS BEGIN DATE: 06/21/2013

TANK CAPACITY (GAL): NOT REPORTED REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 218972 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 4000136 REGISTRATION DATE: 09/27/2013

INSTALLATION DATE: 09/26/2013 STATUS BEGIN DATE: 09/26/2013

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220559 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 4000151 REGISTRATION DATE: 01/28/2015

INSTALLATION DATE: 01/08/2015 STATUS BEGIN DATE: 01/08/2015

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO



Order# 121435 Job# 277689 304 of 1203

CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 220743 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 4000152 REGISTRATION DATE: 04/02/2015

INSTALLATION DATE: 03/20/2015 STATUS BEGIN DATE: 03/20/2015
TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220969 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 4000153 REGISTRATION DATE: 06/26/2015

INSTALLATION DATE: 06/01/2015 STATUS BEGIN DATE: 06/01/2015

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221555 MULTIPLE COMPARTMENT FLAG: NC
TANK ID: 4000161 REGISTRATION DATE: 04/27/2016

INSTALLATION DATE: 04/05/2016 STATUS BEGIN DATE: 04/05/2016

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222044 MULTIPLE COMPARTMENT FLAG: NO



TANK ID: 4000162 REGISTRATION DATE: 12/05/2016

INSTALLATION DATE: 11/01/2016 STATUS BEGIN DATE: 11/01/2016

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 222045 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 4000163 REGISTRATION DATE: 12/05/2016

INSTALLATION DATE: 11/01/2016 STATUS BEGIN DATE: 11/01/2016

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223126 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 4000181 REGISTRATION DATE: 04/05/2018

INSTALLATION DATE: 03/26/2018 STATUS BEGIN DATE: 03/26/2018

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 223529 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 4000182 REGISTRATION DATE: 08/20/2018

INSTALLATION DATE: 07/20/2018 STATUS BEGIN DATE: 07/20/2018

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

#### **MATERIAL OF CONSTRUCTION**

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 218636 MULTIPLE COMPARTMENT FLAG: NC
TANK ID: 4000313 REGISTRATION DATE: 06/25/2013

INSTALLATION DATE: 06/25/2013 STATUS BEGIN DATE: 06/25/2013

TANK CAPACITY (GAL): NOT REPORTED REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216785 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 6000102 REGISTRATION DATE: 06/26/2012

INSTALLATION DATE: 06/13/2012 STATUS BEGIN DATE: 06/13/2012

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **YES**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 221124 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 6000105 REGISTRATION DATE: 09/22/2015

INSTALLATION DATE: 09/08/2015 STATUS BEGIN DATE: 09/08/2015

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO

Order# 121435 Job# 277689 307 of 1203

**CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 218590 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 6000131 REGISTRATION DATE: 06/07/2013

INSTALLATION DATE: 05/31/2013 STATUS BEGIN DATE: 05/31/2013

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 218977 MULTIPLE COMPARTMENT FLAG: NO
TANK ID: 6000132 REGISTRATION DATE: 10/01/2013

INSTALLATION DATE: 09/24/2013 STATUS BEGIN DATE: 09/24/2013

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220900 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 6000152 REGISTRATION DATE: 05/15/2015

INSTALLATION DATE: 05/12/2015 STATUS BEGIN DATE: 05/12/2015

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED



Order# 121435 Job# 277689 308 of 1203

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220970 MULTIPLE COMPARTMENT FLAG: NC TANK ID: 6000153 REGISTRATION DATE: 06/26/2015

INSTALLATION DATE: 06/01/2015 STATUS BEGIN DATE: 06/01/2015

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221070 MULTIPLE COMPARTMENT FLAG: NO
TANK ID: 6000154 REGISTRATION DATE: 08/21/2015

INSTALLATION DATE: 07/27/2015 STATUS BEGIN DATE: 07/27/2015

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221168 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 6000155 REGISTRATION DATE: 10/20/2015

INSTALLATION DATE: 10/12/2015 STATUS BEGIN DATE: 10/12/2015

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221556 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 6000161 REGISTRATION DATE: 04/27/2016

INSTALLATION DATE: 04/26/2016 STATUS BEGIN DATE: 04/26/2016

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **NO** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221850 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 6000162 REGISTRATION DATE: 07/28/2016

INSTALLATION DATE: 07/12/2016 STATUS BEGIN DATE: 07/12/2016

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **NO** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221898 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 6000163 REGISTRATION DATE: 09/01/2016

INSTALLATION DATE: 08/23/2016 STATUS BEGIN DATE: 08/23/2016

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222043 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 6000164 REGISTRATION DATE: 12/05/2016

INSTALLATION DATE: 11/23/2016 STATUS BEGIN DATE: 11/23/2016

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO

Order# 121435 Job# 277689 310 of 1203

FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222641 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 6000171 REGISTRATION DATE: 09/25/2017

INSTALLATION DATE: 06/15/2017 STATUS BEGIN DATE: 06/15/2017
TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 223525 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 6000811 REGISTRATION DATE: 08/16/2018

INSTALLATION DATE: 08/01/2018 STATUS BEGIN DATE: 08/01/2018

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220250 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 8000111 REGISTRATION DATE: 10/13/2014

INSTALLATION DATE: 10/02/2014 STATUS BEGIN DATE: 10/02/2014

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO

CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 220242 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 8000113 REGISTRATION DATE: 10/08/2014

INSTALLATION DATE: 08/01/2014 STATUS BEGIN DATE: 08/01/2014
TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221357 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 8000114 REGISTRATION DATE: 02/04/2016

INSTALLATION DATE: 01/22/2016 STATUS BEGIN DATE: 01/22/2016

TANK CAPACITY (GAL): 80000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220451 MULTIPLE COMPARTMENT FLAG: NC TANK ID: 8000141 REGISTRATION DATE: 12/18/2014

INSTALLATION DATE: 12/01/2014 STATUS BEGIN DATE: 12/01/2014

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222230 MULTIPLE COMPARTMENT FLAG: NO

Order# 121435 Job# 277689 312 of 1203

TANK ID: 8000171 REGISTRATION DATE: 02/28/2017

INSTALLATION DATE: 02/03/2017 STATUS BEGIN DATE: 02/03/2017

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222231 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 8000172 REGISTRATION DATE: 02/28/2017

INSTALLATION DATE: 02/03/2017 STATUS BEGIN DATE: 02/03/2017

TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 218919 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 10000111 REGISTRATION DATE: 09/16/2013

INSTALLATION DATE: 09/09/2013 STATUS BEGIN DATE: 09/09/2013

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 217744 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 10000121 REGISTRATION DATE: 12/20/2012

INSTALLATION DATE: 11/28/2012 STATUS BEGIN DATE: 04/05/2016

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

Order# 121435 Job# 277689 313 of 1203

#### **MATERIAL OF CONSTRUCTION**

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 218589 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 10000131 REGISTRATION DATE: 06/07/2013

INSTALLATION DATE: 05/31/2013 STATUS BEGIN DATE: 05/31/2013

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220871 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 10000151 REGISTRATION DATE: 05/06/2015

INSTALLATION DATE: 04/24/2015 STATUS BEGIN DATE: 04/24/2015

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 221554 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 10000161 REGISTRATION DATE: 04/27/2016

INSTALLATION DATE: 04/25/2016 STATUS BEGIN DATE: 04/25/2016

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO

**CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222232 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 10000171 REGISTRATION DATE: 02/28/2017

INSTALLATION DATE: 02/03/2017 STATUS BEGIN DATE: 02/03/2017

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216939 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 10000316 REGISTRATION DATE: 07/30/2012

INSTALLATION DATE: 07/24/2012 STATUS BEGIN DATE: 07/24/2012

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: YES NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216936 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 12000111 REGISTRATION DATE: 07/27/2012

INSTALLATION DATE: 07/17/2012 STATUS BEGIN DATE: 07/17/2012

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED



Order# 121435 Job# 277689 315 of 1203

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220241 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 12000112 REGISTRATION DATE: 10/08/2014

INSTALLATION DATE: 08/01/2014 STATUS BEGIN DATE: 08/01/2014

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220971 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 12000151 REGISTRATION DATE: 06/26/2015

INSTALLATION DATE: 06/01/2015 STATUS BEGIN DATE: 06/01/2015

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221020 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 12000152 REGISTRATION DATE: 07/31/2015

INSTALLATION DATE: 07/24/2015 STATUS BEGIN DATE: 07/24/2015

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216761 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 12000810 REGISTRATION DATE: 06/27/2012

INSTALLATION DATE: 06/25/2012 STATUS BEGIN DATE: 04/05/2016

Order# 121435 Job# 277689 316 of 1203

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: YES
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 222186 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 20001010 REGISTRATION DATE: 02/22/2017

INSTALLATION DATE: 02/03/2017 STATUS BEGIN DATE: 02/03/2017
TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 217723 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 20001016 REGISTRATION DATE: 12/14/2012

INSTALLATION DATE: 11/27/2012 STATUS BEGIN DATE: 11/27/2012
TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

MATERIAL OF CONSTRUCTION

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: YES
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 216146 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 20001112 REGISTRATION DATE: 02/28/2012

INSTALLATION DATE: 02/16/2012 STATUS BEGIN DATE: 02/16/2012

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO

Order# 121435 Job# 277689 317 of 1203

FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: YES NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 220668 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 20001410 REGISTRATION DATE: 03/10/2015

INSTALLATION DATE: 02/17/2015 STATUS BEGIN DATE: 02/17/2015
TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 220695 MULTIPLE COMPARTMENT FLAG: N
TANK ID: 20001411 REGISTRATION DATE: 03/18/2015

INSTALLATION DATE: 03/10/2015 STATUS BEGIN DATE: 03/10/2015

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 221016 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 100001512 REGISTRATION DATE: 07/30/2015

INSTALLATION DATE: 07/29/2015 STATUS BEGIN DATE: 07/29/2015

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO

Order# 121435 Job# 277689 318 of 1203

CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 215564 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 806020001 REGISTRATION DATE: 09/28/2011

INSTALLATION DATE: 09/28/2011 STATUS BEGIN DATE: 09/28/2011

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 215736 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 6351200075 REGISTRATION DATE: 10/28/2011

INSTALLATION DATE: 10/28/2011 STATUS BEGIN DATE: 10/28/2011

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: YES NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 215510 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 7544200083 REGISTRATION DATE: 09/13/2011

INSTALLATION DATE: 09/13/2011 STATUS BEGIN DATE: 09/13/2011

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: YES NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 215733 MULTIPLE COMPARTMENT FLAG: NO

Order# 121435 Job# 277689 319 of 1203

TANK ID: **7544400062** REGISTRATION DATE: **10/27/2011** 

INSTALLATION DATE: 09/13/2011 STATUS BEGIN DATE: 09/13/2011

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 215458 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 8073200098 REGISTRATION DATE: 08/26/2011

INSTALLATION DATE: 08/25/2011 STATUS BEGIN DATE: 08/25/2011

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: YES NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 215804 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 8196100006 REGISTRATION DATE: 11/22/2011

INSTALLATION DATE: 11/22/2011 STATUS BEGIN DATE: 11/22/2011

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: YES STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 215778 MULTIPLE COMPARTMENT FLAG: NO TANK ID: 8206800011 REGISTRATION DATE: 11/10/2011

INSTALLATION DATE: 11/10/2011 STATUS BEGIN DATE: 09/12/2012
TANK CAPACITY (GAL): 8000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

### **MATERIAL OF CONSTRUCTION**

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 29** 

Distance from Property: 0.047 mi. (248 ft.) WNW

Elevation: 586 ft.

**FACILITY INFORMATION** 

ID#: 78246

NAME: REEDER DISTRIBUTORS

ADDRESS: 5450A WILBARGER ST

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING BEGIN DATE: 10/03/2006 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 10/06/2006 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 10/06/2006 SIGNATURE NAME & TITLE: GINNY KAMPER, CORP COMP DIR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600244339 NAME: REEDER DISTRIBUTORS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/03/2006

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN602853376 NAME: BRETT CONSTRUCTION COMPANY

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE CORPORATION/COMPANY

BEGIN DATE: 10/06/2006

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED **CONTACT INFORMATION** 

NAME: GINNY KAMPER TITLE: NOT REPORTED

ORGANIZATION: REEDER DISTRIBUTORS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4295957 0

GeoSearch www.geo-search.com 888-396-0042

322 of 1203 

ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 207357 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: BRETT REGISTRATION DATE: 10/06/2006

INSTALLATION DATE: 10/03/2006 STATUS BEGIN DATE: 05/26/2009

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

Order# 121435 Job# 277689 323 of 1203

**MAP ID# 30** 

Distance from Property: 0.048 mi. (253 ft.) E

Elevation: 644 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 091229

LPST ID: 091229

FACILITY ID: 0026619

NAME: EXXON STATION 64732

ADDRESS: 6601 BRENTWOOD STAIR RD

FORT WORTH, TX

### **LEAKING TANK DETAILS**

LPST ID: 091229

NAME: EXXON STATION 64732

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 2.5 - GW IMPACT PUBLIC/DOMESTIC WATER SUPPLY WELL W/IN 0.25MI

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 2/24/87

REPORTED DATE: 1/30/1987 ENTERED DATE: 2/24/1987

PRP INFORMATION
NAME: EXXONMOBIL

ADDRESS: ADDRESS NOT REPORTED

**HOUSTON TX 77210** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 30** 

Distance from Property: 0.048 mi. (253 ft.) E

Elevation: 644 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 113780

LPST ID: 113780

FACILITY ID: 0026619

NAME: FINA STATION RAS 64732

ADDRESS: 6601 BRENTWOOD STAIR RD

FORT WORTH, TX

### **LEAKING TANK DETAILS**

LPST ID: 113780

NAME: FINA STATION RAS 64732 FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 12/7/98

REPORTED DATE: 12/4/1998 ENTERED DATE: 12/7/1998

PRP INFORMATION

NAME: ATLANTIC OIL & GAS INC

ADDRESS: ADDRESS NOT REPORTED

**ADDISON TX 75248** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1A NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 09/19/1996 REGISTRATION DATE: 06/18/1999

TANK CAPACITY (GAL): 19975 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/23/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**COMPOSITE** 

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 325 of 1203

UST COMPARTMENT ID: 36930

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12044

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 09/19/1996 REGISTRATION DATE: 06/18/1999

TANK CAPACITY (GAL): 19975 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/23/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**COMPOSITE** 

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 36931

TANK ID: 1A

COMPARTMENT LETTER: B
SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 7931

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1B NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1963 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/21/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 36926

TANK ID: 1B

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

Order# 121435 Job# 277689 327 of 1203

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/09/2007 REGISTRATION DATE: 01/07/2008

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 08/09/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36932

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1963 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/21/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

GeoSearch www.geo-search.com 888-396-0042

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36928

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/09/2007 REGISTRATION DATE: 01/07/2008

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 08/09/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

Order# 121435 Job# 277689 329 of 1203

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 36933

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: **3A** NUMBER OF COMPARTMENTS: **1**INSTALLATION DATE: **01/01/1963** REGISTRATION DATE: **05/08/1986** 

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/21/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 36927

TANK ID: 3A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/09/2007 REGISTRATION DATE: 01/07/2008

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 08/09/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36934

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES



Order# 121435 Job# 277689 331 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1965 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/21/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36929

TANK ID: 4A

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

**MAP ID# 30** 

Distance from Property: 0.048 mi. (253 ft.) E

Elevation: 644 ft.

**FACILITY INFORMATION** 

ID#: 26619

NAME: QUIKTRIP 861

ADDRESS: 6601 BRENTWOOD STAIR RD

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 10/15/1986

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 04/17/2013 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/18/2013

SIGNATURE NAME & TITLE: LAURA THOMPSON, ENV COMP ADMINISTRATOR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600241673 NAME: QUIKTRIP CORPORATION

CONTACT ADDRESS: 4705 S 129TH EAST AVE

**TULSA OK 74134** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/26/2007 CONTACT ROLE: OWNCON

CONTACT NAME: LAURA THOMPSON CONTACT TITLE: ENV ENGINEER

ORGANIZATION: QUIKTRIP CORPORATION

PHONE: (918) 6157990 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600241673 NAME: QUIKTRIP CORPORATION

CONTACT ADDRESS: 14450 TRINITY BLVD

FORT WORTH TX 76155

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/26/2007 CONTACT ROLE: OPRCON

CONTACT NAME: BILL D ARKISON CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: AMY OGG

TITLE: STORE SUPERVISOR ORGANIZATION: QUIKTRIP 861

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 7181394 0

GeoSearch www.geo-search.com 888-396-0042

333 of 1203 

ORGANIZATION: QUIKTRIP CORPORATION

PHONE: **(817) 3587694 0** FAX: **(817) 8580213** 

EMAIL: WMCMENNA@QUICKTRIP.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 300446 SIGNATURE DATE: 03/05/2018

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENV COMPLIANCE MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 284023
SIGNATURE DATE: 03/21/2017

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENV. COMPLIANCE MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 268184
SIGNATURE DATE: 04/15/2016

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENV. COMPLI. MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 250145
SIGNATURE DATE: 03/09/2015

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENVIRO COMPL ADMIN

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 233528
SIGNATURE DATE: 03/13/2014

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENVIRON.COMP. ADMIN.

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 218514
SIGNATURE DATE: 03/18/2013

SIGNATURE NAME & TITLE: LAURA THOMPSON, ENV COMP ADMIN

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38043
SIGNATURE DATE: 03/13/2012

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENVIRONMENTAL COORD.

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38042
SIGNATURE DATE: 03/09/2011

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENVIRONMENTAL COORD.

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38041
SIGNATURE DATE: 03/09/2010

SIGNATURE NAME & TITLE: MOLLY WRATZ, ENV COMP ENG

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38040
SIGNATURE DATE: 03/13/2009

SIGNATURE NAME & TITLE: MOLLY WRATZ, ENV COMP ENG

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38039
SIGNATURE DATE: 12/12/2007

SIGNATURE NAME & TITLE: MONICA OLASON, ENV COMP ENGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38038
SIGNATURE DATE: 12/11/2007

SIGNATURE NAME & TITLE: MONICA OLASON, ENV COMP ENGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38037
SIGNATURE DATE: 08/26/2006

SIGNATURE NAME & TITLE: ESHETU TEKLU, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38036
SIGNATURE DATE: 08/25/2005

SIGNATURE NAME & TITLE: ESHETU TEKLU, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38035
SIGNATURE DATE: 06/16/2005

SIGNATURE NAME & TITLE: ESHETU TEKLU, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38034
SIGNATURE DATE: 02/18/2004

SIGNATURE NAME & TITLE: PERRY MOLUBHOY, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38033
SIGNATURE DATE: 04/22/2003

SIGNATURE NAME & TITLE: PERRY MOLUBHOY, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38032
SIGNATURE DATE: 09/24/2002

SIGNATURE NAME & TITLE: PERRY MOLUBHOY, NOT REPORTED

FILING STATUS: INITIAL

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 38031
SIGNATURE DATE: 01/18/2001

SIGNATURE NAME & TITLE: A NOORALI, MGR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 3393

APPLICATION RECEIVED DATE: 05/21/2007

SCHEDULE CONSTRUCTION DATE: 05/14/2007

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

NOTIFICATION CONSTRUCTION ID: 3392

APPLICATION RECEIVED DATE: 07/09/2007

SCHEDULE CONSTRUCTION DATE: 08/08/2007

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

NOTIFICATION CONSTRUCTION ID: 3391

APPLICATION RECEIVED DATE: 09/27/2002

SCHEDULE CONSTRUCTION DATE: 09/17/2002

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1A NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 09/19/1996 REGISTRATION DATE: 06/18/1999

TANK CAPACITY (GAL): 19975 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/23/2007** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36930

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12044



COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL.INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 09/19/1996 REGISTRATION DATE: 06/18/1999

TANK CAPACITY (GAL): 19975 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/23/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES
PIPE DESIGN SINGLE WALL: YES
PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36931

TANK ID: 1A

COMPARTMENT LETTER: B
SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 7931

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1B NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1963 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/21/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36926

TANK ID: 1B

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO

Order# 121435 Job# 277689 338 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/09/2007 REGISTRATION DATE: 01/07/2008

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 08/09/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:
FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36932

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1963 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/21/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36928

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/09/2007 REGISTRATION DATE: 01/07/2008

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 08/09/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

Order# 121435 Job# 277689 340 of 1203

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36933

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: **3A** NUMBER OF COMPARTMENTS: **1**INSTALLATION DATE: **01/01/1963** REGISTRATION DATE: **05/08/1986** 

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/21/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36927

TANK ID: 3A

COMPARTMENT LETTER: A

Order# 121435 Job# 277689 341 of 1203

SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/09/2007 REGISTRATION DATE: 01/07/2008

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 08/09/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36934

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

Order# 121435 Job# 277689 342 of 1203

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1965 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/21/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36929

TANK ID: 4A

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

# Dry Cleaner Registration Database (DCR)

**MAP ID# 31** 

Distance from Property: 0.049 mi. (259 ft.) NNW

Elevation: 617 ft.

**FACILITY INFORMATION** 

REGISTRATION #: RN103951778 CUSTOMER #: CN604534552 NAME: BOSS CLEANERS

ADDRESS: 5817 W INTERSTATE 20 STE 410

ARLINGTON, TX 76017

ACCOUNT NUMBER: 24,007,014

PRINCIPAL NAME: L & R WORLD REMNANT LLC

PHONE NUMBER: 817-5615333
SITE TYPE: FACILITY REGISTRATION

FISCAL YEAR: FY2018
SOLVENT: PETROLEUM
QUANTITY: 25 GALLONS

FISCAL YEAR: FY2017
SOLVENT: PETROLEUM
QUANTITY: 25 GALLONS

FISCAL YEAR: FY2017
SOLVENT: PETROLEUM
QUANTITY: 25 GALLONS

FISCAL YEAR: FY2016
SOLVENT: PETROLEUM
QUANTITY: 1 GALLONS

FISCAL YEAR: FY2016
SOLVENT: PETROLEUM
QUANTITY: 1 GALLONS

FISCAL YEAR: FY2015
SOLVENT: PETROLEUM
QUANTITY: 1 GALLONS

FISCAL YEAR: FY2014
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2007

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 60 GALLONS

FISCAL YEAR: FY2006
SOLVENT: NOT REPORTED

# Dry Cleaner Registration Database (DCR)

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2005

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 0 GALLONS

FISCAL YEAR: FY2004

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 31** 

Distance from Property: 0.049 mi. (259 ft.) NNW

Elevation: 617 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 72629 EPA ID: TXD130160526

TNRCC ID #: 27068

NAME: CENTRE CLEANERS INTERSTATE 20 W

ADDRESS: 5817 W INTERSTATE 20 STE 410

**ARLINGTON, TX 76017** 

CONTACT: NOZAR DARYAPAYMA

PHONE: 817-5722356

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 11/02/2006

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 150356

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: PERC SLUDGE

WASTE ID: 150357

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: PERC FILTERS

WASTE ID: **52804** 

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

OWNER INFORMATION

NAME: CENTRE SERVICES INC

ADDRESS: 1360 W CAMPBELL RD STE 126

RICHARDSON, TX 75080

PHONE: 1-817-5722356

GeoSearch www.geo-search.com 888-396-0042

## Industrial and Hazardous Waste Sites (IHW)

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 31** 

Distance from Property: 0.049 mi. (259 ft.) NNW

Elevation: 617 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD130160526 OWNER TYPE: PRIVATE

NAME: CENTRE CLEANERS OWNER NAME: CENTRE CLEANERS

ADDRESS: 5817 INTERSTATE 20 W STE 410 OPERATOR TYPE: PRIVATE

ARLINGTON, TX 76017 OPERATOR NAME: CENTRE CLEANERS

CONTACT NAME: NOZAR DARYAPAYMA

CONTACT ADDRESS: 1360 W CAMPBELL RD STE 126

**RICHARDSON TX 75080** 

CONTACT PHONE: 817-572-2356

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 11/02/2006

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

NOZAR DARYAPAYMA ENVIRONMENTAL M 11/02/2006 NOZAR DARYAPAYMA UNKNOWN 08/21/2001

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 11/09/2006

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: **NO**UNIVERSAL WASTE DESTINATION FACILITY: **NO** 

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS - NO ENFORCEMENTS REPORTED -**

HAZARDOUS WASTE

D007 CHROMIUM

D039 TETRACHLOROETHYLENE

Order# 121435 Job# 277689 349 of 1203

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

F002

THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

**MAP ID# 32** 

Distance from Property: 0.049 mi. (259 ft.) NE

Elevation: 636 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 114841

LPST ID: 114841

FACILITY ID: 0072639

NAME: FORMER SERVICE STATION
ADDRESS: 4213 WILBARGER ST
FORT WORTH, TX

FORT WORTH, I

#### **LEAKING TANK DETAILS**

LPST ID: 114841

NAME: FORMER SERVICE STATION
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 1/10/00

REPORTED DATE: 11/7/1999 ENTERED DATE: 1/10/2000

PRP INFORMATION

NAME: WELLS FARGO CO MAC T5776 030 ADDRESS: ADDRESS NOT REPORTED

DENTON TX 76201
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 11/12/1999

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/17/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT NON-USE SINCE 1974

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 351 of 1203

UST COMPARTMENT ID: 172425

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 11/12/1999

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/17/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT NON-USE SINCE 1974

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 172426

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL



Order# 121435 Job# 277689 352 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 11/12/1999

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/17/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT NON-USE SINCE 1974

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 172427

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 11/12/1999

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/17/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT NON-USE SINCE 1974

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 172428

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 32** 

Distance from Property: 0.049 mi. (259 ft.) NE

Elevation: 636 ft.

**FACILITY INFORMATION** 

ID#: **72639** 

NAME: VACANT STATION

ADDRESS: 4213 WILBARGER ST

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 08/31/1987 STATUS: INACTIVE EXEMPT STATUS: YES RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 11/12/1999 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 11/08/1999

SIGNATURE NAME & TITLE: JAMES TAYLOR, MANAGER

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601196892

NAME: HARPER LEONARD W AND ROBERTA BLEWETT CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 08/31/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 19838

APPLICATION RECEIVED DATE: 11/08/1999

SCHEDULE CONSTRUCTION DATE: 11/16/1999

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**CONTACT INFORMATION** 

NAME: NOT REPORTED
TITLE: NOT REPORTED

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 11/12/1999

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/17/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT NON-USE SINCE 1974

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 172425

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 11/12/1999

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/17/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT NON-USE SINCE 1974

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 172426

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 11/12/1999

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/17/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT NON-USE SINCE 1974

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 357 of 1203

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 172427

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 11/12/1999

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **11/17/1999**INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **EXEMPT NON-USE SINCE 1974** 

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 172428

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

#### **PIPING SYSTEMS**

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: BOB MCCASLIN ANCHOR

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: D NIMPTON

PHONE: (817) 4297667 0

TITLE: VP

**MAP ID# 33** 

Distance from Property: 0.05 mi. (264 ft.) ESE

Elevation: 582 ft.

**FACILITY INFORMATION** 

ID#: **29815** 

NAME: BOB MCCASLIN ANCHOR ADDRESS: 3951 E LOOP 820 S

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: UNKNOWN
BEGIN DATE: 10/30/1986
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/09/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/19/1986

SIGNATURE NAME & TITLE: **D NIMPTON, VP**ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600816052
NAME: BOB MCCASLIN ANCHOR CO

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 10/30/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/09/1986
TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/31/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 71076

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/09/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/31/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 361 of 1203

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 71077

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

# PIPING SYSTEMS MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

#### **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 34** 

Distance from Property: 0.05 mi. (264 ft.) NW

Elevation: 647 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 109967

LPST ID: 109967

FACILITY ID: 0033155

NAME: SHELL OIL CO RETAIL FACILITY
ADDRESS: 6517 BRENTWOOD STAIR RD

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 109967

NAME: SHELL OIL CO RETAIL FACILITY
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 3.5 - A DESIGNATED MAJOR OR MINOR AQUIFER IS IMPACTED CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 11/13/95

REPORTED DATE: 1/12/1990 ENTERED DATE: 11/13/1995

PRP INFORMATION
NAME: SHELL OIL CO

ADDRESS: ADDRESS NOT REPORTED

OAK BROOK IL 60522

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY
STATUS: PERM FILLED IN PLACE STATUS BEGIN DATE: 05/30/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL
CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 363 of 1203

UST COMPARTMENT ID: 22855

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: **PERM FILLED IN PLACE** STATUS BEGIN DATE: **05/30/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 22858

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

Order# 121435 Job# 277689 364 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **PERM FILLED IN PLACE** STATUS BEGIN DATE: **05/30/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 22857

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1986

Order# 121435 Job# 277689 365 of 1203

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: PERM FILLED IN PLACE STATUS BEGIN DATE: 05/30/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

**CORROSION PROTECTION:** 

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 22856

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 44 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/07/1998
INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:



Order# 121435 Job# 277689 366 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 22860

TANK ID: 5

COMPARTMENT LETTER: A

SUBSTANCES: HYDRAULIC LIFT OIL
OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 44

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 44 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 22859

TANK ID: 6

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 44

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 34** 

Distance from Property: 0.05 mi. (264 ft.) NW

Elevation: 647 ft.

**FACILITY INFORMATION** 

ID#: **33155** 

NAME: SHELL OILCO RETAIL FACILITY
ADDRESS: 6517 BRENTWOOD STAIR RD

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 12/01/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/05/1986

SIGNATURE NAME & TITLE: **B T BATY, DIST MGR.** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600124051
NAME: MOTIVA ENTERPRISES LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/01/1998

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

CONTACT INFORMATION

NAME: P H CARROLL

TITLE: DEALER MGR.

ORGANIZATION: SHELL OIL CO RETAIL FACILITY
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4516262 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 369 of 1203

STATUS: **PERM FILLED IN PLACE** STATUS BEGIN DATE: **05/30/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 22855

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY
STATUS: PERM FILLED IN PLACE STATUS BEGIN DATE: 05/30/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 370 of 1203

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 22858

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: **NOT REPORTED** CAPACITY (GAL): **NOT REPORTED** 

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: PERM FILLED IN PLACE STATUS BEGIN DATE: 05/30/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 22857

TANK ID: 3

Order# 121435 Job# 277689 371 of 1203

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **PERM FILLED IN PLACE** STATUS BEGIN DATE: **05/30/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 22856

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED

Order# 121435 Job# 277689 372 of 1203

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 44 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 22860

TANK ID: 5

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 44

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 1

INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 44 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 22859

TANK ID: 6

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 44

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

OWNER INFORMATION

ADDRESS: PO BOX 2470

PHONE: 1-714-8512259

**NEWPORT BEACH, CA 92658** 

**MAP ID# 35** 

Distance from Property: 0.051 mi. (269 ft.) NNW

Elevation: 630 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 76133 EPA ID: TXD987983681 NAME: ECONO LUBE NTUNE INC

TNRCC ID #: 30461

NAME: ECONO LUBE N TUNE 169

ADDRESS: 5890 W POLY WEBB RD

**ARLINGTON, TX 76016** 

CONTACT: CHUCK CARTER

PHONE: **714-8512259** 

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/07/2003

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

WASTE NO RECORDS

**Back to Report Summary** 



**MAP ID# 35** 

Distance from Property: 0.051 mi. (269 ft.) NNW

Elevation: 630 ft.

**FACILITY INFORMATION** 

ID#: **48700** 

NAME: MEINEKE CARE CENTER 4169

ADDRESS: 5980 W PONY WEBB RD

ARLINGTON, TX 76016

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 01/01/1989

STATUS: **ACTIVE**EXEMPT STATUS: **NO**RECORDS OFF-SITE: **NO** 

NUMBER OF ACTIVE UNDERGROUND TANKS: 1 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 07/14/1989
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 07/12/1989

SIGNATURE NAME & TITLE: SAME, SAME ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN605237635
NAME: LANDIS PROPERTIES LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/23/2012

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OWNER NUMBER: CN600249965
NAME: ECONO LUBE N TUNE INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 07/17/1989

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED

CONTACT INFORMATION

NAME: JORGE CEREIJO
TITLE: NOT REPORTED

ORGANIZATION: MEINEKE CAR CARE CENTER 4169
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 4761272 0

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN604733170

NAME: CIPERCEN LLC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/01/2015

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1989 REGISTRATION DATE: 07/14/1989

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 01/01/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 118247

TANK ID: 1

COMPARTMENT LETTER: A

SUBSTANCES: **NEW** 

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 36** 

Distance from Property: 0.051 mi. (269 ft.) ESE

Elevation: 644 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 109721

LPST ID: 109721

FACILITY ID: 0003612

NAME: WORKINGMANS FRIEND 510 ADDRESS: 1801 E LOOP 820

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 109721

NAME: WORKINGMANS FRIEND 510
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 8/28/95

REPORTED DATE: **7/21/1995** ENTERED DATE: **8/28/1995** 

PRP INFORMATION

NAME: WORKING MANS FRIEND OIL CO ADDRESS: ADDRESS NOT REPORTED

TOPEKA KS 66603
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/16/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 379 of 1203

UST COMPARTMENT ID: 12502

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/16/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 12504

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/16/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 12503

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY



**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: WORKINGMANS FRIEND 510

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: MIKE PULLEY

TITLE: SUPERVISOR

PHONE: (214) 7240120 0

**MAP ID# 36** 

Distance from Property: 0.051 mi. (269 ft.) ESE

Elevation: 644 ft.

**FACILITY INFORMATION** 

ID#: **3612** 

NAME: WORKINGMANS FRIEND 510

ADDRESS: 1801 E LOOP 820

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: UNKNOWN
BEGIN DATE: 06/16/1986
STATUS: INACTIVE
EXEMPT STATUS: NO

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/11/1986

SIGNATURE NAME & TITLE: GY L COOK, ASST VP ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN602552937

NAME: WORKINGMANS FRIEND OIL INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/16/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/16/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 12502

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/16/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:



Order# 121435 Job# 277689 384 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 12504

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/16/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 12503

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

# Resource Conservation & Recovery Act - Generator (RCRAGR06)

**MAP ID# 37** 

Distance from Property: 0.052 mi. (275 ft.) NNE

Elevation: 606 ft.

**FACILITY INFORMATION** 

EPA ID#: TX0000276121 OWNER TYPE: PRIVATE

NAME: NICHOLS FORD COLLISION CENTER OWNER NAME: KEN NICHOLS NICHOLS FORD

ADDRESS: 5105 MARTIN LUTHER KING FWY

OPERATOR TYPE: NOT REPORTED

FORT WORTH, TX 76119

OPERATOR NAME: NOT REPORTED

FORT WORTH, TX 76119
CONTACT NAME: JERRY GILBREATH

CONTACT ADDRESS: 5105 MARTIN LUTHER KING FWY

**FORT WORTH TX 76119** 

CONTACT PHONE: 817-496-0222

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 05/09/1994

CERTIFICATION - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

- CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: SMALL QUANTITY GENERATOR LAST UPDATED DATE: 09/02/2000

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - **NO EVALUATIONS REPORTED** - <u>VIOLATIONS</u> - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS

FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 387 of 1203

### Resource Conservation & Recovery Act - Generator (RCRAGR06)

F005

THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

**MAP ID# 38** 

Distance from Property: 0.052 mi. (275 ft.) S

Elevation: 653 ft.

**FACILITY INFORMATION** 

ID#: **57186** 

NAME: ANGLIN FOOD STORE
ADDRESS: 4724 SE LOOP 820

FOREST HILL, TX 76140

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 01/04/1991

STATUS: **ACTIVE**EXEMPT STATUS: **NO**RECORDS OFF-SITE: **NO** 

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 04/13/2018
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/26/2018

SIGNATURE NAME & TITLE: GULNAR NOORANI, VP ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600834337
NAME: NOORANI CORPORATION

CONTACT ADDRESS: 4724 SE LOOP 820

**FOREST HILL TX 76140** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/24/1995 CONTACT ROLE: OWNCON

CONTACT NAME: GULNAR NOORANI

CONTACT TITLE: MANAGER

ORGANIZATION: NOORANI CORPORATION

PHONE: (817) 4786242 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN600834337

NAME: NOORANI CORPORATION

CONTACT ADDRESS: 4724 SE LOOP 820

FOREST HILL TX 76140

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/24/1995 CONTACT ROLE: OPRCON

CONTACT NAME: GULNAR NOORANI

CONTACT TITLE: VP

CONTACT INFORMATION

NAME: GULNAR NOORANI

TITLE: VP

ORGANIZATION: ANGLIN FOOD STORE

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 4786242 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: NOORANI CORPORATION

PHONE: (817) 4786242 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 302507 SIGNATURE DATE: 02/26/2018

SIGNATURE NAME & TITLE: GULNAR NOORANI, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 284531
SIGNATURE DATE: 02/07/2017

SIGNATURE NAME & TITLE: GULNAR NOORANI, VICE PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 267750
SIGNATURE DATE: 03/02/2016

SIGNATURE NAME & TITLE: GULNAR NOORANI, VICE PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 251212
SIGNATURE DATE: 03/14/2015

SIGNATURE NAME & TITLE: GULNAR NOORANI, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 234036
SIGNATURE DATE: 02/11/2014

SIGNATURE NAME & TITLE: GULNAR NOORANI, V PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 218584
SIGNATURE DATE: 04/19/2013

SIGNATURE NAME & TITLE: GULNAR NOORANI, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109808
SIGNATURE DATE: 03/10/2012

SIGNATURE NAME & TITLE: GULNAR NOORANI, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109807
SIGNATURE DATE: 03/01/2011

SIGNATURE NAME & TITLE: GULNAR NOORANI,  ${f VP}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109806
SIGNATURE DATE: 03/20/2010

SIGNATURE NAME & TITLE: GULNAR NOORANI, REP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109805
SIGNATURE DATE: 03/20/2009

SIGNATURE NAME & TITLE: GULNAR NOORANI, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109804
SIGNATURE DATE: 03/30/2008

SIGNATURE NAME & TITLE: GULNAR NOORANI, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109803
SIGNATURE DATE: 02/27/2007

SIGNATURE NAME & TITLE: GULNAR NOORANI, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109802
SIGNATURE DATE: 02/21/2006

SIGNATURE NAME & TITLE: GULNAR NOORANI, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109801
SIGNATURE DATE: 03/07/2005

SIGNATURE NAME & TITLE: GULNAR NOORANI, VICE PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109800
SIGNATURE DATE: 03/08/2004

SIGNATURE NAME & TITLE: GULNAR NOORANI, VICE PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109799
SIGNATURE DATE: 03/10/2003

SIGNATURE NAME & TITLE: GULNAR NOORANI, V PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109798
SIGNATURE DATE: 02/15/2002

SIGNATURE NAME & TITLE: GULNAR NOORANI, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109797
SIGNATURE DATE: 02/14/2001

SIGNATURE NAME & TITLE: WAZIR NOORANI, OWNER

FILING STATUS: INITIAL

REGISTRATION FLAG: YES

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1990 REGISTRATION DATE: 12/29/1990

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 11/01/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 120653

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1990 REGISTRATION DATE: 12/29/1990

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 120652

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1990 REGISTRATION DATE: 12/29/1990

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:



Order# 121435 Job# 277689 393 of 1203

#### **COMPOSITE**

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 120654

TANK ID: 3

COMPARTMENT LETTER: A
SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 394 of 1203

**MAP ID# 39** 

Distance from Property: 0.054 mi. (285 ft.) ESE

Elevation: 581 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 114484

LPST ID: 114484

FACILITY ID: 0028192

NAME: TEX O KAN TRANSPORTATION CO INC

ADDRESS: 3301 E LOOP 820 S

FORT WORTH, TX

### **LEAKING TANK DETAILS**

LPST ID: 114484

NAME: TEX O KAN TRANSPORTATION CO INC

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.0 - ASSESSMENT INCOMPLETE NO APPARENT RECEPTORS IMPACTED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 1/19/00

REPORTED DATE: 1/1/1999 ENTERED DATE: 1/19/2000

PRP INFORMATION

NAME: TEX O KAN TRANSPORTATION
ADDRESS: ADDRESS NOT REPORTED

**FORT WORTH TX 76119** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/15/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/01/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 395 of 1203

UST COMPARTMENT ID: 121612

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1984 REGISTRATION DATE: 05/15/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/01/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 121611

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/15/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/01/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 121610

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/15/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 03/02/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 121609

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

AST ID #: 213066 MULTIPLE COMPARTMENT FLAG: YES

TANK ID: 13092 REGISTRATION DATE: 01/21/2010

INSTALLATION DATE: 12/10/2009 STATUS BEGIN DATE: 06/13/2014

TANK CAPACITY (GAL): 3000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL, GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: **NO CONTAINMENT** 

Order# 121435 Job# 277689 398 of 1203

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

**MAP ID# 39** 

Distance from Property: 0.054 mi. (285 ft.) ESE

Elevation: 581 ft.

**FACILITY INFORMATION** 

ID#: **28192** 

NAME: TEXAS STATE UTILITIES
ADDRESS: 3301 E LOOP 820 S

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING
BEGIN DATE: 10/23/1986
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 06/26/2014 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 06/24/2014

SIGNATURE NAME & TITLE: R J PARROTT, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600345193

NAME: RANPARR INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/10/2009

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN603632209

NAME: TEXAS STATE UTILITIES INC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/10/2009

CONTACT ROLE: **NOT REPORTED**CONTACT NAME: **NOT REPORTED**CONTACT TITLE: **NOT REPORTED** 

CONTACT INFORMATION

NAME: **R J PARROTT**TITLE: **NOT REPORTED** 

ORGANIZATION: TEXAS STATE UTILITIES

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (214) 4969898 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 11045

APPLICATION RECEIVED DATE: 11/03/2009

SCHEDULE CONSTRUCTION DATE: 12/03/2009

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

#### **NOT REPORTED**

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/15/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/01/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

### **TANK DETAILS**

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 121612

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 



Order# 121435 Job# 277689 401 of 1203

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1984 REGISTRATION DATE: 05/15/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/01/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 121611

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/15/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/01/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO

Order# 121435 Job# 277689 402 of 1203

PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 121610

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/15/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **03/02/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

Order# 121435 Job# 277689 403 of 1203

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 121609

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: **STEEL**CORROSION PROTECTION:

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

AST ID #: 213066 MULTIPLE COMPARTMENT FLAG: YES

TANK ID: 13092 REGISTRATION DATE: 01/21/2010

INSTALLATION DATE: 12/10/2009 STATUS BEGIN DATE: 06/13/2014

TANK CAPACITY (GAL): 3000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL, GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: YES
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 404 of 1203

**CONTACT INFORMATION** 

ORGANIZATION: DYKES AIR

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: R W THOMPSON

PHONE: (817) 4781191 0

TITLE: VP

**MAP ID# 40** 

Distance from Property: 0.056 mi. (296 ft.) S

Elevation: 653 ft.

**FACILITY INFORMATION** 

ID#: **836** 

NAME: DYKES AIR

ADDRESS: 4800 SE LOOP 820

FORT WORTH, TX 76140

COUNTY: TARRANT

REGION: 4

TYPE: UNKNOWN
BEGIN DATE: 05/30/1986
STATUS: INACTIVE
EXEMPT STATUS: NO

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/04/1986

SIGNATURE NAME & TITLE: R W THOMPSON, VP ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600827844

NAME: DYKES AIR INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/30/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1980 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 405 of 1203

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/05/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 4131

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 41** 

Distance from Property: 0.057 mi. (301 ft.) E

Elevation: 592 ft.

**FACILITY INFORMATION** 

ID#: 63883

NAME: PARADISE QUICK STOP 1 ADDRESS: 5401 SUN VALLEY DR

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 12/02/1992

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 4 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 03/30/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/27/2018

SIGNATURE NAME & TITLE: ANWAR DOSSANI, PRESIDENT

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601571987 NAME: ALS QUICK STOP INC

CONTACT ADDRESS: 520 E NORTHWEST HWY STE 100

**GRAPEVINE TX 76051** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/01/1994 CONTACT ROLE: OWNCON CONTACT NAME: SAL SAL CONTACT TITLE: MANAGER

ORGANIZATION: ALS QUICK STOP INC

PHONE: (817) 5722269 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN601571987 NAME: ALS QUICK STOP INC

CONTACT ADDRESS: 520 E NORTHWEST HWY STE 100

**GRAPEVINE TX 76051** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/01/1994

CONTACT ROLE: OWNOPRCON CONTACT NAME: SAM MERCHANT

CONTACT TITLE: MGR

**CONTACT INFORMATION** 

NAME: SAL SAL TITLE: MGR

ORGANIZATION: PARADISE QUICK STOP 1

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 5722269 0

ORGANIZATION: ALS QUICK STOP INC

PHONE: (817) 4421159 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 302195 SIGNATURE DATE: 03/27/2018

SIGNATURE NAME & TITLE: ANWAR DOSSANI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 285205
SIGNATURE DATE: 03/27/2017

SIGNATURE NAME & TITLE: ANWAR DOSSANI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 268493
SIGNATURE DATE: 03/29/2016

SIGNATURE NAME & TITLE: ANWAR DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 253254
SIGNATURE DATE: 05/09/2015

SIGNATURE NAME & TITLE: ANWAR DOSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 235097
SIGNATURE DATE: 03/14/2014

SIGNATURE NAME & TITLE: ANWAR DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 219410
SIGNATURE DATE: 05/02/2013

SIGNATURE NAME & TITLE: LUCKY LAXMAN, ACCOUNTANT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 155560
SIGNATURE DATE: 04/03/2012

SIGNATURE NAME & TITLE: AL DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 155559
SIGNATURE DATE: 03/22/2011

SIGNATURE NAME & TITLE: AL DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 155558
SIGNATURE DATE: 03/22/2010

SIGNATURE NAME & TITLE: AL DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 155557
SIGNATURE DATE: 03/24/2009

SIGNATURE NAME & TITLE: ANWAR DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 155556
SIGNATURE DATE: 05/01/2008

SIGNATURE NAME & TITLE: ANWAR DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 155555
SIGNATURE DATE: 05/21/2007

SIGNATURE NAME & TITLE: ANWAR DOSSANI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 155554
SIGNATURE DATE: 04/27/2006

SIGNATURE NAME & TITLE: ANWAR DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 155553
SIGNATURE DATE: 05/13/2005

SIGNATURE NAME & TITLE: AL DOSSANI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 155552
SIGNATURE DATE: 03/22/2004

SIGNATURE NAME & TITLE: AL DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 155551
SIGNATURE DATE: 03/31/2003

SIGNATURE NAME & TITLE: AL DOSSANI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 155550
SIGNATURE DATE: 07/26/2002

SIGNATURE NAME & TITLE: AL DOSSANI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 155549
SIGNATURE DATE: 03/01/2001

SIGNATURE NAME & TITLE: AL DOSSANI, OWNER

FILING STATUS: INITIAL

Order# 121435 Job# 277689 409 of 1203

REGISTRATION FLAG: YES

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 33224

APPLICATION RECEIVED DATE: 07/03/2018

SCHEDULE CONSTRUCTION DATE: 07/03/2018

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REPAIR DIESEL LINE @ PUMP 11/12

NOTIFICATION CONSTRUCTION ID: 32963

APPLICATION RECEIVED DATE: 05/03/2018

SCHEDULE CONSTRUCTION DATE: 04/18/2018

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REPAIR HIT PUMP, REPLACE SHEAR VALVES AND RESET PUMP.

NOTIFICATION CONSTRUCTION ID: 32873

APPLICATION RECEIVED DATE: 04/11/2018

SCHEDULE CONSTRUCTION DATE: 05/06/2018

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REPAIR DIESEL LINE THAT IS LEAKING

NOTIFICATION CONSTRUCTION ID: 14947

APPLICATION RECEIVED DATE: 11/05/2004

SCHEDULE CONSTRUCTION DATE: 12/05/2004

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1984 REGISTRATION DATE: 11/13/1992

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/01/1984

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 154383

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000



Order# 121435 Job# 277689 410 of 1203

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1984 REGISTRATION DATE: 11/13/1992

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/01/1984

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:
COATED

CORROSION PROTECTION:

COATED TANK (STEEL W/EXTERNAL POLYURETHANE LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 154382

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

Order# 121435 Job# 277689 411 of 1203

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1984 REGISTRATION DATE: 11/13/1992

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/01/1984

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
COATED

CORROSION PROTECTION:

COATED TANK (STEEL W/EXTERNAL POLYURETHANE LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 154384

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES



Order# 121435 Job# 277689 412 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/20/2005 REGISTRATION DATE: 05/18/2005

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 04/20/2005

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:
FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 154385

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary



Order# 121435 Job# 277689 413 of 1203

**MAP ID# 42** 

Distance from Property: 0.058 mi. (306 ft.) WNW

Elevation: 649 ft.

**FACILITY INFORMATION** 

ID#: 79118

NAME: TIGER MART 61

**ADDRESS: 2250 E LOOP 820** 

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 02/07/2008

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 03/12/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/09/2018 SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN602815540 NAME: VICTRON STORES LP

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/07/2008

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN604058065 NAME: KHWICE PETROLEUM LLC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION BEGIN DATE: 12/01/2011

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED **CONTACT INFORMATION** 

NAME: FADY KHWICE

TITLE: OPR

ORGANIZATION: TIGER MART 61

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4924900 0

GeoSearch www.geo-search.com 888-396-0042

414 of 1203 

ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 301071 SIGNATURE DATE: 03/09/2018

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 283791
SIGNATURE DATE: 03/09/2017

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 266665
SIGNATURE DATE: 02/22/2016

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 249131
SIGNATURE DATE: 02/17/2015

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 234212
SIGNATURE DATE: 03/24/2014

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 216981
SIGNATURE DATE: 03/15/2013

SIGNATURE NAME & TITLE: GINGER KELLEY, COMPLIANCE SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 216980
SIGNATURE DATE: 03/27/2012

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 216979
SIGNATURE DATE: 03/29/2011

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 216978
SIGNATURE DATE: 03/31/2010

Order# 121435 Job# 277689 415 of 1203

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 216977
SIGNATURE DATE: 03/30/2009

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 216976
SIGNATURE DATE: 04/14/2008

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 20854

APPLICATION RECEIVED DATE: 01/10/2008

SCHEDULE CONSTRUCTION DATE: 02/03/2008

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/07/2008 REGISTRATION DATE: 04/16/2008

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 02/07/2008

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:
COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 183335

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE



Order# 121435 Job# 277689 416 of 1203

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 02/07/2008 REGISTRATION DATE: 04/16/2008

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 02/07/2008

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 183336

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

Order# 121435 Job# 277689 417 of 1203

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 02/07/2008 REGISTRATION DATE: 04/16/2008

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 02/07/2008

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 183337

TANK ID: 2

COMPARTMENT LETTER: **B** SUBSTANCES: **DIESEL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 418 of 1203

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 43** 

Distance from Property: 0.059 mi. (312 ft.) NNW

Elevation: 620 ft.

**FACILITY INFORMATION** 

EPA ID#: TXR000028597 OWNER TYPE: PRIVATE

NAME: AMERICAN POWDER COATING OWNER NAME: UNKNOWN

ADDRESS: 5105 E CALIFORNIA OPERATOR TYPE: NOT REPORTED

FORT WORTH, TX 76119-7606 OPERATOR NAME: NOT REPORTED

CONTACT NAME: NOT REPORTED

CONTACT ADDRESS: 5105 E CALIFORNIA

**FORT WORTH TX 76119-7606** 

CONTACT PHONE: NOT REPORTED

NON-NOTIFIER: E - INITIALLY A NON-NOTIFIER, SUBSEQUENTLY DETERMINED TO BE EXEMPT FROM REQUIREMENTS TO

NOTIFY.

DATE RECEIVED BY AGENCY: 08/20/1998

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 04/14/2015

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** 

01/19/1999 FCI FOCUSED COMPLIANCE INSPECTION
01/22/1996 NRR NON-FINANCIAL RECORD REVIEW
01/22/1996 SNY SIGNIFICANT NON-COMPLIER
06/25/1999 SNN NOT A SIGNIFICANT NON-COMPLIER

08/21/1997 CSE COMPLIANCE SCHEDULE EVALUATION

<u>VIOLATIONS</u>

01/22/1996 262.A GENERATORS - GENERAL

01/22/1996 XXS STATE STATUTE OR REGULATION

**ENFORCEMENTS** 

02/27/1997 141 NOT REPORTED



Order# 121435 Job# 277689 419 of 1203

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

06/25/1999 310 FINAL 3008(A) COMPLIANCE ORDER

07/11/1997 211 REVOCATION ORDER-REVOKE OR DISMISS INITIAL/UNILATERAL ORDERS (CODE 210)

HAZARDOUS WASTE

- NO HAZARDOUS WASTE INFORMATION REPORTED -

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

<u>CORRECTIVE ACTION AREA</u> - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

Back to Report Summary

**MAP ID# 44** 

Distance from Property: 0.059 mi. (312 ft.) S

Elevation: 650 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 112259

LPST ID: 112259

FACILITY ID: 0011379

NAME: FOREST HILL 66

ADDRESS: 6551 FOREST HILL DR

**FOREST HILL, TX** 

#### **LEAKING TANK DETAILS**

LPST ID: 112259

NAME: FOREST HILL 66

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 4/25/97

REPORTED DATE: 4/8/1997 ENTERED DATE: 4/25/1997

PRP INFORMATION

NAME: WR CHILDRESS OIL CO

ADDRESS: ADDRESS NOT REPORTED

FORT WORTH TX 76111

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1969 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/02/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 421 of 1203

UST COMPARTMENT ID: 27582

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1969 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/02/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 27584

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

Order# 121435 Job# 277689 422 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/02/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 27583

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY



Order# 121435 Job# 277689 423 of 1203

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: WR CHILDRESS OIL

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: A CHILDRESS

PHONE: (817) 8341901 0

TITLE: PRES

**MAP ID# 44** 

Distance from Property: 0.059 mi. (312 ft.) S

Elevation: 650 ft.

**FACILITY INFORMATION** 

ID#: **11379** 

NAME: WR CHILDRESS OIL

ADDRESS: 6551 FOREST HILL DR

FOREST HILL, TX 76140

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 07/28/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/28/1986

SIGNATURE NAME & TITLE: A CHILDRESS, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600813588

NAME: WR CHILDRESS OIL COMPANY INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 07/28/1986

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1969 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 425 of 1203

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/02/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 27582

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1969 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/02/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:



Order# 121435 Job# 277689 426 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 27584

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/02/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 27583

TANK ID: 3

Order# 121435 Job# 277689 427 of 1203

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 45** 

Distance from Property: 0.059 mi. (312 ft.) SSW

Elevation: 650 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

PHONE: NOT REPORTED

REGISTRATION#: 83994 EPA ID: TX0000995068 NAME: MOTIVA ENTERPRISES LLC

TNRCC ID #: 101672 ADDRESS: NOT REPORTED

NAME: MOTIVA ENTERPRISE
ADDRESS: 6550 FOREST HILL DR

**FOREST HILL, TX 76140** 

CONTACT: **JENA HENRY** PHONE: **713-2410236** 

BUSINESS DESCRIPTION: RETAIL GASOLINE SALES
INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/10/2005

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 132674

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: TANK WATER BOTTOMS FROM CONDENSATION & CONTAMINATED SOIL

**GENERATED PERIODICALLYO** 

Back to Report Summary

Order# 121435 Job# 277689 429 of 1203

**MAP ID# 45** 

Distance from Property: 0.059 mi. (312 ft.) SSW

Elevation: 650 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 091185

LPST ID: 091185

FACILITY ID: 0013505 NAME: TEXACO SS

ADDRESS: 6550 FOREST HILL DR

FOREST HILL, TX

#### **LEAKING TANK DETAILS**

LPST ID: 091185 NAME: TEXACO SS

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 12/17/86

REPORTED DATE: 12/5/1986 ENTERED DATE: 12/17/1986

PRP INFORMATION

NAME: STAR ENTERPRISES INC

ADDRESS: ADDRESS NOT REPORTED

IRVING TX 75038

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 45** 

Distance from Property: 0.059 mi. (312 ft.) SSW

Elevation: 650 ft.

**FACILITY INFORMATION** 

ID#: 13505

NAME: **7-ELEVEN 34098** 

ADDRESS: 6550 FOREST HILL DR

FOREST HILL, TX 76140

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 08/07/1986

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 4
NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/07/1986

SIGNATURE NAME & TITLE: F H VAN DYKE, DIV MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: 1500 CORSICANA HWY

HILLSBORO TX 76645

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/22/2008

CONTACT ROLE: OWNOPRCON
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: 7-ELEVEN INC
PHONE: NOT REPORTED

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: 1202 RICHARDSON DR

**RICHARDSON TX 75080** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/22/2008
CONTACT ROLE: OPRCON

CONTACT NAME: CRAIG ZIMMER
CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION

NAME: PEGGIE BETZ
TITLE: ENV COMP SPEC

ORGANIZATION: 7-ELEVEN 34098

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (972) 8287805 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 431 of 1203

ORGANIZATION: 7-ELEVEN INC PHONE: (214) 8611274 0

FAX: (214) 8611270
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 296398 SIGNATURE DATE: 12/28/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENV. MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 280861
SIGNATURE DATE: 01/19/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MANAGE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 263286
SIGNATURE DATE: 01/15/2016

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 247383
SIGNATURE DATE: 01/19/2015

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 230193
SIGNATURE DATE: 01/13/2014

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125775
SIGNATURE DATE: 12/19/2012

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: **RENEWAL**REGISTRATION FLAG: **YES**SELF-CERTIFICATION ID: **125774**SIGNATURE DATE: **12/18/2011** 

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125773
SIGNATURE DATE: 01/05/2011

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125772
SIGNATURE DATE: 01/07/2010

Order# 121435 Job# 277689 432 of 1203

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125771
SIGNATURE DATE: 01/05/2009

SIGNATURE NAME & TITLE: SHANE PARTRIDGE, GAS COMPLIANCE MGR.

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125770
SIGNATURE DATE: 02/22/2008

SIGNATURE NAME & TITLE: SHANE PARTRIDGE, GAS & ENV COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125769
SIGNATURE DATE: 02/21/2008

SIGNATURE NAME & TITLE: ALAN GOLMAN, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125768
SIGNATURE DATE: 02/20/2008

SIGNATURE NAME & TITLE: ALAN GOLMAN, MGR

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125767
SIGNATURE DATE: 04/01/2007

SIGNATURE NAME & TITLE: S DEMARCUS CHAVOUS, PERMITTING MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125766
SIGNATURE DATE: 03/06/2006

SIGNATURE NAME & TITLE: MYRA L LOWERY, HSE COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125765
SIGNATURE DATE: 02/17/2005

SIGNATURE NAME & TITLE: SCOTT HAGGERTON, HSE COMPLIANCE COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125764
SIGNATURE DATE: 01/16/2004

SIGNATURE NAME & TITLE: SCOTT HAGGERTON, HSE COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125763
SIGNATURE DATE: 03/04/2003

SIGNATURE NAME & TITLE: SCOTT HAGGERTON, HSE COMP COORD

FILING STATUS: RENEWAL

Order# 121435 Job# 277689 433 of 1203

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125762
SIGNATURE DATE: 03/18/2002

SIGNATURE NAME & TITLE: RIRENEAU, SH&E COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 125761
SIGNATURE DATE: 11/27/2000

SIGNATURE NAME & TITLE: RIRENEAU, SH & E COMP COOR

FILING STATUS: **INITIAL** REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 29474

APPLICATION RECEIVED DATE: 04/29/2016

SCHEDULE CONSTRUCTION DATE: 05/22/2016

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REPLACE EXISTING DISPENSERS AND SHEAR VALVES WITH 3 NEW GILBARCO E700 3 +0 AND 3 NEW GILBARCO E700 3 + 1

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/01/1995 REGISTRATION DATE: 10/29/1995

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 09/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 117933

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 



Order# 121435 Job# 277689 434 of 1203

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1982 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/13/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 117928

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:



Order# 121435 Job# 277689 435 of 1203

#### **GROUNDWATER MONITORING**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/01/1995 REGISTRATION DATE: 10/29/1995

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 09/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 117931

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH), ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1982 REGISTRATION DATE: 05/08/1986

Order# 121435 Job# 277689 436 of 1203

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/13/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 117927

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION: GROUNDWATER MONITORING

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/01/1995 REGISTRATION DATE: 10/29/1995

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 09/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

Order# 121435 Job# 277689 437 of 1203

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 117932

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH), ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1982 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/13/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

Order# 121435 Job# 277689 438 of 1203

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 117926

TANK ID: 3A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**GROUNDWATER MONITORING** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/01/1995 REGISTRATION DATE: 10/29/1995

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 09/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 117930

TANK ID: 4

COMPARTMENT LETTER: A

Order# 121435 Job# 277689 439 of 1203

SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1982 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/13/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 117925

TANK ID: 4A

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

Order# 121435 Job# 277689 440 of 1203

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION: GROUNDWATER MONITORING

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1968 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/01/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 117924

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:



Order# 121435 Job# 277689 441 of 1203

#### **GROUNDWATER MONITORING**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/01/1986 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/13/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 117929

TANK ID: 5A

COMPARTMENT LETTER: A SUBSTANCES: **USED OIL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 



Order# 121435 Job# 277689 442 of 1203

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 45** 

Distance from Property: 0.059 mi. (312 ft.) SSW

Elevation: 650 ft.

**FACILITY INFORMATION** 

EPA ID#: TX0000995068 OWNER TYPE: PRIVATE

NAME: STAR ENTERPRISE OWNER NAME: MOTIVA ENTERPRISES LLC

ADDRESS: 6550 FORREST HILL DR OPERATOR TYPE: NOT REPORTED

FORT WORTH, TX 76140 OPERATOR NAME: NOT REPORTED

CONTACT NAME: **E V (JENA) HENRY**CONTACT ADDRESS: **PO BOX 2099** 

**HOUSTON TX 77252-2099** 

CONTACT PHONE: 713-241-0236

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 04/21/2003

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

SONDRA BIENVENU RDC SUPERVISOR 06/03/2002
JENA HENRY UNKNOWN 01/25/2000

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 04/23/2003

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: **NO**UNIVERSAL WASTE DESTINATION FACILITY: **NO** 

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS - NO ENFORCEMENTS REPORTED -**

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D018 BENZENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 443 of 1203

## Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

CORRECTIVE ACTION EVENT
NO CORRECTIVE ACTION EVENT(S) REPORTED

Back to Report Summary

**MAP ID# 46** 

Distance from Property: 0.059 mi. (312 ft.) E

Elevation: 578 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 103151

LPST ID: 103151

FACILITY ID: 0005590

NAME: CHEVRON 60106192

ADDRESS: 6101 E ROSEDALE ST

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 103151

NAME: CHEVRON 60106192

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 2.6 - IMPACTED GW DISCHARGE TO SW USED BY HUMANENDGR SPEC LT500FT

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 11/30/16

REPORTED DATE: 5/15/1992 ENTERED DATE: 6/22/1992

PRP INFORMATION

NAME: CHEVRON USA INC

ADDRESS: ADDRESS NOT REPORTED

**HOUSTON TX 77210** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: WO1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/22/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 80564

TANK ID: WO1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1995 REGISTRATION DATE: 12/21/1995

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80567

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

Order# 121435 Job# 277689 446 of 1203

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 11/01/1995 REGISTRATION DATE: 12/21/1995

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80568

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 11/01/1995 REGISTRATION DATE: 12/21/1995

Order# 121435 Job# 277689 447 of 1203

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 11/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN SINGLE WALL: YES

PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 80569

TANK ID: 2

COMPARTMENT LETTER: **B** SUBSTANCES: **DIESEL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 104S NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/22/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

Order# 121435 Job# 277689 448 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80563

TANK ID: 104S

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: **345G** NUMBER OF COMPARTMENTS: **1**INSTALLATION DATE: **01/01/1981** REGISTRATION DATE: **05/08/1986** 

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/22/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80566

TANK ID: 345G

COMPARTMENT LETTER: A

SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 601C NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/22/1989** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80565

TANK ID: 601C

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

**MAP ID# 46** 

Distance from Property: 0.059 mi. (312 ft.) E

Elevation: 578 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 118273

LPST ID: 118273

FACILITY ID: 0005590

NAME: ROSEDALE TEXACO

ADDRESS: 6101 E ROSEDALE ST

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 118273

NAME: ROSEDALE TEXACO

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 2.6 - IMPACTED GW DISCHARGE TO SW USED BY HUMANENDGR SPEC LT500FT

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 4/13/16

REPORTED DATE: 10/12/2007 ENTERED DATE: 3/30/2010

PRP INFORMATION

NAME: INARA CONVENIENCE INC
ADDRESS: ADDRESS NOT REPORTED

FRISCO TX 75034
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: WO1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/22/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 452 of 1203

UST COMPARTMENT ID: 80564

TANK ID: WO1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1995 REGISTRATION DATE: 12/21/1995

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80567

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

Order# 121435 Job# 277689 453 of 1203

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 11/01/1995 REGISTRATION DATE: 12/21/1995

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80568

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 11/01/1995 REGISTRATION DATE: 12/21/1995

Order# 121435 Job# 277689 454 of 1203

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 11/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN SINGLE WALL: YES

PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

**CORROSION PROTECTION:** 

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 80569

TANK ID: 2

COMPARTMENT LETTER: **B** SUBSTANCES: **DIESEL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 104S NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/22/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

Order# 121435 Job# 277689 455 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80563

TANK ID: 104S

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 345G NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/22/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80566

TANK ID: 345G

COMPARTMENT LETTER: A

SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 601C NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/22/1989** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80565

TANK ID: 601C

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

Order# 121435 Job# 277689 457 of 1203

### **NOT REPORTED**

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

**MAP ID# 46** 

Distance from Property: 0.059 mi. (312 ft.) E

Elevation: 578 ft.

**FACILITY INFORMATION** 

ID#: 5590

NAME: QUICKWAY FOOD STORE 1 ADDRESS: 6101 E ROSEDALE ST

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 09/01/1988

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 03/26/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/13/2018

SIGNATURE NAME & TITLE: ZESHAN HUSSAIN, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN605486208 NAME: K & Z ENTERPRISES LLC

CONTACT ADDRESS: 6101 E ROSEDALE ST FORT WORTH TX 76112

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/06/2017

CONTACT ROLE: OWNOPRCON CONTACT NAME: ZESHAN HUSSAIN CONTACT TITLE: NOT REPORTED

ORGANIZATION: K & Z ENTERPRISES LLC

PHONE: (817) 8915949 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

OWNER NUMBER: CN603364597

NAME: NEW A MALIK INC

CONTACT ADDRESS: 6751 E LANCASTER AVE STE 101

FORT WORTH TX 76112

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/01/2010

CONTACT ROLE: OWNOPRCON CONTACT NAME: ABID MALIK

CONTACT TITLE: PRES

ORGANIZATION: NEW A MALIK INC

PHONE: (817) 3712708 0

**CONTACT INFORMATION** 

NAME: ZESHAN HUSSAIN TITLE: NOT REPORTED

ORGANIZATION: QUICKWAY FOOD STORE 1

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 8915949 0

GeoSearch www.geo-search.com 888-396-0042

459 of 1203

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN605486208 NAME: K & Z ENTERPRISES LLC

CONTACT ADDRESS: 6101 E ROSEDALE ST FORT WORTH TX 76112

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/06/2017

CONTACT ROLE: OWNOPRCON
CONTACT NAME: ZESHAN HUSSAIN
CONTACT TITLE: NOT REPORTED

ORGANIZATION: K & Z ENTERPRISES LLC

PHONE: (817) 8915949 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OPERATOR NUMBER: CN603364597

NAME: **NEW A MALIK INC** 

CONTACT ADDRESS: 6751 E LANCASTER AVE STE 101

FORT WORTH TX 76112

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/01/2010

CONTACT ROLE: **OWNOPRCON** CONTACT NAME: **ABID MALIK** 

CONTACT TITLE: PRES

ORGANIZATION: NEW A MALIK INC

PHONE: (817) 3712708 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 301710

SIGNATURE DATE: 03/13/2018

SIGNATURE NAME & TITLE: ZESHAN HUSSAIN, PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 263055
SIGNATURE DATE: 01/07/2016

SIGNATURE NAME & TITLE: ABID MALIK, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 246491
SIGNATURE DATE: 01/08/2015

SIGNATURE NAME & TITLE: ABID MALIK, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 230730
SIGNATURE DATE: 01/22/2014

SIGNATURE NAME & TITLE: ABID MALIK, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 76202
SIGNATURE DATE: 05/22/2012

SIGNATURE NAME & TITLE: ABID MALIK, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 76201
SIGNATURE DATE: 05/10/2011

SIGNATURE NAME & TITLE: ABID MALIK, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 76200
SIGNATURE DATE: 05/21/2010

SIGNATURE NAME & TITLE: ABID MALIK, PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 76199
SIGNATURE DATE: 04/11/2009

SIGNATURE NAME & TITLE: SHEHZAD DHANANI, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 76198
SIGNATURE DATE: 04/10/2008

SIGNATURE NAME & TITLE: SHEHZAD DHANANI, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 76197
SIGNATURE DATE: 04/11/2007

SIGNATURE NAME & TITLE: SHEHZAD DHANANI, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 76196
SIGNATURE DATE: 04/15/2006

SIGNATURE NAME & TITLE: SHEHZAD DHANANI, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 76195
SIGNATURE DATE: 04/14/2005

SIGNATURE NAME & TITLE: SHEHZAD DHANANI, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 76194
SIGNATURE DATE: 04/27/2004

SIGNATURE NAME & TITLE: SHEHZAD DHANANI, MGR

FILING STATUS: RENEWAL

Order# 121435 Job# 277689 461 of 1203

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 76193
SIGNATURE DATE: 05/01/2003

SIGNATURE NAME & TITLE: DELENE S WARD, MGR

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 76192
SIGNATURE DATE: 02/28/2001

SIGNATURE NAME & TITLE: RAMZAN ALI PANJWANI, PRES

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 8047
APPLICATION RECEIVED DATE: 10/19/2007
SCHEDULE CONSTRUCTION DATE: 11/16/2007

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: **WO1** NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: **01/01/1971** REGISTRATION DATE: **05/08/1986** 

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/22/1989** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80564

TANK ID: WO1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED



Order# 121435 Job# 277689 462 of 1203

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1995 REGISTRATION DATE: 12/21/1995

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80567

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2

Order# 121435 Job# 277689 463 of 1203

INSTALLATION DATE: 11/01/1995 REGISTRATION DATE: 12/21/1995

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/1995

TANK DESIGN SINGLE WALL: YES

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN SINGLE WALL: YES

PIPE DESIGN DOUBLE WALL: YES

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DETAILS MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80568

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 11/01/1995 REGISTRATION DATE: 12/21/1995

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:



Order# 121435 Job# 277689 464 of 1203

#### **FRP**

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80569

TANK ID: 2

COMPARTMENT LETTER: **B**SUBSTANCES: **DIESEL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 104S NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/22/1989** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 465 of 1203

UST COMPARTMENT ID: 80563

**TANK ID: 104S** 

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 345G NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/22/1989** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80566

TANK ID: 345G

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

Order# 121435 Job# 277689 466 of 1203

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 601C NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/22/1989** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL: FRP

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 80565

TANK ID: 601C

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO

Order# 121435 Job# 277689 467 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION
NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

# Voluntary Cleanup Program Sites (VCP)

**MAP ID# 47** 

Distance from Property: 0.06 mi. (317 ft.) SSE

Elevation: 624 ft.

**SITE INFORMATION** 

**APPLICANT INFORMATION** 

ID#: 1128

ORGANIZATION: RANDALLS-OVERLAND, LTD. TERRY, MONTESI, PRESIDENT

NAME: OVERLAND STAGE SHOPPING CENTER

**ARLINGTON TX 76017** 

301 COMMERCE STREET, SUITE 3060

ADDRESS: 5705 - 5791 SOUTHWEST GREEN OAKS BLVD.

FORT WORTH, TX, 76102

ACRES: 9.8

PHONE: 817-870-1122

FACILITY TYPE: DRY CLEANERS APPLICATION DATE: 2/2/2000

FAX: 817-429-1815

DATE OF AGREEMENT: 2/10/2000

CERTIFICATE OF COMPLETION DATE: 9/7/2004

TYPE OF CERTIFICATE ISSUED: FINAL

**CONSULTANT/ATTORNEY INFORMATION** 

TYPE LEAD: OPERATOR PHASE: COMPLETED

ORGANIZATION: TERRA-MAR, INC.

MEDIA AFFECTED: GROUNDWATER

DAVID I., MAYES, CPG, SENIOR GEOLOGI

TNRCC SOLID WASTE REGISTRATION #: NOT REPORTED REMEDY: NATURAL ATTENUATION (ACL)/LOW YIELD

11050 ABLES LANE **DALLAS, TX, 75229** 

CLASS 3

INSTITUTIONAL CONTROL: NONRESIDENTIAL, NO GW USE PHONE: 972-488-8800 LPST #: 107484

FAX: 972-488-8080

EPA CERCLIS #: NOT REPORTED EPA RCRIS #: NOT REPORTED

CONTAMINANT/S: CHLORINATED SOLVENTS

**Back to Report Summary** 

469 of 1203 

**CONTACT INFORMATION** 

ORGANIZATION: L GRIMES & CO

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: (817) 4513946 0

**MAP ID# 48** 

Distance from Property: 0.06 mi. (317 ft.) ESE

Elevation: 559 ft.

**FACILITY INFORMATION** 

ID#: 47402

NAME: L GRIMES &

ADDRESS: 3401 E LOOP 820 S

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 03/03/1989 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 01/06/1989
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 01/04/1989
SIGNATURE NAME & TITLE: SAME, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600816227 NAME: L GRIMES & CO INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 03/03/1989

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 01/06/1989
TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/20/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 112484

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 01/06/1989

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/20/1989**INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED** 

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 471 of 1203

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 112485

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 49** 

Distance from Property: 0.061 mi. (322 ft.) ESE

Elevation: 580 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 103644

LPST ID: 103644

FACILITY ID: 0018525

NAME: FFP 577 EARLS FOOD STORE

ADDRESS: 5800 E BERRY ST

FORT WORTH, TX

### **LEAKING TANK DETAILS**

LPST ID: 103644

NAME: FFP 577 EARLS FOOD STORE FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 7/22/92

REPORTED DATE: 6/9/1992 ENTERED DATE: 7/22/1992

PRP INFORMATION

NAME: FFP OPERATING PARTNERS LP
ADDRESS: ADDRESS NOT REPORTED

**FORT WORTH TX 76117** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/12/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 473 of 1203

UST COMPARTMENT ID: 107453

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/12/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 107454

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

Order# 121435 Job# 277689 474 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

ORGANIZATION: FFP 577

PHONE: (817) 8384786 0

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

**MAP ID# 49** 

Distance from Property: 0.061 mi. (322 ft.) ESE

Elevation: 580 ft.

**FACILITY INFORMATION** 

ID#: **18525** NAME: **FFP 577** 

ADDRESS: 5800 E BERRY ST

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 09/04/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/17/1986 SIGNATURE NAME & TITLE: B KLINGSMITH, 3ETROLEUM DIR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600664957

NAME: FFP OPERATING PARTNERS LP

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: PARTNERSHIP
BEGIN DATE: 09/04/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 476 of 1203

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/12/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 107453

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/12/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 477 of 1203

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 107454

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

# PIPING SYSTEMS MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

### **NOT REPORTED**

PIPING RELEASE DETECTION:

#### **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 49** 

Distance from Property: 0.061 mi. (322 ft.) ESE

Elevation: 580 ft.

**FACILITY INFORMATION** 

ID#: 73021

NAME: TRIPLE SEVEN CONOCO ADDRESS: 5800 E BERRY ST

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 02/20/2000

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 1 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 02/07/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/06/2018

SIGNATURE NAME & TITLE: MUHAMMED ASHOEEN, MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600745780 NAME: TONYS ENTERPRISES INC CONTACT ADDRESS: 5800 E BERRY ST

FORT WORTH TX 76119

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/01/2003 CONTACT ROLE: OWNCON

CONTACT NAME: TONY ASHQEEN

CONTACT TITLE: PRES

ORGANIZATION: TONYS ENTERPRISES INC

PHONE: (817) 4510841 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600745780 NAME: TONYS ENTERPRISES INC CONTACT ADDRESS: 5800 E BERRY ST

FORT WORTH TX 76119

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/01/2003 CONTACT ROLE: OPRCON

CONTACT NAME: TONY ASHQEEN

CONTACT TITLE: MGR

**CONTACT INFORMATION** 

NAME: TONY ASHQEEN

TITLE: PRES

ORGANIZATION: TRIPLE SEVEN CONOCO

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4510841 0

GeoSearch www.geo-search.com 888-396-0042

479 of 1203 

ORGANIZATION: TONYS ENTERPRISES INC

PHONE: (817) 4510841 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 299042 SIGNATURE DATE: 02/06/2018

SIGNATURE NAME & TITLE: MUHAMMED ASHOEEN, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 283209
SIGNATURE DATE: 01/29/2017

SIGNATURE NAME & TITLE: MUHAMMAD ASHOEEN, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 265930
SIGNATURE DATE: 01/23/2016

SIGNATURE NAME & TITLE: MUHAMMAD ASHQEEN, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 249166
SIGNATURE DATE: 01/31/2015

SIGNATURE NAME & TITLE: MUHAMMAD ASHEEN, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 232078
SIGNATURE DATE: 02/05/2014

SIGNATURE NAME & TITLE: TONY ASHQEN, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190690
SIGNATURE DATE: 02/02/2013

SIGNATURE NAME & TITLE: MUHAMMAD ASHQEEN, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190689
SIGNATURE DATE: 02/04/2012

SIGNATURE NAME & TITLE: TONY ASHOEW, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190688
SIGNATURE DATE: 01/29/2011

SIGNATURE NAME & TITLE: TONY ASHQEEN, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190687
SIGNATURE DATE: 01/30/2010

SIGNATURE NAME & TITLE: TONY ASHQEEN, MANAGER PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190686
SIGNATURE DATE: 01/29/2009

SIGNATURE NAME & TITLE: TONY ASHEEN, MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190685
SIGNATURE DATE: 02/04/2008

SIGNATURE NAME & TITLE: TONY ASHQEEN, MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190684
SIGNATURE DATE: 01/23/2007

SIGNATURE NAME & TITLE: TONY ASHQEEN, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190683
SIGNATURE DATE: 12/20/2005

SIGNATURE NAME & TITLE: TONY ASHQEEN, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190682
SIGNATURE DATE: 01/22/2005

SIGNATURE NAME & TITLE: TONY ASHDEEN, MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190681
SIGNATURE DATE: 01/25/2004

SIGNATURE NAME & TITLE: TONY ASHQEEN, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190680
SIGNATURE DATE: 02/01/2003

SIGNATURE NAME & TITLE: TONY ASHQEEN, MGR/PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190679
SIGNATURE DATE: 02/16/2002

SIGNATURE NAME & TITLE: TONY ASHQEEN, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 190678
SIGNATURE DATE: 12/16/2000

SIGNATURE NAME & TITLE: MUHAMMAD ASHQEEN, PRES

FILING STATUS: INITIAL

Order# 121435 Job# 277689 481 of 1203

REGISTRATION FLAG: YES

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 17798

APPLICATION RECEIVED DATE: 09/22/1999

SCHEDULE CONSTRUCTION DATE: 10/22/1999

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 3 INSTALLATION DATE: 02/20/2000 REGISTRATION DATE: 03/16/2000

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 02/20/2000

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 169211

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 482 of 1203

TANK ID: 1 NUMBER OF COMPARTMENTS: 3
INSTALLATION DATE: 02/20/2000 REGISTRATION DATE: 03/16/2000

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 02/20/2000

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES
PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:
COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 169212

TANK ID: 1

COMPARTMENT LETTER: B
SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 3 INSTALLATION DATE: 02/20/2000 REGISTRATION DATE: 03/16/2000

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 02/20

STATUS: IN USE STATUS BEGIN DATE: 02/20/2000

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 483 of 1203

PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 169213

TANK ID: 1

COMPARTMENT LETTER: C SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: DOUGLAS & ELMS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: (512) 3498877 0

**MAP ID# 50** 

Distance from Property: 0.062 mi. (327 ft.) ESE

Elevation: 568 ft.

**FACILITY INFORMATION** 

ID#: **61677** 

NAME: DOUGLAS & ELMS

ADDRESS: 5733 GOOD SHEPHERD WAY

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: OTHER

BEGIN DATE: 11/18/1991 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 11/14/1991 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 11/12/1991 SIGNATURE NAME & TITLE: KATHIE BENAVIDES, OFFICE MNGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601246952
NAME: DOUGLAS & ELMS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: **ORGANIZATION**BEGIN DATE: **11/18/1991** 

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 11/14/1991
TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **PERM FILLED IN PLACE** STATUS BEGIN DATE: **11/12/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 139560

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: **NOT REPORTED**CAPACITY (GAL): **NOT REPORTED** 

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 51** 

Distance from Property: 0.064 mi. (338 ft.) N

Elevation: 650 ft.

**FACILITY INFORMATION** 

**OWNER INFORMATION** 

REGISTRATION#: 87605 EPA ID: TXR000061283 NAME: TAS ENVIRONMENTAL SERVICES LP

TNRCC ID #: 118374 ADDRESS: 3929 E CALIFORNIA PKWY
NAME: TAS ENVIRONMENTAL SERVICES FOREST HILL, TX 76119

ADDRESS: 1110 W HARRIS RD STE 118 PHONE: 1-817-5357222

**ARLINGTON, TX 76001** 

CONTACT: KEVIN BRANT PHONE: 817-5357222

BUSINESS DESCRIPTION: EMERGENCY RESPONSE FOR ENVIRONMENTAL SPILLS.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: NO
WASTE RECEIVER: NO
WASTE TRANSPORTER: YES
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/30/2005

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

WASTE NO RECORDS

**Back to Report Summary** 

Order# 121435 Job# 277689 487 of 1203

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 51** 

Distance from Property: 0.067 mi. (354 ft.) N

Elevation: 650 ft.

**FACILITY INFORMATION** 

EPA ID#: TXR000061283 OWNER TYPE: OTHER

NAME: TAS ENVIRONMENTAL SERVICES LP

ADDRESS: 3929 CALIFORNIA PKWY E

FORT WORTH, TX 76119 OPERATOR NAME: JSALZER

OPERATOR NAME: JSALZER

CONTACT NAME: KEVIN BRANT

CONTACT ADDRESS: 3929 CALIFORNIA PKWY E

**FORT WORTH TX 76119** 

CONTACT PHONE: 817-535-7222

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 11/09/2004

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

562998 - ALL OTHER MISCELLANEOUS WASTE MANAGEMENT SERVICES

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 01/03/2005

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO TRANSPORTER: YES USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** 

05/16/2005 FCI FOCUSED COMPLIANCE INSPECTION

**VIOLATIONS** - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

- NO HAZARDOUS WASTE INFORMATION REPORTED -

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 488 of 1203

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

Back to Report Summary

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 52** 

Distance from Property: 0.066 mi. (348 ft.) SSE

Elevation: 628 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 36033 EPA ID: TXD008415218 NAME: WIN-DOR SUPPLY INC TNRCC ID #: 13007 ADDRESS: 5140 SE LOOP 820

NAME: WIN-DOR SUPPLY FORT WORTH, TX 76140

ADDRESS: 5140 SE LOOP 820 PHONE: NOT REPORTED

FORT WORTH, TX 76140

CONTACT: WILLIAM ADAMS
PHONE: NOT REPORTED

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT A HW GENERATOR

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/22/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 35176

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

Back to Report Summary

Order# 121435 Job# 277689 490 of 1203

**MAP ID# 52** 

Distance from Property: 0.066 mi. (348 ft.) SSE

Elevation: 628 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 104880

LPST ID: 104880

FACILITY ID: 0014425

NAME: CUSTOM WIN DOR INC
ADDRESS: 5140 SE LOOP 820

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 104880

NAME: CUSTOM WIN DOR INC

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 5 - MINOR SOIL CONTAMINATION - DOES NOT REQUIRE A RAP CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 11/12/92

REPORTED DATE: 12/5/1991 ENTERED DATE: 11/12/1992

PRP INFORMATION

NAME: ADAMS, MIKE

ADDRESS: ADDRESS NOT REPORTED

KEENE TX 76059

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/17/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 491 of 1203

UST COMPARTMENT ID: 150160

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

**CONTACT INFORMATION** 

ORGANIZATION: CUSTOM WIN-DOR

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: (817) 4785447 0

**MAP ID# 52** 

Distance from Property: 0.066 mi. (348 ft.) SSE

Elevation: 628 ft.

**FACILITY INFORMATION** 

ID#: **14425** 

NAME: CUSTOM WIN-DOR

ADDRESS: 5140 SE LOOP 820

FORT WORTH, TX 76140

COUNTY: TARRANT

REGION: 4

TYPE: UNKNOWN
BEGIN DATE: 09/01/1987
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/14/1986

SIGNATURE NAME & TITLE: JOHN P DUNTON, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN604184887
NAME: DUNTON & ADAMS ETAL

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 09/01/1989

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 493 of 1203

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/17/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 150160

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

<u>PIPING SYSTEMS</u>

MATERIAL: **STEEL** 

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

CONNECTORS & VALVES:

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 494 of 1203

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

OWNER TYPE: NOT REPORTED

OWNER NAME: WIN-DOR SUPPLY INC

OPERATOR TYPE: **NOT REPORTED**OPERATOR NAME: **WIN-DOR SUPPLY INC** 

**MAP ID# 52** 

Distance from Property: 0.067 mi. (354 ft.) SSE

Elevation: 628 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD008415218

NAME: WIN-DOR SUPPLY INC

ADDRESS: 5140 SE LOOP 820

FORT WORTH, TX 76140

CONTACT NAME: WILLIAM ADAMS

CONTACT ADDRESS: 5140 SE LOOP 820

FORT WORTH TX 76140

CONTACT PHONE: **NOT REPORTED**NON-NOTIFIER: **NOT A NON-NOTIFIER**DATE RECEIVED BY AGENCY: **02/14/2001** 

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS)

3219 - OTHER WOOD PRODUCT MANUFACTURING 321911 - WOOD WINDOW AND DOOR MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

- NO HAZARDOUS WASTE INFORMATION REPORTED -

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

CORRECTIVE ACTION EVENT

NO CORRECTIVE ACTION EVENT(S) REPORTED

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 495 of 1203

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

Back to Report Summary

**MAP ID# 53** 

Distance from Property: 0.068 mi. (359 ft.) ESE

Elevation: 587 ft.

**FACILITY INFORMATION** 

ID#: **1376** 

NAME: EAST SIDE OFFICE SUPPLY

ADDRESS: 2837 S CRAVENS RD

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: UNKNOWN
BEGIN DATE: 06/03/1986
STATUS: INACTIVE
EXEMPT STATUS: NO

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/20/1986

SIGNATURE NAME & TITLE: **DAN CANNON, PRESIDENT** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600805626

NAME: EAST SIDE OFFICE SUPPLY

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 06/03/1986

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

CONTACT INFORMATION
NAME: DAN CANNON

TITLE: PRESIDENT

ORGANIZATION: EAST SIDE OFFICE SUPPLY

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4574555 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 497 of 1203

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/01/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 119003

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 54** 

Distance from Property: 0.068 mi. (359 ft.) ESE

Elevation: 582 ft.

**FACILITY INFORMATION** 

TXD085781367 NAME: TUBENFIN COILS INC

REGISTRATION#: 38450 EPA ID: TXD085781367

ADDRESS: 4015 E LOOP 820 S

OWNER INFORMATION

NAME: TUBENFIN COILS

TNRCC ID #: 15072

FORT WORTH, TX 76119

ADDRESS: 4009 E LOOP 820 S STE C

PHONE: 1-817-4578132

FORT WORTH, TX 76119

CONTACT: RICHARD B ROOKS

PHONE: **817-4578132** 

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: **NOT REPORTED**WASTE GENERATOR: **YES** 

WASTE RECEIVER: NO

WASTE TRANSPORTER: NO TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: LARGE QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 08/15/2012

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 39602

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 499 of 1203

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 54** 

Distance from Property: 0.068 mi. (359 ft.) ESE

Elevation: 582 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD085781367 OWNER TYPE: PRIVATE

NAME: TUBENFIN COILS INC OWNER NAME: TUBENFIN COILS INC

ADDRESS: 4009 E LOOP 820 S STE C OPERATOR TYPE: PRIVATE

FORT WORTH, TX 76119 OPERATOR NAME: TUBENFIN COILS INC

CONTACT NAME: RICHARD B ROOKS
CONTACT ADDRESS: 4015 E LOOP 820 S

FORT WORTH TX 76119

CONTACT PHONE: 817-457-8132

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 08/15/2012

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

RICHARD B ROOKS ENV MGR 08/15/2012

**INDUSTRY CLASSIFICATION (NAICS)** 

333415 - AIR-CONDITIONING AND WARM AIR HEATING EQUIPMENT AND COMMERCIAL AND INDUSTRIAL REFRIGERATION EQUIPMENT MANUFACTURING

335312 - MOTOR AND GENERATOR MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 04/14/2015

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - **NO EVALUATIONS REPORTED** - <u>VIOLATIONS</u> - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

Order# 121435 Job# 277689 500 of 1203

#### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

F001 THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING:

TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE ANDCHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 55** 

Distance from Property: 0.071 mi. (375 ft.) NNW

Elevation: 613 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 75631 EPA ID: TXD987993524 NAME: STAR ENTERPRISES INC

TNRCC ID #: 29978 ADDRESS: PO BOX 152145

NAME: TEXACO SERVICE STATION 2304 IRVING, TX 75015

ADDRESS: 4401 W GREEN OAKS BLVD PHONE: 1-404-4535400

**ARLINGTON, TX 76016** 

CONTACT: DARVIN E MAYO

PHONE: 404-4535400

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THIS FACILITY WAS REGISTERED PRIOR

TO1994 AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/22/2004

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 121352

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: TANK WATER BOTTOM / CONDENSATION / UNKNOWN

WASTE ID: 58156

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 



Order# 121435 Job# 277689 502 of 1203

**MAP ID# 55** 

Distance from Property: 0.071 mi. (375 ft.) NNW

Elevation: 613 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 100091

LPST ID: 100091

FACILITY ID: 0013520 NAME: **TEXACO 4119100** 

ADDRESS: 4401 W GREEN OAKS BLVD

ARLINGTON, TX

#### **LEAKING TANK DETAILS**

LPST ID: 100091

NAME: **TEXACO 4119100** 

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 3.5 - A DESIGNATED MAJOR OR MINOR AQUIFER IS IMPACTED CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 11/26/91

REPORTED DATE: 8/26/1991 ENTERED DATE: 11/26/1991

PRP INFORMATION

NAME: MOTIVA ENTERPRISES LLC
ADDRESS: ADDRESS NOT REPORTED

IRVING TX 75063

CONTACT: NOT REPORTED

PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/22/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 503 of 1203

UST COMPARTMENT ID: 118667

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

CONNECTORS & VALVES:

**NOT REPORTED** 

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/22/2010** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 118666

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 504 of 1203

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/22/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 118665

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE, ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)



Order# 121435 Job# 277689 505 of 1203

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/22/2010**INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED** 

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 118664

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/22/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO

Order# 121435 Job# 277689 506 of 1203

PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 118668

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/30/2010 REGISTRATION DATE: 12/22/2010

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 09/30/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

Order# 121435 Job# 277689 507 of 1203

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 118669

TANK ID: 6

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 7 NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 09/30/2010 REGISTRATION DATE: 12/22/2010

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 09/30/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 118670

TANK ID: 7

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

Order# 121435 Job# 277689 508 of 1203

CAPACITY (GAL): 7000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 7 NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 09/30/2010 REGISTRATION DATE: 12/22/2010

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 09/30/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 118671

TANK ID: 7

COMPARTMENT LETTER: B
SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

Order# 121435 Job# 277689 509 of 1203

#### **NOT REPORTED**

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

**MAP ID# 55** 

Distance from Property: 0.071 mi. (375 ft.) NNW

Elevation: 613 ft.

**FACILITY INFORMATION** 

ID#: **13520** 

NAME: 7-ELEVEN 34099

ADDRESS: 4401 W GREEN OAKS BLVD

ARLINGTON, TX 76016

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 08/31/1988

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/07/1986

SIGNATURE NAME & TITLE: **F H VAN DYKE, DIV MGR** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: 1500 CORSICANA HWY

**HILLSBORO TX 76645** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/27/2008

CONTACT ROLE: OWNOPRCON
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: 7-ELEVEN INC
PHONE: NOT REPORTED

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: 1202 RICHARDSON DR

**RICHARDSON TX 75080** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/27/2008
CONTACT ROLE: OPRCON

CONTACT NAME: CRAIG ZIMMER
CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION

NAME: PEGGIE BETZ
TITLE: ENV COMP SPEC

ORGANIZATION: 7-ELEVEN 34099

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (972) 8287805 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: 7-ELEVEN INC PHONE: (214) 8611274 0

FAX: (214) 8611270
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 296657 SIGNATURE DATE: 12/29/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENV. MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 280599
SIGNATURE DATE: 01/18/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENIRONMENTAL MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 263765
SIGNATURE DATE: 01/19/2016

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 247203
SIGNATURE DATE: 01/19/2015

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 230091
SIGNATURE DATE: 01/13/2014

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126142
SIGNATURE DATE: 12/19/2012

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126141
SIGNATURE DATE: 12/18/2011

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126140
SIGNATURE DATE: 12/17/2010

SIGNATURE NAME & TITLE: SCOTT JOHNSON, GAS & ENV COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126139
SIGNATURE DATE: 01/07/2010

Order# 121435 Job# 277689 512 of 1203

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126138
SIGNATURE DATE: 01/05/2009

SIGNATURE NAME & TITLE: SHANE PARTRIDGE, GAS COMPLIANCE MGR.

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126137
SIGNATURE DATE: 02/27/2008

SIGNATURE NAME & TITLE: SHANE PARTRIDGE, GAS & ENV COMP MGR

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126136
SIGNATURE DATE: 02/21/2008

SIGNATURE NAME & TITLE: ALAN GOLMAN, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126135
SIGNATURE DATE: 02/20/2008

SIGNATURE NAME & TITLE: ALAN GOLMAN, MGR

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126134
SIGNATURE DATE: 04/01/2007

SIGNATURE NAME & TITLE: S DEMARCUS CHAVOUS, PERMITTING MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126133
SIGNATURE DATE: 03/06/2006

SIGNATURE NAME & TITLE: MYRA L LOWERY, HSE COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126132
SIGNATURE DATE: 02/17/2005

SIGNATURE NAME & TITLE: SCOTT HAGGERTON, HSE COMPLIANCE COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126131
SIGNATURE DATE: 01/16/2004

SIGNATURE NAME & TITLE: SCOTT HAGGERTON, HSE COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126130
SIGNATURE DATE: 03/04/2003

SIGNATURE NAME & TITLE: SCOTT HAGGERTON, HSE COMP COORD

FILING STATUS: RENEWAL

Order# 121435 Job# 277689 513 of 1203

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126129
SIGNATURE DATE: 03/18/2002

SIGNATURE NAME & TITLE: RIRENEAU, SH&E COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 126128
SIGNATURE DATE: 11/27/2000

SIGNATURE NAME & TITLE: RIRENEAU, SH & E COMP COOR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 29475

APPLICATION RECEIVED DATE: 04/29/2016

SCHEDULE CONSTRUCTION DATE: 05/22/2016

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REPLACE EXISTING DISPENSERS AND SHEAR VALVES WITH 4 NEW GILBARCO E700 3 +0 AND 2 NEW GILBARCO E700 3 +1

NOTIFICATION CONSTRUCTION ID: 13524

APPLICATION RECEIVED DATE: 08/02/2010

SCHEDULE CONSTRUCTION DATE: 09/06/2010

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REMOVAL OF (5) 10,000 GAL UST'S, DISPENSERS/SUMPS & PIPING.

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/22/2010** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 118667

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000



Order# 121435 Job# 277689 514 of 1203

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/22/2010** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 118666

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

Order# 121435 Job# 277689 515 of 1203

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/22/2010** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 118665

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG



Order# 121435 Job# 277689 516 of 1203

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/22/2010** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 118664

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/22/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

Order# 121435 Job# 277689 517 of 1203

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 118668

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/30/2010 REGISTRATION DATE: 12/22/2010

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 09/30/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

Order# 121435 Job# 277689 518 of 1203

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 118669

TANK ID: 6

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 7 NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 09/30/2010 REGISTRATION DATE: 12/22/2010

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 09/30/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 519 of 1203

UST COMPARTMENT ID: 118670

TANK ID: 7

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 7000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE

PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 7 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 09/30/2010 REGISTRATION DATE: 12/22/2010

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 09/30/2010

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 118671

TANK ID: 7

COMPARTMENT LETTER: B
SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

Order# 121435 Job# 277689 520 of 1203

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET,AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 55** 

Distance from Property: 0.071 mi. (375 ft.) NNW

Elevation: 613 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD987993524 OWNER TYPE: NOT REPORTED

NAME: STAR ENTERPRISES INC

ADDRESS: 4401 W GREEN OAKS BLVD

OWNER NAME: STAR ENTERPRISES INC

OPERATOR TYPE: NOT REPORTED

ARLINGTON, TX 76016 OPERATOR NAME: STAR ENTERPRISES INC

CONTACT NAME: DARVIN E MAYO
CONTACT ADDRESS: PO BOX 152145

**IRVING TX 75015** 

CONTACT PHONE: 404-453-5400

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 02/14/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

44711 - GASOLINE STATIONS WITH CONVENIENCE STORES

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - **NO EVALUATIONS REPORTED** - <u>VIOLATIONS</u> - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

- HAZARDOUS WASTE

D001 IGNITABLE WASTE

D008 LEAD
D018 BENZENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED



Order# 121435 Job# 277689 522 of 1203

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

Back to Report Summary

**CONTACT INFORMATION** 

ORGANIZATION: EASTSIDE CENTER

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: J LUNDGREN

PHONE: (817) 4963274 0

TITLE: MGR

**MAP ID# 56** 

Distance from Property: 0.072 mi. (380 ft.) W

Elevation: 609 ft.

**FACILITY INFORMATION** 

ID#: **18602** 

NAME: EASTSIDE CENTER

ADDRESS: 6050 TENSION DR

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING
BEGIN DATE: 09/03/1986
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/03/1986

SIGNATURE NAME & TITLE: **D BREWER, CONST MGR** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600815815 NAME: U-HAUL CO OF DALLAS

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: **ORGANIZATION**BEGIN DATE: **09/03/1986** 

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 524 of 1203

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/01/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 39947

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 57** 

Distance from Property: 0.074 mi. (391 ft.) ESE

Elevation: 587 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 84933 EPA ID: NOT REPORTED

NAME: HAYES LEASING COMPANY INC

TNRCC ID #: 105034

ADDRESS: 2727 E LOOP 820 S

NAME: HAYS LEASING

FORT WORTH, TX 76119

ADDRESS: 2727 E LOOP 820 S

PHONE: 1-972-8692400

FORT WORTH, TX 76119

CONTACT: CLARENCE E ROBERTSON PHONE: 972-8692400

BUSINESS DESCRIPTION: SALES, RENTAL, SERVICE AND REPAIR OF GMC, U.D., ISUZU AND HINO TRUCKS

INDUSTRIAL WASTE PERMIT #: NOT REPORTED MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: YES WASTE RECEIVER: NO WASTE TRANSPORTER: NO TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 10/30/2002

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 156471

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: SPENT SOLVENT FROM DEGREASING OPERATIONS

WASTE ID: 156472

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: GASOLINE AND DIESEL MIXTURE FROM FUEL TANKS OF TRUCKS

WASTE ID: 288877

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: NO

526 of 1203

# Industrial and Hazardous Waste Sites (IHW)

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 57** 

Distance from Property: 0.074 mi. (391 ft.) ESE

Elevation: 587 ft.

#### **FACILITY INFORMATION**

ID#: 63669

NAME: BOBCAT OF FORT WORTH ADDRESS: 2727 E LOOP 820 S

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING
BEGIN DATE: 01/01/1991
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 10/29/1992 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 08/25/1992 SIGNATURE NAME & TITLE: ROSANNE HALL, DIRECTOR OF PRICING

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603033416
NAME: BERRY COMPANIES INC

CONTACT ADDRESS: 2727 E LOOP 820 S

FORT WORTH TX 76119

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/11/2011 CONTACT ROLE: OWNCON

CONTACT NAME: **NOT REPORTED**CONTACT TITLE: **NOT REPORTED** 

ORGANIZATION: BERRY COMPANIES INC

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OWNER NUMBER: CN603988171
NAME: BERRY COMPANIES INC

CONTACT ADDRESS: 2727 E LOOP 820 S

FORT WORTH TX 76119

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/11/2011
CONTACT ROLE: OWNCON

CONTACT NAME: **NOT REPORTED**CONTACT TITLE: **NOT REPORTED** 

ORGANIZATION: BERRY COMPANIES INC

PHONE: NOT REPORTED

#### CONTACT INFORMATION

NAME: MIKE PAVELKA
TITLE: NOT REPORTED

ORGANIZATION: BOBCAT OF FORT WORTH

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 6542202 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 528 of 1203

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN603033416
NAME: BERRY COMPANIES INC

CONTACT ADDRESS: 2727 E LOOP 820 S

FORT WORTH TX 76119

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/11/2011
CONTACT ROLE: OPRCON
CONTACT NAME: GLEN FREE
CONTACT TITLE: BRANCH MGR

ORGANIZATION: BERRY COMPANIES INC

PHONE: (817) 6542202 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OPERATOR NUMBER: CN603988171
NAME: BERRY COMPANIES INC

CONTACT ADDRESS: 2727 E LOOP 820 S

FORT WORTH TX 76119

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/11/2011
CONTACT ROLE: OPRCON
CONTACT NAME: GLEN FREE
CONTACT TITLE: BRANCH MGR

ORGANIZATION: BERRY COMPANIES INC

PHONE: (817) 6542202 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**ABOVEGROUND STORAGE TANK INFORMATION** 

AST ID #: 166464 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: A REGISTRATION DATE: 10/29/1992

INSTALLATION DATE: 01/01/1991 STATUS BEGIN DATE: 10/31/2016

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT



Order# 121435 Job# 277689 529 of 1203

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 166463 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: B REGISTRATION DATE: 10/29/1992

INSTALLATION DATE: 01/01/1991 STATUS BEGIN DATE: 10/31/2016

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

Order# 121435 Job# 277689 530 of 1203

**CONTACT INFORMATION** 

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: NOT REPORTED

**MAP ID# 58** 

Distance from Property: 0.076 mi. (401 ft.) SE

Elevation: 615 ft.

**FACILITY INFORMATION** 

ID#: **63207** 

NAME: RENARD BLACKSTOCK

ADDRESS: 6704 LINDALE RD

FORT WORTH, TX 76140

COUNTY: TARRANT

REGION: 4

TYPE: FARM OR RESIDENTIAL BEGIN DATE: 06/30/1992 STATUS: INACTIVE

EXEMPT STATUS: YES RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 06/23/1992 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/16/1992 SIGNATURE NAME & TITLE: RENARD BLACKSTOCK, OWNER

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601411838
NAME: BLACKSTOCK RENARD

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 06/30/1992

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 06/23/1992
TANK CAPACITY (GAL): 750 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/26/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 138121

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 750

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 06/23/1992

TANK CAPACITY (GAL): 750 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/26/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 532 of 1203

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 138121

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 750

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 533 of 1203

**MAP ID# 59** 

Distance from Property: 0.077 mi. (407 ft.) NNW

Elevation: 621 ft.

**FACILITY INFORMATION** 

ID#: **49441** 

NAME: A & R FOOD MART

ADDRESS: 5960 W POLY WEBB RD

ARLINGTON, TX 76016

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 01/12/1990

STATUS: **ACTIVE**EXEMPT STATUS: **NO**RECORDS OFF-SITE: **NO** 

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 03/16/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/12/2018

SIGNATURE NAME & TITLE: AHMED FARISHTA, MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN604375675
NAME: NIMAT ENTERPRISE INC

CONTACT ADDRESS: 5960 W POLY WEBB RD

**ARLINGTON TX 76016** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/28/2012

CONTACT ROLE: OWNOPRCON
CONTACT NAME: AHMED FARISHTA
CONTACT TITLE: NOT REPORTED

ORGANIZATION: NIMAT ENTERPRISE INC

PHONE: (817) 5619279 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN604375675
NAME: NIMAT ENTERPRISE INC

CONTACT ADDRESS: 5960 W POLY WEBB RD

ARLINGTON TX 76016

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/28/2012

CONTACT ROLE: OWNOPRCON
CONTACT NAME: AHMED FARISHTA
CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION
NAME: AHMED FARISHTA

TITLE: MGR

ORGANIZATION: A & R FOOD MART

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 5619279 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 534 of 1203

ORGANIZATION: NIMAT ENTERPRISE INC

PHONE: (817) 5619279 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 301535 SIGNATURE DATE: 03/12/2018

SIGNATURE NAME & TITLE: AHMED FARISHTA, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 285152
SIGNATURE DATE: 03/08/2017

SIGNATURE NAME & TITLE: AHMED FARISHTA, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 267933
SIGNATURE DATE: 03/29/2016

SIGNATURE NAME & TITLE: AHMED FARISHTA, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 251722
SIGNATURE DATE: 04/15/2015

SIGNATURE NAME & TITLE: AHMED FARISHTA, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 235306
SIGNATURE DATE: 04/02/2014

SIGNATURE NAME & TITLE: ISHWAR KC, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 224934
SIGNATURE DATE: 08/22/2013

SIGNATURE NAME & TITLE: AHMED FARISHTA, PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109771
SIGNATURE DATE: 09/03/2012

SIGNATURE NAME & TITLE: ISHWAR KE, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109770
SIGNATURE DATE: 08/26/2011

 ${\tt SIGNATURE\ NAME\ \&\ TITLE:\ \textbf{RASFIK\ PATEL},\ \textbf{PRESIDENT}}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109769
SIGNATURE DATE: 08/12/2010

Order# 121435 Job# 277689 535 of 1203

SIGNATURE NAME & TITLE: RASIK I PATEL, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109768
SIGNATURE DATE: 08/26/2009

SIGNATURE NAME & TITLE: RASIK PATEL, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109767
SIGNATURE DATE: 08/22/2008

SIGNATURE NAME & TITLE: RASIK I PATEL, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109766
SIGNATURE DATE: 08/10/2007

SIGNATURE NAME & TITLE: RASILE PATEL, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109765
SIGNATURE DATE: 09/04/2006

SIGNATURE NAME & TITLE: RASIK PATEL, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109764
SIGNATURE DATE: 08/25/2005

SIGNATURE NAME & TITLE: R J PATEL, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109763
SIGNATURE DATE: 08/16/2004

SIGNATURE NAME & TITLE: RASIK PATEL, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109762
SIGNATURE DATE: 08/05/2003

SIGNATURE NAME & TITLE: RASIK PATEL, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109761
SIGNATURE DATE: 08/01/2002

SIGNATURE NAME & TITLE: RASIK PATEL, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109760
SIGNATURE DATE: 01/15/2001

SIGNATURE NAME & TITLE: RASIK PATEL, PRESIDENT

FILING STATUS: INITIAL

Order# 121435 Job# 277689 536 of 1203

REGISTRATION FLAG: YES

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1989 REGISTRATION DATE: 11/06/1989

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 01/01/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FACTORY INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 120644

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1989 REGISTRATION DATE: 11/06/1989

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1989

Order# 121435 Job# 277689 537 of 1203

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FACTORY INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 120645

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1989 REGISTRATION DATE: 11/06/1989

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 01/01/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

Order# 121435 Job# 277689 538 of 1203

#### **CATHODIC PROTECTION - FACTORY INSTALLATION**

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 120643

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 539 of 1203

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 59** 

Distance from Property: 0.079 mi. (417 ft.) NNW

Elevation: 621 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD987983681 OWNER TYPE: NOT REPORTED

NAME: **ECONO LUBE N TUNE INC**OWNER NAME: **ECONO LUBE N TUNE INC** 

ADDRESS: 5890 POLYWEB ROAD OPERATOR TYPE: NOT REPORTED

ARLINGTON, TX 76016 OPERATOR NAME: ECONO LUBE NTUNE INC

CONTACT NAME: CHUCK CARTER CONTACT ADDRESS: PO BOX 2470

**NEWPORT BEACH CA 92658** 

CONTACT PHONE: 714-851-2259

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 08/23/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - **NO EVALUATIONS REPORTED** - <u>VIOLATIONS</u> - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

UNKN

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

<u>CORRECTIVE ACTION AREA</u> - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 540 of 1203

### Affected Property Assessment Reports (APAR)

**MAP ID# 60** 

Distance from Property: 0.078 mi. (412 ft.) ESE

Elevation: 650 ft.

**FACILITY INFORMATION** 

**CONTACTS** 

PROGRAM ID: 1030 KOOS, DONNELL

REFERENCE NUMBER: RN101053460

FACILITY NAME: BRENTWOOD STAIR RETAIL CENTER

ADDRESS: 6612 BRENTWOOD STAIR RD

FORT WORTH, TX 76112

COUNTY: TARRANT

LOCATION DESCRIPTION: 6612 BRENTWOOD STAIR ROAD

TYPE OF FACILITY: DRY CLEANER
FACILITY STATUS: COMPLETED
PROGRAM: VOLUNTARY CLEANUP
PROGRAM STATUS: INACTIVE

**REMEDIATIONS** 

NO REMEDIATION REPORTED

**CATEGORY OF CONTAMINATION** 

DATE CONTAMINATIONS: 05/15/03 NOT REPORTED

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 60** 

Distance from Property: 0.078 mi. (412 ft.) ESE

Elevation: 650 ft.

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 75314 EPA ID: TXR000048314 NAME: ONE HOUR MARTINIZING
TNRCC ID #: 29667 ADDRESS: NOT REPORTED

NAME: ONE HOUR MARTINIZING

ADDRESS: 6612 BRENTWOOD STAIR RD STE A PHONE: NOT REPORTED

FORT WORTH, TX 76112

CONTACT: LARRY HASSELL

PHONE: 817-4514581

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 04/22/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 57605

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 542 of 1203

**MAP ID# 60** 

Distance from Property: 0.097 mi. (512 ft.) ESE

Elevation: 650 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 101351

LPST ID: 101351

FACILITY ID: **0044704** NAME: **NCS 2380** 

ADDRESS: 6620 BRENTWOOD STAIR RD

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: **101351** NAME: **NCS 2380** 

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 1/20/92

REPORTED DATE: 12/2/1991 ENTERED DATE: 1/20/1992

PRP INFORMATION

NAME: NATIONAL CONVENIENCE STORES
ADDRESS: ADDRESS NOT REPORTED

HOUSTON TX 77001
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1969 REGISTRATION DATE: 06/11/1987

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

 ${\tt EXTERNAL\ DIELECTRIC\ COATING/LAMINATE/TAPE/WRAP, CATHODIC\ PROTECTION\ -\ FACTORY\ INSTALLATION}$ 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 543 of 1203

UST COMPARTMENT ID: 46744

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 06/11/1987

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

STEFI

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 46748

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

Order# 121435 Job# 277689 544 of 1203

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1969 REGISTRATION DATE: 06/11/1987

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 46746

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 



Order# 121435 Job# 277689 545 of 1203

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 06/11/1987

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 46747

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 06/11/1987
TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/14/2011** 

Order# 121435 Job# 277689 546 of 1203

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FIELD INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 46745

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 3
INSTALLATION DATE: 11/01/2011 REGISTRATION DATE: 08/21/2012

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 11/01/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

Order# 121435 Job# 277689 547 of 1203

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 46749

TANK ID: 6

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 3 INSTALLATION DATE: 11/01/2011 REGISTRATION DATE: 08/21/2012

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 46750

TANK ID: 6

COMPARTMENT LETTER: B

Order# 121435 Job# 277689 548 of 1203

SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 3 INSTALLATION DATE: 11/01/2011 REGISTRATION DATE: 08/21/2012

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 46751

TANK ID: 6

COMPARTMENT LETTER: C SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

Order# 121435 Job# 277689 549 of 1203

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

**MAP ID# 60** 

Distance from Property: 0.097 mi. (512 ft.) ESE

Elevation: 650 ft.

**FACILITY INFORMATION** 

ID#: **44704** 

NAME: BRENTWOOD C STORE

ADDRESS: 6620 BRENTWOOD STAIR RD

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 08/31/1990

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 1
NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 01/03/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 12/30/2017 SIGNATURE NAME & TITLE: MOHAMMAD WAHEDI, OWNER/MANAGER

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN604938688
NAME: SILVER ROAD LLC

CONTACT ADDRESS: 6620 BRENTWOOD STAIR RD

FORT WORTH TX 76112

TYPE: CORPORATION/COMPANY

BEGIN DATE: 03/01/2015

CONTACT ROLE: OWNOPRCON

CONTACT NAME: AMINULLAH NAJEEB

CONTACT TITLE: OWNER MGR
ORGANIZATION: SILVER ROAD LLC

PHONE: **(817) 4571444 0** FAX: **NOT REPORTED** 

EMAIL: TAHIB.WAHEDI@GMAIL.COM
OWNER NUMBER: CN603608068
NAME: GOLD LAND INVESTORS LLC

CONTACT ADDRESS: 2302 W WALNUT HILL LN

IRVING TX 75038

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/07/2011
CONTACT NAME: NOT BEFORE

CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED

ORGANIZATION: GOLD LAND INVESTORS LLC

PHONE: NOT REPORTED

CONTACT INFORMATION

NAME: AMINULLAH NAJEEB

TITLE: OWNER/MGR

ORGANIZATION: BRENTWOOD C STORE

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 4571444 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 551 of 1203

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN604938688

NAME: SILVER ROAD LLC

CONTACT ADDRESS: 6620 BRENTWOOD STAIR RD FORT WORTH TX 76112

TYPE: CORPORATION/COMPANY

BEGIN DATE: 03/01/2015

CONTACT ROLE: OWNOPRCON

CONTACT NAME: AMINULLAH NAJEEB

CONTACT TITLE: OWNER MGR
ORGANIZATION: SILVER ROAD LLC

PHONE: **(817) 4571444 0** FAX: **NOT REPORTED** 

EMAIL: TAHIB.WAHEDI@GMAIL.COM

OPERATOR NUMBER: CN603608068

NAME: GOLD LAND INVESTORS LLC

CONTACT ADDRESS: 6620 BRENTWOOD STAIR RD

FORT WORTH TX 76112

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/07/2011

CONTACT ROLE: OPRCON

CONTACT NAME: MO SHOHAIB

CONTACT TITLE: NOT REPORTED

ORGANIZATION: GOLD LAND INVESTORS LLC

PHONE: (214) 4556664 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 296907 SIGNATURE DATE: 12/30/2017

SIGNATURE NAME & TITLE: MOHAMMAD WAHEDI, OWNER/MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 281724
SIGNATURE DATE: 01/18/2017

SIGNATURE NAME & TITLE: MOHAMMAD WAHEDI, OWNER/MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 265404
SIGNATURE DATE: 02/10/2016

SIGNATURE NAME & TITLE: MOHAMMED WAHEDI, MGR OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 260683
SIGNATURE DATE: 09/12/2015

SIGNATURE NAME & TITLE: MOHAMMAD WAHEDI, OWNER/MGR

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 248606
SIGNATURE DATE: 02/09/2015

SIGNATURE NAME & TITLE: MOHAMMAD SHOHAIB, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 233103
SIGNATURE DATE: 03/05/2014

SIGNATURE NAME & TITLE: MOHAMMAD SHOAIB, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50915
SIGNATURE DATE: 04/08/2013

SIGNATURE NAME & TITLE: MOHAMMAD SHOHAIB, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50914
SIGNATURE DATE: 08/15/2012

SIGNATURE NAME & TITLE: MOHAMMAD SHOHAIB, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50913
SIGNATURE DATE: 08/24/2011

SIGNATURE NAME & TITLE: MOHAMMAD SHOAIB, OWNER

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50912
SIGNATURE DATE: 07/20/2010

SIGNATURE NAME & TITLE: RASHPAH SINGH, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50911
SIGNATURE DATE: 08/13/2009

SIGNATURE NAME & TITLE: RASHPAL SINGH, OWNER

FILING STATUS: AMENDMENT REGISTRATION FLAG: YES SELF-CERTIFICATION ID: 50910 SIGNATURE DATE: 08/12/2009

SIGNATURE NAME & TITLE: RASHPAL SINGH, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50909
SIGNATURE DATE: 08/01/2008

SIGNATURE NAME & TITLE: RASHPAL SINGH, PRESIDENT

FILING STATUS: RENEWAL

Order# 121435 Job# 277689 553 of 1203

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50908
SIGNATURE DATE: 06/07/2007

SIGNATURE NAME & TITLE: RASHPAL SINGH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50907
SIGNATURE DATE: 06/06/2007

SIGNATURE NAME & TITLE: RASHPAL SINGH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50906
SIGNATURE DATE: 07/10/2005

SIGNATURE NAME & TITLE: RASHPAL SINGH, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50905
SIGNATURE DATE: 08/09/2004

SIGNATURE NAME & TITLE: RASHPAL SINGA, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50904
SIGNATURE DATE: 07/09/2003

SIGNATURE NAME & TITLE: RASHPAL SINGH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50903
SIGNATURE DATE: 06/28/2003

SIGNATURE NAME & TITLE: RASHPAL SINGH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 50902
SIGNATURE DATE: 05/01/2001

SIGNATURE NAME & TITLE: RASHPAL SINGH, PRES

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 5265
APPLICATION RECEIVED DATE: 07/19/2011
SCHEDULE CONSTRUCTION DATE: 07/18/2011

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REPIPING TO DOUBLE WALL PIPING. ADDING 2 DISPENSERS AND SUMPS.

NOTIFICATION CONSTRUCTION ID: 5264
APPLICATION RECEIVED DATE: 09/02/2011
SCHEDULE CONSTRUCTION DATE: 09/02/2011

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**REMOVE (4) UST'S** 

Order# 121435 Job# 277689 554 of 1203

NOTIFICATION CONSTRUCTION ID: 5263
APPLICATION RECEIVED DATE: 11/01/2011
SCHEDULE CONSTRUCTION DATE: 11/01/2011

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

INSTALL (1) 20,000 GAL UST.

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1969 REGISTRATION DATE: 06/11/1987

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 46744

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 555 of 1203

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 06/11/1987

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 46748

TANK ID: 2

COMPARTMENT LETTER: A
SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1969 REGISTRATION DATE: 06/11/1987

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 556 of 1203

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS MATERIAL:

**STEEL** 

**CORROSION PROTECTION:** 

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 46746

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 06/11/1987

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:
STEEL



Order# 121435 Job# 277689 557 of 1203

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 46747

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 06/11/1987

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/14/2011** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FIELD INSTALLATION

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 558 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 46745

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 3 INSTALLATION DATE: 11/01/2011 REGISTRATION DATE: 08/21/2012

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 11/01/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 46749

TANK ID: 6

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

Order# 121435 Job# 277689 559 of 1203

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 3 INSTALLATION DATE: 11/01/2011 REGISTRATION DATE: 08/21/2012

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 46750

TANK ID: 6

COMPARTMENT LETTER: **B** SUBSTANCES: **GASOLINE** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

Order# 121435 Job# 277689 560 of 1203

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 3
INSTALLATION DATE: 11/01/2011 REGISTRATION DATE: 08/21/2012

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 46751

TANK ID: 6

COMPARTMENT LETTER: C
SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG



Order# 121435 Job# 277689 561 of 1203

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

# ABOVEGROUND STORAGE TANK INFORMATION NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

# Resource Conservation & Recovery Act - Generator (RCRAGR06)

**MAP ID# 60** 

Distance from Property: 0.078 mi. (412 ft.) ESE

Elevation: 650 ft.

**FACILITY INFORMATION** 

EPA ID#: TXR000048314 OWNER TYPE: PRIVATE

NAME: LARRY HASSELL ONE HOUR OWNER NAME: UNKNOWN

ADDRESS: 6612A BRENTWOOD STAIR RD OPERATOR TYPE: NOT REPORTED

FORT WORTH, TX 76112 OPERATOR NAME: NOT REPORTED

CONTACT NAME: NOT REPORTED

CONTACT ADDRESS: 6612A BRENTWOOD STAIR RD

**FORT WORTH TX 76112** 

CONTACT PHONE: NOT REPORTED

NON-NOTIFIER: E - INITIALLY A NON-NOTIFIER, SUBSEQUENTLY DETERMINED TO BE EXEMPT FROM REQUIREMENTS TO

NOTIFY.

DATE RECEIVED BY AGENCY: 04/09/2002

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR LAST UPDATED DATE: 04/09/2002

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** 

02/05/2002 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE

04/24/2003 CSE COMPLIANCE SCHEDULE EVALUATION 04/24/2003 FCI FOCUSED COMPLIANCE INSPECTION

**VIOLATIONS** 

02/05/2002 262.A GENERATORS - GENERAL

02/05/2002 XXS STATE STATUTE OR REGULATION

**ENFORCEMENTS** 

02/01/2002 120 WRITTEN INFORMAL

HAZARDOUS WASTE

Order# 121435 Job# 277689 563 of 1203

# Resource Conservation & Recovery Act - Generator (RCRAGR06)

F002

THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

Back to Report Summary

# Voluntary Cleanup Program Sites (VCP)

**MAP ID# 60** 

Distance from Property: 0.078 mi. (412 ft.) ESE

Elevation: 650 ft.

**SITE INFORMATION** 

**APPLICANT INFORMATION** 

ID#: 1030 ORGANIZATION: D TX ASSOCIATES

NAME: BRENTWOOD STAIR RETAIL CENTER STEVEN, KATOS, MANAGING PARTNER

33-04 DITMARS BOULEVARD ADDRESS: 6612 BRENTWOOD STAIR ROAD **FORT WORTH TX 76112 ASTORIA, NY, 11105** 

ACRES: 0.92 PHONE: 718-932-5600 FACILITY TYPE: DRY CLEANERS FAX: 718-726-7912

APPLICATION DATE: 8/20/1999 DATE OF AGREEMENT: 11/3/1999

CERTIFICATE OF COMPLETION DATE: 4/16/2007

TYPE OF CERTIFICATE ISSUED: FINAL

TYPE LEAD: OWNER **CONSULTANT/ATTORNEY INFORMATION** PHASE: COMPLETED ORGANIZATION: KOOS & ASSOCIATES, INC. MEDIA AFFECTED: GROUNDWATER DONNELL, KOOS, PRESIDENT

TNRCC SOLID WASTE REGISTRATION #: NOT REPORTED 10410 MARKISON ROAD REMEDY: NATURAL ATTENUATION (ACL) **DALLAS, TX, 75238** 

INSTITUTIONAL CONTROL: NOT REPORTED PHONE: 214-341-5377 LPST #: NOT REPORTED FAX: 214-341-7540

**EPA CERCLIS #: NOT REPORTED EPA RCRIS #: NOT REPORTED** 

CONTAMINANT/S: CHLORINATED SOLVENTS

**Back to Report Summary** 

565 of 1203 

**MAP ID# 61** 

Distance from Property: 0.078 mi. (412 ft.) W

Elevation: 596 ft.

**FACILITY INFORMATION** 

ID#: 69863

NAME: UNITED EQUIPMENT RENTALS GULF 537

ADDRESS: 5930 E LOOP 820 S

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING BEGIN DATE: 08/08/1997

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **1** 

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/11/1997 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 08/11/1997

SIGNATURE NAME & TITLE: GREG FORBESS, MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600494033
NAME: UNITED RENTALS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/01/2008

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600302244

NAME: UNITED EQUIPMENT RENTALS GULF LP

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/08/1997

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED

#### CONTACT INFORMATION

NAME: **JOE JONES** 

TITLE: NOT REPORTED

ORGANIZATION: UNITED EQUIPMENT RENTALS GULF 537
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 4836411 0

ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 184153 MULTIPLE COMPARTMENT FLAG: YES

TANK ID: 1 REGISTRATION DATE: 08/11/1997

INSTALLATION DATE: 08/08/1997 STATUS BEGIN DATE: 08/08/1997

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE, DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: YES

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

**MAP ID# 62** 

Distance from Property: 0.078 mi. (412 ft.) NE

Elevation: 636 ft.

**FACILITY INFORMATION** 

ID#: **57967** 

NAME: N & N FOODSTORE

ADDRESS: 4245 WILBARGER ST

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 08/31/1987

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 04/09/1991 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 12/05/1990

SIGNATURE NAME & TITLE: CHARLES R SMITH, V PRES

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600128862
NAME: CITY OF FORT WORTH

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CITY GOVERNMENT BEGIN DATE: 11/13/2001

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OWNER NUMBER: CN603560061
NAME: CITY OF FT WORTH

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

CITY NOT REPORTED

TYPE: CITY GOVERNMENT BEGIN DATE: 11/13/2001

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED

CONTACT INFORMATION

NAME: MAHMOD QALAWI
TITLE: NOT REPORTED

ORGANIZATION: N & N FOODSTORE

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 5317284 0

Order# 121435 Job# 277689 568 of 1203

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 04/09/1991

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 07/14/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 86686

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO

Order# 121435 Job# 277689 569 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 04/09/1991

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 07/14/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 86685

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 04/09/1991

TANK CAPACITY (GAL): 8000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 07/14/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO



Order# 121435 Job# 277689 570 of 1203

#### **TANK DETAILS**

MATERIAL:

#### COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 86684

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

#### **PIPING SYSTEMS**

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

#### AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 571 of 1203

**MAP ID# 63** 

Distance from Property: 0.082 mi. (433 ft.) N

Elevation: 593 ft.

**FACILITY INFORMATION** 

ID#: **73461** 

NAME: FUEL UP MART

ADDRESS: 4331 KELLY ELLIOTT RD

ARLINGTON, TX 76016

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 08/31/1987

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 07/23/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 07/01/2018

SIGNATURE NAME & TITLE: AMIN VIDA, DIRECTOR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN605387257 NAME: VJP VENTURES LLC

CONTACT ADDRESS: 4331 KELLY ELLIOTT RD

**ARLINGTON TX 76016** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/01/2017

CONTACT ROLE: OWNOPRCON
CONTACT NAME: AMIN VIDA
CONTACT TITLE: NOT REPORTED
ORGANIZATION: VJP VENTURES LLC

PHONE: **(404) 6415173 0** FAX: **NOT REPORTED** 

EMAIL: VJP.ATX@GMAIL.COM
OWNER NUMBER: CN604377283

NAME: **DEEP ELLUM ENTERPRISES INC**CONTACT ADDRESS: **317 S EDGEFIELD AVE** 

DALLAS TX 75208

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/15/2013

CONTACT ROLE: OWNOPRCON

CONTACT NAME: BARBARA MARTINEZ
CONTACT TITLE: NOT REPORTED

ORGANIZATION: DEEP ELLUM ENTERPRISES INC

PHONE: (214) 8015831 0

CONTACT INFORMATION

NAME: AMIN VIDA

TITLE: NOT REPORTED

ORGANIZATION: FUEL UP MART

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (404) 6415173 0

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN605387257

NAME: VJP VENTURES LLC

CONTACT ADDRESS: 4331 KELLY ELLIOTT RD

ARLINGTON TX 76016

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/01/2017

CONTACT ROLE: OWNOPRCON
CONTACT NAME: AMIN VIDA
CONTACT TITLE: NOT REPORTED
ORGANIZATION: VJP VENTURES LLC

PHONE: **(404) 6415173 0** FAX: **NOT REPORTED** 

EMAIL: VJP.ATX@GMAIL.COM

OPERATOR NUMBER: CN604377283

NAME: DEEP ELLUM ENTERPRISES INC

CONTACT ADDRESS: 317 S EDGEFIELD AVE

DALLAS TX 75208

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/15/2013

CONTACT ROLE: OWNOPRCON

CONTACT NAME: BARBARA MARTINEZ

CONTACT TITLE: NOT REPORTED

ORGANIZATION: DEEP ELLUM ENTERPRISES INC

PHONE: (214) 8015831 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

SELF-CERTIFICATION

SELF-CERTIFICATION ID: 306814 SIGNATURE DATE: 07/01/2018

SIGNATURE NAME & TITLE: AMIN VIDA, DIRECTOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 289035
SIGNATURE DATE: 06/30/2017

SIGNATURE NAME & TITLE: AMIN VIDA, DIR

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 276098
SIGNATURE DATE: 08/26/2016

SIGNATURE NAME & TITLE: JOSEPH MARTINEZ, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 259933
SIGNATURE DATE: 08/10/2015

SIGNATURE NAME & TITLE: JOSEPH MARTINEZ, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 243535
SIGNATURE DATE: 07/20/2014

SIGNATURE NAME & TITLE: JOSEPH R MARTINEZ, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 225589
SIGNATURE DATE: 09/10/2013

SIGNATURE NAME & TITLE: JOSEPH R MARTINEZ, PRESIDENT

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 223375
SIGNATURE DATE: 07/27/2013

SIGNATURE NAME & TITLE: K DHADDA, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 195180
SIGNATURE DATE: 06/22/2012

SIGNATURE NAME & TITLE: K OHADDA, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 195179
SIGNATURE DATE: 07/13/2011

SIGNATURE NAME & TITLE: KUL DHADDA, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 195178
SIGNATURE DATE: 06/10/2010

SIGNATURE NAME & TITLE: KUL DHADDA, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 195177
SIGNATURE DATE: 02/10/2010

SIGNATURE NAME & TITLE: KUL DHADDA, OWNER

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 195176
SIGNATURE DATE: 09/15/2009

SIGNATURE NAME & TITLE: MAO CHHAY, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 195175
SIGNATURE DATE: 11/18/2008

SIGNATURE NAME & TITLE: MAO CHHAY, OWNER

FILING STATUS: RENEWAL

Order# 121435 Job# 277689 574 of 1203

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 195174
SIGNATURE DATE: 04/04/2005

SIGNATURE NAME & TITLE: LYNN KORMAN, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 195173
SIGNATURE DATE: 08/09/2004

SIGNATURE NAME & TITLE: RON KORMAN, MGR

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 195172
SIGNATURE DATE: 09/01/2002

SIGNATURE NAME & TITLE: ISHRAT REHMETULLAH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 195171
SIGNATURE DATE: 10/11/2000

SIGNATURE NAME & TITLE: ISHRAT REHMATULLAH, PRESIDENT

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/04/2000 REGISTRATION DATE: 09/08/2000

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/04/2000

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 172460

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED



Order# 121435 Job# 277689 575 of 1203

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/04/2000 REGISTRATION DATE: 09/08/2000

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/04/2000

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 172461

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

Order# 121435 Job# 277689 576 of 1203

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

# Industrial and Hazardous Waste Sites (IHW)

OWNER INFORMATION

ADDRESS: PO BOX 50727

PHONE: 1-817-4510620

NAME: TRIUMPH FABRICATIONS-FORT WORTH INC

FORT WORTH, TX 76105

**MAP ID# 64** 

Distance from Property: 0.082 mi. (433 ft.) W

Elevation: 600 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 33784 EPA ID: TXD980699573

TNRCC ID #: 11258

NAME: AEROSPACE TECHNOLOGIES
ADDRESS: 5965 E ROSEDALE ST

FORT WORTH, TX 76112

CONTACT: DENNIS BLACKBURN

PHONE: 817-4510620

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: LARGE QUANTITY GENERATOR

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 01/12/2018

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 259440

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 260185

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 29440

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 578 of 1203

# Industrial and Hazardous Waste Sites (IHW)

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 259440

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 260185

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 64** 

Distance from Property: 0.082 mi. (433 ft.) W

Elevation: 600 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD980699573 OWNER TYPE: PRIVATE

NAME: AEROSPACE TECHNOLOGIES INC OWNER NAME: AEROSPACE TECHNOLOGIES INC

ADDRESS: 5965 E ROSEDALE ST OPERATOR TYPE: PRIVATE

FORT WORTH, TX 76112 OPERATOR NAME: AEROSPACE TECHNOLOGIES INC

CONTACT NAME: **DENNIS BLACKBURN**CONTACT ADDRESS: **PO BOX 50727** 

**FORT WORTH TX 76105** 

CONTACT PHONE: 817-451-0620

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 02/14/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS)

33251 - HARDWARE MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** 

01/20/1987 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE

05/29/1987 CSE COMPLIANCE SCHEDULE EVALUATION

10/31/1996 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE

11/30/1987 FCI FOCUSED COMPLIANCE INSPECTION

**VIOLATIONS** 

01/20/1987 262.A GENERATORS - GENERAL

**ENFORCEMENTS** 

02/17/1987 120 WRITTEN INFORMAL

HAZARDOUS WASTE



Order# 121435 Job# 277689 580 of 1203

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

F019 WASTEWATER TREATMENT SLUDGES FROM THE CHEMICAL CONVERSION COATING OF ALUMINUM EXCEPT FROM ZIRCONIUM PHOSPHATING IN ALUMINUM CAN WASHING WHEN SUCH PHOSPHATING IS AN EXCLUSIVE CONVERSION COATING PROCESS.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

# Resource Conservation & Recovery Act - Generator (RCRAGR06)

**MAP ID# 65** 

Distance from Property: 0.083 mi. (438 ft.) E

Elevation: 590 ft.

**FACILITY INFORMATION** 

EPA ID#: TXR000082996 OWNER TYPE: PRIVATE

NAME: FAMILY DOLLAR #5915 OWNER NAME: JOHN AND BARBARA NETHERLAND

ADDRESS: 6156 RAMEY AVE. OPERATOR TYPE: PRIVATE

FORT WOTH, TX 76112-8054 OPERATOR NAME: FAMILY DOLLAR STORES

CONTACT NAME: **KEVIN STRAIGHT**CONTACT ADDRESS: **PO. BOX 1017** 

**CHARLOTTE NC 28201** 

CONTACT PHONE: 704-708-1909

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 03/11/2015

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

KEVIN STRAIGHT PROGRAM MGR., ENV. COMPLIANCE 11/13/2014

**INDUSTRY CLASSIFICATION (NAICS)** 

45299 - ALL OTHER GENERAL MERCHANDISE STORES

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR LAST UPDATED DATE: 03/17/2015

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: **NO**UNIVERSAL WASTE DESTINATION FACILITY: **NO** 

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO

USED OIL FUEL MARKETER TO BURNER: NO

USED OIL REFINER: NO

SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - NO EVALUATIONS REPORTED - <u>VIOLATIONS</u> - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D004 ARSENIC
D005 BARIUM
D007 CHROMIUM
D008 LEAD



Order# 121435 Job# 277689 582 of 1203

# Resource Conservation & Recovery Act - Generator (RCRAGR06)

D009 MERCURY
D010 SELENIUM
D011 SILVER

D016 2,4-D (2,4-DICHLOROPHENOXYACETIC ACID)

D024 M-CRESOL

D035 METHYL ETHYL KETONE

U002 2-PROPANONE (I)
U002 ACETONE (I)

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 66** 

Distance from Property: 0.083 mi. (438 ft.) ESE

Elevation: 580 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 33056 EPA ID: NOT REPORTED NAME: BORDEN FOODS CORPORATION

TNRCC ID #: 10572 ADDRESS: 6333 DENTON DR
NAME: BORDEN FOODS DALLAS, TX 75235

ADDRESS: 3853 E LOOP 820 S STE 59 PHONE: 1-817-4514858

FORT WORTH, TX 76119

CONTACT: ELVIS F WEIR PHONE: 817-4514858

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED

WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 11/03/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 27353

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 584 of 1203

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 66** 

Distance from Property: 0.083 mi. (438 ft.) ESE

Elevation: 580 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 83788 EPA ID: NOT REPORTED

ADDDECC. FOOD F DEDDY CT

TNRCC ID #: 101184

ADDRESS: 5882 E BERRY ST

NAME: TEXAS ULTRA GLOSS INC

NAME: TEXAS ULTRA GLOSS

FORT WORTH, TX 76119

ADDRESS: 3825 E LOOP 820 S

PHONE: 1-817-4969681

FORT WORTH, TX 76119

CONTACT: JOE NICELY

PHONE: 817-4969681

BUSINESS DESCRIPTION: RESIN COAT WOOD FIXTURES FOR CUSTOMIZED AUTOMOTIVE (VANS) INTERIORS.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/17/2004

<u>ACTIVITIES</u>

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 126835

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: GENERAL PLANT AND OFFICE TRASH, LESS THAN 20% OF WHICH IS FROM

PRODUCTION, MANUF

WASTE ID: 126836

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: RESIN SPRAY GUN CLEAN OUT WASTE - CLEAN OUT USING ACETONE AND

**METHYLENE CHLORIDE** 

**Back to Report Summary** 



Order# 121435 Job# 277689 585 of 1203

# Resource Conservation & Recovery Act - Generator (RCRAGR06)

**MAP ID# 66** 

Distance from Property: 0.083 mi. (438 ft.) ESE

Elevation: 580 ft.

**FACILITY INFORMATION** 

EPA ID#: TX0001010990 OWNER TYPE: PRIVATE

NAME: TEXAS ULTRA GLOSS INC OWNER NAME: TEXAS ULTRA GLOSS INC

ADDRESS: 3895 E LOOP 820 SOUTH OPERATOR TYPE: NOT REPORTED

FORT WORTH, TX 76119 OPERATOR NAME: NOT REPORTED

CONTACT NAME: BILL POLSTER
CONTACT ADDRESS: 5882 E BERRY

**FORT WORTH TX 76119** 

CONTACT PHONE: 817-496-8420

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/20/1995

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR LAST UPDATED DATE: 09/02/2000

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - **NO EVALUATIONS REPORTED** - <u>VIOLATIONS</u> - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

F002

THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 586 of 1203

#### Resource Conservation & Recovery Act - Generator (RCRAGR06)

F003

THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

CORRECTIVE ACTION EVENT

NO CORRECTIVE ACTION EVENT(S) REPORTED

Back to Report Summary

**MAP ID# 67** 

Distance from Property: 0.084 mi. (444 ft.) ESE

Elevation: 610 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 118079

LPST ID: 118079

FACILITY ID: 0055625 NAME: ROYAL MARKET

ADDRESS: 1302 MANSFIELD HWY

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 118079

NAME: ROYAL MARKET

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 6/25/09

REPORTED DATE: 6/2/2009 ENTERED DATE: 6/25/2009

PRP INFORMATION

NAME: R M PRIVATE LIMITED

ADDRESS: ADDRESS NOT REPORTED

**KENNEDALE TX 76060** 

CONTACT: **NOT REPORTED**PHONE: **NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 08/24/1990

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/11/2013

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 588 of 1203

UST COMPARTMENT ID: 127565

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 08/24/1990

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/11/2013

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**COMPOSITE** 

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 127566

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

Order# 121435 Job# 277689 589 of 1203

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 08/24/1990

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/11/2013** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 127567

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 



Order# 121435 Job# 277689 590 of 1203

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 08/24/1990

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/11/2013

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL: COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 127568

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary



Order# 121435 Job# 277689 591 of 1203

**MAP ID# 67** 

Distance from Property: 0.084 mi. (444 ft.) ESE

Elevation: 610 ft.

**FACILITY INFORMATION** 

ID#: **55625** 

NAME: ROYAL MARKET

ADDRESS: 1302 MANSFIELD HWY

FORT WORTH, TX 76140

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 01/01/1987 STATUS: INACTIVE

EXEMPT STATUS: **NO**RECORDS OFF-SITE: **YES** 

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 12/13/2013 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 12/10/2013

SIGNATURE NAME & TITLE: LAWRENCE C WOOD, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN602909418

NAME: R&M PRIVATE LIMITED

CONTACT ADDRESS: PO BOX 587

**KENNEDALE TX 76060** 

TYPE: OTHER

BEGIN DATE: 08/31/2005 CONTACT ROLE: OWNCON

CONTACT NAME: MANPREET BHATIA

CONTACT TITLE: PARTNER

ORGANIZATION: R&M PRIVATE LIMITED

PHONE: (817) 5844360 0 FAX: NOT REPORTED EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN602909418

NAME: R&M PRIVATE LIMITED

CONTACT ADDRESS: PO BOX 587

**KENNEDALE TX 76060** 

TYPE: OTHER

BEGIN DATE: 08/31/2005 CONTACT ROLE: OPRCON

CONTACT NAME: MANPREET BHATIA

CONTACT TITLE: PARTNER

CONTACT INFORMATION

NAME: MANPREET BHATIA

TITLE: PARTNER

ORGANIZATION: ROYAL MARKET

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 5844360 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 592 of 1203

ORGANIZATION: R&M PRIVATE LIMITED

PHONE: (817) 5894360 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 222455 SIGNATURE DATE: 06/20/2013

SIGNATURE NAME & TITLE: MANPREET BHATIA, GP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 139864
SIGNATURE DATE: 06/26/2012

SIGNATURE NAME & TITLE: MANPREET BHATIA, MGR OF GP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 139863
SIGNATURE DATE: 07/05/2011

SIGNATURE NAME & TITLE: MANPREET BHATA, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 139862
SIGNATURE DATE: 06/27/2010

SIGNATURE NAME & TITLE: MANPREET BHATIA, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 139861
SIGNATURE DATE: 08/19/2009

SIGNATURE NAME & TITLE: MANPREET BHATIA, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 139860
SIGNATURE DATE: 07/02/2007

SIGNATURE NAME & TITLE:  ${\bf MANPREET\ BHATIA}, {\bf PARTNER/GM}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 139859
SIGNATURE DATE: 07/08/2006

SIGNATURE NAME & TITLE: MANPREET BHATIA, PARTNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 139858
SIGNATURE DATE: 09/08/2005

SIGNATURE NAME & TITLE: MANPREET BHATIA, PARTNER

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 139857
SIGNATURE DATE: 12/15/2004



Order# 121435 Job# 277689 593 of 1203

SIGNATURE NAME & TITLE: ALEX SCHOEPLEIN, VICE PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 139856
SIGNATURE DATE: 01/07/2004

SIGNATURE NAME & TITLE: ALEX SCHOEPLEIN, VICE PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 139581
SIGNATURE DATE: 01/13/2003

SIGNATURE NAME & TITLE: ALEX SCHOEPLEIN, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 139580
SIGNATURE DATE: 12/26/2001

SIGNATURE NAME & TITLE: ALEX SCHOEPLEIN, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 139579
SIGNATURE DATE: 01/10/2001

SIGNATURE NAME & TITLE: ALEX SCHOEPLEIN, VP

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 24714

APPLICATION RECEIVED DATE: 09/20/2013

SCHEDULE CONSTRUCTION DATE: 10/07/2013

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REMOVE (4) UST'S

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 08/24/1990

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/11/2013

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 594 of 1203

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 127565

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 08/24/1990

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/11/2013

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 127566

TANK ID: 2

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

Order# 121435 Job# 277689 595 of 1203

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 08/24/1990

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/11/2013** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL: COMPOSITE

.....

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 127567

TANK ID: 3

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS



MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1

INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 08/24/1990 TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/11/2013

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 127568

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:



Order# 121435 Job# 277689 597 of 1203

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 68** 

Distance from Property: 0.085 mi. (449 ft.) NE

Elevation: 636 ft.

**FACILITY INFORMATION** 

ID#: 66381

NAME: Z ONE GROCERY & GRILL ADDRESS: 4225 MILLER AVE

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 08/31/1987

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 10/16/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 09/30/2018 SIGNATURE NAME & TITLE: KAMAL HANTOULI, PRESIDENT

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN605452663 NAME: ZONE GROUP INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/05/2017

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

OWNER NUMBER: CN603174293

NAME: JOES & CHO INC

CONTACT ADDRESS: 4225 MILLER AVE

FORT WORTH TX 76119

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/20/2007 CONTACT ROLE: OWNCON CONTACT NAME: ANNA CHO CONTACT TITLE: PRES

ORGANIZATION: JOES & CHO INC

PHONE: (817) 5354215 0

#### **CONTACT INFORMATION**

NAME: IHAB HANTOLI

TITLE: MGR

ORGANIZATION: Z ONE GROCERY & GRILL

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 8084063 0

599 of 1203

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN605452671

NAME: H2D GROUP INC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/05/2017

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OPERATOR NUMBER: CN603174293

NAME: JOES & CHO INC

CONTACT ADDRESS: 4225 MILLER AVE

FORT WORTH TX 76119

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/20/2007
CONTACT ROLE: OPRCON
CONTACT NAME: ANNA CHO
CONTACT TITLE: NOT REPORTED
ORGANIZATION: JOES & CHO INC

PHONE: (817) 5354215 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

SELF-CERTIFICATION

SELF-CERTIFICATION ID: 311992 SIGNATURE DATE: 09/30/2018

SIGNATURE NAME & TITLE: KAMAL HANTOULI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 296876
SIGNATURE DATE: 12/05/2017

SIGNATURE NAME & TITLE: KAMAL HANTOULI, OWNER

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 283561
SIGNATURE DATE: 02/28/2017

SIGNATURE NAME & TITLE: ANNA CHO, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 265253
SIGNATURE DATE: 02/17/2016

SIGNATURE NAME & TITLE: ANNA CHO, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 246308
SIGNATURE DATE: 12/26/2014

SIGNATURE NAME & TITLE: ANNA CHO, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 231132
SIGNATURE DATE: 01/11/2014

SIGNATURE NAME & TITLE: ANNA CHO, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 164268
SIGNATURE DATE: 12/31/2012

SIGNATURE NAME & TITLE: ANNA CHO, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 164267
SIGNATURE DATE: 03/08/2012

SIGNATURE NAME & TITLE: ANNA CHO, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 164266
SIGNATURE DATE: 12/26/2010

SIGNATURE NAME & TITLE: ANNA CHO, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 164265
SIGNATURE DATE: 06/10/2010

SIGNATURE NAME & TITLE: ANNA CHO, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 164264
SIGNATURE DATE: 02/12/2007

SIGNATURE NAME & TITLE: AE OK PARK, PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 164263
SIGNATURE DATE: 12/06/2006

SIGNATURE NAME & TITLE: NASIM A AZIZ, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 164262
SIGNATURE DATE: 12/03/2005

SIGNATURE NAME & TITLE: NASIM AZIZ, PRES

FILING STATUS: RENEWAL

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 164261
SIGNATURE DATE: 01/02/2005

SIGNATURE NAME & TITLE: NASIM AZIZ, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 164260
SIGNATURE DATE: 01/21/2004

SIGNATURE NAME & TITLE: NASIM AZIZ, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 164259
SIGNATURE DATE: 01/26/2003

SIGNATURE NAME & TITLE: NASIM A AZIZ, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 164258
SIGNATURE DATE: 05/15/2001

SIGNATURE NAME & TITLE: NASIM A AZIZ, PRES

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1995 REGISTRATION DATE: 01/26/1995

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 151496

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED



Order# 121435 Job# 277689 602 of 1203

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 01/01/1995 REGISTRATION DATE: 01/26/1995

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 151497

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 



Order# 121435 Job# 277689 603 of 1203

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 01/01/1995 REGISTRATION DATE: 01/26/1995

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 151498

TANK ID: 2

COMPARTMENT LETTER: **B** SUBSTANCES: **GASOLINE** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:



Order# 121435 Job# 277689 604 of 1203

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 69** 

Distance from Property: 0.086 mi. (454 ft.) SE

Elevation: 620 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 38211 EPA ID: NOT REPORTED NAME: MASTER BUILDERS INC ADDRESS: 23700 CHAGRIN BLVD

NAME: MASTER BUILDERS

**CLEVELAND, OH 44122** 

PHONE: 1-216-8315500

ADDRESS: 5230 SE LOOP 820

FORT WORTH, TX 76140

CONTACT: PAROSSKOPF PHONE: 216-8315500

TNRCC ID #: 14839

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: YES WASTE RECEIVER: NO WASTE TRANSPORTER: NO TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 10/21/2003

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 38944

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

Back to Report Summary

606 of 1203

# Alternative Fueling Stations (ALTFUELS)

**MAP ID# 70** 

Distance from Property: 0.086 mi. (454 ft.) W

Elevation: 597 ft.

**FACILITY INFORMATION** 

GEOSEARCH ID: 53774

UNIQUE IDENTIFIER FOR THIS SPECIFIC STATION: 53774
STATION NAME: TRILLIUM - EVO CENTRAL FREIGHT

ADDRESS: 5200 E LOOP 820 S
FORT WORTH, TX 76119

INTERSECTION DIRECTIONS: NOT REPORTED

STATION PHONE: 800-920-1166

STATION CURRENT STATUS: OPEN: THE STATION IS OPEN.

TYPE OF ALTERNATIVE FUEL THE STATION PROVIDES: COMPRESSED NATURAL GAS

OWNER TYPE: PRIVATELY OWNED
FEDERAL AGANCY ID: NOT REPORTED
FEDERAL AGENCY NAME: NOT REPORTED

DATE THAT THE STATION BEGAN OFFERING THE FUEL: 1/23/2015
DATE THE STATION'S DETAILS WERE LAST CONFIRMED: 8/7/2018

TIME THE STATION'S DETAILS WERE LAST UPDATED (ISO 8601 FORMAT).: 2018-08-07 22:32:24 UTC

**Back to Report Summary** 

Order# 121435 Job# 277689 607 of 1203

OWNER INFORMATION

ADDRESS: PO BOX 540277

PHONE: 1-972-5794120

NAME: CENTRAL FREIGHT LINES INC

**DALLAS, TX 75354** 

**MAP ID# 70** 

Distance from Property: 0.086 mi. (454 ft.) W

Elevation: 597 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 69609 EPA ID: TXD026418111

TNRCC ID #: 24483

NAME: CENTRAL FREIGHT LINES

ADDRESS: 5200 E LOOP 820 S

FORT WORTH, TX 76119

CONTACT: KERRY W HILL PHONE: 972-5794120

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/24/2004

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 98183

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: USED PARTS CLEANER FROM SELF CONTAINED VAT.

WASTE ID: 119854

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: USED BATTERIES, TRUCK & CAR USE.

WASTE ID: 119857

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 608 of 1203

GENERATOR'S DESCRIPTION OF WASTE: SCRAP METAL/ROUTINE VEHICLE & TRAILER MAINTENANCE.

WASTE ID: 119859

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: GRIT/VEHICLE WASH BAY

WASTE ID: 119860

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: USED OIL FILTERS/CAR/TRUCK USE

WASTE ID: 119861

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: USED & SCRAP TIRES/CAR & TRUCK USE

WASTE ID: 119863

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: USED OIL/LUBRICANT TRUCKS/CARS

WASTE ID: 124616

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: HEAVY TRUCK MAINTENANCE

WASTE ID: 257737

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 292851

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 292852

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 292853

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 



Order# 121435 Job# 277689 609 of 1203

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 292854

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 294489

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 294490

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 294491

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 294492

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 307387

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 309152

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 309153

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 309154

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 



Order# 121435 Job# 277689 610 of 1203

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 309155

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 309156

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 309157

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 309158

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 304385

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 49617

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 611 of 1203

**MAP ID# 70** 

Distance from Property: 0.086 mi. (454 ft.) W

Elevation: 597 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 113463

LPST ID: 113463

FACILITY ID: 0034154

NAME: CENTRAL FREIGHT LINES INC

ADDRESS: 5200 E LOOP 820 S

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 113463

NAME: CENTRAL FREIGHT LINES INC FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 9/23/98

REPORTED DATE: 9/23/1998 ENTERED DATE: 9/23/1998

PRP INFORMATION

NAME: CENTRAL FREIGHT LINES INC ADDRESS: ADDRESS NOT REPORTED

**DALLAS TX 75354** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/18/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 612 of 1203

UST COMPARTMENT ID: 70287

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,ALARM

(SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1988 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1988

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: WASTEWATER TREATMENT

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70295

TANK ID: 2

COMPARTMENT LETTER: A

SUBSTANCES: **OIL WATER SEPARATOR** OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, SIR (STAT. INVENTORY RECONCILIATION) &

**INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF

Order# 121435 Job# 277689 613 of 1203

VALVE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FIELD

INSTALLATION

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FIELD

**INSTALLATION** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/18/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 70292

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,ALARM

(SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

Order# 121435 Job# 277689 614 of 1203

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/18/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70291

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, ALARM

(SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/18/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

Order# 121435 Job# 277689 615 of 1203

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70290

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, ALARM

(SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/24/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

Order# 121435 Job# 277689 616 of 1203

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70289

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/24/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 70288

TANK ID: 6

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

Order# 121435 Job# 277689 617 of 1203

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 7 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/24/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 70294

TANK ID: 7

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

Order# 121435 Job# 277689 618 of 1203

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 8 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/24/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 70293

TANK ID: 8

COMPARTMENT LETTER: A SUBSTANCES: **NEW OIL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

AST ID #: 189611 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: T1 REGISTRATION DATE: 01/14/1999

INSTALLATION DATE: 01/11/1999 STATUS BEGIN DATE: 01/11/1999

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 



Order# 121435 Job# 277689 619 of 1203

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 189612 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: T2 REGISTRATION DATE: 01/14/1999

INSTALLATION DATE: 01/11/1999 STATUS BEGIN DATE: 01/11/1999

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

**MAP ID# 70** 

Distance from Property: 0.086 mi. (454 ft.) W

Elevation: 597 ft.

**FACILITY INFORMATION** 

ID#: **34154** 

NAME: CENTRAL FREIGHT LINES

ADDRESS: 5200 E LOOP 820 S

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: **FLEET REFUELING**BEGIN DATE: **09/01/1987** 

STATUS: **ACTIVE**EXEMPT STATUS: **NO**RECORDS OFF-SITE: **NO** 

NUMBER OF ACTIVE UNDERGROUND TANKS: 1 NUMBER OF ACTIVE ABOVEGROUND TANKS: 2

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/05/1986

SIGNATURE NAME & TITLE: M D DOOLEY, TERM MANAGER

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603566860

NAME: SOUTHWEST PREMIER PROPERTIES LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/2007

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OWNER NUMBER: CN600258990

NAME: CENTRAL FREIGHT LINES INC

CONTACT ADDRESS: PO BOX 2638

WACO TX 76702

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/2007 CONTACT ROLE: OWNCON

CONTACT NAME: CLIFF STEPHENS

CONTACT TITLE: DIR ADMIN

ORGANIZATION: CENTRAL FREIGHT LINES INC

PHONE: (254) 7415525 0

**CONTACT INFORMATION** 

NAME: LONNIE APPLEGATE

TITLE: NOT REPORTED

ORGANIZATION: CENTRAL FREIGHT LINES

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4788211 0

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600258990
NAME: CENTRAL FREIGHT LINES INC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/2007

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 81091 SIGNATURE DATE: 02/23/2007

SIGNATURE NAME & TITLE: GARY WEINBERGER, MEMBER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 81090
SIGNATURE DATE: 02/22/2007

SIGNATURE NAME & TITLE: GARY WEINBERGER, MEMBER

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/18/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO

Order# 121435 Job# 277689 622 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70287

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, ALARM

(SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1988 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 01/01/1988

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: WASTEWATER TREATMENT

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70295

TANK ID: 2

COMPARTMENT LETTER: A

SUBSTANCES: OIL WATER SEPARATOR
OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

Order# 121435 Job# 277689 623 of 1203

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF

VALVE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FIELD

**INSTALLATION** 

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

GROUNDWATER MONITORING, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/18/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70292

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,ALARM

(SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED

Order# 121435 Job# 277689 624 of 1203

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/18/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70291

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, ALARM

(SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 625 of 1203

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/18/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70290

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,ALARM

(SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/24/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO



Order# 121435 Job# 277689 626 of 1203

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70289

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/24/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO

Order# 121435 Job# 277689 627 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70288

TANK ID: 6

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 7 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/24/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70294

TANK ID: 7

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

Order# 121435 Job# 277689 628 of 1203

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 8 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/24/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 70293

TANK ID: 8

COMPARTMENT LETTER: A SUBSTANCES: **NEW OIL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

Order# 121435 Job# 277689 629 of 1203

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 189611 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: T1 REGISTRATION DATE: 01/14/1999

INSTALLATION DATE: 01/11/1999 STATUS BEGIN DATE: 01/11/1999

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 189612 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: T2 REGISTRATION DATE: 01/14/1999

INSTALLATION DATE: 01/11/1999 STATUS BEGIN DATE: 01/11/1999

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

Order# 121435 Job# 277689 630 of 1203

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 70** 

Distance from Property: 0.086 mi. (454 ft.) W

Elevation: 597 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD026418111 OWNER TYPE: PRIVATE

NAME: CENTRAL FREIGHT LINES INC OWNER NAME: CENTRAL FREIGHT LINES INC

ADDRESS: 5200 E LOOP 820 S OPERATOR TYPE: PRIVATE

FORT WORTH, TX 76101 OPERATOR NAME: CENTRAL FREIGHT LINES INC

CONTACT NAME: KERRY W HILL
CONTACT ADDRESS: PO BOX 540277
DALLAS TX 75354

CONTACT PHONE: 972-579-4120

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 04/09/2003

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

48849 - OTHER SUPPORT ACTIVITIES FOR ROAD TRANSPORTATION

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - **NO EVALUATIONS REPORTED** - <u>VIOLATIONS</u> - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D018 BENZENE

D027 1,4-DICHLOROBENZENE
D039 TETRACHLOROETHYLENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 631 of 1203

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

NO CORRECTIVE ACTION EVENT(S) REPORTED

Back to Report Summary

**MAP ID# 71** 

Distance from Property: 0.087 mi. (459 ft.) SW

Elevation: 656 ft.

**FACILITY INFORMATION** 

ID#: 75460

NAME: CORNER STORE 1738 ADDRESS: 4900 W SUBLETT RD

ARLINGTON, TX 76001

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 04/04/2002

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/25/2017 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 08/15/2017

SIGNATURE NAME & TITLE: GEORGE GALE, COMP SPC

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN604312421 NAME: BIG DIAMOND LLC

CONTACT ADDRESS: PO BOX 690350

**SAN ANTONIO TX 78269** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/29/2013

CONTACT ROLE: OWNOPRCON CONTACT NAME: KENT HAMEL CONTACT TITLE: NOT REPORTED ORGANIZATION: BIG DIAMOND LLC

PHONE: (210) 6922275 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN604312421

NAME: BIG DIAMOND LLC

CONTACT ADDRESS: PO BOX 690350

**SAN ANTONIO TX 78269** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/29/2013

CONTACT ROLE: OWNOPRCON CONTACT NAME: KENT HAMEL CONTACT TITLE: NOT REPORTED **CONTACT INFORMATION** 

NAME: VERONICA RIVERA TITLE: NOT REPORTED

**ORGANIZATION: CORNER STORE 1738** 

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (602) 7288000 0

GeoSearch www.geo-search.com 888-396-0042

633 of 1203 

ORGANIZATION: BIG DIAMOND LLC

PHONE: (210) 6922275 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 311005 SIGNATURE DATE: 10/01/2018

SIGNATURE NAME & TITLE: ANNETTE S TOALE, WC ENVIRO MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 291826
SIGNATURE DATE: 08/15/2017

SIGNATURE NAME & TITLE: GEORGE GALE, COMP SPC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 275470
SIGNATURE DATE: 08/25/2016

SIGNATURE NAME & TITLE: GEORGE GALE, COMPLIANCE SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 258351
SIGNATURE DATE: 08/24/2015

SIGNATURE NAME & TITLE: GEORGE GALE, COMP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 243235
SIGNATURE DATE: 08/15/2014

SIGNATURE NAME & TITLE: GEORGE GALE, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 226052
SIGNATURE DATE: 08/15/2013

SIGNATURE NAME & TITLE: GEORGE GALE, COMP COORD

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209331
SIGNATURE DATE: 08/15/2012

SIGNATURE NAME & TITLE: GEORGE GALE, COMP COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209330
SIGNATURE DATE: 08/24/2011

SIGNATURE NAME & TITLE: GEORGE GALE, RETAIL COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209329
SIGNATURE DATE: 08/25/2010

Order# 121435 Job# 277689 634 of 1203

SIGNATURE NAME & TITLE: GEORGE GALE, RETAIL COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209328
SIGNATURE DATE: 08/20/2009

SIGNATURE NAME & TITLE: GEORGE GALE, RETAIL COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209327
SIGNATURE DATE: 08/20/2008

SIGNATURE NAME & TITLE: GEORGE GALE, RETAIL COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209326
SIGNATURE DATE: 08/19/2008

SIGNATURE NAME & TITLE: GEORGE GALE, RETAIL COMP COORD

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209325
SIGNATURE DATE: 02/29/2008

SIGNATURE NAME & TITLE: BOB DENINNO, ENV MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209324
SIGNATURE DATE: 02/07/2007

SIGNATURE NAME & TITLE: PAUL G ROWAN, SR VP/GEN COUNSEL

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209323
SIGNATURE DATE: 03/14/2006

SIGNATURE NAME & TITLE: DOUG KASEFANG, DIR ENV AFFAIRS

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209322
SIGNATURE DATE: 02/22/2005

SIGNATURE NAME & TITLE: BARBARA RUSSELL, DIR OF AFFAIRS

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209321
SIGNATURE DATE: 02/05/2004

SIGNATURE NAME & TITLE: BARBARA RUSSELL, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209320
SIGNATURE DATE: 02/25/2003

SIGNATURE NAME & TITLE: BARBARA RUSSELL, DIR ENV AFFAIRS

FILING STATUS: RENEWAL

Order# 121435 Job# 277689 635 of 1203

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 209319
SIGNATURE DATE: 10/21/2002

SIGNATURE NAME & TITLE: BARB RUSSELL, NOT REPORTED

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/04/2002 REGISTRATION DATE: 10/23/2002

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 04/04/2002

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 171968

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 15000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND

CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG



Order# 121435 Job# 277689 636 of 1203

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/04/2002 REGISTRATION DATE: 10/23/2002

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 04/04/2002

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 171969

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND

CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 



Order# 121435 Job# 277689 637 of 1203

# Industrial and Hazardous Waste Sites (IHW)

OWNER INFORMATION

PHONE: 1-817-4838689

NAME: LO-RICH TRUCKING

ADDRESS: 6512 HARTMAN RD

FORT WORTH, TX 76140

**MAP ID# 72** 

Distance from Property: 0.087 mi. (459 ft.) S

Elevation: 636 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 88210 EPA ID: NOT REPORTED

TNRCC ID #: 121412

NAME: LO-RICH TRUCKING

ADDRESS: 6512 HARTMAN RD

FORT WORTH, TX 76140

CONTACT: DARYL J RICHARDSON

PHONE: 817-4838689

BUSINESS DESCRIPTION: HAULING BY DUMP TRUCK INDUSTRIAL WASTE PERMIT #: NOT REPORTED MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: NO
WASTE RECEIVER: NO
WASTE TRANSPORTER: YES
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/23/2017

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

WASTE NO RECORDS

**Back to Report Summary** 

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 638 of 1203

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 73** 

Distance from Property: 0.088 mi. (465 ft.) SSE

Elevation: 628 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 66419 EPA ID: NOT REPORTED NAME: BELL PETROLEUM SYSTEMS

TNRCC ID #: 21694 ADDRESS: 5144 SE LOOP 820

NAME: BELL PETROLEUM SYSTEMS FORT WORTH, TX 76140

ADDRESS: 5144 SE LOOP 820 PHONE: NOT REPORTED

FORT WORTH, TX 76140

CONTACT: **GENE MAYES** PHONE: **NOT REPORTED** 

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THIS FACILITY WAS REGISTERED PRIOR

TO1994 AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/23/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE NO RECORDS

**Back to Report Summary** 

Order# 121435 Job# 277689 639 of 1203

**MAP ID# 74** 

Distance from Property: 0.088 mi. (465 ft.) SW

Elevation: 697 ft.

**FACILITY INFORMATION** 

EPA ID#: TXR000080091 OWNER TYPE: PRIVATE

NAME: NTW, LLC NO 810 OWNER NAME: NTW, LLC

ADDRESS: 5030 HWY 287 OPERATOR TYPE: PRIVATE

ARLINGTON, TX 76017 OPERATOR NAME: NTW, LLC

CONTACT NAME: **DAVID ZOLNOWSKI**CONTACT ADDRESS: **4300 TBC WAY** 

**PALM BEACH GARDENS FL 33410** 

CONTACT PHONE: 561-383-3100 4381

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 05/10/2010

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

KELLY VAN LEUVEN RISK ASSOCIATE 04/14/2010

INDUSTRY CLASSIFICATION (NAICS)
811111 - GENERAL AUTOMOTIVE REPAIR

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR LAST UPDATED DATE: 05/18/2010

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: **NO**UNIVERSAL WASTE DESTINATION FACILITY: **NO** 

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D008 LEAD

D039 TETRACHLOROETHYLENE
D040 TRICHLORETHYLENE



Order# 121435 Job# 277689 640 of 1203

**UNIVERSAL WASTE** 

WASTE TYPE: ACCUMULATED GENERATED SOURCE TYPE:

WASTE ON-SITE: WASTE ON-SITE:

**NOT REPORTED NOTIFICATION BATTERIES LAMPS** NO **NOT REPORTED NOTIFICATION PESTICIDES** NO **NOT REPORTED NOTIFICATION NOT REPORTED** NO NO **NOTIFICATION** MERCURY CONTAINING NO NOT REPORTED **NOTIFICATION** 

**EQUIPMENT** 

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 641 of 1203

**MAP ID# 75** 

Distance from Property: 0.089 mi. (470 ft.) NW

Elevation: 647 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 113078

LPST ID: 113078

FACILITY ID: 0013506

NAME: AKRANIS CONOCO

ADDRESS: 6509 BRENTWOOD STAIR RD

FORT WORTH, TX

### **LEAKING TANK DETAILS**

LPST ID: 113078

NAME: AKRANIS CONOCO

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 4/1/98

REPORTED DATE: 3/31/1998 ENTERED DATE: 4/1/1998

PRP INFORMATION
NAME: RIBANI, ABRAM

ADDRESS: ADDRESS NOT REPORTED

**FORT WORTH TX 76103** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 642 of 1203

UST COMPARTMENT ID: 147800

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 147802

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

Order# 121435 Job# 277689 643 of 1203

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 147801

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES

Order# 121435 Job# 277689 644 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 147803

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 645 of 1203

**MAP ID# 75** 

Distance from Property: 0.089 mi. (470 ft.) NW

Elevation: 647 ft.

**FACILITY INFORMATION** 

ID#: 13506

NAME: RZ FOOD MART

ADDRESS: 6509 BRENTWOOD STAIR RD

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: **RETAIL** 

BEGIN DATE: 08/31/1988

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 4
NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/29/2018
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/17/2018

SIGNATURE NAME & TITLE: **REHAN KAPADIA, OWNER** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN604587089

NAME: **ZOHAIL INC** 

CONTACT ADDRESS: 6509 BRENTWOOD STAIR RD

FORT WORTH TX 76112

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/07/2017

CONTACT ROLE: **OWNOPRCON**CONTACT NAME: **REHAN KAPADIA** 

CONTACT TITLE: PRES
ORGANIZATION: ZOHAIL INC
PHONE: (817) 4517426 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OWNER NUMBER: CN601260755
NAME: AKRAM F RIHANI INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

CITY NOT REPORTED

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/09/2003

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: **REHAN KAPADIA**TITLE: **NOT REPORTED** 

ORGANIZATION: RZ FOOD MART

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4517426 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 646 of 1203

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN604587089

NAME: **ZOHAIL INC** 

CONTACT ADDRESS: 6509 BRENTWOOD STAIR RD FORT WORTH TX 76112

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/07/2017

CONTACT ROLE: **OWNOPRCON**CONTACT NAME: **REHAN KAPADIA** 

CONTACT TITLE: PRES
ORGANIZATION: ZOHAIL INC
PHONE: (817) 4517426 0
FAX: NOT REPORTED

EMAIL: NOT REPORTED

OPERATOR NUMBER: CN604587089

NAME: **ZOHAIL INC** 

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/01/2013

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OPERATOR NUMBER: CN603876699

NAME: MERCHANT

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

CITY NOT REPORTED

TYPE: **INDIVIDUAL**BEGIN DATE: **05/15/11** 

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 304594 SIGNATURE DATE: 05/17/2018

SIGNATURE NAME & TITLE: REHAN KAPADIA, OWNER

FILING STATUS: INITIAL

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 287922
SIGNATURE DATE: 05/23/2017

SIGNATURE NAME & TITLE: REHAM KAPADIA, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 270622
SIGNATURE DATE: 05/27/2016

SIGNATURE NAME & TITLE: REHAM KAPADIR, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 253562
SIGNATURE DATE: 05/18/2015

SIGNATURE NAME & TITLE: REHAN KAPADIA, OPER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 237046
SIGNATURE DATE: 05/21/2014

SIGNATURE NAME & TITLE: REHAN KAPADIA, OPER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 220406
SIGNATURE DATE: 05/02/2013

SIGNATURE NAME & TITLE: REHAN MERCHANT, OPER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143117
SIGNATURE DATE: 04/27/2012

SIGNATURE NAME & TITLE: REHAN MERCHANT, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143116
SIGNATURE DATE: 06/11/2011

SIGNATURE NAME & TITLE: REHAN MERCHANT, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143115
SIGNATURE DATE: 08/19/2010

SIGNATURE NAME & TITLE: THONG VAN NGUYEN, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143114
SIGNATURE DATE: 04/24/2009

SIGNATURE NAME & TITLE: THONG VAN NGUYEN, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143113

Order# 121435 Job# 277689 648 of 1203

SIGNATURE DATE: 05/10/2008

SIGNATURE NAME & TITLE: THONG NGUYEN, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143112
SIGNATURE DATE: 06/02/2007

SIGNATURE NAME & TITLE: THONG NGUYEN, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143111
SIGNATURE DATE: 08/23/2006

SIGNATURE NAME & TITLE: THONG VAN NGUYEN, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143110
SIGNATURE DATE: 05/04/2005

SIGNATURE NAME & TITLE: UYEN PHAM, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143109
SIGNATURE DATE: 01/14/2004

SIGNATURE NAME & TITLE: UYEN PHAM, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143108
SIGNATURE DATE: 05/11/2003

SIGNATURE NAME & TITLE: ANN PHAM, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143107
SIGNATURE DATE: 08/21/2002

SIGNATURE NAME & TITLE: ANN PHAM, OPERATOR

FILING STATUS: AMENDMENT
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143106
SIGNATURE DATE: 05/11/2002

SIGNATURE NAME & TITLE: JOE V QUACH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143105
SIGNATURE DATE: 05/10/2002

SIGNATURE NAME & TITLE: JOE V QUACH, PRES

FILING STATUS: AMENDMENT
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143104
SIGNATURE DATE: 01/10/2002

SIGNATURE NAME & TITLE: JOE V QUACH, PRES

Order# 121435 Job# 277689 649 of 1203

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 143103
SIGNATURE DATE: 05/01/2001

SIGNATURE NAME & TITLE: JOE V QUACH, OWNER

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 147800

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG



Order# 121435 Job# 277689 650 of 1203

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 01/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 147802

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 01/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

Order# 121435 Job# 277689 651 of 1203

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 147801

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 01/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

Order# 121435 Job# 277689 652 of 1203

### FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

### COMPARTMENT DETAILS

UST COMPARTMENT ID: 147803

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

### **PIPING SYSTEMS**

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 653 of 1203

**CONTACT INFORMATION** 

ORGANIZATION: TIGER MART 77

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: MAAN ASALI

TITLE: NOT REPORTED

PHONE: (817) 5610265 0

**MAP ID# 76** 

Distance from Property: 0.092 mi. (486 ft.) S

Elevation: 618 ft.

**FACILITY INFORMATION** 

ID#: 70122

NAME: TIGER MART 77

ADDRESS: 4401 KELLY ELLIOTT RD

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 06/10/1997

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 12/04/2017 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 12/01/2017 SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601616188

NAME: RASHWAN INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/11/2009

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN604258178

NAME: **ASALI INC** 

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/18/2013

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 295488 SIGNATURE DATE: 12/01/2017

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 280681
SIGNATURE DATE: 01/11/2017

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 262348
SIGNATURE DATE: 12/09/2015

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 245820
SIGNATURE DATE: 12/09/2014

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 230494
SIGNATURE DATE: 01/15/2014

SIGNATURE NAME & TITLE: GINGER KELLEY, COMPL SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183708
SIGNATURE DATE: 01/22/2013

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183707
SIGNATURE DATE: 01/17/2012

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183706
SIGNATURE DATE: 01/12/2011

SIGNATURE NAME & TITLE:  ${\bf GINGER} \ {\bf KELLEY}, \ {\bf COMP} \ {\bf SPEC}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183705
SIGNATURE DATE: 12/29/2009

Order# 121435 Job# 277689 655 of 1203

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183704
SIGNATURE DATE: 06/11/2009

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183703
SIGNATURE DATE: 03/27/2009

SIGNATURE NAME & TITLE: TARONZA L GRAVES, AUTHORIZED AGENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183702
SIGNATURE DATE: 03/26/2008

SIGNATURE NAME & TITLE: ADRIANNE RUTHERFORD, OWNERS AUTH AGENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183701
SIGNATURE DATE: 04/04/2007

SIGNATURE NAME & TITLE: HEATHER GILMORE, AGENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183700
SIGNATURE DATE: 03/06/2006

SIGNATURE NAME & TITLE: ERIC M MCPHEE, PERMITTING MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183699
SIGNATURE DATE: 03/15/2005

SIGNATURE NAME & TITLE: ERIC M MCPHEE, PERMITTING MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183698
SIGNATURE DATE: 03/12/2004

SIGNATURE NAME & TITLE: ERIC M. MCPHEE, CMS PERMITTING MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183697
SIGNATURE DATE: 03/05/2003

SIGNATURE NAME & TITLE: ERIC M. MCPHEE, PERMIT TEAM LEAD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183696
SIGNATURE DATE: 03/13/2002

SIGNATURE NAME & TITLE: WENDY SALAS, PERMIT TEAM LEAD

FILING STATUS: RENEWAL

Order# 121435 Job# 277689 656 of 1203

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 183695
SIGNATURE DATE: 01/15/2001

SIGNATURE NAME & TITLE: DAPHYNE JENKINS, PROG MGR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 18250
APPLICATION RECEIVED DATE: 04/12/2005
SCHEDULE CONSTRUCTION DATE: 06/27/2005

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/10/1997 REGISTRATION DATE: 11/04/1997

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/10/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 178154

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED



Order# 121435 Job# 277689 657 of 1203

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/10/1997 REGISTRATION DATE: 11/04/1997

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/10/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 178155

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 658 of 1203

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/10/1997 REGISTRATION DATE: 11/04/1997

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 06/10/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 178156

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 



Order# 121435 Job# 277689 659 of 1203

**MAP ID# 76** 

Distance from Property: 0.094 mi. (496 ft.) S

Elevation: 618 ft.

**FACILITY INFORMATION** 

EPA ID#: TXR000034785 OWNER TYPE: PRIVATE

NAME: EXXON RAS NO 60364 OWNER NAME: EXXON MOBIL

ADDRESS: 4401 KELLY ELLIOT ROAD OPERATOR TYPE: NOT REPORTED

ARLINGTON, TX 76017 OPERATOR NAME: NOT REPORTED

CONTACT NAME: ALDA S POOL

CONTACT ADDRESS: 1200 TIMBERLOCH PLACE
THE WOODLANDS TX 77380

CONTACT PHONE: 281-296-3579

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 02/15/2000

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR LAST UPDATED DATE: 09/02/2000

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - **NO EVALUATIONS REPORTED** - <u>VIOLATIONS</u> - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D018 BENZENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 



Order# 121435 Job# 277689 660 of 1203

# Dry Cleaner Registration Database (DCR)

**MAP ID# 77** 

Distance from Property: 0.093 mi. (491 ft.) SSE

Elevation: 642 ft.

#### **FACILITY INFORMATION**

REGISTRATION #: RN103962072 CUSTOMER #: CN602699670 NAME: COMET CLEANERS

ADDRESS: 5712 SW GREEN OAKS BLVD

**ARLINGTON, TX 76017** 

ACCOUNT NUMBER: 24,002,671
PRINCIPAL NAME: HYUNSUK PARK
PHONE NUMBER: 469-9390156
SITE TYPE: FACILITY REGISTRATION

FISCAL YEAR: FY2018
SOLVENT: PETROLEUM
QUANTITY: 120 GALLONS

FISCAL YEAR: FY2017
SOLVENT: PETROLEUM
QUANTITY: 100 GALLONS

FISCAL YEAR: FY2017
SOLVENT: PETROLEUM
QUANTITY: 100 GALLONS

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2015
SOLVENT: PETROLEUM
QUANTITY: 180 GALLONS

FISCAL YEAR: FY2014
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2013
SOLVENT: PETROLEUM
QUANTITY: 180 GALLONS

FISCAL YEAR: FY2012 SOLVENT: PETROLEUM

Order# 121435 Job# 277689 661 of 1203

# Dry Cleaner Registration Database (DCR)

QUANTITY: 180 GALLONS

FISCAL YEAR: FY2011
SOLVENT: PETROLEUM
QUANTITY: 150 GALLONS

FISCAL YEAR: FY2010
SOLVENT: PETROLEUM
QUANTITY: 200 GALLONS

FISCAL YEAR: FY2009
SOLVENT: PETROLEUM
QUANTITY: 0 GALLONS

FISCAL YEAR: FY2008

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2007

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2006
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2005
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2004

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

**Back to Report Summary** 

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 77** 

Distance from Property: 0.103 mi. (544 ft.) SSE

Elevation: 642 ft.

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 55345 EPA ID: TXD981605926 NAME: COMET CLEANERS

TNRCC ID #: 19307 ADDRESS: NOT REPORTED

NAME: COMET ONE-HOUR CLEANERS

ADDRESS: 5708 SW GREEN OAKS BLVD PHONE: NOT REPORTED

ARLINGTON, TX 76017
CONTACT: JIM GODFREY

PHONE: **817-4671212** 

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/18/2007

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 44128

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

Back to Report Summary

Order# 121435 Job# 277689 663 of 1203

**MAP ID# 77** 

Distance from Property: 0.103 mi. (544 ft.) SSE

Elevation: 642 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD981605926 OWNER TYPE: PRIVATE

NAME: COMET ONE-HOUR CLEANERS OWNER NAME: COMET ONE-HOUR CLEANERS

ADDRESS: 5708 SW GREEN OAKS BLVD OPERATOR TYPE: PRIVATE

ARLINGTON, TX 76017 OPERATOR NAME: COMET ONE-HOUR CLEANERS

CONTACT NAME: JIM GODFREY
CONTACT ADDRESS: PO BOX 13937

**ARLINGTON TX 76013** 

CONTACT PHONE: 817-467-1212

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 09/18/2007

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

JIM GODFREY UNKNOWN 09/18/2007

**INDUSTRY CLASSIFICATION (NAICS)** 

81232 - DRYCLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 09/28/2007

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: **NO**UNIVERSAL WASTE DESTINATION FACILITY: **NO** 

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO

USED OIL FUEL MARKETER TO BURNER: NO

USED OIL REFINER: NO

SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

F002

THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 664 of 1203

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

Back to Report Summary

**MAP ID# 78** 

Distance from Property: 0.093 mi. (491 ft.) W

Elevation: 600 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD980796353 OWNER TYPE: PRIVATE

NAME: ROBERTSON MANAGEMENT OWNER NAME: ROBERTSON MANAGEMENT

CORPORATION

ADDRESS: FORT WORTH, TX OPERATOR TYPE: PRIVATE

FORT WORTH, TX 76179 OPERATOR NAME: ROBERTSON MANAGEMENT

**CORPORATION** 

CONTACT NAME: ENV MANAGER
CONTACT ADDRESS: RR 9 BOX 151A

**FORT WORTH TX 76179-9809** 

CONTACT PHONE: 817-870-9140

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 04/13/2018

<u>CERTIFICATION</u>

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

ENV MANAGER ENVIRONMENTAL MANAGER 04/13/2018
ENVIRONMENTAL MANAGER ENVIRONMENTAL M 11/02/2006

**INDUSTRY CLASSIFICATION (NAICS)** 

48411 - GENERAL FREIGHT TRUCKING, LOCAL

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 05/10/2018

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - **NO EVALUATIONS REPORTED** - <u>VIOLATIONS</u> - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS - NO ENFORCEMENTS REPORTED -**

- HAZARDOUS WASTE

- NO HAZARDOUS WASTE INFORMATION REPORTED -

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 666 of 1203

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

**MAP ID# 79** 

Distance from Property: 0.094 mi. (496 ft.) NNW

Elevation: 613 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 118162

LPST ID: 118162

FACILITY ID: 0073292

NAME: MINYARD ON THE GO 4072
ADDRESS: 4420 W GREEN OAKS BLVD

ARLINGTON, TX

### **LEAKING TANK DETAILS**

LPST ID: 118162

NAME: MINYARD ON THE GO 4072 FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 3.5 - A DESIGNATED MAJOR OR MINOR AQUIFER IS IMPACTED CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 10/14/09

REPORTED DATE: 9/17/2009 ENTERED DATE: 10/14/2009

PRP INFORMATION

NAME: MINYARD FOOD STORES INC ADDRESS: ADDRESS NOT REPORTED

**COPPELL TX 75019** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/22/1999 REGISTRATION DATE: 06/28/2000

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/27/2009**INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED** 

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 668 of 1203

UST COMPARTMENT ID: 170928

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED
OTHER SUBSTANCES: NOT REPORTED
CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/22/1999 REGISTRATION DATE: 06/28/2000

TANK CAPACITY (GAL): 20000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 03/01/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 170928

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: **NOT REPORTED** CAPACITY (GAL): **NOT REPORTED** 

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

Order# 121435 Job# 277689 669 of 1203

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/22/1999 REGISTRATION DATE: 06/28/2000

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/27/2009** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 170929

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 



Order# 121435 Job# 277689 670 of 1203

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/22/1999 REGISTRATION DATE: 06/28/2000

TANK CAPACITY (GAL): 12000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 03/01/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 170929

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 



Order# 121435 Job# 277689 671 of 1203

**MAP ID# 79** 

Distance from Property: 0.094 mi. (496 ft.) NNW

Elevation: 613 ft.

**FACILITY INFORMATION** 

ID#: 73292

NAME: MINYARD ON THE GO FUEL CENTER 4072

ADDRESS: 4420 W GREEN OAKS BLVD

ARLINGTON, TX 76016

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 09/22/1999 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 06/28/2000 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 06/28/2000

SIGNATURE NAME & TITLE: RON MCDEARMON, SR VP ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN604109900 NAME: AVT GROCERY INC

CONTACT ADDRESS: 301 COMMERCE ST STE 3232

FORT WORTH TX 76102

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/22/1999 CONTACT ROLE: OWNCON

CONTACT NAME: ALAN VAUGHAN CONTACT TITLE: PRESIDENT

ORGANIZATION: AVT GROCERY INC

PHONE: (214) 5633944 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN604109900

NAME: AVT GROCERY INC

CONTACT ADDRESS: 4420 W GREEN OAKS BLVD

**ARLINGTON TX 76016** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/22/1999 CONTACT ROLE: OPRCON

CONTACT NAME: DALE SIMONEAUX CONTACT TITLE: STORE MGR

#### **CONTACT INFORMATION**

NAME: DALE SIMONEAUX TITLE: STORE MANAGER

ORGANIZATION: MINYARD ON THE GO FUEL CENTER 4072 MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (972) 3938451 0

GeoSearch www.geo-search.com 888-396-0042

672 of 1203

ORGANIZATION: AVT GROCERY INC

PHONE: (972) 3938451 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 192039 SIGNATURE DATE: 05/29/2009

SIGNATURE NAME & TITLE: RONALD L MCDEARMON, PRES CEO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 192038
SIGNATURE DATE: 06/26/2008

SIGNATURE NAME & TITLE: MICHAEL D BYARS, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 192037
SIGNATURE DATE: 06/26/2007

SIGNATURE NAME & TITLE: MIKE BYARS, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 192036
SIGNATURE DATE: 06/26/2006

SIGNATURE NAME & TITLE: MIKE BYARS, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 192035
SIGNATURE DATE: 07/14/2005

SIGNATURE NAME & TITLE: LYLE HALE, DIRECTOR FUEL MKTG

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 192034
SIGNATURE DATE: 07/27/2004

SIGNATURE NAME & TITLE: TED FULLERTON, V PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 192033
SIGNATURE DATE: 10/09/2003

SIGNATURE NAME & TITLE: GEORGE SPEARS, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 192032
SIGNATURE DATE: 02/26/2002

SIGNATURE NAME & TITLE:  $\ensuremath{\text{TED}}$  FULLERTON,  $\ensuremath{\text{VP}}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 192031
SIGNATURE DATE: 01/11/2001

Order# 121435 Job# 277689 673 of 1203

SIGNATURE NAME & TITLE: RONALD L MCDEARMON, SR VP

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 18315

APPLICATION RECEIVED DATE: 05/22/2009

SCHEDULE CONSTRUCTION DATE: 06/21/2009

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/22/1999 REGISTRATION DATE: 06/28/2000

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/27/2009** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 170928

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),TRIENNIAL TIGHTNESS TEST (FOR SUCTION/GRAVITY PIPING),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 674 of 1203

PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/22/1999 REGISTRATION DATE: 06/28/2000

TANK CAPACITY (GAL): 20000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 03/01/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 170928

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),TRIENNIAL TIGHTNESS TEST (FOR SUCTION/GRAVITY PIPING),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1

Order# 121435 Job# 277689 675 of 1203

INSTALLATION DATE: 09/22/1999 REGISTRATION DATE: 06/28/2000

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/27/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 170929

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),TRIENNIAL TIGHTNESS TEST (FOR SUCTION/GRAVITY PIPING),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/22/1999 REGISTRATION DATE: 06/28/2000

TANK CAPACITY (GAL): 12000 EMPTY TANK: EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 03/01/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

Order# 121435 Job# 277689 676 of 1203

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 170929

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),TRIENNIAL TIGHTNESS TEST (FOR SUCTION/GRAVITY PIPING),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 677 of 1203

**MAP ID# 80** 

Distance from Property: 0.094 mi. (496 ft.) ESE

Elevation: 610 ft.

**FACILITY INFORMATION** 

ID#: 85001

NAME: QUIKTRIP 874

ADDRESS: 1225 W KENNEDALE PKWY

FORT WORTH, TX 76140

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 07/18/2012

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 4 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 03/21/2014 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/17/2014

SIGNATURE NAME & TITLE: LAURA THOMPSON, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600241673 NAME: QUIKTRIP CORPORATION

CONTACT ADDRESS: 4705 S 129TH EAST AVE

**TULSA OK 74134** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 07/18/2012 CONTACT ROLE: OWNCON

CONTACT NAME: LAURA THOMPSON CONTACT TITLE: ENV ENGINEER

ORGANIZATION: QUIKTRIP CORPORATION

PHONE: (918) 6157990 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600241673 NAME: QUIKTRIP CORPORATION

CONTACT ADDRESS: 14450 TRINITY BLVD

FORT WORTH TX 76155

TYPE CORPORATION/COMPANY

BEGIN DATE: 07/18/2012 CONTACT ROLE: OPRCON

CONTACT NAME: BILL D ARKISON CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: MISTY PRIMERA TITLE: STORE SUPVR

ORGANIZATION: QUIKTRIP 874

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 5634858 0

GeoSearch www.geo-search.com 888-396-0042

678 of 1203 

ORGANIZATION: QUIKTRIP CORPORATION

PHONE: **(817) 3587694 0** FAX: **(817) 8580213** 

EMAIL: WMCMENNA@QUICKTRIP.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 300516 SIGNATURE DATE: 03/05/2018

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENV COMPLIANCE MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 284014
SIGNATURE DATE: 03/21/2017

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENV. COMPLIANCE MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 268202
SIGNATURE DATE: 04/15/2016

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENV. COMPLI. MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 250665
SIGNATURE DATE: 03/18/2015

SIGNATURE NAME & TITLE: LAURA A THOMPSON, ENV COMPL ADMIN

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 234531
SIGNATURE DATE: 03/17/2014

SIGNATURE NAME & TITLE: LAURA THOMPSON, ENV COMP ADM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 217888
SIGNATURE DATE: 03/18/2013

SIGNATURE NAME & TITLE: LAURA THOMPSON, ENVIRO COMP ADMIN

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 217887
SIGNATURE DATE: 11/02/2012

SIGNATURE NAME & TITLE: MOLLY WRATZ, ENV ENG

FILING STATUS: **RENEWAL** REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 22627
APPLICATION RECEIVED DATE: 03/28/2012
SCHEDULE CONSTRUCTION DATE: 04/26/2012

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

INSTALLATION OF FOUR (4) FIBERGLASS UNDERGROUND STORAGE TANKS AND TWELVE (12) GA SOLINE DISPENSERS

WITH DOUBLE-WALL FIBERGLASS PIPING.



Order# 121435 Job# 277689 679 of 1203

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/18/2012 REGISTRATION DATE: 11/09/2012

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 07/18/2012

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 181837

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH), ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/18/2012 REGISTRATION DATE: 11/09/2012
TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 07/18/2012

Order# 121435 Job# 277689 680 of 1203

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 181838

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINMEN/BUCKET/SUMP, FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH), ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/18/2012 REGISTRATION DATE: 11/09/2012

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 07/18/2012

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 



Order# 121435 Job# 277689 681 of 1203

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 181839

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH), ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/18/2012 REGISTRATION DATE: 11/09/2012

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 07/18/2012

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

Order# 121435 Job# 277689 682 of 1203

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 181840

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

#### **PIPING SYSTEMS**

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH), ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 683 of 1203

**CONTACT INFORMATION** 

ORGANIZATION: BILL PATTERSTON MOTORS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: (817) 4511696 0

**MAP ID# 81** 

Distance from Property: 0.095 mi. (502 ft.) E

Elevation: 578 ft.

**FACILITY INFORMATION** 

ID#: 60843

NAME: BILL PATTERSTON MOTORS

ADDRESS: 6200 E ROSEDALE ST

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 10/23/1991 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 10/16/1991 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 10/10/1991

SIGNATURE NAME & TITLE: CLIFTON DOUGLAS, OWNER

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600833412
NAME: DOUGLAS CLIFTON

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 10/23/1991

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 10/16/1991
TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 684 of 1203

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/01/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 141256

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 10/16/1991

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/01/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 685 of 1203

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 141255

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 686 of 1203

## Closed & Abandoned Landfill Inventory (CALF)

**MAP ID# 82** 

Distance from Property: 0.095 mi. (502 ft.) NNW

Elevation: 617 ft.

SITE INFORMATION

SITE NUMBER: 1383
SITE NAME: NO NAME

LOCATION:

ARLINGTON: N. OF 20 BETWEEN TATE SPRINGS & LITTLE RD.

COUNTY: TARRANT

COMMENTS:

TYPE IV BUILDING MATERIAL, BRICK, CONCRETE. NOT CLEANED UP.

INSPECTION:

???

OWNER NAME: NOT REPORTED

DATE OPEN: 0

DATE CLOSE: 0

SIZE (ACRES): 1.00

SIZE (CUBIC YARDS): 0.00

PARTIES: NOT REPORTED

**LANDFILL CONTENTS** 

HOUSEHOLD: NO CONSTRUCTION DEMOLITION: YES

INDUSTRIAL: NO TIRES: NO AGRICULTURE: NO BRUSH: NO OTHER: NO LEGAL: YES

UNAUTHORIZED: NO HAZARD UNLIKELY: YES
HAZARD PROBABLY: NO HAZARD CERTAINLY: NO
DEPTH CD: NR MINIMUM THICKNESS: NR

MAXIMUM DEPTH: 0.00 USE: UK

OTHER DESCRIPTION: NOT REPORTED

REVIEWER: CITY HAS NO RECORD OF THIS SITE

Back to Report Summary

Order# 121435 Job# 277689 687 of 1203

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 83** 

Distance from Property: 0.096 mi. (507 ft.) ESE

Elevation: 586 ft.

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 38935 EPA ID: TXD139220560 NAME: OAK CREEK HOMES INC
TNRCC ID #: 15545 ADDRESS: NOT REPORTED

NAME: OAK CREEK HOMES

ADDRESS: 4805 E LOOP 820 S PHONE: NOT REPORTED

FORT WORTH, TX 76119

CONTACT: GARY LUHDVALL

PHONE: 817-4785551

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/12/2004

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 41474

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 41475

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

Back to Report Summary



Order# 121435 Job# 277689 688 of 1203

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 83** 

Distance from Property: 0.096 mi. (507 ft.) ESE

Elevation: 586 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD139220560 OWNER TYPE: PRIVATE

NAME: OAK CREEK HOMES INC OWNER NAME: OAK CREEK HOMES INC

ADDRESS: 4805 E LOOP 820 S OPERATOR TYPE: PRIVATE

FORT WORTH, TX 76119 OPERATOR NAME: OAK CREEK HOMES INC

CONTACT NAME: GARY LUHDVALL
CONTACT ADDRESS: 4805 E LOOP 820 S

FORT WORTH TX 76119

CONTACT PHONE: **817-478-5551** 

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 08/23/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

— CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** 

10/18/2007 FCI FOCUSED COMPLIANCE INSPECTION

**VIOLATIONS** - NO VIOLATIONS REPORTED -

**ENFORCEMENTS - NO ENFORCEMENTS REPORTED -**

HAZARDOUS WASTE

F005

THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 689 of 1203

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

NO CORRECTIVE ACTION EVENT(S) REPORTED

Back to Report Summary

### Industrial and Hazardous Waste Sites (IHW)

OWNER INFORMATION

PHONE: 1-817-4830089

NAME: FUTURE MARBLE INC

ADDRESS: 5300 VESTA FARLEY RD

FORT WORTH, TX 76119

**MAP ID# 84** 

Distance from Property: 0.096 mi. (507 ft.) W

Elevation: 595 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 37477 EPA ID: NOT REPORTED

TNRCC ID #: 14146
NAME: FUTURE MARBLE

ADDRESS: 5300 VESTA FARLEY RD

FORT WORTH, TX 76119

CONTACT: KEITH AMASON

PHONE: 817-4830089

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/23/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 36830

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 36831

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 691 of 1203

**MAP ID# 85** 

Distance from Property: 0.098 mi. (517 ft.) ESE

Elevation: 610 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 103857

LPST ID: 103857

FACILITY ID: 0034412

NAME: MAJESTIC LIQUOR

ADDRESS: 5400 KENNEDALE PKWY

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 103857

NAME: MAJESTIC LIQUOR

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 9/1/92

REPORTED DATE: **7/14/1992** ENTERED DATE: **9/1/1992** 

PRP INFORMATION

NAME: J V LEGGETT INC

ADDRESS: ADDRESS NOT REPORTED

**FORT WORTH TX 76147** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 04/15/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/08/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 692 of 1203

UST COMPARTMENT ID: 99668

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 04/15/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/08/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 99667

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

Order# 121435 Job# 277689 693 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 04/15/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/08/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 99666

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Order# 121435 Job# 277689 694 of 1203

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: MAJESTIC LIQUOR

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: (817) 3355252 0

**MAP ID# 85** 

Distance from Property: 0.098 mi. (517 ft.) ESE

Elevation: 610 ft.

**FACILITY INFORMATION** 

ID#: **34412**NAME: **MAJESTIC LIQUOR** 

NAME. WAJESTIC LIQUOR

ADDRESS: 5400 KENNEDALE PKWY

FORT WORTH, TX 76140

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 12/08/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 04/15/1986
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/15/1986

SIGNATURE NAME & TITLE: CAROLYN STEVENS, SEC ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603396839

NAME: MAJESTIC LIQUOR STORES INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/08/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 04/15/1986
TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/08/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 99668

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 04/15/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/08/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 697 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 99667

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 04/15/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/08/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 99666

TANK ID: 3

Order# 121435 Job# 277689 698 of 1203

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: MAJESTIC LIQUOR 16

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

NAME: TOM LEGGETT

PHONE: (817) 4443521 0

TITLE: OWNER

**MAP ID# 85** 

Distance from Property: 0.098 mi. (517 ft.) ESE

Elevation: 610 ft.

**FACILITY INFORMATION** 

ID#: 34413 NAME: MAJESTIC LIQUOR 16

ADDRESS: **HWY 199 & FM 730** 

AZLE, TX 76020

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 09/01/1988 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 04/15/1986
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/15/1986

SIGNATURE NAME & TITLE: CAROLYN STEVENS, SEC. ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600461990

NAME: ADVANCE PETROLEUM DISTRIBUTING COMPANY INC CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1988

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 04/15/1986
TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 700 of 1203

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/01/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 46056

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 04/15/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/01/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 46057

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 04/15/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/01/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 46058

TANK ID: 3

Order# 121435 Job# 277689 702 of 1203

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

# Dry Cleaner Registration Database (DCR)

**MAP ID# 86** 

Distance from Property: 0.101 mi. (533 ft.) NE

Elevation: 647 ft.

#### **FACILITY INFORMATION**

REGISTRATION #: RN104095807

CUSTOMER #: CN603101841

NAME: STANTON II CLEANERS

ADDRESS: 4801 LITTLE RD STE 135

ARLINGTON, TX 76017-1079

ACCOUNT NUMBER: 24004221

PRINCIPAL NAME: **JOHN HUN CHUNG**PHONE NUMBER: **NOT REPORTED** 

SITE TYPE: DROP STATION REGISTRATION

FISCAL YEAR: FY2009
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2008

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2007
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2006
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2005
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2004

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

**Back to Report Summary** 

704 of 1203

**MAP ID# 87** 

Distance from Property: 0.118 mi. (623 ft.) SSE

Elevation: 642 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 091255

LPST ID: 091255

FACILITY ID: 0007309

NAME: 7 ELEVEN 163123056

ADDRESS: 5704 SW GREEN OAKS BLVD

ARLINGTON, TX

#### **LEAKING TANK DETAILS**

LPST ID: 091255

NAME: 7 ELEVEN 163123056

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 3/20/87

REPORTED DATE: 3/20/1987 ENTERED DATE: 3/20/1987

PRP INFORMATION

NAME: SOUTHLAND CORP

ADDRESS: ADDRESS NOT REPORTED

DALLAS TX 75221

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 87** 

Distance from Property: 0.118 mi. (623 ft.) SSE

Elevation: 642 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 115942

LPST ID: 115942

FACILITY ID: 0007309

NAME: FORMER 7 ELEVEN 23056

ADDRESS: 5704 SW GREEN OAKS BLVD

ARLINGTON, TX

#### **LEAKING TANK DETAILS**

LPST ID: 115942

NAME: FORMER 7 ELEVEN 23056 FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 4/20/04

REPORTED DATE: 5/13/2002 ENTERED DATE: 4/20/2004

PRP INFORMATION
NAME: 7-ELEVEN INC

ADDRESS: ADDRESS NOT REPORTED

DALLAS TX 75204

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/12/2002** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 706 of 1203

### Leaking Petroleum Storage Tanks (LPST)

UST COMPARTMENT ID: 24963

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/12/2002** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 24962

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 707 of 1203

### Leaking Petroleum Storage Tanks (LPST)

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/11/2002** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 24961

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES

Order# 121435 Job# 277689 708 of 1203

## Leaking Petroleum Storage Tanks (LPST)

CORROSION PROTECTION VARIANCE: NO VARIANCE

# ABOVEGROUND STORAGE TANK INFORMATION NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 87** 

Distance from Property: 0.118 mi. (623 ft.) SSE

Elevation: 642 ft.

**FACILITY INFORMATION** 

ID#: 7309

NAME: 7-ELEVEN 23056

ADDRESS: 5704 SW GREEN OAKS BLVD

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 04/01/1987 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/25/1986

SIGNATURE NAME & TITLE: B VALENTINE, ENVIRON MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: 1500 CORSICANA HWY

HILLSBORO TX 76645

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1989

CONTACT ROLE: OWNOPRCON CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: 7-ELEVEN INC PHONE: NOT REPORTED

FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: 1202 RICHARDSON DR

**RICHARDSON TX 75080** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1989 CONTACT ROLE: OPRCON

CONTACT NAME: CRAIG ZIMMER CONTACT TITLE: NOT REPORTED **CONTACT INFORMATION** 

NAME: WILLO SMITH TITLE: ENVIR MGR

ORGANIZATION: 7-ELEVEN 23056

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (407) 5322039 0

GeoSearch www.geo-search.com 888-396-0042

710 of 1203 

ORGANIZATION: 7-ELEVEN INC PHONE: (214) 8611274 0 FAX: (214) 8611270

EMAIL: NOT REPORTED

SELF-CERTIFICATION

SELF-CERTIFICATION ID: 28991 SIGNATURE DATE: 11/28/2001

SIGNATURE NAME & TITLE: WILLO A SMITH, ENVIR MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 28990
SIGNATURE DATE: 01/17/2001

SIGNATURE NAME & TITLE: WILLO A SMITH, ENVIR MGR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 2549

APPLICATION RECEIVED DATE: 02/15/2002

SCHEDULE CONSTRUCTION DATE: 03/11/2002

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/12/2002** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 24963

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/12/2002** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

\_\_\_

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 24962

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE, ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

Order# 121435 Job# 277689 712 of 1203

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 04/01/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/11/2002

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** UST COMPARTMENT ID: 24961

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE, ALARM (SET@<=90%) W3A OR 3B **PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 713 of 1203

ABOVEGROUND STORAGE TANK INFORMATION
NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 



714 of 1203

**MAP ID# 88** 

Distance from Property: 0.103 mi. (544 ft.) S

Elevation: 650 ft.

**FACILITY INFORMATION** 

ID#: 54616

NAME: SMOKERS PARADISE

ADDRESS: 6601 FOREST HILL DR

FOREST HILL, TX 76140

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 07/12/1990

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 06/26/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/28/2018

SIGNATURE NAME & TITLE: AZIZ TESANT, OWNER ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603075896

NAME: ALNOOR INC

CONTACT ADDRESS: 6601 FOREST HILL DR

**FOREST HILL TX 76140** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/26/2004 CONTACT ROLE: OWNCON CONTACT NAME: AZIZ TEJANI

CONTACT TITLE: SEC

ORGANIZATION: ALNOOR INC PHONE: (817) 4787431 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN603075896

NAME: ALNOOR INC

CONTACT ADDRESS: 6601 FOREST HILL DR

**FOREST HILL TX 76140** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/26/2004 CONTACT ROLE: OPRCON CONTACT NAME: AZIZ TEJANI

CONTACT TITLE: SEC

**CONTACT INFORMATION** 

NAME: AZIZ NAUSHAD

TITLE: MANAGER

ORGANIZATION: SMOKERS PARADISE

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4787431 0

715 of 1203 

ORGANIZATION: ALNOOR INC PHONE: (817) 4787431 0 FAX: NOT REPORTED EMAIL: NOT REPORTED

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 305947 SIGNATURE DATE: 05/28/2018

SIGNATURE NAME & TITLE: AZIZ TESANT, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 288515
SIGNATURE DATE: 06/10/2017

SIGNATURE NAME & TITLE: AZIZ TEJANI, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 272205
SIGNATURE DATE: 07/12/2016

SIGNATURE NAME & TITLE: AZIZ TEJAM, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 254202
SIGNATURE DATE: 06/01/2015

SIGNATURE NAME & TITLE: AZIZ TEJANI, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 237139
SIGNATURE DATE: 05/19/2014

SIGNATURE NAME & TITLE: AZIZ TESANI, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 221759
SIGNATURE DATE: 06/01/2013

SIGNATURE NAME & TITLE: AZIZ TESANI, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41453
SIGNATURE DATE: 06/04/2012

SIGNATURE NAME & TITLE: AZIZ TEJANI, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41452
SIGNATURE DATE: 06/08/2011

SIGNATURE NAME & TITLE:  $\mbox{AZIZ TEJANI}$ ,  $\mbox{OWNER}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41451
SIGNATURE DATE: 05/11/2010

SIGNATURE NAME & TITLE: AZIZ TEJANI, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41450
SIGNATURE DATE: 05/11/2009

SIGNATURE NAME & TITLE: AZIZ TEJANI, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41449
SIGNATURE DATE: 06/10/2008

SIGNATURE NAME & TITLE: TEJANI AZIZ, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41448
SIGNATURE DATE: 05/14/2007

SIGNATURE NAME & TITLE: TEJANI AZIZ, SEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41447
SIGNATURE DATE: 05/29/2006

SIGNATURE NAME & TITLE: TEJANI AZIZ, SECRETARY

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41446
SIGNATURE DATE: 05/20/2005

SIGNATURE NAME & TITLE: TEJANI AZIZ, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41445
SIGNATURE DATE: 05/30/2004

SIGNATURE NAME & TITLE: TEJANI AZIZ, SEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41444
SIGNATURE DATE: 05/29/2004

SIGNATURE NAME & TITLE: TEJANI AZIZ, SEC

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41443
SIGNATURE DATE: 08/18/2003

SIGNATURE NAME & TITLE: DAVID W MCKAMIE, ENVIRON. DIRECTOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41442
SIGNATURE DATE: 08/01/2002

SIGNATURE NAME & TITLE: DAVID MCKAMIE, ENVIRO DIR

FILING STATUS: RENEWAL

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 41441
SIGNATURE DATE: 01/22/2001

SIGNATURE NAME & TITLE: DAVID MCKAMIE, ENV DIR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 4486
APPLICATION RECEIVED DATE: 11/15/2006
SCHEDULE CONSTRUCTION DATE: 11/10/2006

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1990 REGISTRATION DATE: 07/09/1990

TANK CAPACITY (GAL): 9816 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/01/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 34545

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9816

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:



Order# 121435 Job# 277689 718 of 1203

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1990 REGISTRATION DATE: 07/09/1990

TANK CAPACITY (GAL): 9816 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/01/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 34546

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9816

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1990 REGISTRATION DATE: 07/09/1990

Order# 121435 Job# 277689 719 of 1203

TANK CAPACITY (GAL): 9816 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/01/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 34547

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9816

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

#### Dry Cleaner Registration Database (DCR)

**MAP ID# 89** 

Distance from Property: 0.132 mi. (697 ft.) S

Elevation: 639 ft.

#### **FACILITY INFORMATION**

REGISTRATION #: RN103950846
CUSTOMER #: NOT REPORTED
NAME: ANNS CLEANERS

ADDRESS: 6611 FOREST HILL DR

FOREST HILL, TX 76140-1207

ACCOUNT NUMBER: NOT REPORTED
PRINCIPAL NAME: NOT REPORTED
PHONE NUMBER: NOT REPORTED

SITE TYPE: DROP STATION REGISTRATION

FISCAL YEAR: FY2013
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2012
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2011
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2010
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2009

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2008
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2007
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2006
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2005
SOLVENT: NOT REPORTED

## Dry Cleaner Registration Database (DCR)

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2004 SOLVENT: NOT REPORTED QUANTITY: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 90** 

Distance from Property: 0.104 mi. (549 ft.) NNW

Elevation: 644 ft.

**FACILITY INFORMATION** 

ID#: **72268** 

NAME: BERRY STREET FOOD MART

ADDRESS: 3300 E BERRY ST

FORT WORTH, TX 76105

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 04/30/1999

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 06/27/2018
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 06/27/2018

SIGNATURE NAME & TITLE: ANWAR DOSSANI, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN604583229
NAME: SIMRAN & ZOYA INC

CONTACT ADDRESS: 3300 E BERRY ST

FORT WORTH TX 76105

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/01/2014

CONTACT ROLE: OWNOPRCON
CONTACT NAME: RAHIM THARANI
CONTACT TITLE: NOT REPORTED
ORGANIZATION: SIMRAN & ZOYA INC

PHONE: (817) 7917860 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OWNER NUMBER: CN602446486

NAME: SAMS CONVENIENT STORE INC CONTACT ADDRESS: 3300 E BERRY ST

FORT WORTH TX 76105

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/17/2003 CONTACT ROLE: OWNCON

CONTACT NAME: MANSOOR SHAH

CONTACT TITLE: OWNER

ORGANIZATION: SAMS CONVENIENT STORE INC

PHONE: (214) 2077374

CONTACT INFORMATION

NAME: RAHIM THARANI

TITLE: OWNER

ORGANIZATION: BERRY STREET FOOD MART

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 7917860 0

Order# 121435 Job# 277689 723 of 1203

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN604583229

NAME: SIMRAN & ZOYA INC

CONTACT ADDRESS: 3300 E BERRY ST

FORT WORTH TX 76105

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/01/2014

CONTACT ROLE: OWNOPRCON
CONTACT NAME: RAHIM THARANI
CONTACT TITLE: NOT REPORTED
ORGANIZATION: SIMRAN & ZOYA INC

PHONE: (817) 7917860 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OPERATOR NUMBER: CN602446486

NAME: SAMS CONVENIENT STORE INC

CONTACT ADDRESS: 3300 E BERRY ST

FORT WORTH TX 76105

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/17/03
CONTACT ROLE: OPRCON

CONTACT NAME: MANSOOR SHAH

CONTACT TITLE: PRES

ORGANIZATION: SAMS CONVENIENT STORE INC

PHONE: (214) 2077374
FAX: NOT REPORTED
EMAIL: NOT REPORTED

SELF-CERTIFICATION

SELF-CERTIFICATION ID: 305997 SIGNATURE DATE: 06/27/2018

SIGNATURE NAME & TITLE: ANWAR DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 285671
SIGNATURE DATE: 03/30/2017

SIGNATURE NAME & TITLE: ANWAR DOSSANI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 269040
SIGNATURE DATE: 03/29/2016

SIGNATURE NAME & TITLE: ANWAS DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 253930
SIGNATURE DATE: 06/01/2015

SIGNATURE NAME & TITLE: RAHIM THARANI, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 236766
SIGNATURE DATE: 05/20/2014

SIGNATURE NAME & TITLE: RAHIM THARANI, OWNER

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 232986
SIGNATURE DATE: 02/26/2014

SIGNATURE NAME & TITLE: BURJEES F SHAH, ADM SJR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186580
SIGNATURE DATE: 02/26/2013

SIGNATURE NAME & TITLE: BURJEES SHAH, ADMINISTRATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186579
SIGNATURE DATE: 02/21/2012

SIGNATURE NAME & TITLE: MANSOOR SHAH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186578
SIGNATURE DATE: 02/18/2011

SIGNATURE NAME & TITLE: MANSOOR SHAH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186577
SIGNATURE DATE: 02/20/2010

SIGNATURE NAME & TITLE: MANSOOR SHAH, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186576
SIGNATURE DATE: 02/24/2009

SIGNATURE NAME & TITLE: MANSOOR SHAH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186575
SIGNATURE DATE: 02/25/2008

SIGNATURE NAME & TITLE: MANSOOR SHAH, PRES

FILING STATUS: AMENDMENT
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186574
SIGNATURE DATE: 02/12/2008

SIGNATURE NAME & TITLE: MANSOOR SHAH, PRES

FILING STATUS: RENEWAL

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186573
SIGNATURE DATE: 02/22/2007

SIGNATURE NAME & TITLE: MANSOOR SHAH, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186572
SIGNATURE DATE: 02/15/2006

SIGNATURE NAME & TITLE: MANSOOR SHAH, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186571
SIGNATURE DATE: 01/13/2005

SIGNATURE NAME & TITLE: MANSOOR SHAH, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186570
SIGNATURE DATE: 02/17/2004

SIGNATURE NAME & TITLE: MANSOOR SHAH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186569
SIGNATURE DATE: 11/17/2003

SIGNATURE NAME & TITLE: MANSOOR SHAH, PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186568
SIGNATURE DATE: 05/23/2003

SIGNATURE NAME & TITLE: JAMES H LYNCH, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186567
SIGNATURE DATE: 05/13/2002

SIGNATURE NAME & TITLE: JAMES H LYNCH, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 186566
SIGNATURE DATE: 05/03/2001

SIGNATURE NAME & TITLE: CLIFFORD FIELDS, MANAGER

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 04/30/1999 REGISTRATION DATE: 07/28/1999
TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY



Order# 121435 Job# 277689 726 of 1203

STATUS: IN USE STATUS BEGIN DATE: 04/30/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 170622

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 04/30/1999 REGISTRATION DATE: 07/28/1999

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 04/30/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



Order# 121435 Job# 277689 727 of 1203

MATERIAL:

**FRP** 

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 170623

TANK ID: 1

COMPARTMENT LETTER: B
SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/30/1999 REGISTRATION DATE: 07/28/1999

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 04/30/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 



Order# 121435 Job# 277689 728 of 1203

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 170624

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 729 of 1203

**CONTACT INFORMATION** 

ORGANIZATION: POLY RENTAL

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: (817) 5362663 0

**MAP ID# 91** 

Distance from Property: 0.135 mi. (713 ft.) SW

Elevation: 671 ft.

**FACILITY INFORMATION** 

ID#: **60856** 

NAME: POLY RENTAL

ADDRESS: 3600 VAUGHN BLVD

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: OTHER

BEGIN DATE: 10/29/1991 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 10/16/1991 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 10/13/1991 SIGNATURE NAME & TITLE: CHARLES T BEAVERS, OWNER

\_..\_\_\_

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600830335 NAME: BEAVERS CHARLES T

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: **ORGANIZATION**BEGIN DATE: **10/29/1991** 

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 10/16/1991
TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/28/1999** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 141222

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 10/16/1991

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/28/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 141221

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 91** 

Distance from Property: 0.107 mi. (565 ft.) SW

Elevation: 671 ft.

**FACILITY INFORMATION** 

ID#: 9032

NAME: MI TIERRA FOOD STORE

ADDRESS: 3521 VAUGHN BLVD

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 01/01/1980

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/08/1986

SIGNATURE NAME & TITLE: NOEL HARRIS, GEN MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601411317

NAME: BECK

CONTACT ADDRESS: 1525 E BERRY ST

FORT WORTH TX 76119

TYPE: INDIVIDUAL BEGIN DATE: 03/12/1996 CONTACT ROLE: OWNCON CONTACT NAME: RUTN BECK CONTACT TITLE: NOT REPORTED ORGANIZATION: BECK RUTN PEREZ

PHONE: (817) 2231476 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN601411317

NAME: **BECK** 

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPF: INDIVIDUAL BEGIN DATE: 03/12/1996

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED **CONTACT INFORMATION** 

NAME: RUTN BECK TITLE: NOT REPORTED

ORGANIZATION: MI TIERRA FOOD STORE

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 2231476 0

733 of 1203 

ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1980 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 12/31/2001

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 119847

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 734 of 1203

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY
STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 12/31/2001

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 119846

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: **NOT REPORTED** CAPACITY (GAL): **NOT REPORTED** 

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY
STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 12/31/2001

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



Order# 121435 Job# 277689 735 of 1203

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 119848

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 92** 

Distance from Property: 0.109 mi. (576 ft.) W

Elevation: 595 ft.

**FACILITY INFORMATION** 

ID#: 78854

NAME: EMPIRE ROOFING

ADDRESS: 5301 SUN VALLEY DR

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING BEGIN DATE: 10/25/2007

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 1

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 11/06/2007 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 11/01/2007

SIGNATURE NAME & TITLE: R J PARROTT, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600345193

NAME: RANPARR INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/25/2007

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN603610478 NAME: EMPIRE ROOFING INC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/25/2007

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: NOT REPORTED TITLE: NOT REPORTED

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

737 of 1203 

ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 20348

APPLICATION RECEIVED DATE: 05/14/2007

SCHEDULE CONSTRUCTION DATE: 06/13/2007

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

AST ID #: 209047 MULTIPLE COMPARTMENT FLAG: YES

TANK ID: 21816 REGISTRATION DATE: 11/06/2007

INSTALLATION DATE: 10/25/2007 STATUS BEGIN DATE: 10/25/2007

TANK CAPACITY (GAL): 3000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL, GASOLINE

#### **MATERIAL OF CONSTRUCTION**

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: YES
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 93** 

Distance from Property: 0.114 mi. (602 ft.) W

Elevation: 618 ft.

**FACILITY INFORMATION** 

**OWNER INFORMATION** 

REGISTRATION#: 65523 EPA ID: TXD054641618 NAME: CITY PRINTING CO INC

TNRCC ID #: 20996 ADDRESS: 6025 E LANCASTER AVE
NAME: CITY PRINTING FORT WORTH, TX 76112

ADDRESS: 6025 E LANCASTER AVE PHONE: NOT REPORTED

FORT WORTH, TX 76112

CONTACT: NOT REPORTED PHONE: NOT REPORTED

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THIS FACILITY WAS REGISTERED PRIOR

TO1994 AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/23/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE NO RECORDS

**Back to Report Summary** 

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 93** 

Distance from Property: 0.11 mi. (581 ft.) W

Elevation: 618 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD054641618 OWNER TYPE: NOT REPORTED

NAME: CITY PRINTING CO INC
ADDRESS: 6025 E LANCASTER AVE
OPERATOR TYPE: NOT REPORTED

FORT WORTH, TX 76103 OPERATOR NAME: CITY PRINTING CO INC

CONTACT NAME: ENVIRONMENTAL MANAGER
CONTACT ADDRESS: 6025 E LANCASTER AVE
FORT WORTH TX 76103

CONTACT PHONE: NOT REPORTED

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 08/23/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - NO EVALUATIONS REPORTED - <u>VIOLATIONS</u> - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

- NO HAZARDOUS WASTE INFORMATION REPORTED -

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

<u>CORRECTIVE ACTION AREA</u> - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 740 of 1203

**MAP ID# 94** 

Distance from Property: 0.111 mi. (586 ft.) ESE

Elevation: 665 ft.

**FACILITY INFORMATION** 

ID#: **65856** 

NAME: SUBLETT SHELL

ADDRESS: 4810 W SUBLETT RD

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 07/01/1994

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 02/16/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/16/2018 SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601264328

NAME: WALEEDO INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/31/2009

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN605469113
NAME: YOLLA PETROLEUM INC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

CITY NOT REPORTED

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/2018

CONTACT ROLE: **NOT REPORTED**CONTACT NAME: **NOT REPORTED**CONTACT TITLE: **NOT REPORTED** 

CONTACT INFORMATION

NAME: **GABRIEL SAID**TITLE: **NOT REPORTED** 

ORGANIZATION: SUBLETT SHELL

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4786668 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OPERATOR NUMBER: CN604270405
NAME: BARAKA INTERNATIONAL INC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/2016

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OPERATOR NUMBER: CN602619090
NAME: MIKES TRADING COMPANY INC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/20/2014

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OPERATOR NUMBER: CN601264328

NAME: WALEEDO INC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/31/2009

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 299380 SIGNATURE DATE: 02/16/2018

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

Order# 121435 Job# 277689 742 of 1203

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 281908
SIGNATURE DATE: 01/16/2017

SIGNATURE NAME & TITLE: WALID ALCHAHROUR, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 265014
SIGNATURE DATE: 01/08/2016

SIGNATURE NAME & TITLE: WALID ALCHAHROUR, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 248086
SIGNATURE DATE: 01/28/2015

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 232645
SIGNATURE DATE: 02/20/2014

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163818
SIGNATURE DATE: 02/14/2013

SIGNATURE NAME & TITLE: WALID ALCHAHROUR, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163817
SIGNATURE DATE: 02/16/2012

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163816
SIGNATURE DATE: 02/28/2011

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163815
SIGNATURE DATE: 02/15/2010

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163814
SIGNATURE DATE: 02/20/2009

SIGNATURE NAME & TITLE: GINGER KELLEY, COMP SPEC

FILING STATUS: **RENEWAL** REGISTRATION FLAG: **YES** 

Order# 121435 Job# 277689 743 of 1203

SELF-CERTIFICATION ID: 163813 SIGNATURE DATE: 02/01/2008

SIGNATURE NAME & TITLE: WALID ALCHAROUR, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163812
SIGNATURE DATE: 01/09/2007

SIGNATURE NAME & TITLE: WALID ALCHAHOUR, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163811
SIGNATURE DATE: 01/26/2006

SIGNATURE NAME & TITLE: WALID ALCHAHROUR, OWNER

FILING STATUS: AMENDMENT
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163810
SIGNATURE DATE: 01/25/2006

SIGNATURE NAME & TITLE: WALID ALCHAHROUR, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163809
SIGNATURE DATE: 01/31/2005

SIGNATURE NAME & TITLE: WALID ALCHAHRAR, PRESIDENT/OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163808
SIGNATURE DATE: 01/30/2004

SIGNATURE NAME & TITLE: WALID ALCHAHROUR, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163807
SIGNATURE DATE: 12/30/2002

SIGNATURE NAME & TITLE: WALID ALCHAHROUR, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163806
SIGNATURE DATE: 03/27/2001

SIGNATURE NAME & TITLE: WALID ALCHAHROUR, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 163805
SIGNATURE DATE: 03/07/2001

SIGNATURE NAME & TITLE: WALID ALCHAHROUR, OWNER

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

CONSTRUCTION NOTIFICATION

NOTIFICATION CONSTRUCTION ID: 16651

APPLICATION RECEIVED DATE: 12/07/2000 SCHEDULE CONSTRUCTION DATE: 01/06/2001

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

NOTIFICATION CONSTRUCTION ID: 16650

APPLICATION RECEIVED DATE: 05/22/2001

SCHEDULE CONSTRUCTION DATE: 06/21/2001

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

NOTIFICATION CONSTRUCTION ID: 16649

APPLICATION RECEIVED DATE: 10/16/2006

SCHEDULE CONSTRUCTION DATE: 11/13/2006

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/01/1994 REGISTRATION DATE: 07/01/1994

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 07/01/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 163481

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 07/01/1994 REGISTRATION DATE: 07/01/1994

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 07/01/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES
PIPE DESIGN SINGLE WALL: YES
PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 163482

TANK ID. 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG



Order# 121435 Job# 277689 746 of 1203

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 07/01/1994 REGISTRATION DATE: 07/01/1994

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 07/01/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 163483

TANK ID: 2

COMPARTMENT LETTER: **B** SUBSTANCES: **DIESEL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/10/2007 REGISTRATION DATE: 02/20/2009
TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/10/2007

Order# 121435 Job# 277689 747 of 1203

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** MATERIAL:

COMPOSITE

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 163484

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING

(NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

748 of 1203 

## Brownfields Management System (BF)

**MAP ID# 95** 

Distance from Property: 0.111 mi. (586 ft.) ESE

Elevation: 619 ft.

SITE INFORMATION

ID#: 174723

NAME: 5412 HIGH RIDGE ROAD

ADDRESS: 5412, 5414, 5420, AND 5424 HIGH RIDGE ROAD

**KENNEDALE, TX 76140** 

TYPE FUNDING: N/A

PREDOMINANT PAST USE (ACREAGE):

GREENSPACE: RESIDENTIAL: COMMERCIAL: INDUSTRIAL: NOT REPORTED NOT REPORTED NOT REPORTED NOT REPORTED

FUTURE USE (ACREAGE):

GREENSPACE: RESIDENTIAL: COMMERCIAL: INDUSTRIAL: NOT REPORTED NOT REPORTED NOT REPORTED NOT REPORTED

PROPERTY HIGHLIGHT:

**NOT REPORTED** 

PROPERTY SIZE (Acres): 0.92
CURRENT OWNER: NOT REPORTED
PROPERTY DESCRIPTION/ FORMER USE:

THE SITE CURRENTLY CONSISTS OF UNDEVELOPED LOTS ADJACENT TO HIGH RIDGE ROAD. THE SITE IS ALSO ADJACENT TO OCCUPIED, RESIDENTIAL LOTS. ROAD CONSTRUCTION WAS OCCURRING ACROSS THE SOUTHEASTERN PART OF THE SITE (AT 5424 HIGH RIDGE ROAD) AT THE TIME OF THE SITE VISIT. NO BUILDINGS ARE PRESENT ON THE SITE. RESIDENCES THAT ONCE OCCUPIED THE SITE HAVE BEEN REMOVED. A LARGE CONCRETE SLAB IS PRESENT AT 5424 HIGH RIDGE ROAD AT THE SOUTHEAST PORTION OF THE SITE. AN ABRUPT BREAK IN SLOPE UP TO ABOUT 10 FEET HIGH IS PRESENT ALONG THE SOUTHWEST BOUNDARY, TRASH AND LITTER WAS OBSERVED ON THE GROUND SURFACE. THIS LITTER CONSISTED OF SMALL PIECES OF PAPER, PLASTIC BAGS, FOAM CUPS, METALLIC DEBRIS, BROKEN GLASS, AND A SHORT SECTION OF CORRUGATED FIBERGLASS ROOFING MATERIAL. THE REMNANT OF A UTILITY POLE WAS IDENTIFIED AT 5420 HIGH RIDGE ROAD AT THE SOUTHEAST PORTION OF THE SITE. SMALL PILES OF CONCRETE AND ASPHALT, AND WHAT APPEARED TO BE REMNANTS OF DRIVEWAYS OR BUILDING FOUNDATIONS WERE OBSERVED AT THE SITE. THE PILES OF CONCRETE AND ASPHALT APPEARED TO BE RELATED TO CLEARING OF THE RESIDENCES FROM THE SITE. IN ADDITION, PILES OF SAND AND GRAVEL THAT WERE OBSERVED ALSO APPEARED TO BE RELATED TO CLEARING OF THE SITE AND ROAD CONSTRUCTION THROUGH THE SITE. A LARGE CONCRETE PAD WAS OBSERVED AT THE SOUTHEAST PORTION OF THE SITE AT 5424 HIGH RIDGE ROAD. THIS PAD MAY HAVE ORIGINALLY BEEN USED AS A BUILDING FOUNDATION.THE PHASE I ESA PERFORMED FOR THIS SITE DID NOT REVEAL RECS IN CONNECTION WITH THE PROPERTY. ONE HREC WAS IDENTIFIED (ROYAL MARKET) RELATED TO GROUNDWATER CONTAMINATION FROM AN LPST.

CONTAMINATE(S): NOT REPORTED

CONTAMINATE(S) CLEANED UP: NOT REPORTED

MEDIA(S) AFFECTED: **GROUND WATER**MEDIA(S) CLEANED UP: **NOT REPORTED** 

TYPE OF BROWNFIELD GRANT: TBA

ENVIRONMENTAL ASSESSMENT ACTIVITY: PHASE I ENVIRONMENTAL ASSESSMENT

ASSESSMENT START DATE: 3/28/2014 0:00
ASSESSMENT COMPLETION DATE: 6/10/2014 0:00

CLEANUP REQUIRED: UNKNOWN

STATE & TRIBAL ENROLLMENT ID: NOT REPORTED
STATE & TRIBAL ENROLLMENT DATE: NOT REPORTED



Order# 121435 Job# 277689 749 of 1203

# Brownfields Management System (BF)

PROPERTY ENROLLED IN A STATE & TRIBAL PROGRAM?: NOT REPORTED

ARE INSTITUTIONAL CONTROLS REQUIRED?: UNKNOWN

Back to Report Summary

**CONTACT INFORMATION** 

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: NOT REPORTED

**MAP ID# 96** 

Distance from Property: 0.111 mi. (586 ft.) ESE

Elevation: 650 ft.

**FACILITY INFORMATION** 

ID#: 64001

NAME: VACANT GOODYEAR TIRE CENTER

ADDRESS: 1800 HANDLEY DR

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 12/31/1992 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 12/11/1992 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 12/09/1992 SIGNATURE NAME & TITLE: SOL TAYLOR, GENERAL MANAGER

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600813109 NAME: PARAGON ENTERPRISE INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION BEGIN DATE: 12/31/1992

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 12/11/1992 EMPTY TANK: NOT EMPTY TANK CAPACITY (GAL): 550

GeoSearch www.geo-search.com 888-396-0042

751 of 1203 

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/28/1993

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 156042

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 97** 

Distance from Property: 0.113 mi. (597 ft.) SW

Elevation: 638 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION NAME: CVS PHARMACY INC

REGISTRATION#: 91374 EPA ID: TXR000081000

ADDRESS: 1 CVS DR

TNRCC ID #: 130341

NAME: CVS PHARMACY 6903 ADDRESS: 3350 FOREST HILL CIR **WOONSOCKET, RI 02895** 

PHONE: 1-401-7651500

**FOREST HILL, TX 76140** 

PHONE: 401-7651500

CONTACT: WENDY BRANT

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED

WASTE GENERATOR: YES

WASTE RECEIVER: NO

WASTE TRANSPORTER: NO

TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: LARGE QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 12/06/2018

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 350851

WASTE CODE STATUS: INACTIVE

WASTE IS RADIOACTIVE: NO

WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NA3082 HAZARDOUS WASTE, LIQUID, N.O.S. (SILVER, AMMONIUM THIOSULFATE) 9

**PGIII** 

WASTE ID: 359221

WASTE CODE STATUS: ACTIVE

WASTE IS RADIOACTIVE: NO

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: UN1760 WASTE CORROSIVE LIQUIDS, N.O.S. (SULFURIC ACID, POTASSIUM

**HYDROXIDE) 8 PG** 

WASTE ID: 389254

WASTE CODE STATUS: ACTIVE



753 of 1203

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: COMPRESSED GAS, FLAMMABLE, N.O.S., LIGHTERS, PETROLEUM GASES,

LIQUEFIED, BUTANE, WASTE ID: 350846

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: UN1950 AEROSOLS, [FLAMMABLE, (EACH NOT EXCEEDING 1 L CAPACITY)] 2.1, PG

, ERG-1

WASTE ID: 359219

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVE LIQUIDS, BASIC, N.O.S.

WASTE ID: 350848

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: UN1993 FLAMMABLE LIQUIDS, N.O.S. (ACETONE, ALCOHOLS) 3, PG II, ERG-128

WASTE ID: 359220

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING LIQUID, N.O.S.

WASTE ID: 337456

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SPENT PHOTO PROCESSING SOLUTIONS CONTAINING SILVER FROM PHOTO LAB

PROCESSING

WASTE ID: 350849

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: UN2811 TOXIC SOLIDS, ORGANIC, N.O.S. (PYRETHOIDS, SELENIUM) 6.1, PG II, ERG-

154

WASTE ID: 359218

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC SOLIDS, ORGANIC, N.O.S. (ACUTE TOXIC SOLID)

WASTE ID: 350847

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO



WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: UN3077 ENVIRONMENTALLY HAZARDOUS SUBSTANCES, SOLID, N.O.S.

(MERCURY, SILVER) 9,

WASTE ID: 369542

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC, LIQUIDS, ORGANIC, N.O.S.

**Back to Report Summary** 

## Resource Conservation & Recovery Act - Generator (RCRAGR06)

**MAP ID# 97** 

Distance from Property: 0.113 mi. (597 ft.) SW

Elevation: 638 ft.

**FACILITY INFORMATION** 

EPA ID#: TXR000081000 OWNER TYPE: PRIVATE

NAME: CVS PHARMACY 6903 OWNER NAME: CVS PHARMACY INC

ADDRESS: 3350 FOREST HILL CIR OPERATOR TYPE: PRIVATE

FOREST HILL, TX 76140-1105 OPERATOR NAME: CVS PHARMACY INC

CONTACT NAME: **WENDY BRANT**CONTACT ADDRESS: **1 CVS DR** 

**WOONSOCKET RI 02895-6146** 

CONTACT PHONE: 401-765-1500

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 12/06/2018

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

WENDY BRANT **CORPORATE ENVIRONMENTAL MANAGER** 12/06/2018 CORPORATE ENVIRONMENTAL MANAGER **WENDY BRANT** 04/12/2018 **WENDY BRANT** CORPORATE ENVIRONMENTAL MANAGER 02/07/2017 WENDY BRANT CORPORATE ENVIRONMENTAL MANAGER 02/17/2015 **WENDY BRANT** CORPORATE ENVIRONMENTAL MANAGER 10/23/2014 **WENDY BRANT AUTHORIZED COMPANY AGENT** 03/01/2014 **WENDY BRANT CORPORATE ENVIRONMENTAL MANAGER** 05/13/2013 **WENDY BRANT CORPORATE ENVIRONMENTAL MANAGER** 02/26/2013 **WENDY BRANT ENV MGR** 07/16/2012

INDUSTRY CLASSIFICATION (NAICS)
812922 - ONE-HOUR PHOTOFINISHING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: LARGE QUANTITY GENERATOR LAST UPDATED DATE: 12/10/2018

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO TRANSPORTER: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -



# Resource Conservation & Recovery Act - Generator (RCRAGR06)

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE	— HAZAF
0001 IGNITABLE WASTE	D001
0002 CORROSIVE WASTE	D002
0009 MERCURY	D009
0010 SELENIUM	D010
0011 SILVER	D011
0024 M-CRESOL	D024
2001 2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%	P001
001 WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%	P001
P075 NICOTINE, & SALTS	P075
PO75 PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & SALTS	P075
2081 1,2,3-PROPANETRIOL, TRINITRATE (R)	P081
P081 NITROGLYCERINE (R)	P081
P188 BENZOIC ACID, 2-HYDROXY-,COMPD. WITH (3AS-CIS)-1,2,3,3A,8,8A-HEXAHYDRO-1,3A,8-TRIMETHYLPYRROLO [2,3-B]INDOL-5-YL METHYLCARBAMATE ESTER (1:1)	P188
P188 PHYSOSTIGMINE SALICYLATE	P188
J188 PHENOL	U188
INIVERSAL WASTE - NO UNIVERSAL WASTE REPORTED -	UNIVERSAL
CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -	CORRECTI
CORRECTIVE ACTION EVENT	CORRECT
IO CORRECTIVE ACTION EVENT(S) REPORTED	NO CORRE

**Back to Report Summary** 

OWNER INFORMATION

NAME: LEAK-TEC CORP

PHONE: 1-817-5720347

ADDRESS: PO BOX 170968

**ARLINGTON, TX 76003** 

**MAP ID# 98** 

Distance from Property: 0.116 mi. (612 ft.) W

Elevation: 583 ft.

**FACILITY INFORMATION** REGISTRATION#: 41335

EPA ID: TXD982558363

TNRCC ID #: 17726

NAME: LEAK-TEC

ADDRESS: 5228 KALTENBRUN RD

FORT WORTH, TX 76119

CONTACT: TOM TAYLOR

PHONE: 817-5720347

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: NO

WASTE RECEIVER: NO

WASTE TRANSPORTER: YES

TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/15/2003

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE **NO RECORDS** 

**Back to Report Summary** 

758 of 1203 

## Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 98** 

Distance from Property: 0.116 mi. (612 ft.) W

Elevation: 583 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD982558363 OWNER TYPE: NOT REPORTED

NAME: LEAK-TEC CORP

ADDRESS: 5228 KALTENBRUN

FORT WORTH, TX 76119
OWNER TYPE: NOT REPORTED

OPERATOR TYPE: NOT REPORTED

OPERATOR NAME: LEAK-TEC CORP

CONTACT NAME: TOM TAYLOR
CONTACT ADDRESS: PO BOX 170968

**ARLINGTON TX 76003** 

CONTACT PHONE: 817-572-0347

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 03/15/2002

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS)

48411 - GENERAL FREIGHT TRUCKING, LOCAL

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO TRANSPORTER: YES USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

- NO HAZARDOUS WASTE INFORMATION REPORTED -

UNIVERSAL WASTE - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED



Order# 121435 Job# 277689 759 of 1203

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

Back to Report Summary

OWNER INFORMATION

ADDRESS: PO BOX 1959

PHONE: 1-817-4516391

NAME: ALCON LABORATORIES INC

FORT WORTH, TX 76101

**MAP ID# 99** 

Distance from Property: 0.119 mi. (628 ft.) W

Elevation: 600 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 31818 EPA ID: TXD980624704

TNRCC ID #: 9367

NAME: ALCON LABORATORIES ADDRESS: 5927 E ROSEDALE ST

FORT WORTH, TX 76112

CONTACT: MICHAEL DAVIS

PHONE: 817-4516391

BUSINESS DESCRIPTION: NOT REPORTED INDUSTRIAL WASTE PERMIT #: NOT REPORTED MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: YES WASTE RECEIVER: NO WASTE TRANSPORTER: NO TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: LARGE QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/23/2003

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE

WASTE ID: 21320

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

OWNER INFORMATION

PHONE: NOT REPORTED

**MAP ID# 99** 

Distance from Property: 0.119 mi. (628 ft.) W

Elevation: 600 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 65503 EPA ID: NOT REPORTED NAME: ALCON LABORATORIES INC

TNRCC ID #: 20985 ADDRESS: NOT REPORTED

NAME: ALCON LABORATORIES
ADDRESS: 5927 E ROSEDALE ST

FORT WORTH, TX 76112

CONTACT: WAYNE WELBORN

PHONE: 817-2930450

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: MERGED

AMOUNT OF WASTE GENERATED: LARGE QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/04/2010

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

WASTE NO RECORDS

**Back to Report Summary** 

## Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 99** 

Distance from Property: 0.119 mi. (628 ft.) W

Elevation: 600 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD980624704 OWNER TYPE: PRIVATE

NAME: ALCON LABORATORIES INC OWNER NAME: ALCON LABORATORIES INC

ADDRESS: 5927 E ROSEDALE ST OPERATOR TYPE: PRIVATE

FORT WORTH, TX 76112 OPERATOR NAME: ALCON LABORATORIES INC

CONTACT NAME: MICHAEL DAVIS
CONTACT ADDRESS: PO BOX 1959

**FORT WORTH TX 76101** 

CONTACT PHONE: 817-451-6391

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 08/23/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - NO EVALUATIONS REPORTED - <u>VIOLATIONS</u> - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

U002 2-PROPANONE (I)
U002 ACETONE (I)

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 



Order# 121435 Job# 277689 763 of 1203

**MAP ID# 100** 

Distance from Property: 0.123 mi. (649 ft.) NNE

Elevation: 600 ft.

**FACILITY INFORMATION** 

ID#: **75637** 

NAME: **7-ELEVEN 33125** 

ADDRESS: 4225 PARK SPRINGS BLVD

ARLINGTON, TX 76016

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 08/31/1987

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 01/29/2003 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 01/23/2003

SIGNATURE NAME & TITLE: WILLO A SMITH, ENV MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: 1500 CORSICANA HWY

HILLSBORO TX 76645

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/23/2003

CONTACT ROLE: OWNOPRCON
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: 7-ELEVEN INC
PHONE: NOT REPORTED
FAX: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN600240329

NAME: 7-ELEVEN INC

**EMAIL: NOT REPORTED** 

CONTACT ADDRESS: 1202 RICHARDSON DR

**RICHARDSON TX 75080** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/23/2003 CONTACT ROLE: OPRCON

CONTACT NAME: CRAIG ZIMMER CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: SHANE PARTRIDGE
TITLE: NOT REPORTED

ORGANIZATION: 7-ELEVEN 33125

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (214) 8611277 0

ORGANIZATION: 7-ELEVEN INC PHONE: (214) 8611274 0

FAX: (214) 8611270
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 296009 SIGNATURE DATE: 12/20/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENV.MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 280565
SIGNATURE DATE: 01/18/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENIRONMENTAL MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 263364
SIGNATURE DATE: 01/15/2016

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 246877
SIGNATURE DATE: 01/15/2015

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 229686
SIGNATURE DATE: 01/06/2014

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206514
SIGNATURE DATE: 12/19/2012

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206513
SIGNATURE DATE: 12/16/2011

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206512
SIGNATURE DATE: 01/05/2011

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206511
SIGNATURE DATE: 01/07/2010

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, REGION GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206510
SIGNATURE DATE: 01/05/2009

SIGNATURE NAME & TITLE: SHANE PARTRIDGE, GAS COMPLIANCE MGR.

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206509
SIGNATURE DATE: 12/18/2007

SIGNATURE NAME & TITLE: SHANE PARTRIDGE, GAS COMPLIANCE MGR.

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206508
SIGNATURE DATE: 11/21/2006

SIGNATURE NAME & TITLE: SHANE PARTRIDGE, GAS & ENV COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206507
SIGNATURE DATE: 12/12/2005

SIGNATURE NAME & TITLE: RON FULENCHEK, GAS &ENV COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206506
SIGNATURE DATE: 12/10/2004

SIGNATURE NAME & TITLE: RON FULENCHEK, ENV COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206505
SIGNATURE DATE: 11/03/2003

SIGNATURE NAME & TITLE: WILLO A SMITH, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206504
SIGNATURE DATE: 01/23/2003

SIGNATURE NAME & TITLE: WILLO A SMITH, NOT REPORTED

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 22101
APPLICATION RECEIVED DATE: 03/14/2001
SCHEDULE CONSTRUCTION DATE: 04/13/2001

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/01/2001 REGISTRATION DATE: 01/29/2003

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 10/01/2001

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 170241

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 15000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE

PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/01/2001 REGISTRATION DATE: 01/29/2003

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 10/01/2001

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 



MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 170242

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIRING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 768 of 1203

## Resource Conservation & Recovery Act - Generator (RCRAGR06)

MAP ID# 101

Distance from Property: 0.125 mi. (660 ft.) ESE

Elevation: 623 ft.

**FACILITY INFORMATION** 

EPA ID#: TXD988089058 OWNER TYPE: PRIVATE

NAME: WAL-MART STORE #1455

ADDRESS: 6750 MANDY LN/E LOOP 820

OWNER NAME: WAL-MART STORES INC

OPERATOR TYPE: NOT REPORTED

FORT WORTH, TX 76112 OPERATOR NAME: NOT REPORTED

CONTACT NAME: ANDY SALLEE
CONTACT ADDRESS: 702 SW 8TH ST

**BENTONVILLE AR 72712** 

CONTACT PHONE: 817-496-9199

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 07/20/1993

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR LAST UPDATED DATE: 09/02/2000

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - **NO EVALUATIONS REPORTED** - <u>VIOLATIONS</u> - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

UNIVERSAL WASTE - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 769 of 1203

# Municipal Solid Waste Landfill Sites (MSWLF)

**MAP ID# 102** 

Distance from Property: 0.126 mi. (665 ft.) NNE

Elevation: 619 ft.

#### **FACILITY INFORMATION**

PERMIT#: 100449

NAME: COMMODITY RECYCLING SOLUTIONS
ADDRESS: 5043 MARTIN LUTHER KING FWY
FORT WORTH, TX 76119-4169

COUNTY: TARRANT FACILITY DETAILS

FACILITY TYPE #: NOTICE OF INTENT TO OPERATE A RECYCLING FACILITY

PHYSICAL FACILITY STATUS: ACTIVE
LEGAL STATUS: ACKNOWLEDGED
REFERENCE NUMBER(RN): RN109238949
REGION: REGION 04 - DFW METROPLEX

**Back to Report Summary** 

OWNER INFORMATION

PHONE: NOT REPORTED

ADDRESS: 5224 MOSSON RD STE B

FORT WORTH, TX 76119

NAME: HAZ-TANK INC

**MAP ID# 103** 

Distance from Property: 0.128 mi. (676 ft.) W

Elevation: 591 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 41483 EPA ID: TXD987982964

TNRCC ID #: 17872 NAME: **HAZ TANK** 

ADDRESS: 5224 MOSSON RD STE B

FORT WORTH, TX 76119

CONTACT: JACK SMITH PHONE: NOT REPORTED

BUSINESS DESCRIPTION: NOT REPORTED INDUSTRIAL WASTE PERMIT #: NOT REPORTED MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: NO WASTE RECEIVER: NO WASTE TRANSPORTER: YES TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/24/2010

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE **NO RECORDS** 

**Back to Report Summary** 

GeoSearch www.geo-search.com 888-396-0042

OWNER INFORMATION

PHONE: 1-817-5723135

ADDRESS: 5212 MOSSON RD STE B

FORT WORTH, TX 76119

**MAP ID# 103** 

Distance from Property: 0.156 mi. (824 ft.) W

Elevation: 591 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 70327 EPA ID: TXD131019390 NAME: R&R CONCRETE PUMPING SERVICE

TNRCC ID #: 25155

NAME: R & R CONCRETE PUMPING SERVICE

ADDRESS: 5212 MOSSON RD STE B

FORT WORTH, TX 76119

CONTACT: ROLAND SCHINKOWSKY

PHONE: **817-5723135** 

BUSINESS DESCRIPTION: MAILING ADDRESS INCORRECT

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 11/18/2003

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 50555

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

OWNER INFORMATION

**MAP ID# 104** 

Distance from Property: 0.13 mi. (686 ft.) SW

Elevation: 700 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 89175 EPA ID: TXR000079157 NAME: WAL-MART STORES TEXAS LLC

TNRCC ID #: 128493 ADDRESS: PO BOX 8041

NAME: WALMART SUPERCENTER 3284 BENTONVILLE, AR 72712

ADDRESS: 4800 HIGHWAY 287 PHONE: 1-479-2042231

**ARLINGTON, TX 76017** 

CONTACT: ROSE ARNOLD
PHONE: 479-2778972

BUSINESS DESCRIPTION: WAREHOUSE CLUBS AND SUPERCENTERS.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 11/30/2016

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 246609

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE SOLIDS. DATE OF GENERATION 01/01/2010.

WASTE ID: 246610

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: AEROSOLS. DATE OF GENERATION 01/01/2010.

WASTE ID: 246611

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

Order# 121435 Job# 277689 773 of 1203

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVE LIQUIDS. DATE OF GENERATION 01/01/2010.

WASTE ID: 246612

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE LIQUIDS. DATE OF GENERATION 01/01/2010.

WASTE ID: 246613

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LIGHTERS. DATE OF GENERATION 01/01/2010.

WASTE ID: 246614

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING SOLIDS. DATE OF GENERATION 01/01/2010.

WASTE ID: 246615

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ORGANIC PEROXIDE. DATE OF GENERATION 01/01/2010.

WASTE ID: 246616

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC SOLIDS. DATE OF GENERATION 01/01/2010.

WASTE ID: 246617

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC LIQUIDS. DATE OF GENERATION 01/01/2010.

WASTE ID: 246618

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING LIQUIDS. DATE OF GENERATION 01/01/2010.

WASTE ID: 250765

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: P-LISTED WASTE PHARMACEUTICALS

WASTE ID: 250766

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 



GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE WASTE PHARMACEUTICALS

**Back to Report Summary** 

775 of 1203

**CONTACT INFORMATION** 

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: NOT REPORTED

**MAP ID# 104** 

Distance from Property: 0.13 mi. (686 ft.) SW

Elevation: 700 ft.

**FACILITY INFORMATION** 

ID#: **87744** 

NAME: WAL-MART SUPERCENTER 3284

ADDRESS: 4800 HIGHWAY 287

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4

TYPE: NOT REPORTED

BEGIN DATE: NOT REPORTED

STATUS: PENDING

**EXEMPT STATUS: NOT REPORTED** 

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **NOT REPORTED** NUMBER OF ACTIVE ABOVEGROUND TANKS: **NOT REPORTED** 

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: **NOT REPORTED**SIGNATURE DATE ON EARLIEST REGISTRATION FORM: **NOT REPORTED** 

SIGNATURE NAME & TITLE: SIGNATURE NAME NOT REPORTED, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603246240

NAME: WAL-MART STORES TEXAS LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/18/2015

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN603246240

NAME: WAL-MART STORES TEXAS LLC

CONTACT ADDRESS: PO BOX 8041

**BENTONVILLE AR 72712** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/18/2015 CONTACT ROLE: OPRCON

CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: WALMART STORES TEXAS LLC

PHONE: (479) 2042231 0 FAX: (479) 2049675

EMAIL: TERESA.PRUITT@WAL-MART.COM

#### **SELF-CERTIFICATION**

-NO SELF-CERTIFICATION INFORMATION REPORTED-

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 27789

APPLICATION RECEIVED DATE: 06/18/2015

SCHEDULE CONSTRUCTION DATE: 12/20/2015

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

INSTALLATION OF (1) 20,000 GAL UST AND (1) 20,000 GAL SPLIT TANK (12K/8K). REC'D AN AMENDED NOC 12-1-15 SHOWING

**NEW INSTALL DATE OF 12-20-15.** 

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

**CONTACT INFORMATION** 

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: NOT REPORTED

**MAP ID# 105** 

Distance from Property: 0.13 mi. (686 ft.) ESE

Elevation: 610 ft.

**FACILITY INFORMATION** 

ID#: 88708
NAME: CONSTRUCTION SITE

ADDRESS: 1298 W KENNEDALE PKWY

......

KENNEDALE, TX 76060

COUNTY: TARRANT

REGION: 4

TYPE: **NOT REPORTED**BEGIN DATE: **NOT REPORTED** 

STATUS: PENDING

**EXEMPT STATUS: NOT REPORTED** 

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **NOT REPORTED**NUMBER OF ACTIVE ABOVEGROUND TANKS: **NOT REPORTED** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: NOT REPORTED SIGNATURE DATE ON EARLIEST REGISTRATION FORM: NOT REPORTED

SIGNATURE NAME & TITLE: SIGNATURE NAME NOT REPORTED, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600571814
NAME: MCDONALDS CORPORATION

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/13/2016

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 30201

APPLICATION RECEIVED DATE: 09/13/2016

SCHEDULE CONSTRUCTION DATE: 09/16/2016

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REMOVAL OF 600 GALLON GHOST TANK DISCOVERED DURING CONSTRUCTION ACTIVITIES.

GeoSearch www.geo-search.com 888-396-0042

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 106** 

Distance from Property: 0.13 mi. (686 ft.) ESE

Elevation: 665 ft.

#### **FACILITY INFORMATION**

REGISTRATION #: RN104247598 CUSTOMER #: CN602968901 NAME: SUBLETT CLEANERS

ADDRESS: 4720 W SUBLETT RD STE 100

**ARLINGTON, TX 76017** 

ACCOUNT NUMBER: 24,003,523
PRINCIPAL NAME: OMID INC
PHONE NUMBER: 817-5721379

SITE TYPE: DROP STATION REGISTRATION

FISCAL YEAR: FY2018
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2015
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2014
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2013
SOLVENT: PETROLEUM
QUANTITY: 50 GALLONS

FISCAL YEAR: FY2012 SOLVENT: PETROLEUM

QUANTITY: 50 GALLONS

FISCAL YEAR: FY2011
SOLVENT: PETROLEUM
QUANTITY: 50 GALLONS

FISCAL YEAR: FY2011
SOLVENT: PETROLEUM
QUANTITY: 50 GALLONS

FISCAL YEAR: FY2010
SOLVENT: PETROLEUM
QUANTITY: 75 GALLONS

FISCAL YEAR: FY2009
SOLVENT: PETROLEUM
QUANTITY: 75 GALLONS

FISCAL YEAR: FY2008

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 0 GALLONS

FISCAL YEAR: FY2007

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 150 GALLONS

FISCAL YEAR: FY2006

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 40 GALLONS

FISCAL YEAR: FY2005

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 0 GALLONS

FISCAL YEAR: FY2004
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 781 of 1203

**MAP ID# 107** 

Distance from Property: 0.131 mi. (692 ft.) NE

Elevation: 639 ft.

#### **FACILITY INFORMATION**

REGISTRATION #: RN102011244
CUSTOMER #: CN603188293
NAME: COWBOY CLEANERS
ADDRESS: 4148 MILLER AVE

FORT WORTH, TX 76119

ACCOUNT NUMBER: 24,004,693
PRINCIPAL NAME: PANACORP LLC
PHONE NUMBER: 817-9236732

SITE TYPE: DROP STATION REGISTRATION

FISCAL YEAR: FY2018
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2015
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2014
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2013
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2012
SOLVENT: NOT REPORTED

782 of 1203

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2011
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2010
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2009
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2008

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2007

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2006
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2005
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2004

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

**Back to Report Summary** 

783 of 1203

**CONTACT INFORMATION** 

ORGANIZATION: COWBOY CLEANERS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

NAME: H PEERSQ

TITLE: ACCOUNTANT

PHONE: (817) 9236732 0

**MAP ID# 107** 

Distance from Property: 0.131 mi. (692 ft.) NE

Elevation: 639 ft.

**FACILITY INFORMATION** 

ID#: **22339** 

NAME: COWBOY CLEANERS

ADDRESS: 4148 MILLER AVE

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: UNKNOWN
BEGIN DATE: 09/18/1986
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/24/1986

SIGNATURE NAME & TITLE: **H PEERS**, **ACCOUNTANT** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN603907924
NAME: COWBOY CLEANERS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 09/18/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 784 of 1203

STATUS: **PERM FILLED IN PLACE** STATUS BEGIN DATE: **08/31/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 120828

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **PERM FILLED IN PLACE** STATUS BEGIN DATE: **08/31/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:



Order# 121435 Job# 277689 785 of 1203

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 120830

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: **NOT REPORTED** CAPACITY (GAL): **NOT REPORTED** 

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **PERM FILLED IN PLACE** STATUS BEGIN DATE: **08/31/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 120829

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

## Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 108** 

Distance from Property: 0.133 mi. (702 ft.) SSW

Elevation: 635 ft.

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 82899 EPA ID: NOT REPORTED NAME: POWERLINE INC
TNRCC ID #: 99227 ADDRESS: NOT REPORTED

NAME: **POWERLINE** 

ADDRESS: 4616 FAIRLANE AVE PHONE: NOT REPORTED

FORT WORTH, TX 76119

CONTACT: KARL HADDOCK

PHONE: 817-5350284

BUSINESS DESCRIPTION: REBUILD/REMANUFACTURE OF ALTERNATORS/STARTERS

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/16/2004

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 98691

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: SPENT MINERAL SPIRITS FROM PARTS CLEANING

**Back to Report Summary** 

**MAP ID# 109** 

Distance from Property: 0.133 mi. (702 ft.) NE

Elevation: 651 ft.

#### **FACILITY INFORMATION**

ID#: 42889 NAME: JMC 205

ADDRESS: 3428 E BERRY ST

FORT WORTH, TX 76105

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 02/02/1987 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 06/17/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/23/1986

SIGNATURE NAME & TITLE: JOSH DAVIS, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600447676 NAME: J-MC OIL COMPANY

CONTACT ADDRESS: 621 W CHERYL AVE

**HURST TX 76053** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/07/2004 CONTACT ROLE: OWNCON CONTACT NAME: J W DAVIS

CONTACT TITLE: VP

ORGANIZATION: J MC OIL COMPANY

PHONE: (817) 2822718 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600447676

NAME: J-MC OIL COMPANY

CONTACT ADDRESS: 621 W CHERYL AVE

**HURST TX 76053** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/07/2004 CONTACT ROLE: OPRCON CONTACT NAME: J W DAVIS

CONTACT TITLE: VP

**CONTACT INFORMATION** 

NAME: J W DAVIS

TITLE: VP

ORGANIZATION: J MC 205

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 8342868 0

GeoSearch www.geo-search.com 888-396-0042

789 of 1203 

ORGANIZATION: J MC OIL COMPANY

PHONE: (817) 8342868 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1966 REGISTRATION DATE: 06/17/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/17/1999** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 29400

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO



Order# 121435 Job# 277689 790 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1966 REGISTRATION DATE: 06/17/1986

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/17/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 29399

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1974 REGISTRATION DATE: 06/17/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/17/1999

omics Removed Mon Ground

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO



#### **TANK DETAILS**

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 29398

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 792 of 1203

**CONTACT INFORMATION** 

ORGANIZATION: BROWN EXCAVATING

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

NAME: JUDY BROWN

TITLE: NOT REPORTED

PHONE: (817) 4577757 0

**MAP ID# 110** 

Distance from Property: 0.135 mi. (713 ft.) WSW

Elevation: 592 ft.

#### **FACILITY INFORMATION**

ID#: 61304

NAME: BROWN EXCAVATING

ADDRESS: 5216 CAREY

**FT WORTH, TX 76119** 

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING BEGIN DATE: 11/05/1991 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 10/28/1991 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 10/24/1991

SIGNATURE NAME & TITLE: JIM NORMAN, GEN MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600244339 NAME: REEDER DISTRIBUTORS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/05/1991

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

ABOVEGROUND STORAGE TANK INFORMATION

GeoSearch www.geo-search.com 888-396-0042

793 of 1203 

AST ID #: 165159 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 10/28/1991

INSTALLATION DATE: 01/01/1987 STATUS BEGIN DATE: 06/26/1992
TANK CAPACITY (GAL): 5000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

**Back to Report Summary** 

MAP ID# 111

Distance from Property: 0.158 mi. (834 ft.) SSE

Elevation: 632 ft.

#### **FACILITY INFORMATION**

REGISTRATION #: RN100656719 CUSTOMER #: CN600365886 NAME: BOSS CLEANERS

ADDRESS: 5735 SW GREEN OAKS BLVD
ARLINGTON, TX 76017-1202

ACCOUNT NUMBER: 24000807

PRINCIPAL NAME: L&LNATIONAL INC
PHONE NUMBER: NOT REPORTED

SITE TYPE: DROP STATION REGISTRATION

FISCAL YEAR: FY2007
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2006

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2005
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2004

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 111** 

Distance from Property: 0.153 mi. (808 ft.) SSE

Elevation: 632 ft.

#### **FACILITY INFORMATION**

REGISTRATION #: RN105308316 CUSTOMER #: CN602834780 NAME: NOT REPORTED

ADDRESS: 5755 SW GREEN OAKS BLVD

**ARLINGTON, TX 76017** 

ACCOUNT NUMBER: 24,003,080

PRINCIPAL NAME: **GRANIK CCHG CORP**PHONE NUMBER: **NOT REPORTED** 

SITE TYPE: DROP STATION REGISTRATION

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2015
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2014

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2013
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2012
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2011
SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2010
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2009

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2008
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

**Back to Report Summary** 

## Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 111** 

Distance from Property: 0.158 mi. (834 ft.) SSE

Elevation: 632 ft.

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 65465 EPA ID: TXD980880173 NAME: BOSS CLEANERS
TNRCC ID #: 20949 ADDRESS: NOT REPORTED

NAME: BOSS CLEANERS

ADDRESS: 5735 SW GREEN OAKS BLVD PHONE: NOT REPORTED

ARLINGTON, TX 76017

CONTACT: ADAM M SAHYOUNI

PHONE: 817-4782011

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THIS FACILITY WAS REGISTERED PRIOR

TO1994 AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 04/21/2004

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE NO RECORDS

**Back to Report Summary** 

Order# 121435 Job# 277689 798 of 1203

## Industrial and Hazardous Waste Sites (IHW)

OWNER INFORMATION

ADDRESS: PO BOX 4256

PHONE: 1-713-7543500

NAME: CHEVRON USA INC

**HOUSTON, TX 77210** 

MAP ID# 111

Distance from Property: 0.136 mi. (718 ft.) SSE

Elevation: 632 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 79217 EPA ID: TXD988035028

TNRCC ID #: 32771

NAME: CHEVRON FAC 157013

ADDRESS: 5711 SW GREEN OAKS BLVD

**ARLINGTON, TX 76017** 

CONTACT: KATHRYN MINTER

PHONE: 713-7543500

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 12/01/2005

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 62787

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 111** 

Distance from Property: 0.136 mi. (718 ft.) SSE

Elevation: 632 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 107484

LPST ID: 107484

FACILITY ID: 0005679

NAME: CHEVRON 60157013

ADDRESS: 5711 SW GREEN OAKS BLVD

ARLINGTON, TX

#### **LEAKING TANK DETAILS**

LPST ID: 107484

NAME: CHEVRON 60157013

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 12/30/93

REPORTED DATE: 11/4/1993 ENTERED DATE: 12/30/1993

PRP INFORMATION

NAME: CHEVRON USA INC

ADDRESS: ADDRESS NOT REPORTED

**HOUSTON TX 77210** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 104S NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/05/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 800 of 1203

UST COMPARTMENT ID: 68340

**TANK ID: 104S** 

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 345G NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/05/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 68341

TANK ID: 345G

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

Order# 121435 Job# 277689 801 of 1203

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 502D NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/01/1980 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/05/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 68343

TANK ID: 502D

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 



Order# 121435 Job# 277689 802 of 1203

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 601C NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/05/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 68342

TANK ID: 601C

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary



Order# 121435 Job# 277689 803 of 1203

**MAP ID# 111** 

Distance from Property: 0.136 mi. (718 ft.) SSE

Elevation: 632 ft.

#### **FACILITY INFORMATION**

ID#: 5679

NAME: CHEVRON FAC 157013

ADDRESS: 5711 SW GREEN OAKS BLVD

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 09/01/1987 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/22/1986

SIGNATURE NAME & TITLE: JUDI L HICKERSON, ENGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600132484 NAME: CHEVRON USA INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600132484

NAME: CHEVRON USA INC

CONTACT ADDRESS: PO BOX 4256

**HOUSTON TX 77210** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1987 CONTACT ROLE: OPRCON

CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED **CONTACT INFORMATION** 

NAME: JUDI L HICKERSON TITLE: NOT REPORTED

ORGANIZATION: CHEVRON FAC 157013

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (214) 6996623 0

GeoSearch www.geo-search.com 888-396-0042

804 of 1203

ORGANIZATION: CHEVRON USA INC

PHONE: (713) 7543500 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

#### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

#### **UNDERGROUND STORAGE TANK**

TANK ID: 104S NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **11/05/1999** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 68340

**TANK ID: 104S** 

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG



Order# 121435 Job# 277689 805 of 1203

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 345G NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/05/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 68341

TANK ID: 345G

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 502D NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/01/1980 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/05/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

Order# 121435 Job# 277689 806 of 1203

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 68343

TANK ID: 502D

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 601C NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/05/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

Order# 121435 Job# 277689 807 of 1203

#### FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 68342

TANK ID: 601C

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 808 of 1203

**MAP ID# 112** 

Distance from Property: 0.139 mi. (734 ft.) S

Elevation: 612 ft.

**FACILITY INFORMATION** 

ID#: **50164** 

NAME: QUICK WAY 2

ADDRESS: 4400 PARK SPRINGS BLVD

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 01/01/1990 STATUS: INACTIVE EXEMPT STATUS: NO

RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 0

NUMBER OF ACTIVE UNDERGROUND TANKS: 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 07/15/2013 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 07/15/2013

SIGNATURE NAME & TITLE: SAM BADRUDDIN, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603615907

NAME: KONDA ONE LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/01/2012

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OWNER NUMBER: CN602523995 NAME: KONDA HOLDINGS LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

CITY NOT REPORTED

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/04/2004

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: SAM BADRU

TITLE: MGR

ORGANIZATION: QUICK WAY 2

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 8194344 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 809 of 1203

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OWNER NUMBER: CN603615907

NAME: KONDA ONE LLC

CONTACT ADDRESS: 3802 HICKORY VIEW CT

FRIENDSWOOD TX 77546

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/2004 CONTACT ROLE: OWNCON

CONTACT NAME: MANNAN MOHAMMED

CONTACT TITLE: NOT REPORTED

ORGANIZATION: TICK TACK FOOD STORE

PHONE: (281) 5856901 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN603615907

NAME: KONDA ONE LLC

CONTACT ADDRESS: 4700 MEANDERING WAY

**COLLEYVILLE TX 76034** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/01/2012 CONTACT ROLE: OPRCON CONTACT NAME: SAM BADRU

CONTACT TITLE: MGR

ORGANIZATION: KONDA ONE LLC

PHONE: (817) 8194344

FAX: NOT REPORTED

EMAIL: NOT REPORTED

OPERATOR NUMBER: CN603615907

NAME: KONDA ONE LLC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/2004

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 222171
SIGNATURE DATE: 07/15/2013

SIGNATURE NAME & TITLE: SAM BADRUDDIN, NOT REPORTED

FILING STATUS: RENEWAL

Order# 121435 Job# 277689 810 of 1203

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1356
SIGNATURE DATE: 12/07/2012

SIGNATURE NAME & TITLE: SAM BADRU, MGR

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1355
SIGNATURE DATE: 02/27/2012

SIGNATURE NAME & TITLE: ALEX CHARANIYA, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1354
SIGNATURE DATE: 02/28/2011

SIGNATURE NAME & TITLE: ALEX CHARANIYA, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1353
SIGNATURE DATE: 01/27/2010

SIGNATURE NAME & TITLE: CHARANIYA, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1352
SIGNATURE DATE: 03/13/2009

SIGNATURE NAME & TITLE: ALEX CHARANIYA, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1351
SIGNATURE DATE: 10/16/2008

SIGNATURE NAME & TITLE: ALEX CHARANIYA, OPER MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1350
SIGNATURE DATE: 02/28/2007

SIGNATURE NAME & TITLE: SHAWN KONDA, MEMBER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1349
SIGNATURE DATE: 02/02/2006

SIGNATURE NAME & TITLE: SHAWN KONDA, MEMBER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1348
SIGNATURE DATE: 02/21/2005

SIGNATURE NAME & TITLE: S KONDA, MG MEMBER

FILING STATUS: **RENEWAL**REGISTRATION FLAG: **YES**SELF-CERTIFICATION ID: **1347** 

SIGNATURE DATE: 10/05/2004

SIGNATURE NAME & TITLE: SHAWN KONDA, NOT REPORTED

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1346
SIGNATURE DATE: 10/22/2003

SIGNATURE NAME & TITLE: S KONDA, OPERATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1345
SIGNATURE DATE: 02/28/2003

SIGNATURE NAME & TITLE: JENNIFER SIEGRIST FOR JEFF DEGROOT, VP OPS

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1344
SIGNATURE DATE: 03/29/2002

SIGNATURE NAME & TITLE: ROBERT J BYRNES, NOT REPORTED

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1343
SIGNATURE DATE: 01/10/2002

SIGNATURE NAME & TITLE: JEFF DEGROOT, VP OF OPER

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 1342
SIGNATURE DATE: 03/19/2001

SIGNATURE NAME & TITLE: SHAVON THORNTON, AGENT

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 28348

APPLICATION RECEIVED DATE: 10/19/2015

SCHEDULE CONSTRUCTION DATE: 11/13/2015

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

EXCAVATE AND REMOVE (3) 10K GALLON UST'S AND ALL RELATED FUELING PIPING. BACK FILL FOR CONCRETE BY

OTHERS.

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1990 REGISTRATION DATE: 02/05/1990

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/20/2015** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
FRP



Order# 121435 Job# 277689 812 of 1203

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 1305

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1990 REGISTRATION DATE: 02/05/1990

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/2

STATUS: **TEMP OUT OF SERVICE** STATUS BEGIN DATE: **04/29/2014**INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED** 

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES

Order# 121435 Job# 277689 813 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 1305

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1990 REGISTRATION DATE: 02/05/1990

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/20/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 1304

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

Order# 121435 Job# 277689 814 of 1203

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1990 REGISTRATION DATE: 02/05/1990

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: TEMP OUT OF SERVICE STATUS BEGIN DATE: 04/29/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 1304

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

Order# 121435 Job# 277689 815 of 1203

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1990 REGISTRATION DATE: 02/05/1990

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/20/2015** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 1303

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 



Order# 121435 Job# 277689 816 of 1203

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1990 REGISTRATION DATE: 02/05/1990

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **TEMP OUT OF SERVICE** STATUS BEGIN DATE: **04/29/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 1303

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



ABOVEGROUND STORAGE TANK INFORMATION
NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

# Dry Cleaner Registration Database (DCR)

**MAP ID# 113** 

Distance from Property: 0.139 mi. (734 ft.) ESE

Elevation: 651 ft.

**FACILITY INFORMATION** 

REGISTRATION #: RN104428107 CUSTOMER #: CN602724924 NAME: HASSELL CLEANERS

ADDRESS: 6700 BRENTWOOD STAIR RD
FORT WORTH, TX 76112-3310

ACCOUNT NUMBER: 24002828

PRINCIPAL NAME: LARRY HASSELL DBA HASSELL CLEANERS

PHONE NUMBER: NOT REPORTED

SITE TYPE: DROP STATION REGISTRATION

FISCAL YEAR: FY2007
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2006

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2005
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2004
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

**MAP ID# 113** 

Distance from Property: 0.164 mi. (866 ft.) ESE

Elevation: 651 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 55113 EPA ID: TXD981058761 NAME: IMAGE PLUS CLEANERS

TNRCC ID #: 19089 ADDRESS: 1700 W PARK ROW DR STE 120

NAME: IMAGE PLUS CLEANERS BRENTWOOD STAIR ROAD ARLINGTON, TX 76013

ADDRESS: 6712 BRENTWOOD STAIR RD PHONE: 1-817-4514148

FORT WORTH, TX 76112

CONTACT: GREGG LAMBERT

PHONE: 817-4514148

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THIS FACILITY WAS REGISTERED PRIOR

TO1994 AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: LARGE QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/24/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE NO RECORDS

**Back to Report Summary** 

MAP ID# 114

Distance from Property: 0.14 mi. (739 ft.) S

Elevation: 631 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 73583 EPA ID: TXD095223905 NAME: HORTON TREE SERVICE

TNRCC ID #: 27996 ADDRESS: NOT REPORTED

NAME: HORTON TREE SERVICE

ADDRESS: 5100 GLENN CT PHONE: NOT REPORTED

FOREST HILL, TX 76140

CONTACT: JIMMY MANNING

PHONE: **817-5722334** 

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/24/2009

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 150415

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: SPENT SOLVENT

WASTE ID: 54468

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

# Municipal Solid Waste Landfill Sites (MSWLF)

**MAP ID# 114** 

Distance from Property: 0.14 mi. (739 ft.) SSE

Elevation: 631 ft.

#### **FACILITY INFORMATION**

PERMIT#: 100395

NAME: THE ORGANIC RECYCLER OF TEXAS

ADDRESS: 5100 FOREST HILL CIR

**FOREST HILL, TX 76140-1524** 

COUNTY: TARRANT
FACILITY DETAILS

FACILITY TYPE #: NOTICE OF INTENT TO OPERATE A RECYCLING FACILITY

PHYSICAL FACILITY STATUS: ACTIVE
LEGAL STATUS: ACKNOWLEDGED
REFERENCE NUMBER(RN): RN106903230
REGION: REGION 04 - DFW METROPLEX

## Superfund Enterprise Management System (SEMS)

MAP ID# 114

Distance from Property: 0.14 mi. (739 ft.) S

Elevation: 631 ft.

#### **FACILITY INFORMATION**

EPA ID#: **TXN000606672**SITE ID#: **0606672** 

NAME: HORTON TREE SERVICES DUMP FIRE

ADDRESS: 5100 GLENN COURT

FOREST HILLS, TX NOT REPORTED

COUNTY: TARRANT

FEDERAL FACILITY: N - NOT A FEDERAL FACILITY

NPL: NOT ON THE NPL

NON NPL STATUS: REMOVAL ONLY SITE (NO SITE ASSESSMENT WORK NEEDED)

Below information was gathered from the prior CERCLIS update completed in 10/2013 update:

NON-NPL STATUS DATE: 07/05/06

PHYSICAL CLASSIFICATION OF SITE / INCIDENT: NO INFORMATION AVAILABLE SITE DESCRIPTION - NO SITE DESCRIPTION INFORMATION AVAILABLE -

SITE HISTORY - NO SITE HISTORY INFORMATION AVAILABLE -

**ACTIONS** 

TYPE: PJ - POTENTIALLY RESPONSIBLE PARTY EMERGENCY REMOVAL

START DATE: 06/09/2006 COMPLETION DATE: 06/09/2006 ACTION TYPE DEFINITION:

THE PRP OR THEIR CONTRACTORS HAVE BEGUN CONSTRUCTION WORK ON-SITE IN RESPONSE TO AN EMERGENCY INCIDENT, AND EPA PROVIDES ON-SITE TECHNICAL OVERSIGHT AND/OR IS PART OF AN INCIDENT COMMAND SYSTEM/UNIFIED COMMAND. THE DATE OF CONSTRUCTION IS REPORTED IN WASTELAN AS THE PRP EMERGENCY REMOVAL ACTUAL START DATE.

<u>CONTAMINANTS</u> - NO CONTAMINATION INFORMATION AVAILABLE -

LISTING OF PUBLISHED INSTITUTIONAL CONTROL SITE REPORT - NOT AN INSTITUTIONAL CONTROL SITE -

Back to Report Summary

Order# 121435 Job# 277689 823 of 1203

**MAP ID# 115** 

Distance from Property: 0.143 mi. (755 ft.) SSE

Elevation: 642 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

PHONE: 1-817-4837351

REGISTRATION#: 82335 EPA ID: TXD988000634 NAME: JI

NAME: JIFFY LUBE INTERNATIONAL INC

TNRCC ID #: 98054
NAME: JIFFY LUBE 1150

ADDRESS: 3430 COURTYARD CIR

ADDRESS: 5710 FOREST BEND DR

DALLAS, TX 75234

**ARLINGTON, TX 76017** 

CONTACT: ROBERT E WHITE

PHONE: 817-4837351

BUSINESS DESCRIPTION: QUICK OIL CHANGE SERVICE THIS REGISTRATION WAS INACTIVATED BECAUSE THE

FACILITYWAS REGISTERED PRIOR TO 1995 AND NO WASTE ACTIVITY WAS REPORTED IN 95,96, AND 97.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 02/05/2004

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 87435

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: USED OIL FROM CUSTOMERS' VEHICLE IS DRAINED AND PICKED UP BY A

LICENSED/BONDED T

**Back to Report Summary** 

Order# 121435 Job# 277689 824 of 1203

CONTACT INFORMATION
NAME: DENNIS BAUGHMAN

ORGANIZATION: JIFFY LUBE STORE 1150

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TITLE: NOT REPORTED

PHONE: (817) 2617189 0

**MAP ID# 115** 

Distance from Property: 0.143 mi. (755 ft.) SSE

Elevation: 642 ft.

#### **FACILITY INFORMATION**

ID#: 66509

NAME: JIFFY LUBE STORE 1150
ADDRESS: 5710 FOREST BEND DR

DIREGO. OF TO FOREOF BEIND BIR

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 08/31/1987 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0**NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 02/27/1995 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/24/1995 SIGNATURE NAME & TITLE: ARNOLD ADAMS, DIVISION ES COORDINA

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600246094

NAME: JIFFY LUBE INTERNATIONAL INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/31/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 02/27/1995
TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/16/1996** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 152385

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: NOT REPORTED

**MAP ID# 116** 

Distance from Property: 0.147 mi. (776 ft.) WSW

Elevation: 648 ft.

#### **FACILITY INFORMATION**

ID#: 89323

NAME: KROGER FUEL CENTER 592

ADDRESS: 5175 W SUBLETT RD

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 11/30/2017

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 2

NUMBER OF ACTIVE ABOVEGROUND TANKS: NOT REPORTED

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 07/17/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 07/17/2018 SIGNATURE NAME & TITLE: RAHUL GAUTAMA, DIV FUEL MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601489354
NAME: KROGER TEXAS LP

CONTACT ADDRESS: 19245 DAVID MEMORIAL DR
SHENANDOAH TX 77385

TYPE: PARTNERSHIP

BEGIN DATE: 07/11/2017

CONTACT ROLE: OWNOPRCON
CONTACT NAME: PATRICIA T ASH
CONTACT TITLE: NOT REPORTED
ORGANIZATION: KROGER TEXAS LP

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN601489354

NAME: KROGER TEXAS LP

CONTACT ADDRESS: 19245 DAVID MEMORIAL DR
SHENANDOAH TX 77385

TYPE: PARTNERSHIP
BEGIN DATE: 07/11/2017
CONTACT ROLE: OPRCON
CONTACT NAME: MIKE BOEHM

CONTACT TITLE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 827 of 1203

ORGANIZATION: KROGER TEXAS LP

PHONE: (713) 5074817 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 306674 SIGNATURE DATE: 07/17/2018

SIGNATURE NAME & TITLE: RAHUL GAUTAMA, DIV FUEL MGR

FILING STATUS: AMENDMENT
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 302072
SIGNATURE DATE: 04/04/2018

SIGNATURE NAME & TITLE: RAHUL GAUTAMA, DIV FUEL MGR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 31632

APPLICATION RECEIVED DATE: 07/11/2017

SCHEDULE CONSTRUCTION DATE: 09/01/2017

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

INSTALLATION OF (1) 20K UST AND (1) SPLIT UST (8K/10K) COMPARTMENTS.

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/30/2017 REGISTRATION DATE: 04/04/2017

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/30/2017

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 192868

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE



Order# 121435 Job# 277689 828 of 1203

TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF

VALVE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONITORING OF SECONDARY CONTAINMENT BARRIER, INTERSTITIAL MONITORING WITHIN SECONDARY

WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 11/30/2017 REGISTRATION DATE: 04/04/2017

TANK CAPACITY (GAL): 18000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 11/30/2017

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 192869

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE

TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF

VALVE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONITORING OF SECONDARY CONTAINMENT BARRIER, INTERSTITIAL MONITORING WITHIN SECONDARY

WALL/JACKET,AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 11/30/2017 REGISTRATION DATE: 04/04/2017

TANK CAPACITY (GAL): 18000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/30/2017

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 192870

TANK ID: 2

COMPARTMENT LETTER: **B**SUBSTANCES: **DIESEL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE

TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF

VALVE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONITORING OF SECONDARY CONTAINMENT BARRIER, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

....

Order# 121435 Job# 277689 830 of 1203

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 117** 

Distance from Property: 0.148 mi. (781 ft.) W

Elevation: 595 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 38158 EPA ID: NOT REPORTED NAME: FUTURE MARBLE INC

TNRCC ID #: 14787 ADDRESS: 5216 DAVID STRICKLAND RD

NAME: FUTURE MARBLE FORT WORTH, TX 76119

ADDRESS: 5216 DAVID STRICKLAND RD PHONE: 1-817-4830089

FORT WORTH, TX 76119

CONTACT: KEITH AMASON

PHONE: 817-4830089

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THIS FACILITY WAS REGISTERED PRIOR

TO1994 AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/23/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE NO RECORDS

**Back to Report Summary** 

Order# 121435 Job# 277689 832 of 1203

OWNER INFORMATION

ADDRESS: PO BOX 15420

PHONE: 1-817-4575885

NAME: CRAFTMARK LABEL GRAPHICS INC

FORT WORTH, TX 76119

**MAP ID# 118** 

Distance from Property: 0.15 mi. (792 ft.) ESE

Elevation: 579 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 37130 EPA ID: TXD981055510

TNRCC ID #: 13867

NAME: CRAFTMARK PRODUCTS
ADDRESS: 3212 S CRAVENS RD

FORT WORTH, TX 76119

CONTACT: **BOB SARD** PHONE: **817-4575885** 

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: LARGE QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/13/2003

<u>ACTIVITIES</u>

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 268205

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 268206

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 36050

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

Order# 121435 Job# 277689 833 of 1203

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**MAP ID# 119** 

Distance from Property: 0.153 mi. (808 ft.) S

Elevation: 641 ft.

#### **FACILITY INFORMATION**

ID#: 79403

NAME: VANDERRA TRUCKING ADDRESS: 6629 ANGLIN DR

FOREST HILL, TX 76140

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING
BEGIN DATE: 08/05/2008
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/06/2008 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 08/05/2008 SIGNATURE NAME & TITLE: GINNY KAMPER, CORP COMPLIANCE DIR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600244339
NAME: REEDER DISTRIBUTORS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/05/2008

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN603411042

NAME: DMM HOLDINGS LLC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/05/2008

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION

NAME: NOT REPORTED
TITLE: NOT REPORTED

ORGANIZATION: VANDERRA TRUCKING

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 8976179 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 835 of 1203

ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 210466 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 08/06/2008

INSTALLATION DATE: 08/05/2008 STATUS BEGIN DATE: 02/04/2009

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 210467 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 2 REGISTRATION DATE: 08/06/2008

INSTALLATION DATE: 08/05/2008 STATUS BEGIN DATE: 02/04/2009

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONTAINMENT LINER: **YES**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

Order# 121435 Job# 277689 836 of 1203

**MAP ID# 120** 

Distance from Property: 0.154 mi. (813 ft.) WNW

Elevation: 593 ft.

#### **FACILITY INFORMATION**

ID#: 78823

NAME: HAYES WELDING

ADDRESS: 5401 WILBARGER ST

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING
BEGIN DATE: 10/15/2007
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 10/22/2007 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 10/15/2007 SIGNATURE NAME & TITLE: GINNY KAMPER, COMP COMP DIR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600244339
NAME: REEDER DISTRIBUTORS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/15/2007

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN603247289

NAME: HAYES WELDING

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: **ORGANIZATION**BEGIN DATE: **10/15/2007** 

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION

NAME: NOT REPORTED
TITLE: NOT REPORTED

ORGANIZATION: HAYES WELDING

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (409) 6592693 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 837 of 1203

ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 208974 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 10/22/2007

INSTALLATION DATE: 10/15/2007 STATUS BEGIN DATE: 01/22/2008

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **YES**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

AST ID #: 208975 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 2 REGISTRATION DATE: 10/22/2007

INSTALLATION DATE: 10/15/2007 STATUS BEGIN DATE: 01/22/2008

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **YES**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 



Order# 121435 Job# 277689 838 of 1203

**MAP ID# 121** 

Distance from Property: 0.154 mi. (813 ft.) NE

Elevation: 639 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 112949

LPST ID: 112949

FACILITY ID: 0018392

NAME: KINDLES FOOD STORE FFP 576

ADDRESS: 4113 MILLER AVE

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 112949

NAME: KINDLES FOOD STORE FFP 576 FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 2/4/98

REPORTED DATE: 1/26/1998 ENTERED DATE: 2/4/1998

PRP INFORMATION

NAME: FFP OPERATING PARTNERS LP ADDRESS: ADDRESS NOT REPORTED

**FORT WORTH TX 76117** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 03/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/21/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL: **STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

839 of 1203

UST COMPARTMENT ID: 106467

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 01/21/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 106466

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

Order# 121435 Job# 277689 840 of 1203

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **01/21/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 106465

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO

Order# 121435 Job# 277689 841 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION
NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

MAP ID# 121

Distance from Property: 0.154 mi. (813 ft.) NE

Elevation: 639 ft.

#### **FACILITY INFORMATION**

ID#: 18392

NAME: KINDLES FOOD STORE FFP 576

ADDRESS: 4113 MILLER AVE

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 09/03/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/17/1986

SIGNATURE NAME & TITLE: **B KLINGSMITH, DIRECTOR** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600664957

NAME: FFP OPERATING PARTNERS LP

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: PARTNERSHIP
BEGIN DATE: 09/03/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1974 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: TOM WENDORF

ORGANIZATION: KINDLES FOOD STORE FFP 576
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 8384877 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 843 of 1203

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **01/21/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 106467

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **01/21/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL



Order# 121435 Job# 277689 844 of 1203

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 106466

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1974 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/21/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 845 of 1203

UST COMPARTMENT ID: 106465

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 122** 

Distance from Property: 0.155 mi. (818 ft.) NE

Elevation: 647 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 116293

LPST ID: 116293

FACILITY ID: 0053594

NAME: DIAMOND SHAMROCK 1200

ADDRESS: 4747 LITTLE RD

ARLINGTON, TX

#### **LEAKING TANK DETAILS**

LPST ID: 116293

NAME: **DIAMOND SHAMROCK 1200**FACILITY LOCATION: **NOT REPORTED** 

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 12/8/04

REPORTED DATE: 9/9/2004 ENTERED DATE: 12/8/2004

PRP INFORMATION

NAME: DIAMOND SHAMROCK REF MKT ADDRESS: ADDRESS NOT REPORTED

**SAN ANTONIO TX 78269** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1989 REGISTRATION DATE: 05/04/1990

TANK CAPACITY (GAL): 10152 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/13/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

 ${\tt EXTERNAL\ DIELECTRIC\ COATING/LAMINATE/TAPE/WRAP, CATHODIC\ PROTECTION\ -\ FACTORY\ INSTALLATION, FRP\ TANK\ OR\ PROTECTION\ -\ FACTORY\ INSTALLATION\ -\ FACTORY\ -\ F$ 

PIPING (NONCORRODIBLE)
EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 847 of 1203

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 106154

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10152

COMPARTMENT RELEASE DETECTION: WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL), SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1989 REGISTRATION DATE: 05/04/1990

TANK CAPACITY (GAL): 10152 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/13/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 106154

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10152

Order# 121435 Job# 277689 848 of 1203

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1989 REGISTRATION DATE: 05/04/1990

TANK CAPACITY (GAL): 10152 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **11/13/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 106153

TANK ID: 2

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10152

COMPARTMENT RELEASE DETECTION: WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL), SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

Order# 121435 Job# 277689 849 of 1203

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1989 REGISTRATION DATE: 05/04/1990

TANK CAPACITY (GAL): 10152 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/13/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

 $\textbf{EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FROM TAPE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION - FACTORY - FACTORY INSTALLATION - FACTORY - FACT$ 

PIPING (NONCORRODIBLE)
EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 106153

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10152

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1989 REGISTRATION DATE: 05/04/1990

TANK CAPACITY (GAL): 10152 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/13/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 106152

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10152

COMPARTMENT RELEASE DETECTION: WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL), SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1989 REGISTRATION DATE: 05/04/1990

TANK CAPACITY (GAL): 10152 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/13/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

Order# 121435 Job# 277689 851 of 1203

#### FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 106152

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10152

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 122** 

Distance from Property: 0.155 mi. (818 ft.) NE

Elevation: 647 ft.

**FACILITY INFORMATION** 

ID#: **53594** 

NAME: SAMS FOOD MART ADDRESS: 4747 LITTLE RD

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 04/01/1989 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 11/21/2014
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 11/18/2014

SIGNATURE NAME & TITLE: JAMES TAYLOR, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603837618

NAME: ARLINGTON VALERO CORPORATION
CONTACT ADDRESS: 601 E ASH LN APT 6204
EULESS TX 76039

TYPE: CORPORATION/COMPANY

BEGIN DATE: 03/09/2011

CONTACT ROLE: OWNOPRCON
CONTACT NAME: NICK DATOO
CONTACT TITLE: NOT REPORTED

ORGANIZATION: ARLINGTON VALERO CORPORATION

PHONE: (214) 7148199 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN603837618

NAME: ARLINGTON VALERO CORPORATION
CONTACT ADDRESS: 601 E ASH LN APT 6204

EULESS TX 76039

TYPE: CORPORATION/COMPANY

BEGIN DATE: 03/09/2011

CONTACT ROLE: OWNOPRCON
CONTACT NAME: NICK DATOO
CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION

NAME: NICK DATOO

TITLE: MGR

ORGANIZATION: SAMS FOOD MART

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 5130717 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 853 of 1203

ORGANIZATION: ARLINGTON VALERO CORPORATION

PHONE: (214) 7148199 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 106109 SIGNATURE DATE: 06/20/2012

SIGNATURE NAME & TITLE: NICK DATOO, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106108
SIGNATURE DATE: 07/18/2011

SIGNATURE NAME & TITLE: SHIRIN DATOO, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106107
SIGNATURE DATE: 03/07/2011

SIGNATURE NAME & TITLE: SHIRIN DATOO, PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106106
SIGNATURE DATE: 05/27/2010

SIGNATURE NAME & TITLE: RAMAN LAL, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106105
SIGNATURE DATE: 05/26/2010

SIGNATURE NAME & TITLE: RAMAN LAL, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106104
SIGNATURE DATE: 01/16/2009

 ${\tt SIGNATURE\ NAME\ \&\ TITLE:\ \textbf{SARFRAZ\ RABBANI,\ PRESIDENT}}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106103
SIGNATURE DATE: 01/15/2009

 ${\tt SIGNATURE\ NAME\ \&\ TITLE:\ \textbf{SARFRAZ\ RABBANI,\ PRESIDENT}}$ 

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106102
SIGNATURE DATE: 07/21/2008

SIGNATURE NAME & TITLE: MOHAMED DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106101
SIGNATURE DATE: 07/21/2007

Order# 121435 Job# 277689 854 of 1203

SIGNATURE NAME & TITLE: MOHAMED DOSSANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106100
SIGNATURE DATE: 07/24/2006

SIGNATURE NAME & TITLE: MOHAMED DOSSANI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106099
SIGNATURE DATE: 06/18/2005

SIGNATURE NAME & TITLE: MOHAMAD DOSSANI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106098
SIGNATURE DATE: 02/08/2005

SIGNATURE NAME & TITLE: MOHAMED DOSSANI, PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106097
SIGNATURE DATE: 08/20/2004

SIGNATURE NAME & TITLE: MICHAEL UMPHRESS, O&E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106096
SIGNATURE DATE: 08/25/2003

SIGNATURE NAME & TITLE: MICHAEL UMPHRESS, O & E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106095
SIGNATURE DATE: 08/20/2002

SIGNATURE NAME & TITLE: MICHAEL UMPHRESS, O & E SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106094
SIGNATURE DATE: 01/12/2001

SIGNATURE NAME & TITLE: BILLY C HUNT, O&E SPECIALIST

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 26583

APPLICATION RECEIVED DATE: 10/09/2014

SCHEDULE CONSTRUCTION DATE: 11/10/2014

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REMOVAL OF 3 USTS AND ASSOCIATED PIPING AND DISPENSERS.

NOTIFICATION CONSTRUCTION ID: 11432
APPLICATION RECEIVED DATE: 05/13/2003
SCHEDULE CONSTRUCTION DATE: 05/12/2003

Order# 121435 Job# 277689 855 of 1203

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1989 REGISTRATION DATE: 05/04/1990

TANK CAPACITY (GAL): 10152 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/13/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL: **FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR

PIPING (NONCORRODIBLE)
EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 106154

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10152

COMPARTMENT RELEASE DETECTION: WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL), SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1989 REGISTRATION DATE: 05/04/1990



TANK CAPACITY (GAL): 10152 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/13/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

 $\textbf{EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR \\ \textbf{COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FROM TAPE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION - FACTORY - FACTORY INSTALLATION - FACTORY - FACT$ 

PIPING (NONCORRODIBLE)
EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 106154

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10152

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1989 REGISTRATION DATE: 05/04/1990

TANK CAPACITY (GAL): 10152 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/13/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

GeoSearch www.geo-search.com 888-396-0042

#### **TANK DETAILS**

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 106153

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10152

COMPARTMENT RELEASE DETECTION: WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL), SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1989 REGISTRATION DATE: 05/04/1990

TANK CAPACITY (GAL): 10152 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/13/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, FRP TANK OR

GeoSearch www.geo-search.com 888-396-0042

#### PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 106153

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10152

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1989 REGISTRATION DATE: 05/04/1990

TANK CAPACITY (GAL): 10152 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/13/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 859 of 1203

UST COMPARTMENT ID: 106152

TANK ID: 3

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10152

COMPARTMENT RELEASE DETECTION: WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL), SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1989 REGISTRATION DATE: 05/04/1990

TANK CAPACITY (GAL): 10152 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/13/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 106152

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10152

Order# 121435 Job# 277689 860 of 1203

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

# Dry Cleaner Registration Database (DCR)

**MAP ID# 123** 

Distance from Property: 0.155 mi. (818 ft.) SW

Elevation: 700 ft.

**FACILITY INFORMATION** 

REGISTRATION #: RN104002746

CUSTOMER #: NOT REPORTED

NAME: TREE POINT CLEANERS

ADDRESS: 5071 LITTLE RD STE 140

ARLINGTON, TX 76017-0580

ACCOUNT NUMBER: NOT REPORTED PRINCIPAL NAME: NOT REPORTED PHONE NUMBER: NOT REPORTED SITE TYPE: FACILITY REGISTRATION

FISCAL YEAR: FY2008

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 120 GALLONS

FISCAL YEAR: FY2007

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 120 GALLONS

FISCAL YEAR: FY2006

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 120 GALLONS

FISCAL YEAR: FY2005

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 122 GALLONS

FISCAL YEAR: FY2004

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 0 GALLONS

**Back to Report Summary** 

# Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 123** 

Distance from Property: 0.155 mi. (818 ft.) SW

Elevation: 700 ft.

PROGRAM ID: **T1963**RN NUMBER: **RN104663455** 

NAME: TREEPOINT PLAZA SHOPPING CENTER ARLINGTON

ADDRESS: 5071 LITTLE RD

ARLINGTON, TX 76017

STATUS: **INACTIVE**STATUS DATE: 1/20/2005

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

**Back to Report Summary** 

**MAP ID# 123** 

Distance from Property: 0.155 mi. (818 ft.) SW

Elevation: 700 ft.

#### **FACILITY INFORMATION**

ID#: 80048

NAME: MURPHY EXPRESS 8525 ADDRESS: 5071 LITTLE SCHOOL RD

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 08/20/2009

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

#### **APPLICATION INFORMATION:**

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 09/21/2009 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 09/14/2009 SIGNATURE NAME & TITLE: KEVIN ROUSSEL, MGR FIELD CONST

ENFORCEMENT ACTION DATE: NOT REPORTED

#### **OWNER**

OWNER NUMBER: CN601187875 NAME: MURPHY OIL USA INC

CONTACT ADDRESS: 200 E PEACH ST

EL DORADO AR 71730

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/20/2009 CONTACT ROLE: OWNCON

CONTACT NAME: BRAD WEINISCHKE

CONTACT TITLE: ENV COORD

ORGANIZATION: MURPHY OIL USA INC

PHONE: (870) 8816854 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

#### **OPERATOR**

OPERATOR NUMBER: CN601187875 NAME: MURPHY OIL USA INC

CONTACT ADDRESS: 4734 SANFORD ST

**METAIRIE LA 70006** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/20/2009 CONTACT ROLE: OPRCON

CONTACT NAME: RUSSELL S COLVIN CONTACT TITLE: NOT REPORTED

#### **CONTACT INFORMATION**

NAME: NOT REPORTED TITLE: NOT REPORTED

ORGANIZATION: MURPHY EXPRESS 8525

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 5619244 0

ORGANIZATION: MURPHY OIL USA INC

PHONE: **(504) 5612280 0** FAX: **(504) 5612332** 

EMAIL: KEVIN\_ROUSSEL@MURPHYOILCORP.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 308901 SIGNATURE DATE: 09/06/2018

SIGNATURE NAME & TITLE: KRYSTAL TERRELL, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 291325
SIGNATURE DATE: 09/05/2017

SIGNATURE NAME & TITLE: KRYSTAL TERRELL, LICNESE & PERMITS SP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 274434
SIGNATURE DATE: 09/01/2016

SIGNATURE NAME & TITLE: ANNA W JONES, HSSE COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 257547
SIGNATURE DATE: 09/08/2015

SIGNATURE NAME & TITLE: ANNA W JONES, HSSE COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 240138
SIGNATURE DATE: 08/08/2014

SIGNATURE NAME & TITLE: ANNA W JONES, HSSE COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 224031
SIGNATURE DATE: 08/23/2013

 ${\tt SIGNATURE\ NAME\ \&\ TITLE:\ } \textbf{ANNA\ W\ JONES,\ HSSE\ COORDINATOR}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 216810
SIGNATURE DATE: 08/14/2012

SIGNATURE NAME & TITLE: ANNA W JONES, SR ENV SPECIALISLT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 216809
SIGNATURE DATE: 08/22/2011

SIGNATURE NAME & TITLE: ANNA W JONES, SR ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 216808
SIGNATURE DATE: 08/03/2010

SIGNATURE NAME & TITLE: ANNA W JONES, SR ENV SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 216807
SIGNATURE DATE: 09/14/2009

SIGNATURE NAME & TITLE: KEVIN ROUSSEL, MGR FIELD CONST

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 22274

APPLICATION RECEIVED DATE: 06/12/2009

SCHEDULE CONSTRUCTION DATE: 06/12/2009

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/20/2009 REGISTRATION DATE: 09/21/2009

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 08/20/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 184736

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT

 ${\tt SPILL\ CONTAINER/BUCKET/SUMP, DELIVERY\ SHUT-OFF\ VALVE, FLOW\ RESTRICTOR\ VALUE, ALARM\ (SET @<=90\%)\ W3A\ OR\ 3B}$ 

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 



Order# 121435 Job# 277689 866 of 1203

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/20/2009 REGISTRATION DATE: 09/21/2009

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 08/20/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 184737

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 867 of 1203

TANK ID: 3 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 08/20/2009 REGISTRATION DATE: 09/21/2009

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 08/20/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 184738

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 08/20/2009 REGISTRATION DATE: 09/21/2009

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 08/20/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 868 of 1203

PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 184739

TANK ID: 3

COMPARTMENT LETTER: B
SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

 $\label{thm:containment} \begin{tabular}{l} {\tt SPILL CONTAINMENT AND OVERFILL PREVENTION:} & {\tt TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B AND ADDRESS OF ADDR$ 

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 869 of 1203

OWNER INFORMATION

**MAP ID# 124** 

Distance from Property: 0.156 mi. (824 ft.) W

Elevation: 617 ft.

FACILITY INFORMATION

REGISTRATION#: 20637 EPA ID: NOT REPORTED NAME: FRANKE FILLING INC
TNRCC ID #: 7090 ADDRESS: PO BOX 8209

NAME: FRANKE FILLING FORT WORTH, TX 76124

ADDRESS: **5960 TENSION DR** PHONE: **1-817-4575755** 

FORT WORTH, TX 76112

CONTACT: **JOE FRANKE** PHONE: **817-4575755** 

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THIS FACILITY WAS REGISTERED PRIOR

TO1994 AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED

WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/23/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 111192

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: PLANT PRODUCTION RESFUSE MAINLY CARDBOARD PLASTIC WRAP, BANDING

MATERIALS AND ST

WASTE ID: 111193

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: SUPPLEMENTAL PLANT PRODUCTION REFUSE: FLOOR SWEEPINGS, JUNK

METAL AND PLASTIC P
WASTE ID: 111194

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: PLANT OFFICE REFUSE: PAPER, FOOD PACKAGING GLASS, CANS (MOST ARE

RECYCLED), PLAS WASTE ID: 111195

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: OIL-WATER EMULSION GENERATED BY CHANGING OIL IN OUR VACUUM PUMPS.

**PROCESSED OFF** 

WASTE ID: 111196

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: EMPTY METAL CONTAINERS: MAINLY CLEANED OUT PAINT CANS FROM OUR

**COATING OPERATIO** 

WASTE ID: 111197

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NON-HAZARDOUS SAND BLASTING WASTE: WE BLAST CYLINDERS WITH STEEL

SHOT. THE WAS

WASTE ID: 111198

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: WOOD DEBRIS: MAINLY WOODEN PALLET SCRAPS AND JUNK PALLETS

**GENERATED FROM SHIPME** 

WASTE ID: 985

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 986

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 987

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 



**MAP ID# 124** 

Distance from Property: 0.171 mi. (903 ft.) W

Elevation: 617 ft.

**FACILITY INFORMATION** 

NAME: TENSION ENVELOPE CORPORATION

REGISTRATION#: **32091** EPA ID: **TXD081089153** TNRCC ID #: **9634** 

ADDRESS: 5900 TENSION DR

OWNER INFORMATION

NAME: **TENSION ENVELOPE** 

FORT WORTH, TX 76112

ADDRESS: 5900 TENSION DR

PHONE: 1-817-4515811

FORT WORTH, TX 76112

CONTACT: RON DENNIS
PHONE: 817-4515811

BUSINESS DESCRIPTION: NOT REPORTED
INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 04/22/2009

<u>ACTIVITIES</u>

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 123413

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE ABSORBANTS / CLEANUP OF SPILLS / 1-1-94. RECEIVED REQUEST TO

**INACTIVATE 4** 

WASTE ID: 124742

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: INK & INK SOLVENTS/PRESS WASH & CLEANUP OF EQUIPMENT/1-1-94. RECEIVED

REQUEST TO

WASTE ID: 124744

WASTE CODE STATUS: INACTIVE

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: STILL BOTTOMS OF HALOGENATED SOLVENTS/DISTILLING SOLVENT/1-30-94.

RECEIVED REQUE
WASTE ID: 280801

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 23347

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 125** 

Distance from Property: 0.16 mi. (845 ft.) SW

Elevation: 645 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 72261 EPA ID: NOT REPORTED NAME: GRAHAMS GARAGE

TNRCC ID #: 26703 ADDRESS: 4609 MILLER AVE

NAME: GRAHAMS GARAGE FORT WORTH, TX 76119

ADDRESS: 4609 MILLER AVE PHONE: 1-817-5340293

**FORT WORTH, TX 76119** 

CONTACT: PAUL GRAHAM PHONE: 817-5340293

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THIS FACILITY WAS REGISTERED PRIOR

TO1994 AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/23/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE NO RECORDS

**Back to Report Summary** 

Order# 121435 Job# 277689 874 of 1203

**MAP ID# 126** 

Distance from Property: 0.16 mi. (845 ft.) E

Elevation: 580 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 115944

LPST ID: 115944

FACILITY ID: 0040256

NAME: **DIAMOND SHAMROCK 212**ADDRESS: **6400 E ROSEDALE ST FORT WORTH, TX** 

**LEAKING TANK DETAILS** 

LPST ID: 115944

NAME: **DIAMOND SHAMROCK 212**FACILITY LOCATION: **NOT REPORTED** 

PRIORITY CODE: 2.6 - IMPACTED GW DISCHARGE TO SW USED BY HUMANENDGR SPEC LT 500F

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 4/20/04

REPORTED DATE: 8/6/2003 ENTERED DATE: 4/20/2004

PRP INFORMATION

NAME: DIAMOND SHAMROCK REFINING CORPORATION

ADDRESS: ADDRESS NOT REPORTED
SAN ANTONIO TX 78269

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/01/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12077 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/29/2004

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

 ${\tt CATHODIC\ PROTECTION\ -\ FACTORY\ INSTALLATION, COMPOSITE\ TANK\ (STEEL\ W/FRP\ EXTERNAL\ LAMINATE)}$ 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 875 of 1203

UST COMPARTMENT ID: 103460

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12077

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1B NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 7895 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **02/01/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 103455

TANK ID: 1B

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 7895

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

Order# 121435 Job# 277689 876 of 1203

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/01/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12077 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **01/29/2004** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FACTORY INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 103459

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12077

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 877 of 1203

TANK ID: 2B NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12077 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/01/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 103454

TANK ID: 2B

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12077

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: **3A** NUMBER OF COMPARTMENTS: **1**INSTALLATION DATE: **02/01/1987** REGISTRATION DATE: **05/08/1986** 

TANK CAPACITY (GAL): 12077 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **01/29/2004** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

Order# 121435 Job# 277689 878 of 1203

#### **COMPOSITE**

CORROSION PROTECTION:

CATHODIC PROTECTION - FACTORY INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 103458

TANK ID: 3A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12077

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: **3B**NUMBER OF COMPARTMENTS: **1**INSTALLATION DATE: **01/01/1975**REGISTRATION DATE: **05/08/1986** 

TANK CAPACITY (GAL): 7895 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/01/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 879 of 1203

UST COMPARTMENT ID: 103453

TANK ID: 3B

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 7895

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12087 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **01/29/2004** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FACTORY INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 103457

TANK ID: 4A

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12087

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 



MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4B NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 5014 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **02/01/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 103456

TANK ID: 4B

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5014

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 126** 

Distance from Property: 0.16 mi. (845 ft.) E

Elevation: 580 ft.

**FACILITY INFORMATION** 

ID#: **40256** 

NAME: DIAMOND SHAMROCK 0212

ADDRESS: 6400 E ROSEDALE ST

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 09/01/1988 STATUS: INACTIVE EXEMPT STATUS: NO

RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS:  $oldsymbol{0}$  NUMBER OF ACTIVE ABOVEGROUND TANKS:  $oldsymbol{0}$ 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/06/1986

SIGNATURE NAME & TITLE: GARY JORDAN, MGR. ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN602277386 NAME: CST SERVICES LLC

CONTACT ADDRESS: PO BOX 696000

**SAN ANTONIO TX 78269** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/11/2002

CONTACT ROLE: OWNCON

CONTACT NAME: KENT HAMEL

CONTACT TITLE: COORDINATOR

ORGANIZATION: DIAMOND SHAMROCK REFINING AND MARKETING COMPANY

PHONE: (210) 3454670 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN602277386

NAME: CST SERVICES LLC

CONTACT ADDRESS: PO BOX 696000

SAN ANTONIO TX 78269

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/11/2002
CONTACT ROLE: OPRCON
CONTACT NAME: KENT HAMEL
CONTACT TITLE: COORD

CONTACT INFORMATION

NAME: MICHAEL UMPHRESS
TITLE: O&E SPECIALIST

ORGANIZATION: DIAMOND SHAMROCK 0212

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (214) 9021632 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: DIAMOND SHAMROCK REFINING AND MARKETING COMPANY

PHONE: (210) 3454670 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 108120 SIGNATURE DATE: 08/25/2003

SIGNATURE NAME & TITLE: MICHAEL UMPHRESS, O & E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 108119
SIGNATURE DATE: 10/11/2002

SIGNATURE NAME & TITLE: JOHN WILLRODT, NOT REPORTED

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 108118
SIGNATURE DATE: 06/26/2002

SIGNATURE NAME & TITLE: BILLY HUNT, O & E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 108117
SIGNATURE DATE: 01/12/2001

SIGNATURE NAME & TITLE: BILLY C HUNT, O&E SPECIALIST

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 10983

APPLICATION RECEIVED DATE: 12/15/2003

SCHEDULE CONSTRUCTION DATE: 01/08/2004

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/01/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12077 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/29/2004

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FACTORY INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG



CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 103460

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12077

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1B NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 7895 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **02/01/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 103455

TANK ID: 1B

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

Order# 121435 Job# 277689 885 of 1203

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 7895

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/01/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12077 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/29/2004

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FACTORY INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 103459

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12077

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

Order# 121435 Job# 277689 886 of 1203

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: **2B** NUMBER OF COMPARTMENTS: **1**INSTALLATION DATE: **01/01/1975** REGISTRATION DATE: **05/08/1986** 

TANK CAPACITY (GAL): 12077 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/01/1987

STATES. REMOVED FROM SKEEDS

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 103454

TANK ID: 2B

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12077

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3A NUMBER OF COMPARTMENTS: 1

Order# 121435 Job# 277689 887 of 1203

INSTALLATION DATE: 02/01/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12077 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **01/29/2004**INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED** 

TANK DESIGN SINGLE WALL: YES

TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: YES

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FACTORY INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 103458

TANK ID: 3A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12077

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: **3B** NUMBER OF COMPARTMENTS: **1**INSTALLATION DATE: **01/01/1975** REGISTRATION DATE: **05/08/1986** 

TANK CAPACITY (GAL): 7895 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/01/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

Order# 121435 Job# 277689 888 of 1203

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 103453

TANK ID: 3B

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 7895

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12087 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/29/2004

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FACTORY INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES



Order# 121435 Job# 277689 889 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 103457

TANK ID: 4A

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12087

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4B NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 5014 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/01/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 103456

TANK ID: 4B

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

Order# 121435 Job# 277689 890 of 1203

CAPACITY (GAL): 5014

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

### Dry Cleaner Registration Database (DCR)

**MAP ID# 127** 

Distance from Property: 0.161 mi. (850 ft.) NNW

Elevation: 598 ft.

#### **FACILITY INFORMATION**

REGISTRATION #: RN103054722 CUSTOMER #: CN604786202 NAME: FAMOUS CLEANERS

ADDRESS: 4388 W GREEN OAKS BLVD STE 109

ARLINGTON, TX 76016

ACCOUNT NUMBER: 24,007,235
PRINCIPAL NAME: TRANG SIDELL
PHONE NUMBER: NOT REPORTED

SITE TYPE: DROP STATION REGISTRATION

FISCAL YEAR: FY2018
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2018
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED

Order# 121435 Job# 277689 892 of 1203

# Dry Cleaner Registration Database (DCR)

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2015
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2015
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2014

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2013
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2012
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2010
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2009

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2004
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 128** 

Distance from Property: 0.162 mi. (855 ft.) S

Elevation: 641 ft.

### **FACILITY INFORMATION**

ID#: 63795

NAME: LAND SPAN

ADDRESS: 6629 ANGLIN DR

FOREST HILL, TX 76140

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING
BEGIN DATE: 11/02/1992
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 10/26/1992 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 10/20/1992 SIGNATURE NAME & TITLE: CHARLEY R ALEXNDER, VICE PRESIDENT

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600822795

NAME: WATKINS TERMINALS FOR LAND SPAN

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: **ORGANIZATION**BEGIN DATE: **11/02/1992** 

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 14878

APPLICATION RECEIVED DATE: 11/04/2002

SCHEDULE CONSTRUCTION DATE: 12/04/2002

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**CONTACT INFORMATION** 

NAME: CHARLEY ALEXANDER

TITLE: NOT REPORTED

ORGANIZATION: LAND SPAN INC

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (863) 6881102 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 894 of 1203

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/01/1974 REGISTRATION DATE: 10/26/1992

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/07/2002

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 154301

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,FLOW

RESTRICTOR VALUE
PIPING SYSTEMS
MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 129** 

Distance from Property: 0.163 mi. (861 ft.) SSW

Elevation: 615 ft.

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 39688 EPA ID: TXD988021457 NAME: ELDER OIL TOOLS
TNRCC ID #: 16182 ADDRESS: NOT REPORTED

NAME: ARLINGTON OIL TOOLS

ADDRESS: 4705 MARTIN ST PHONE: NOT REPORTED

FORT WORTH, TX 76119

CONTACT: **GREG GIPS** PHONE: **512-5642201** 

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: MERGED

AMOUNT OF WASTE GENERATED: LARGE QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/04/2010

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 43109

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 43110

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 43111

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

Order# 121435 Job# 277689 896 of 1203

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 43112

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 43113

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 43114

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 43115

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 43116

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 43117

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 43118

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 147038

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 147039

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES



Order# 121435 Job# 277689 897 of 1203

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 129** 

Distance from Property: 0.163 mi. (861 ft.) SSW

Elevation: 615 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 76571 EPA ID: TXD988021457

NAME: ARLINGTON OIL TOOLS

TNRCC ID #: 30886

ADDRESS: NOT REPORTED

NAME: ARLINGTON OIL TOOLS
ADDRESS: 4705 MARTIN ST

PHONE: NOT REPORTED

FORT WORTH, TX 76119

CONTACT: DALE ZUCK

PHONE: **512-5642201** 

BUSINESS DESCRIPTION: NOT REPORTED
INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: MERGED

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/04/2010

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 59531

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: **59532** 

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: **59533** 

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

Order# 121435 Job# 277689 899 of 1203

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 129** 

Distance from Property: 0.163 mi. (861 ft.) SSW

Elevation: 615 ft.

**FACILITY INFORMATION** 

NAME: YELLOW ENGINE SERVICE

REGISTRATION#: 78266 EPA ID: TXD988072039

IVAME. ILLEGA ENGINE SERVICE

TNRCC ID #: 32464

ADDRESS: 4705 MARTIN ST

OWNER INFORMATION

NAME: YELLOW ENGINE SERVICE

FORT WORTH, TX 76119

ADDRESS: 4705 MARTIN ST

PHONE: 1-817-4293208

FORT WORTH, TX 76119

CONTACT: JOHN RUMMEL

PHONE: 817-4293208

BUSINESS DESCRIPTION: HEAVY DUTY REPAIR
INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/04/2010

<u>ACTIVITIES</u>

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 99902

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: GENERAL MAINTENANCE ON DIESEL ENGINES.

WASTE ID: 99900

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: PARTS WASHING DURING ENGINE REBUILD.

WASTE ID: 147399

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

Order# 121435 Job# 277689 901 of 1203

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 147400

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 147401

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 147402

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 147403

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 147404

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 147405

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 147406

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 147407

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: ARLINGTON OIL TOOLS WASTE

WASTE ID: 147408

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 147409

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 147410

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

# Leaking Petroleum Storage Tanks (LPST)

**MAP ID# 130** 

Distance from Property: 0.165 mi. (871 ft.) NW

Elevation: 644 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 099171

LPST ID: 099171

FACILITY ID: 0067449

NAME: STOP SHOP GROCERY 3
ADDRESS: 3303 E BERRY ST
FORT WORTH, TX

### **LEAKING TANK DETAILS**

LPST ID: 099171

NAME: STOP SHOP GROCERY 3
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 6/7/91

REPORTED DATE: 5/28/1991 ENTERED DATE: 6/7/1991

PRP INFORMATION

NAME: NGUYEN, TUYEN C

ADDRESS: ADDRESS NOT REPORTED
FORT WORTH TX 76117

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

NAME: DEEPESH SHRESTHA

PHONE: (214) 8028943 0

ORGANIZATION: STOP & SHOP

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TITLE: PRES

**MAP ID# 130** 

Distance from Property: 0.165 mi. (871 ft.) NW

Elevation: 644 ft.

**FACILITY INFORMATION** 

ID#: 67449

NAME: STOP & SHOP

ADDRESS: 3303 E BERRY ST

FORT WORTH, TX 76105

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 08/01/1987

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 06/25/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 06/24/2018 SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRESIDENT

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603721937

NAME: SAI MJD INC

CONTACT ADDRESS: PO BOX 541895

**GRAND PRAIRIE TX 75054** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/25/2010

CONTACT ROLE: OWNOPRCON

CONTACT NAME: DEEPESH SHRESTHA

CONTACT TITLE: PRES ORGANIZATION: SAI MJD INC PHONE: (214) 8028943 0 FAX: NOT REPORTED

EMAIL: ATITSBOOK@GMAIL.COM

**OPERATOR** 

OPERATOR NUMBER: CN603721937

NAME: SAI MJD INC

CONTACT ADDRESS: PO BOX 541895

**GRAND PRAIRIE TX 75054** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/25/2010

CONTACT ROLE: OWNOPRCON

CONTACT NAME: DEEPESH SHRESTHA

CONTACT TITLE: PRES



905 of 1203

ORGANIZATION: SAI MJD INC PHONE: (214) 8028943 0 FAX: NOT REPORTED

EMAIL: ATITSBOOK@GMAIL.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 305793 SIGNATURE DATE: 06/24/2018

SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 288441
SIGNATURE DATE: 06/16/2017

SIGNATURE NAME & TITLE: DEENESH SHRESTHA, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 271312
SIGNATURE DATE: 06/18/2016

SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 254664
SIGNATURE DATE: 06/25/2015

SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 238169
SIGNATURE DATE: 06/25/2014

SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 220648
SIGNATURE DATE: 05/21/2013

SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173191
SIGNATURE DATE: 05/30/2012

 ${\tt SIGNATURE\ NAME\ \&\ TITLE:\ } \textbf{DEEPESH\ SHRESTHA}, \textbf{PRESIDENT}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173190
SIGNATURE DATE: 06/14/2011

 ${\tt SIGNATURE\ NAME\ \&\ TITLE:\ } \textbf{DEEPESH\ SHRESTHA}, \textbf{PRES}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173189
SIGNATURE DATE: 07/22/2010



Order# 121435 Job# 277689 906 of 1203

SIGNATURE NAME & TITLE: DEEPESH SHRESTHA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173188
SIGNATURE DATE: 03/24/2009

SIGNATURE NAME & TITLE: NAEEM INAYAT, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173187
SIGNATURE DATE: 03/15/2008

SIGNATURE NAME & TITLE: NAEEM INAYAT, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173186
SIGNATURE DATE: 03/22/2007

SIGNATURE NAME & TITLE: NAEEM INAYAT, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173185
SIGNATURE DATE: 01/22/2006

SIGNATURE NAME & TITLE: NAEEM INAYAT, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173184
SIGNATURE DATE: 03/10/2005

SIGNATURE NAME & TITLE: NAEEM INAYAT, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173183
SIGNATURE DATE: 03/02/2004

SIGNATURE NAME & TITLE: NAEEM INAYAT, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173182
SIGNATURE DATE: 03/01/2003

SIGNATURE NAME & TITLE: NAEEM INAYA, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173181
SIGNATURE DATE: 03/11/2002

SIGNATURE NAME & TITLE: NAEEM INAYAT, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173180
SIGNATURE DATE: 03/22/2001

SIGNATURE NAME & TITLE: NAEEM INAYAT, OWNER

FILING STATUS: INITIAL

Order# 121435 Job# 277689 907 of 1203

REGISTRATION FLAG: YES

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 11/30/1995

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 08/31/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 172818

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 11/30/1995

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 08/31/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 172819

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 11/30/1995

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 08/31/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:



Order# 121435 Job# 277689 909 of 1203

#### **COMPOSITE**

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 172820

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 910 of 1203

**MAP ID# 131** 

TNRCC ID #: 12954

Distance from Property: 0.167 mi. (882 ft.) W

Elevation: 597 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 35951 EPA ID: NOT REPORTED NAME: ACQUISITIONS UNLIMITED INC

ADDRESS: 5839 E ROSEDALE ST

NAME: ACQUISITIONS UNLIMITED

FORT WORTH, TX 76112

ADDRESS: 5839 E ROSEDALE ST

PHONE: 1-817-4579050

FORT WORTH, TX 76112

CONTACT: BEN JONES PHONE: 817-7154484

BUSINESS DESCRIPTION: DIVERSION OF OBSOLETE COMPUTERS

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT A HW GENERATOR GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 02/25/2013

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 35130

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

Back to Report Summary

Order# 121435 Job# 277689 911 of 1203

**MAP ID# 132** 

Distance from Property: 0.167 mi. (882 ft.) W

Elevation: 632 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 23709 NAME: AMERIA TECH EPA ID: NOT REPORTED

ADDRESS: 6024 DALLAS AVE

TNRCC ID #: 34374

FORT WORTH, TX 76112

NAME: AMERIA TECH

ADDRESS: 6024 DALLAS AVE

PHONE: 1-817-4464555

FORT WORTH, TX 76112

CONTACT: DAN HUNT PHONE: 817-4464555

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: YES WASTE RECEIVER: NO WASTE TRANSPORTER: NO TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 01/10/2002

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 63832

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: MINERAL SPIRITS

Back to Report Summary

912 of 1203

**MAP ID# 132** 

Distance from Property: 0.194 mi. (1,024 ft.) W

Elevation: 632 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 31120 EPA ID: NOT REPORTED NAME: MACHINED PARTS CORPORATION

TNRCC ID #: 8679 ADDRESS: PO BOX 8007

NAME: MACHINED PARTS FORT WORTH, TX 76124

ADDRESS: 5929 S HAMPSHIRE BLVD PHONE: 1-817-4575060

FORT WORTH, TX 76112

CONTACT: W E VERCHER PHONE: 817-4575060

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 10/17/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 16142

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

Back to Report Summary

Order# 121435 Job# 277689 913 of 1203

**MAP ID# 132** 

Distance from Property: 0.167 mi. (882 ft.) W

Elevation: 632 ft.

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 80003 EPA ID: NOT REPORTED NAME: AMERIA TECH
TNRCC ID #: 34373 ADDRESS: NOT REPORTED

NAME: AMERIA TECH

ADDRESS: 6024 DALLAS AVE PHONE: NOT REPORTED

FORT WORTH, TX 76112

CONTACT: NOT REPORTED PHONE: NOT REPORTED

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THIS FACILITY WAS REGISTERED PRIOR

TO1994 AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: MERGED

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/04/2010

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE NO RECORDS

**Back to Report Summary** 

Order# 121435 Job# 277689 914 of 1203

# Leaking Petroleum Storage Tanks (LPST)

**MAP ID# 132** 

Distance from Property: 0.194 mi. (1,024 ft.) W

Elevation: 632 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 099459

LPST ID: 099459

FACILITY ID: 0025478

NAME: MACHINED PARTS CORP ADDRESS: 5929 S HAMPSHIRE BLVD

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 099459

NAME: MACHINED PARTS CORP FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 7/10/91

REPORTED DATE: **7/10/1991**ENTERED DATE: **7/10/1991** 

**PRP INFORMATION** 

NAME: HILITE INDUSTRIES

ADDRESS: ADDRESS NOT REPORTED
FORT WORTH TX 76112

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 132** 

Distance from Property: 0.194 mi. (1,024 ft.) W

Elevation: 632 ft.

### **FACILITY INFORMATION**

ID#: 25478

NAME: MACHINED PARTS

ADDRESS: 5929 S HAMPSHIRE BLVD

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: INDUST/MFG/CHEM PLANT

BEGIN DATE: 10/09/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/16/1986

SIGNATURE NAME & TITLE: ROY HUNT, V PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600298806

NAME: MACHINED PARTS CORPORATION

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION BEGIN DATE: 10/09/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600298806 NAME: MACHINED PARTS CORPORATION

CONTACT ADDRESS: PO BOX 8007

FORT WORTH TX 76124

TYPE: ORGANIZATION BEGIN DATE: 10/09/1986 CONTACT ROLE: OPRCON

CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

### **CONTACT INFORMATION**

NAME: NOT REPORTED TITLE: NOT REPORTED

ORGANIZATION: MACHINED PARTS CORPORATION MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4575060 0

916 of 1203 

ORGANIZATION: MACHINED PARTS CORPORATION

PHONE: (817) 4575060 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

#### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1980 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/01/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 80284

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 917 of 1203

ABOVEGROUND STORAGE TANK INFORMATION
NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

**MAP ID# 133** 

Distance from Property: 0.168 mi. (887 ft.) SSW

Elevation: 650 ft.

**FACILITY INFORMATION** 

ID#: 81353

NAME: ALBERTSONS

ADDRESS: HWY 287

ARLINGTON, TX 76001

COUNTY: TARRANT

REGION: 4

TYPE: NOT REPORTED

BEGIN DATE: NOT REPORTED

STATUS: **PENDING**EXEMPT STATUS: **NO**RECORDS OFF-SITE: **NO** 

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: NOT REPORTED SIGNATURE DATE ON EARLIEST REGISTRATION FORM: NOT REPORTED

SIGNATURE NAME & TITLE: SIGNATURE NAME NOT REPORTED, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603095720 NAME: ALBERTSONS LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/01/2011

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 21788

APPLICATION RECEIVED DATE: 03/21/2002

SCHEDULE CONSTRUCTION DATE: 04/20/2002

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

CONTACT INFORMATION

NAME: NOT REPORTED
TITLE: NOT REPORTED

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 919 of 1203

### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

# Brownfields Management System (BF)

**MAP ID# 134** 

Distance from Property: 0.168 mi. (887 ft.) NE

Elevation: 654 ft.

SITE INFORMATION

ID#: 164381

NAME: MULTICULTURAL WESTERN HERITAGE MUSEUM

ADDRESS: 3520 E. BERRY ST.

FORT WORTH, TX 76105

TYPE FUNDING: HAZARDOUS

PREDOMINANT PAST USE (ACREAGE):

GREENSPACE: RESIDENTIAL: COMMERCIAL: INDUSTRIAL: NOT REPORTED 2.3 NOT REPORTED

FUTURE USE (ACREAGE):

GREENSPACE: RESIDENTIAL: COMMERCIAL: INDUSTRIAL: NOT REPORTED NOT REPORTED NOT REPORTED NOT REPORTED

PROPERTY HIGHLIGHT:

**NOT REPORTED** 

PROPERTY SIZE (Acres): 2.3

CURRENT OWNER: NATIONAL COWBOYS OF COLOR MUSEUM

PROPERTY DESCRIPTION/ FORMER USE:

THE PROPERTY IS CURRENTLY UNOCCUPIED WITH A VACANT BUILDING ASSOCIATED WITH THE PAST USE OF A GROCERY STORE. ACCORDING TO THE TARRANT APPRAISAL DISTRICT, THE BUILDING WAS CONSTRUCTED IN 1966 AND HAS HAD THREE OWNERS. PRIOR TO 1966, THE PROPERTY APPEARS TO HAVE BEEN RESIDENTIAL OR AGRICULTURAL.

CONTAMINATE(S): ASBESTOS

CONTAMINATE(S) CLEANED UP: NOT REPORTED

MEDIA(S) AFFECTED: **NOT REPORTED**MEDIA(S) CLEANED UP: **NOT REPORTED** 

TYPE OF BROWNFIELD GRANT: ASSESSMENT

ENVIRONMENTAL ASSESSMENT ACTIVITY: PHASE I ENVIRONMENTAL ASSESSMENT

ASSESSMENT START DATE: 4/18/2013 0:00
ASSESSMENT COMPLETION DATE: 7/9/2013 0:00

CLEANUP REQUIRED: YES

STATE & TRIBAL ENROLLMENT ID: NOT REPORTED
STATE & TRIBAL ENROLLMENT DATE: NOT REPORTED

PROPERTY ENROLLED IN A STATE & TRIBAL PROGRAM?: NOT REPORTED

ARE INSTITUTIONAL CONTROLS REQUIRED?: NO

**Back to Report Summary** 

Order# 121435 Job# 277689 921 of 1203

**MAP ID# 135** 

Distance from Property: 0.169 mi. (892 ft.) ESE

Elevation: 571 ft.

### **FACILITY INFORMATION**

ID#: **3117** 

NAME: SHIELDS SIGNS

ADDRESS: 3201 S CRAVENS RD

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: UNKNOWN
BEGIN DATE: 06/12/1986
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/10/1986

SIGNATURE NAME & TITLE: **G W SHIELDS, PRESIDENT** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN601531627 NAME: SHIELDS SIGNS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/12/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 1204

APPLICATION RECEIVED DATE: 11/03/1999

SCHEDULE CONSTRUCTION DATE: 11/20/1999

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

#### CONTACT INFORMATION

NAME: **G W SHIELDS**TITLE: **PRESIDENT** 

ORGANIZATION: SHIELDS SIGNS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 4571140 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 922 of 1203

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1980 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/01/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 10632

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 923 of 1203

#### Brownfields Management System (BF)

**MAP ID# 136** 

Distance from Property: 0.17 mi. (898 ft.) ENE

Elevation: 664 ft.

**SITE INFORMATION** 

ID#: 133409

NAME: 4621 W SUBLETT

ADDRESS: 4621 W SUBLETT RD

**ARLINGTON, TX 76017** 

TYPE FUNDING: PETROLEUM

PREDOMINANT PAST USE (ACREAGE):

GREENSPACE: RESIDENTIAL: COMMERCIAL: INDUSTRIAL: 3.41 NOT REPORTED NOT REPORTED NOT REPORTED

FUTURE USE (ACREAGE):

GREENSPACE: RESIDENTIAL: COMMERCIAL: INDUSTRIAL: NOT REPORTED NOT REPORTED NOT REPORTED NOT REPORTED

PROPERTY HIGHLIGHT:

**NOT REPORTED** 

PROPERTY SIZE (Acres): 3.41

CURRENT OWNER: SUBLETT SQUARE LIMITED PROPERTY DESCRIPTION/ FORMER USE:

**NOT REPORTED** 

CONTAMINATE(S): NOT REPORTED

CONTAMINATE(S) CLEANED UP: NOT REPORTED

MEDIA(S) AFFECTED: NOT REPORTED

MEDIA(S) CLEANED UP: NOT REPORTED

TYPE OF BROWNFIELD GRANT: ASSESSMENT

ENVIRONMENTAL ASSESSMENT ACTIVITY: PHASE I ENVIRONMENTAL ASSESSMENT

ASSESSMENT START DATE: 5/4/2011 0:00

ASSESSMENT COMPLETION DATE: 5/24/2011 0:00

CLEANUP REQUIRED: NO

STATE & TRIBAL ENROLLMENT ID: NOT REPORTED
STATE & TRIBAL ENROLLMENT DATE: NOT REPORTED

PROPERTY ENROLLED IN A STATE & TRIBAL PROGRAM?: NOT REPORTED

ARE INSTITUTIONAL CONTROLS REQUIRED?: NO

**Back to Report Summary** 

Order# 121435 Job# 277689 924 of 1203

**MAP ID# 137** 

Distance from Property: 0.171 mi. (903 ft.) W

Elevation: 630 ft.

**FACILITY INFORMATION** 

ID#: 19413

NAME: 451 CENTRAL OFFICE GLENDALE

ADDRESS: 6000 CRAIG ST

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: NOT REPORTED
BEGIN DATE: 09/01/1988

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 1

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/05/1986

SIGNATURE NAME & TITLE: **G BEAN, ASST SUPV** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600261663

NAME: SOUTHWESTERN BELL TELEPHONE LP

CONTACT ADDRESS: ONE BELL CTR

ST LOUIS MO 63101

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1988

CONTACT ROLE: OWNCON

CONTACT NAME: NOT REPORTED

CONTACT TITLE: NOT REPORTED

ORGANIZATION: SOUTHWESTERN BELL TELEPHONE

PHONE: (512) 6533926 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN600261663

NAME: SOUTHWESTERN BELL TELEPHONE LP

CONTACT ADDRESS: ONE BELL CTR

ST LOUIS MO 63101

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1988 CONTACT ROLE: OPRCON

CONTACT NAME: **NOT REPORTED**CONTACT TITLE: **NOT REPORTED** 

CONTACT INFORMATION

NAME: NOT REPORTED
TITLE: NOT REPORTED

ORGANIZATION: 451 CO GLENDALE

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (866) 4926836 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 925 of 1203

ORGANIZATION: SOUTHWESTERN BELL TELELPHONE

PHONE: (314) 2477332 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 117652 SIGNATURE DATE: 02/24/2006

SIGNATURE NAME & TITLE: CHERYL ALLEN, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 117651
SIGNATURE DATE: 02/21/2005

SIGNATURE NAME & TITLE: HARRY C HIXSON, SR ENV MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 117650
SIGNATURE DATE: 01/22/2004

SIGNATURE NAME & TITLE: HARRY C HIXSON, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 117649
SIGNATURE DATE: 02/26/2003

SIGNATURE NAME & TITLE: HARRY C HIXSON, SR ENVIR MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 117648
SIGNATURE DATE: 03/06/2002

SIGNATURE NAME & TITLE: HARRY C HIXSON, SEN ENVIRO MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 117647
SIGNATURE DATE: 01/15/2001

SIGNATURE NAME & TITLE:  $\,$  MICHAEL A OLIVER, SEN ENVIRO MGR  $\,$ 

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 12052
APPLICATION RECEIVED DATE: 01/08/2007
SCHEDULE CONSTRUCTION DATE: 02/07/2007

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

NOT REPORTED

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4030 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/23/2006

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EMERG POWER GENERATOR

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 926 of 1203

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION, CATHODIC PROTECTION - FIELD INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 113952

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4030

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY

INSTALLATION, CATHODIC PROTECTION - FIELD INSTALLATION, ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),TRIENNIAL TIGHTNESS TEST (FOR SUCTION/GRAVITY PIPING),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

AST ID #: 208258 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 04/17/2007

INSTALLATION DATE: 04/02/2007 STATUS BEGIN DATE: 04/02/2007
TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 



Order# 121435 Job# 277689 927 of 1203

ALUMINIUM: NO **CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

OWNER INFORMATION

ADDRESS: PO BOX 8041

PHONE: 1-479-2043517

NAME: WAL-MART STORES TEXAS LP

**BENTONVILLE, AR 72712** 

**MAP ID# 138** 

Distance from Property: 0.171 mi. (903 ft.) ESE

Elevation: 608 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 90913 EPA ID: TXR000072462

TNRCC ID #: 129881

NAME: WALMART NEIGHBORHOOD MARKET 5181

ADDRESS: 6513 MEADOWBROOK DR

FORT WORTH, TX 76112

CONTACT: JUSTIN WILSON

PHONE: 479-2043517

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 12/13/2016

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 329559

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE SOLIDS

WASTE ID: 329560

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: AEROSOLS

WASTE ID: 329561

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 929 of 1203

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVE LIQUIDS

WASTE ID: 329562

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE LIQUIDS

WASTE ID: 329563

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LIGHTERS BUTANE

WASTE ID: 329565

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING SOLIDS

WASTE ID: 329566

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ORGANIC PEROXIDE

WASTE ID: 329567

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC SOLIDS

WASTE ID: 329568

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC LIQUIDS

WASTE ID: 329569

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING LIQUIDS

WASTE ID: 329570

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: P LISTED WASTE PHARMACEUTICALS

WASTE ID: 329571

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE WASTE PHARMACEUTICALS

WASTE ID: 329570

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: P LISTED WASTE PHARMACEUTICALS

WASTE ID: 329561

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVE LIQUIDS

WASTE ID: 329569

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING LIQUIDS

WASTE ID: 329566

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ORGANIC PEROXIDE

WASTE ID: 329562

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE LIQUIDS

WASTE ID: 329568

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC LIQUIDS

WASTE ID: 329571

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE WASTE PHARMACEUTICALS

WASTE ID: 329565

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING SOLIDS

WASTE ID: 329559

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

Order# 121435 Job# 277689 931 of 1203

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE SOLIDS

WASTE ID: 329567

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC SOLIDS

WASTE ID: 329560

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: AEROSOLS

WASTE ID: 329563

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LIGHTERS BUTANE

## Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

MAP ID# 138

Distance from Property: 0.171 mi. (903 ft.) ESE

Elevation: 608 ft.

PROGRAM ID: 90913
RN NUMBER: RN104231642
NAME: WAL-MART STORE 5181
ADDRESS: 6513 MEADOWBROOK DR
FORT WORTH, TX 76112

STATUS: **INACTIVE**STATUS DATE: **12/8/2016** 

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION: 6513 MEADOWBROOK DR

## Affected Property Assessment Reports (APAR)

**MAP ID# 139** 

Distance from Property: 0.172 mi. (908 ft.) WNW

Elevation: 598 ft.

**FACILITY INFORMATION** 

CONTACTS
WELLS, DAVID

PROGRAM ID: 1265

REFERENCE NUMBER: RN100649094

FACILITY NAME: SOLVENTS SOLUTIONS MANUFACTURE

ADDRESS: 5901 FITZHUGH AVE

FORT WORTH, TX 76119

COUNTY: TARRANT

LOCATION DESCRIPTION: NOT REPORTED

TYPE OF FACILITY: MFG CHEMICAL FACILITY STATUS: COMPLETED PROGRAM: VOLUNTARY CLEANUP PROGRAM STATUS: INACTIVE

**REMEDIATIONS** 

NO REMEDIATION REPORTED

**CATEGORY OF CONTAMINATION** 

DATE CONTAMINATIONS: 03/20/01 NOT REPORTED

03/20/01 FORMALDEHYDE, ACETONE, DENATURED ALCOHOL

03/20/01 VOCS

#### Brownfields Management System (BF)

**MAP ID# 139** 

Distance from Property: 0.172 mi. (908 ft.) WNW

Elevation: 598 ft.

SITE INFORMATION

ID#: 15747

NAME: UNNAMED

ADDRESS: 5901 FITZHUGH AVENUE

FORT WORTH, TX 76119

TYPE FUNDING: HAZARDOUS

PREDOMINANT PAST USE (ACREAGE):

GREENSPACE: RESIDENTIAL: COMMERCIAL: INDUSTRIAL: NOT REPORTED NOT REPORTED NOT REPORTED

FUTURE USE (ACREAGE):

GREENSPACE: RESIDENTIAL: COMMERCIAL: INDUSTRIAL: NOT REPORTED NOT REPORTED NOT REPORTED NOT REPORTED

PROPERTY HIGHLIGHT:

**NOT REPORTED** 

PROPERTY SIZE (Acres): 3.64

CURRENT OWNER: FORT WORTH OPPORTUNITY CENTER

PROPERTY DESCRIPTION/ FORMER USE:

CHEMICAL LAB, SCIENTIFIC SUPPLY, CERAMICS, TIMBER

CONTAMINATE(S): VOCS

CONTAMINATE(S) CLEANED UP: NOT REPORTED

MEDIA(S) AFFECTED: SOIL, GROUND WATER

MEDIA(S) CLEANED UP: NOT REPORTED

TYPE OF BROWNFIELD GRANT: CLEANUP

ENVIRONMENTAL ASSESSMENT ACTIVITY: NOT REPORTED

ASSESSMENT START DATE: NOT REPORTED

ASSESSMENT COMPLETION DATE: NOT REPORTED

CLEANUP REQUIRED: YES

STATE & TRIBAL ENROLLMENT ID: NOT REPORTED
STATE & TRIBAL ENROLLMENT DATE: NOT REPORTED

PROPERTY ENROLLED IN A STATE & TRIBAL PROGRAM?: NOT REPORTED

ARE INSTITUTIONAL CONTROLS REQUIRED?: NO

**Back to Report Summary** 

Order# 121435 Job# 277689 935 of 1203

**MAP ID# 139** 

Distance from Property: 0.172 mi. (908 ft.) WNW

Elevation: 598 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

PHONE: NOT REPORTED

REGISTRATION#: 30856 EPA ID: TXD987998275 NAME: ANDERSON LABORATORIES INC

TNRCC ID #: 8416 ADDRESS: NOT REPORTED

NAME: ANDERSON LABORATORIES
ADDRESS: 5901 FITZHUGH AVE

FORT WORTH, TX 76119

CONTACT: R B ANDERSON

PHONE: 817-4574474

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 05/19/2003

<u>ACTIVITIES</u>

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 256330

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 13967

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 13968

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 936 of 1203

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**MAP ID# 139** 

Distance from Property: 0.172 mi. (908 ft.) WNW

Elevation: 598 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 111978

LPST ID: 111978

FACILITY ID: 0024937

NAME: ANDERSON LABORATORY ADDRESS: 5901 FITZHUGH AVE

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 111978

NAME: ANDERSON LABORATORY FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 12/9/96

REPORTED DATE: 12/31/3000 ENTERED DATE: 12/9/1996

PRP INFORMATION

NAME: ANDERSON LABORATORIES INC ADDRESS: ADDRESS NOT REPORTED

**FORT WORTH TX 76163** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/06/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

938 of 1203

UST COMPARTMENT ID: 75813

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED
OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/06/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 75818

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: ACETONE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/06/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 75817

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: METHANOL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

Order# 121435 Job# 277689 940 of 1203

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/06/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 75816

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/06/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 941 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 75815

TANK ID: 5

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED
OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/06/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 75814

TANK ID: 6

COMPARTMENT LETTER: A

SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 139** 

Distance from Property: 0.172 mi. (908 ft.) WNW

Elevation: 598 ft.

**FACILITY INFORMATION** 

ID#: 24937
NAME: ANDERSON LABORATORIES

ADDRESS: 5901 FITZHUGH AVE

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: INDUST/MFG/CHEM PLANT

BEGIN DATE: 10/06/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/06/1986 SIGNATURE NAME & TITLE: BB ANDERSON, CHAIRMAN OF BOARD

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600358964

NAME: ANDERSON LABORATORIES INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/06/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600358964

NAME: ANDERSON LABORATORIES INC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/06/1986

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION

NAME: ROGER ANDERSON
TITLE: NOT REPORTED

ORGANIZATION: ANDERSON LABORATORIES

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 9252772 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 944 of 1203

ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

#### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/06/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 75813

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 945 of 1203

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/06/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 75818

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: ACETONE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/06/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



Order# 121435 Job# 277689 946 of 1203

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 75817

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: METHANOL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/06/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 75816

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/06/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 75815

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

Order# 121435 Job# 277689 948 of 1203

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 6 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/06/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 75814

TANK ID: 6

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

Order# 121435 Job# 277689 949 of 1203

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# ABOVEGROUND STORAGE TANK INFORMATION NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### Voluntary Cleanup Program Sites (VCP)

**MAP ID# 139** 

Distance from Property: 0.172 mi. (908 ft.) WNW

Elevation: 598 ft.

**SITE INFORMATION** 

**APPLICANT INFORMATION** 

ID#: 1265

NAME: ANDERSON LABORATORIES FACILITY

ADDRESS: 5901 FITZHUGH AVENUE

**FORT WORTH TX 76119** 

PHONE: 817-515-5251

ACRES: 3.7

FACILITY TYPE: SOLVENTS SOLUTIONS MANUFACTURER FAX: 817-515-5259

APPLICATION DATE: 10/11/2000 DATE OF AGREEMENT: 10/25/2000

CERTIFICATE OF COMPLETION DATE: 7/9/2012

TYPE OF CERTIFICATE ISSUED: FINAL

TYPE LEAD: OWNER

PHASE: COMPLETED

MEDIA AFFECTED: SOILS/GROUNDWATER

TNRCC SOLID WASTE REGISTRATION #: 30856

REMEDY: NOT REPORTED

INSTITUTIONAL CONTROL: NOT REPORTED

LPST #: 111978

EPA CERCLIS #: TXD987998275 **EPA RCRIS #: NOT REPORTED** CONTAMINANT/S: VOCS

ORGANIZATION: TARRANT COUNTY COLLEGE DISTRICT

**NINA, PETTY, PROVOST** 

1500 HOUSTON STREET

FORT WORTH, TX, 76102

**CONSULTANT/ATTORNEY INFORMATION** 

ORGANIZATION: W&M ENVIRONMENTAL GROUP, INC.

GENE, MURRAY, PROFESSIONAL GEOLOGIST

906 EAST 18TH STREET, SUITE 100

PLANO, TX, 75074

PHONE: 972-516-0300 FAX: 972-516-4145

**Back to Report Summary** 

951 of 1203 

OWNER INFORMATION

ADDRESS: 420 DAVEGA DR

PHONE: 1-803-7947300

NAME: SOUTHEASTERN FREIGHT LINES INC

**LEXINGTON, SC 29073** 

**MAP ID# 140** 

Distance from Property: 0.174 mi. (919 ft.) W

Elevation: 582 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 95269 EPA ID: TXR000081380

TNRCC ID #: 130613

NAME: SOUTHEASTERN FREIGHT LINES FORT WORTH

ADDRESS: 5300 MARTIN ST

FORT WORTH, TX 76119

CONTACT: LISA JOHNSON

PHONE: **803-9393312** 

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 12/07/2018

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 351414

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE FROM DAMAGED GOODS IN-TRANSIT. LAB PACK

WASTE ID: 351415

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE FROM DAMAGED GOODS IN-TRANSIT. LAB PACK

WASTE ID: 351417

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 952 of 1203

GENERATOR'S DESCRIPTION OF WASTE: WASTE FROM DAMAGED GOODS IN-TRANSIT. PAINT RELATED

WASTE ID: 351418

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE FROM DAMAGED GOODS IN-TRANSIT CLAI

WASTE ID: 351419

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE FROM DAMAGED GOODS IN-TRANSIT. CLEANERS W/ORGANIC ACID

WASTE ID: 351421

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE FROM DAMAGED GOODS IN-TRANSIT. CLEANERS WITH INORGANIC BASES

WASTE ID: 355852

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: PHOTO FIXER/UNUSED, OUT OF DATE, UNWANTED PRODUCT.

WASTE ID: 355853

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: INSTAPAK PART A & B/ UNUSED, OUT OF DATE, UNWANTED PRODUCT

WASTE ID: 357487

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OIL DRY CONTAMINATED WITH ORGANIC LIQUID/SPILL CLEAN UP OF ORGANIC

PRODUCT. 07/3
WASTE ID: 377104

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE ADHESIVES, D001

WASTE ID: 377107

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ISOCYANATE RESIN UN2478, D001

WASTE ID: 377114

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO** 



Order# 121435 Job# 277689 953 of 1203

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: MIXED FLAMMABLE LIQUIDS UN1993

WASTE ID: 377115

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: COMBUSTIBLE LIQUIDS

WASTE ID: 377116

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: SPILL CLEAN UP CONTAINING LEAD

WASTE ID: 377117

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: NH LIQUIDS, LATEX ETC.

WASTE ID: 377118

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: RESINS WITH STYRENE UN1866

WASTE ID: 378009

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE, CORROSIVE, PAINT, UN3469, DAMAGED DURING SHIPMENT

WASTE ID: 378010

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NON REGULATED HERBICIDES, PESTICIDES, UN2810

WASTE ID: 378011

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: CSAI, UN3260, DAMAGED DURING SHIPMENT

WASTE ID: 379453

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: PENTANE-2,4DIONE

WASTE ID: 379454

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO** 



Order# 121435 Job# 277689 954 of 1203

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ETHANOLAMINE

WASTE ID: 379455

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: COMPRESSED GAS, NITROGEN, 2.2

WASTE ID: 388922

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: UN2735, WASTE AMINES, LIQUID, CORROSIVEAMINE HARDENERS FOR PAINTS

WASTE ID: 388923

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: SPILL CLEAN-UP OF PAINT THINNERS, PAINTS

WASTE ID: 388925

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: UN2014, WASTE HYDROGEN PEROXIDE SOLUTION (35%)

WASTE ID: 388926

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: UN1791, WASTE HYPOCHLORITE SOLUTIONSHOUSEHOLD BLEACH

WASTE ID: 388927

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: CLAY ABSORBENT, NON-HAZARDOUS CLEAN-UP VIRGIN OILS

WASTE ID: 388931

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: UN2810, TLO (2,4-D HERBICIDE)

WASTE ID: 388933

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: DIBENZOYL PEROXIDE PASTE HARDENER

WASTE ID: 389627

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO** 



Order# 121435 Job# 277689 955 of 1203

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: CLEANUP OF ALKALINE CLEANER (CSBI)

WASTE ID: 397295

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: UN1203 WASTE GASOLINE (TRU-FUEL IN CANS)

WASTE ID: 397297

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: METHYL ETHYL KETONE PEROXIDE

WASTE ID: 397298

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: RED CELL SELENIUM HORSE VITAMIN SUPPLEMENT

WASTE ID: 397351

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: AEROSOLS, FLAMMABLE

**Back to Report Summary** 

**MAP ID# 141** 

Distance from Property: 0.175 mi. (924 ft.) E

Elevation: 593 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 109705

LPST ID: 109705

FACILITY ID: 0008812 NAME: WORTH OIL 9721

ADDRESS: 6217 E LANCASTER AVE

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 109705

NAME: WORTH OIL 9721

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 8/2/95

REPORTED DATE: **7/11/1995** ENTERED DATE: **8/2/1995** 

PRP INFORMATION

NAME: LSI SERVICES CO

ADDRESS: ADDRESS NOT REPORTED

**HOUSTON TX 77282** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1961 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 03/08/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 957 of 1203

UST COMPARTMENT ID: 133029

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1961 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **03/08/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 133031

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1961 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 03/08/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 133030

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1961 REGISTRATION DATE: 07/23/1997

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 03/08/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 133032

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 960 of 1203

**CONTACT INFORMATION** 

NAME: EARL HARRINGTON

PHONE: (817) 2749690 0

ORGANIZATION: WORTH OIL 9721

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TITLE: PRES.

**MAP ID# 141** 

Distance from Property: 0.175 mi. (924 ft.) E

Elevation: 593 ft.

**FACILITY INFORMATION** 

ID#: **8812** 

NAME: WORTH OIL 9721

ADDRESS: 6217 E LANCASTER AVE

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 07/15/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/22/1986

SIGNATURE NAME & TITLE: W SCHWIND, VP ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600459846
NAME: WORTH OIL COMPANY

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 07/15/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1961 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 03/08/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 133029

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1961 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 03/08/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 962 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 133031

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1961 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 03/08/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 133030

TANK ID: 3

Order# 121435 Job# 277689 963 of 1203

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1961 REGISTRATION DATE: 07/23/1997

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **03/08/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 133032

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

Order# 121435 Job# 277689 964 of 1203

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 142** 

Distance from Property: 0.18 mi. (950 ft.) WNW

Elevation: 641 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 113495

LPST ID: 113495

FACILITY ID: 0031092 NAME: B H SERVICE FINA

ADDRESS: 6101 MEADOWBROOK DR

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 113495

NAME: B H SERVICE FINA

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 10/5/98

REPORTED DATE: 9/30/1998 ENTERED DATE: 10/5/1998

#### PRP INFORMATION

NAME: 6101 INC

ADDRESS: ADDRESS NOT REPORTED

FORT WORTH TX 76112

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/31/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 966 of 1203

UST COMPARTMENT ID: 79182

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/31/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 79183

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

Order# 121435 Job# 277689 967 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/31/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 79185

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/31/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 79184

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: **USED OIL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

CONNECTORS & VALVES:

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 969 of 1203

**CONTACT INFORMATION** 

ORGANIZATION: B & H SERVICE FINA

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: T BARNETT

PHONE: (817) 4510411 0

TITLE: LESSEE

**MAP ID# 142** 

Distance from Property: 0.18 mi. (950 ft.) WNW

Elevation: 641 ft.

**FACILITY INFORMATION** 

ID#: **31092** 

NAME: B & H SERVICE FINA

ADDRESS: 6101 MEADOWBROOK DR

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 11/10/1986 STATUS: INACTIVE EXEMPT STATUS: NO

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/05/1986

SIGNATURE NAME & TITLE: RR GODFREY, PRES. ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601103096

NAME: 6101 INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: **ORGANIZATION**BEGIN DATE: 11/10/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 08/31/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 79182

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/31/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 971 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 79183

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/31/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 79185

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/31/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 79184

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: TEXAS WATER PRODUCTS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: JANELLE HALL

PHONE: (817) 4579988 0

TITLE: SECRETARY

MAP ID# 143

Distance from Property: 0.18 mi. (950 ft.) ESE

Elevation: 566 ft.

**FACILITY INFORMATION** 

ID#: **50180** 

NAME: TEXAS WATER PRODUCTS

ADDRESS: 5825 E BERRY ST

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: UNKNOWN
BEGIN DATE: 02/08/1990
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 02/05/1990 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/02/1990

SIGNATURE NAME & TITLE: **DON COOK, PRESIDENT** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600819825
NAME: TEXAS WATER PRODUCTS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 02/08/1990

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 02/05/1990
TANK CAPACITY (GAL): 5000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/03/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 10195

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

CONNECTORS & VALVES:

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 144** 

Distance from Property: 0.184 mi. (972 ft.) WNW

Elevation: 657 ft.

#### **FACILITY INFORMATION**

ID#: 85398

NAME: **7-ELEVEN 36095** 

ADDRESS: 3300 VAUGHN BLVD

FORT WORTH, TX 76105

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 06/11/2013

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/05/2013 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 07/31/2013

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: 1500 CORSICANA HWY

HILLSBORO TX 76645

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/31/1987

CONTACT ROLE: OWNOPRCON
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: 7-ELEVEN INC
PHONE: NOT REPORTED

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: 1202 RICHARDSON DR

**RICHARDSON TX 75080** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/31/1987 CONTACT ROLE: OPRCON

CONTACT NAME: CRAIG ZIMMER
CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION

NAME: **PEGGIE BETZ**TITLE: **NOT REPORTED** 

ORGANIZATION: 7 ELEVEN 36095

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (972) 8287805 0

ORGANIZATION: **7-ELEVEN INC** PHONE: **(214)** 8611274 0

FAX: (214) 8611270
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: **296100**SIGNATURE DATE: **12/20/2017** 

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENV.MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 280936
SIGNATURE DATE: 01/19/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MANAGE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 263907
SIGNATURE DATE: 01/19/2016

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 247149
SIGNATURE DATE: 01/16/2015

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 230831
SIGNATURE DATE: 01/23/2014

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 223377
SIGNATURE DATE: 07/31/2013

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, REG COMP MGR

FILING STATUS: **RENEWAL** REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 24199

APPLICATION RECEIVED DATE: 06/11/2013

SCHEDULE CONSTRUCTION DATE: 06/04/2013

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

NEW 7-ELEVEN STORE WITH FUELING.

NOTIFICATION CONSTRUCTION ID: 23107

APPLICATION RECEIVED DATE: 09/21/2012

SCHEDULE CONSTRUCTION DATE: 11/12/2012

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

NEW 7-ELEVEN CONVENIENCE STORE WITH FUELING. INSTALL (2) NEW UST'S 20K GALLON E ACH. TANK #1 20K

UNLEADED; TANK #2 (SPLIT) 12K DIESEL/8K PREMIUM UNLEADED.

Order# 121435 Job# 277689 978 of 1203

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/11/2013 REGISTRATION DATE: 08/05/2013

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/11/2013

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 186105

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL.INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2
INSTALLATION DATE: 06/11/2013 REGISTRATION DATE: 08/05/2013
TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/11/2013

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED



TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 186106

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 06/11/2013 REGISTRATION DATE: 08/05/2013

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/11/2013

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
FRP

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 980 of 1203

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 186107

TANK ID: 2

COMPARTMENT LETTER: **B** SUBSTANCES: **DIESEL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 981 of 1203

### Affected Property Assessment Reports (APAR)

**MAP ID# 145** 

Distance from Property: 0.185 mi. (977 ft.) NNW

Elevation: 625 ft.

**FACILITY INFORMATION** 

**CONTACTS** 

PROGRAM ID: 2595 LEWIS, STEVE

REFERENCE NUMBER: RN106861669

FACILITY NAME: PROPOSED CHICK FIL-A-RESTAURANT 2809

ADDRESS: 4410 LITTLE RD

**ARLINGTON, TX 76016** 

COUNTY: TARRANT

LOCATION DESCRIPTION: NOT REPORTED TYPE OF FACILITY: PROPERTY COMMERCIAL

FACILITY STATUS: COMPLETED
PROGRAM: VOLUNTARY CLEANUP
PROGRAM STATUS: INACTIVE

**REMEDIATIONS** 

NO REMEDIATION REPORTED

**CATEGORY OF CONTAMINATION** 

DATE CONTAMINATIONS:

 10/29/13
 ARSENIC

 10/29/13
 LEAD

 10/29/13
 MERCURY

 10/29/13
 METALS

**Back to Report Summary** 

### Voluntary Cleanup Program Sites (VCP)

**MAP ID# 145** 

Distance from Property: 0.185 mi. (977 ft.) NNW

Elevation: 625 ft.

**SITE INFORMATION** 

**APPLICANT INFORMATION** 

ORGANIZATION: CHICK-FIL-A INC

ID#: 2595 NAME: PROPOSED CHICK-FIL-A RESTAURANT #2809

STEVE, LEWIS, SR. DEVELOPMENT MANAGE

ADDRESS: 4410 LITTLE RD

**5200 BUFFINGTON RD** 

**ARLINGTON TX 76016** 

**ATLANTA, GA, 30349** 

ACRES: 1.14

PHONE: 404-305-4549

2809

FACILITY TYPE: PROPOSED CHICK -FIL-A RESTAURANT # FAX: 404-684-8550

APPLICATION DATE: 7/18/2013

DATE OF AGREEMENT: NOT REPORTED

CERTIFICATE OF COMPLETION DATE: 3/24/2014

TYPE OF CERTIFICATE ISSUED: FINAL TYPE LEAD: PROSPECTIVE LEESEE

PHASE: COMPLETED

MEDIA AFFECTED: SOIL

TNRCC SOLID WASTE REGISTRATION #: NOT REPORTED

REMEDY: NOT REPORTED

INSTITUTIONAL CONTROL: NOT REPORTED

LPST #: NOT REPORTED

EPA CERCLIS #: NOT REPORTED

EPA RCRIS #: NOT REPORTED CONTAMINANT/S: HEAVY METALS **CONSULTANT/ATTORNEY INFORMATION** 

ORGANIZATION: GILES ENGINEERING

MICHAEL F, PISARIK, REGIONAL MANAGER

**10553 OLYMPIC DR STE 102** 

**DALLAS, TX, 75220** 

PHONE: 214-358-5885 FAX: 214-358-5884

**Back to Report Summary** 

983 of 1203 

## Dry Cleaner Registration Database (DCR)

**MAP ID# 146** 

Distance from Property: 0.187 mi. (987 ft.) S

Elevation: 650 ft.

#### **FACILITY INFORMATION**

REGISTRATION #: RN103951653

CUSTOMER #: NOT REPORTED

NAME: CENTRE CLEANERS SUBLETT

ADDRESS: 6320 US 287 HWY STE 132

ARLINGTON, TX 76001-2868

ACCOUNT NUMBER: NOT REPORTED

ACCOUNT NUMBER: NOT REPORTED
PRINCIPAL NAME: NOT REPORTED
PHONE NUMBER: NOT REPORTED

SITE TYPE: DROP STATION REGISTRATION

FISCAL YEAR: FY2007
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2006

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2005
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2004
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 147** 

Distance from Property: 0.188 mi. (993 ft.) W

Elevation: 630 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 108342

LPST ID: 108342

FACILITY ID: 0060837

NAME: **EASTSIDE MINISTRIES**ADDRESS: **5929 E LANCASTER AVE** 

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 108342

NAME: EASTSIDE MINISTRIES

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 7/22/94

REPORTED DATE: **7/7/1994** ENTERED DATE: **7/22/1994** 

PRP INFORMATION

NAME: EASTSIDE MINISTRIES

ADDRESS: ADDRESS NOT REPORTED

FORT WORTH TX 76112

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 10/16/1991

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/29/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 985 of 1203

UST COMPARTMENT ID: 141263

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 10/16/1991

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY** 

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/29/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 141264

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

Order# 121435 Job# 277689 986 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: WAREHOUSE

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: (817) 5347472 0

**MAP ID# 147** 

Distance from Property: 0.188 mi. (993 ft.) W

Elevation: 630 ft.

**FACILITY INFORMATION** 

ID#: **60837** 

NAME: WAREHOUSE

ADDRESS: 5929 E LANCASTER AVE

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING
BEGIN DATE: 10/23/1991
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 10/16/1991 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 10/11/1991

SIGNATURE NAME & TITLE: BARBARA NOBLE, OWNER

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601106446

NAME: EASTSIDE MINISTRIES OF FORT WORTH

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 06/08/1994

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 10/16/1991
TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 988 of 1203

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/29/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 141263

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 10/16/1991

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/29/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:



Order# 121435 Job# 277689 989 of 1203

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 141264

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 148** 

Distance from Property: 0.192 mi. (1,014 ft.) ESE

Elevation: 579 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 101657

LPST ID: 101657

FACILITY ID: 0018635 NAME: ABC UTILITIES SER ADDRESS: 3025 S CRAVENS RD

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 101657

NAME: ABC UTILITIES SER

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 5 - MINOR SOIL CONTAMINATION - DOES NOT REQUIRE A RAP CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 2/14/92

REPORTED DATE: 1/13/1992 ENTERED DATE: 2/14/1992

PRP INFORMATION

NAME: SUMMIT NATIONAL BANK ADDRESS: ADDRESS NOT REPORTED

FORT WORTH TX 76113

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/31/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

991 of 1203

UST COMPARTMENT ID: 144350

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/31/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 144352

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

Order# 121435 Job# 277689 992 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/31/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 144351

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 195300 MULTIPLE COMPARTMENT FLAG: YES

Order# 121435 Job# 277689 993 of 1203

TANK ID: 1 REGISTRATION DATE: 11/01/2000

INSTALLATION DATE: 10/11/2000 STATUS BEGIN DATE: 10/11/2000

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE, DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

**MAP ID# 148** 

Distance from Property: 0.192 mi. (1,014 ft.) ESE

Elevation: 579 ft.

### **FACILITY INFORMATION**

ID#: 18635

NAME: F B MCINTIRE EQUIPMENT ADDRESS: 3025 S CRAVENS RD

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING BEGIN DATE: 09/03/1986

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **1** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/31/1986

SIGNATURE NAME & TITLE: **F WOLFE, PRES.**ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN601259542

NAME: DAVIS

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: INDIVIDUAL
BEGIN DATE: 08/31/2000

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 15207

APPLICATION RECEIVED DATE: 06/09/2000

SCHEDULE CONSTRUCTION DATE: 07/09/2000

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

### CONTACT INFORMATION

NAME: **KENNETH DAVIS**TITLE: **NOT REPORTED** 

ORGANIZATION: F B MCINTIRE EQUIPMENT

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 4291750 0

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 995 of 1203

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/31/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 144350

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/31/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 144352

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/31/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 997 of 1203

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 144351

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

AST ID #: 195300 MULTIPLE COMPARTMENT FLAG: YES

TANK ID: 1 REGISTRATION DATE: 11/01/2000

INSTALLATION DATE: 10/11/2000 STATUS BEGIN DATE: 10/11/2000

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE, DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: YES
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

**Back to Report Summary** 

# Industrial and Hazardous Waste Sites (IHW)

OWNER INFORMATION

PHONE: NOT REPORTED

NAME: PARK AVENUE CLEANERS

ADDRESS: 4388 W GREEN OAKS BLVD

**ARLINGTON, TX 76016** 

MAP ID# 149

Distance from Property: 0.196 mi. (1,035 ft.) NNW

Elevation: 598 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 68828 EPA ID: TXD981909955

TNRCC ID #: 23755

NAME: PARK AVENUE CLEANERS
ADDRESS: 4388 W GREEN OAKS BLVD

**ARLINGTON, TX 76016** 

CONTACT: MOHAMMED AMIN NOOR

PHONE: NOT REPORTED

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/24/2010

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 48591

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 999 of 1203

**CONTACT INFORMATION** 

ORGANIZATION: DIAMOND SHAMROCK 224

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: (512) 6418882 0

MAP ID# 150

Distance from Property: 0.198 mi. (1,045 ft.) WNW

Elevation: 641 ft.

### **FACILITY INFORMATION**

ID#: 40265

NAME: DIAMOND SHAMROCK 224

ADDRESS: 6036 MEADOWBROOK DR

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 09/01/1988 STATUS: INACTIVE

EXEMPT STATUS: **NO**RECORDS OFF-SITE: **NO** 

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/06/1986

SIGNATURE NAME & TITLE: GARY JORDAN, MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN602277386
NAME: CST SERVICES LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1988

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 6015 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/11/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 103487

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6015

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1965 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9994 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **01/11/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL



Order# 121435 Job# 277689 1001 of 1203

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 103489

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9994

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1965 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9994 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/11/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1002 of 1203

UST COMPARTMENT ID: 103488

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9994

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 151** 

Distance from Property: 0.198 mi. (1,045 ft.) NNE

Elevation: 619 ft.

**FACILITY INFORMATION** 

ID#: **87896** 

NAME: REEDER DISTRIBUTORS

ADDRESS: 4535 VILLAGE CREEK RD

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: NOT REPORTED BEGIN DATE: 02/28/2018

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: NOT REPORTED

NUMBER OF ACTIVE ABOVEGROUND TANKS: 3

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 03/01/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/28/2018

SIGNATURE NAME & TITLE: KATHY JOHNSON, EQUP DEPT

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600244339

NAME: REEDER DISTRIBUTORS INC

CONTACT ADDRESS: PO BOX 8237

FORT WORTH TX 76124

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/28/2018

CONTACT ROLE: **OWNOPRCON**CONTACT NAME: **NOT REPORTED**CONTACT TITLE: **NOT REPORTED** 

ORGANIZATION: REEDER DISTRIBUTOR INC

PHONE: (817) 4295957 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OWNER NUMBER: CN600244339
NAME: REEDER DISTRIBUTORS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

CITY NOT REPORTED

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/1800

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED

CONTACT INFORMATION

NAME: KATHY JOHNSON TITLE: NOT REPORTED

ORGANIZATION: REEDER DISTRIBUTORS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 4295957 216

Order# 121435 Job# 277689 1004 of 1203

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600244339

NAME: REEDER DISTRIBUTORS INC

CONTACT ADDRESS: PO BOX 8237

FORT WORTH TX 76124

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/28/2018

CONTACT ROLE: OWNOPRCON
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED

ORGANIZATION: REEDER DISTRIBUTOR INC

PHONE: (817) 4295957 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 32015

APPLICATION RECEIVED DATE: 10/12/2017

SCHEDULE CONSTRUCTION DATE: 11/20/2017

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

INSTALLATION OF (1) 6000 GAL 2085 FIREGUARD HALL TANK. REC'D AN AMENDED NOC 11-3-17 SHOWING NEW INSTALL

DATE OF 11-20-17.

NOTIFICATION CONSTRUCTION ID: 28092

APPLICATION RECEIVED DATE: 08/28/2015

SCHEDULE CONSTRUCTION DATE: 09/07/2015

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

FUELING SITE, INSTALLATION OF 2 ASTS (12,000 GALLONS & 10,000 GALLONS)

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 223014 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 6000 REGISTRATION DATE: 03/01/2018

INSTALLATION DATE: 02/28/2018 STATUS BEGIN DATE: 02/28/2018

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

#### **MATERIAL OF CONSTRUCTION**

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED** 



Order# 121435 Job# 277689 1005 of 1203

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223013 MULTIPLE COMPARTMENT FLAG: NC
TANK ID: 10000172 REGISTRATION DATE: 03/01/2018

INSTALLATION DATE: 02/28/2018 STATUS BEGIN DATE: 02/28/2018

TANK CAPACITY (GAL): 10000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 223012 MULTIPLE COMPARTMENT FLAG: YES
TANK ID: 12000181 REGISTRATION DATE: 03/01/2018

INSTALLATION DATE: 02/28/2018 STATUS BEGIN DATE: 02/28/2018

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE, DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

**Back to Report Summary** 

# Closed & Abandoned Landfill Inventory (CALF)

**MAP ID# 152** 

Distance from Property: 0.201 mi. (1,061 ft.) E

Elevation: 589 ft.

**SITE INFORMATION** 

SITE NUMBER: 2419

SITE NAME: PHOTOTROPOS

LOCATION:

1000 FT E OF LOOP 820 E ON S SIDE MARTIN ST IN FT WORTH

COUNTY: TARRANT

COMMENTS: TNRCC 31298 INSPECTION: NOT REPORTED

OWNER NAME: NOT REPORTED

DATE OPEN: 32874

DATE CLOSE: 1993

SIZE (ACRES): 12.00

SIZE (CUBIC YARDS): 0.00

PARTIES: NOT REPORTED

**LANDFILL CONTENTS** 

HOUSEHOLD: YES CONSTRUCTION DEMOLITION: YES

INDUSTRIAL: NR TIRES: YES
AGRICULTURE: NR BRUSH: NR
OTHER: NR LEGAL: NR

UNAUTHORIZED: YES HAZARD UNLIKELY: NR
HAZARD PROBABLY: NR HAZARD CERTAINLY: NR
DEPTH CD: NR MINIMUM THICKNESS: NR
MAXIMUM DEPTH: 0.00 USE: NOT REPORTED

OTHER DESCRIPTION: NOT REPORTED

REVIEWER: NOT REPORTED

**Back to Report Summary** 

### Dry Cleaner Registration Database (DCR)

**MAP ID# 153** 

Distance from Property: 0.201 mi. (1,061 ft.) S

Elevation: 633 ft.

#### **FACILITY INFORMATION**

REGISTRATION #: RN104431119
CUSTOMER #: CN605236413

NAME: COMET ONE-HOUR CLEANERS

ADDRESS: 6619 FOREST HILL DR STE 50

FOREST HILL, TX 76140

ACCOUNT NUMBER: 24,007,503

PRINCIPAL NAME: BENBROOK CLEANING CORPORATION

PHONE NUMBER: 817-2497463

SITE TYPE: DROP STATION REGISTRATION

FISCAL YEAR: FY2018
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2015
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2014
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2013
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2012
SOLVENT: NOT REPORTED

# Dry Cleaner Registration Database (DCR)

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2011
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2010
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2009
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2008

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2007

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2006

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

**Back to Report Summary** 

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 153** 

Distance from Property: 0.201 mi. (1,061 ft.) S

Elevation: 633 ft.

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 41615 EPA ID: TXD179100243 NAME: COMET ONE-HOUR CLEANERS

TNRCC ID #: 18001 ADDRESS: NOT REPORTED

NAME: COMET ONE-HOUR CLEANERS

ADDRESS: 6619 FOREST HILL DR PHONE: NOT REPORTED

FOREST HILL, TX 76140

CONTACT: RONALD GODFREY

PHONE: 817-4786923

BUSINESS DESCRIPTION: 8-11-03 LETTER THE CLEANERS WAS SOLD IN 93 TO DORIS A GODFREY. MAILING ADDRESS 600

ST ERIK DR, MANSFIELD, TX 76063 PER MARY KAY GODFREY.SC

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: NO
WASTE RECEIVER: NO
WASTE TRANSPORTER: YES
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/19/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

WASTE NO RECORDS

**Back to Report Summary** 



# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 153** 

Distance from Property: 0.201 mi. (1,061 ft.) S

Elevation: 633 ft.

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 76174 EPA ID: NOT REPORTED NAME: SA FIVE STAR CLEANERS 2 INC

TNRCC ID #: 30501 ADDRESS: NOT REPORTED

NAME: COMET ONE-HOUR CLEANERS

ADDRESS: 6619 FOREST HILL DR STE 50 PHONE: NOT REPORTED

FOREST HILL, TX 76140

CONTACT: JACQUELINE SUMMERS

PHONE: 817-4786923

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 08/13/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 58908

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 1011 of 1203

**MAP ID# 154** 

Distance from Property: 0.204 mi. (1,077 ft.) E

Elevation: 593 ft.

### **FACILITY INFORMATION**

ID#: **32774** 

NAME: WICKHAM SUPPLY

ADDRESS: 6301 E LANCASTER AVE

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 11/24/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/05/1986

SIGNATURE NAME & TITLE: **G C TRESIDDER, VP.** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600804272
NAME: WICKHAM SUPPLY INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/31/2001

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 9454
APPLICATION RECEIVED DATE: 10/26/2000
SCHEDULE CONSTRUCTION DATE: 11/02/2000

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

### **CONTACT INFORMATION**

NAME: G C TRESIDDER

TITLE: VP.

ORGANIZATION: WICKHAM SUPPLY

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (817) 4968001 0



Order# 121435 Job# 277689 1012 of 1203

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1973 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 250 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/30/2000** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 90553

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 250

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 155** 

Distance from Property: 0.205 mi. (1,082 ft.) E

Elevation: 593 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 101001

LPST ID: 101001

FACILITY ID: 0062265
NAME: RACETRAC

ADDRESS: 6300 E LANCASTER AVE

FORT WORTH, TX

### **LEAKING TANK DETAILS**

LPST ID: 101001

NAME: RACETRAC

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 12/2/91

REPORTED DATE: 9/30/1991 ENTERED DATE: 12/2/1991

PRP INFORMATION

NAME: RACETRAC PETROLEUM INC ADDRESS: ADDRESS NOT REPORTED

**ATLANTA GA 30348** 

CONTACT: **NOT REPORTED**PHONE: **NOT REPORTED** 

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1992 REGISTRATION DATE: 01/23/1992

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1014 of 1203

UST COMPARTMENT ID: 137843

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1992 REGISTRATION DATE: 01/23/1992

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL: COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 137845

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

Order# 121435 Job# 277689 1015 of 1203

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1992 REGISTRATION DATE: 01/23/1992

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 01/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 137845

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES

Order# 121435 Job# 277689 1016 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1992 REGISTRATION DATE: 01/23/1992

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1992

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DETAILS
MATERIAL:
COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 137844

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: MUMMES INC PEARSALL

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: (512) 4263313 0

**MAP ID# 155** 

Distance from Property: 0.205 mi. (1,082 ft.) E

Elevation: 593 ft.

### **FACILITY INFORMATION**

ID#: 62245

NAME: MUMMES PEARSALL

ADDRESS: 6300 E LANCASTER AVE

FORT WORTH, TX 76112

COUNTY: FRIO REGION: 13

TYPE: RETAIL

BEGIN DATE: 01/22/1992 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 12/23/1991 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 12/23/1991 SIGNATURE NAME & TITLE: TL PROCTOR, VICE PRESIDENT

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600524516

NAME: MUMMES INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: OTHER

BEGIN DATE: 01/22/1992

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**ABOVEGROUND STORAGE TANK INFORMATION** 

GeoSearch www.geo-search.com 888-396-0042

1018 of 1203 

AST ID #: 165814 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 12/23/1991

INSTALLATION DATE: 01/01/1991 STATUS BEGIN DATE: 08/01/1996

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 165813 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 2 REGISTRATION DATE: 12/23/1991

INSTALLATION DATE: 01/01/1991 STATUS BEGIN DATE: 08/01/1996

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

**MAP ID# 155** 

Distance from Property: 0.205 mi. (1,082 ft.) E

Elevation: 593 ft.

### **FACILITY INFORMATION**

ID#: 62265

NAME: RACEWAY 6761

ADDRESS: 6300 E LANCASTER AVE

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: **RETAIL** 

BEGIN DATE: 01/24/1992

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/16/2017 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 07/28/2017

SIGNATURE NAME & TITLE: MAX MCBRAYER, CSO ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600505283
NAME: RACETRAC PETROLEUM INC

CONTACT ADDRESS: 200 GALLERIA PKWY SE STE 900

ATLANTA GA 30339

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/24/1992

CONTACT ROLE: OWNOPRCON
CONTACT NAME: LISA CIOTOLI
CONTACT TITLE: DIR OF ENV

ORGANIZATION: RACETRAC PETROLEUM INC

PHONE: (770) 4317600 0 FAX: NOT REPORTED EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN600505283
NAME: RACETRAC PETROLEUM INC

CONTACT ADDRESS: 300 TECHNOLOGY CT SE

SMYRNA GA 30082

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/24/1992 CONTACT ROLE: OPRCON

CONTACT NAME: MAX MCBRAYER
CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION

NAME: LISA CIOTOLI
TITLE: NOT REPORTED

ORGANIZATION: RACEWAY 6761

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (770) 4317600 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: RACETRAC PETROLEUM INC

PHONE: (770) 4317600 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 299030 SIGNATURE DATE: 02/09/2018

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 282473
SIGNATURE DATE: 02/20/2017

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR OF ENV

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 265438
SIGNATURE DATE: 02/19/2016

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR OF ENVIRO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 248260
SIGNATURE DATE: 02/06/2015

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR OF ENVIRONM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 231236
SIGNATURE DATE: 02/03/2014

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR OF ENVIRONM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144452
SIGNATURE DATE: 01/09/2013

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR OF ENVIRONM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144451
SIGNATURE DATE: 01/24/2012

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR OF ENVIRO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144450
SIGNATURE DATE: 02/03/2011

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR OF ENVIRO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144449
SIGNATURE DATE: 01/11/2010

SIGNATURE NAME & TITLE: LISA A CIOTOLI, OWNER OF ENVIRO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144448
SIGNATURE DATE: 02/09/2009

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR ENVNMENTAL

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144447
SIGNATURE DATE: 02/12/2008

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR OF ENVIRONM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144446
SIGNATURE DATE: 01/23/2007

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIR OF ENVIRONMENTAL

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144445
SIGNATURE DATE: 01/12/2006

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR OF ENVIRON

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144444
SIGNATURE DATE: 01/06/2005

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR OF ENVIRO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144443
SIGNATURE DATE: 01/08/2004

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144442
SIGNATURE DATE: 11/29/2002

SIGNATURE NAME & TITLE: MAX MCBRAYER JR, VICE PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144441
SIGNATURE DATE: 12/11/2001

SIGNATURE NAME & TITLE: MAX MCBRAYER JR, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 144440
SIGNATURE DATE: 12/01/2000

SIGNATURE NAME & TITLE: MAX MCBRAYER JR, VP

FILING STATUS: INITIAL

Order# 121435 Job# 277689 1022 of 1203

REGISTRATION FLAG: YES

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 28125
APPLICATION RECEIVED DATE: 08/28/2015
SCHEDULE CONSTRUCTION DATE: 08/28/2015

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

CONVERT ONE FUEL TANK TO DIESEL WITH ASSOCIATED HARDWARE

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1992 REGISTRATION DATE: 01/23/1992

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 137843

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 121435 Job# 277689 1023 of 1203

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1992 REGISTRATION DATE: 01/23/1992

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 01/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 137845

TANK ID: 2

COMPARTMENT LETTER: A
SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1992 REGISTRATION DATE: 01/23/1992

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 01/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES

GeoSearch www.geo-search.com 888-396-0042

PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 137845

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1992 REGISTRATION DATE: 01/23/1992

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

Order# 121435 Job# 277689 1025 of 1203

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 137844

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 156** 

Distance from Property: 0.209 mi. (1,104 ft.) SW

Elevation: 695 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 119520

LPST ID: 119520

FACILITY ID: 0039384 NAME: CORNER STORE 2241

ADDRESS: 1201 N LITTLE SCHOOL RD

 $\boldsymbol{\mathsf{ARLINGTON}}, \, \mathsf{TX}$ 

### **LEAKING TANK DETAILS**

LPST ID: 119520

NAME: CORNER STORE 2241

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 3.5 - A DESIGNATED MAJOR OR MINOR AQUIFER IS IMPACTED

CORRECTIVE ACTION STATUS CODE: 3 - MONITORING

CORRECTIVE ACTION START DATE: 3/4/16

REPORTED DATE: 9/15/2014 ENTERED DATE: 12/9/2014

PRP INFORMATION

NAME: **SKIPPER BEVERAGE COMPANY LLC** ADDRESS: **ADDRESS NOT REPORTED** 

CITY NOT REPORTED

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

1027 of 1203

**MAP ID# 156** 

Distance from Property: 0.209 mi. (1,104 ft.) SW

Elevation: 695 ft.

**FACILITY INFORMATION** 

ID#: 39384

NAME: CORNER STORE 2241

ADDRESS: 1201 N LITTLE SCHOOL RD

ARLINGTON, TX 76017

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 01/01/1985 STATUS: INACTIVE EXEMPT STATUS: NO

RECORDS OFF-SITE: YES NUMBER OF ACTIVE UNDERGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 09/06/2013 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 08/15/2013

SIGNATURE NAME & TITLE: GEORGE GALE, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**OWNER** 

OWNER NUMBER: CN604312868

NAME: SKIPPER BEVERAGE COMPANY LLC

CONTACT ADDRESS: PO BOX 690350

**SAN ANTONIO TX 78269** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/29/2013

CONTACT ROLE: OWNOPRCON CONTACT NAME: KENT HAMEL CONTACT TITLE: NOT REPORTED

ORGANIZATION: SKIPPER BEVERAGE COMPANY LLC

PHONE: (210) 6922275 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN604312868

NAME: SKIPPER BEVERAGE COMPANY LLC

CONTACT ADDRESS: PO BOX 690350

**SAN ANTONIO TX 78269** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/29/2013

CONTACT ROLE: OWNOPRCON CONTACT NAME: KENT HAMEL CONTACT TITLE: NOT REPORTED **CONTACT INFORMATION** 

NAME: GEORGE GALE

TITLE: COORD

ORGANIZATION: CORNER STORE 2241

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (210) 3454815 0

GeoSearch www.geo-search.com 888-396-0042

1028 of 1203 

ORGANIZATION: SKIPPER BEVERAGE COMPANY LLC

PHONE: (210) 6922275 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 225925 SIGNATURE DATE: 08/15/2013

SIGNATURE NAME & TITLE: GEORGE GALE, COMP COORD

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63666
SIGNATURE DATE: 08/15/2012

SIGNATURE NAME & TITLE: GEORGE GALA, COMP COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63665
SIGNATURE DATE: 08/24/2011

SIGNATURE NAME & TITLE: GEORGE GALE, RETAIL COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63664
SIGNATURE DATE: 08/25/2010

SIGNATURE NAME & TITLE: GEORGE GALE, RETAIL COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63663
SIGNATURE DATE: 08/20/2009

SIGNATURE NAME & TITLE: GEORGE GALE, RETAIL COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63662
SIGNATURE DATE: 08/19/2008

SIGNATURE NAME & TITLE: GEORGE GALE, RETAIL COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63661
SIGNATURE DATE: 03/11/2008

SIGNATURE NAME & TITLE: TERRY HANKINS, O & E SPECIALIST

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63660
SIGNATURE DATE: 08/15/2007

SIGNATURE NAME & TITLE: GEORGE GALE, COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63659
SIGNATURE DATE: 08/18/2006

SIGNATURE NAME & TITLE: BILLY HUNT, O&E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63658
SIGNATURE DATE: 08/19/2005

SIGNATURE NAME & TITLE: MICHAEL UMPHRESS, O&E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63657
SIGNATURE DATE: 08/20/2004

SIGNATURE NAME & TITLE: MICHAEL UMPHRESS, O & E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63656
SIGNATURE DATE: 08/25/2003

SIGNATURE NAME & TITLE: MICHAEL UMPHRESS, O & E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63655
SIGNATURE DATE: 10/11/2002

SIGNATURE NAME & TITLE: JOHN WILLRODT, NOT REPORTED

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63654
SIGNATURE DATE: 06/26/2002

SIGNATURE NAME & TITLE: BILLY HUNT, O & E SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63653
SIGNATURE DATE: 01/12/2001

SIGNATURE NAME & TITLE: BILLY C HUNT, O&E SPECIALIST

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 25931

APPLICATION RECEIVED DATE: 06/11/2014

SCHEDULE CONSTRUCTION DATE: 07/14/2014

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REMOVE THE ENTIRE FUEL SYSTEM; TANKS, STP & UDC SUMPS, AND DISPENSERS.

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9816 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/04/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

Order# 121435 Job# 277689 1030 of 1203

#### **TANK DETAILS**

MATERIAL:

**FRP** 

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 66818

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9816

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9816 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/04/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 



Order# 121435 Job# 277689 1031 of 1203

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 66818

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9816

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9816 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/04/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 66820

TANK ID: 2

COMPARTMENT LETTER: A

Order# 121435 Job# 277689 1032 of 1203

SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9816

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY

CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9816 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/04/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 66820

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9816

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 



MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9816 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/04/2014** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 66819

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9816

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY

Order# 121435 Job# 277689 1034 of 1203

CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9816 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/04/2014

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 66819

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9816

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Order# 121435 Job# 277689 1035 of 1203

Back to Report Summary

**CONTACT INFORMATION** 

ORGANIZATION: CRITES OIL

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: LEE WOODARD

PHONE: (817) 4574384 0

TITLE: LESSEE

**MAP ID# 157** 

Distance from Property: 0.211 mi. (1,114 ft.) W

Elevation: 588 ft.

**FACILITY INFORMATION** 

ID#: **41987** 

NAME: CRITES OIL

ADDRESS: 5800 E ROSEDALE ST

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING
BEGIN DATE: 01/27/1987
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/28/1986

SIGNATURE NAME & TITLE: MARK CRITES, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601276561
NAME: CRITES PROPERTIES INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/27/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 06/30/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 105369

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/30/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 1038 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 104720

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/30/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 104719

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: FIRESTONE STORE 24W4

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: R S MCLAREN

TITLE: STORE MGR

PHONE: (817) 4830911 0

**MAP ID# 158** 

Distance from Property: 0.212 mi. (1,119 ft.) NNW

Elevation: 609 ft.

**FACILITY INFORMATION** 

ID#: **1404** 

NAME: FIRESTONE STORE 24W4

ADDRESS: 4319 LITTLE RD

ARLINGTON, TX 76016

COUNTY: TARRANT

REGION: 4
TYPE: RETAIL

BEGIN DATE: 06/03/1986 STATUS: INACTIVE

EXEMPT STATUS: **NO**RECORDS OFF-SITE: **NO** 

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/17/1986 SIGNATURE NAME & TITLE: R S MCLAREN, STORE MANAGER

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600971337

NAME: FIRESTONE REAL ESTATE LEASING CO

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/03/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: T1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 4848

TANK ID: T1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 1042 of 1203

**CONTACT INFORMATION** 

ORGANIZATION: KMART 3566

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: G C BECHTOLD

PHONE: (817) 4788256 0

TITLE: MGR

**MAP ID# 159** 

Distance from Property: 0.213 mi. (1,125 ft.) NNW

Elevation: 644 ft.

**FACILITY INFORMATION** 

ID#: **15720** 

NAME: KMART 3566

ADDRESS: 401 SOUTHWEST PLZ

ARLINGTON, TX 76016

COUNTY: TARRANT

REGION: 4

TYPE: UNKNOWN
BEGIN DATE: 08/15/1986
STATUS: INACTIVE
EXEMPT STATUS: NO

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0**NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/15/1986 SIGNATURE NAME & TITLE: J B RONAN, ASST CONTROLLER

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600615017
NAME: K MART CORPORATION

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/15/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/26/1993

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 53666

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

OWNER INFORMATION

PHONE: 1-817-5721053

NAME: SPECIAL EFFECTS INC

ADDRESS: 5136 SAUNDERS RD

FORT WORTH, TX 76119

**MAP ID# 160** 

Distance from Property: 0.216 mi. (1,140 ft.) W

Elevation: 593 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 70379 EPA ID: TXD981511645

TNRCC ID #: 25202

NAME: SPECIAL EFFECTS

ADDRESS: 5136 SAUNDERS RD

FORT WORTH, TX 76119

CONTACT: JOE LAWLIS PHONE: 817-5721053

BUSINESS DESCRIPTION: NOT REPORTED INDUSTRIAL WASTE PERMIT #: NOT REPORTED MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: YES WASTE RECEIVER: NO WASTE TRANSPORTER: NO TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/26/2004

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 50622

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

1045 of 1203 

**MAP ID# 161** 

Distance from Property: 0.218 mi. (1,151 ft.) W

Elevation: 593 ft.

**FACILITY INFORMATION** 

**OWNER INFORMATION** 

REGISTRATION#: 85774 EPA ID: TXR000051151 NAME: AERO COMPONENTS INC

TNRCC ID #: 107965 ADDRESS: 5124 KALTENBRUN RD

NAME: AERO COMPONENTS FORT WORTH, TX 76119

ADDRESS: 5124 KALTENBRUN RD PHONE: 1-817-5723003

FORT WORTH, TX 76119

CONTACT: JON C WILLIAMS

PHONE: 817-5723003

BUSINESS DESCRIPTION: AIRCRAFT PART MANUFACTURER.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: LARGE QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 11/06/2018

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 171533

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: PAINT BOOTH FILLERS - PAINTING

WASTE ID: 196937

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: WASTE PAINT AND SOLVENTS. PAINT AND CLEANING SOLVENT WASTES FROM

PRIMER SPRAY BO WASTE ID: 196938

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO** 

WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: PRIMER BOOTH FILTERS. WASTE FABRIC AIR FILTERS FROM THE PRIMER BOOTH

PROCESS. D

WASTE ID: 196939

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: EMPTY CONTAINERS, PAINT CANS AND BAGS.

WASTE ID: 196940

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LABORATORY AND PPE WASTE. MISC DEBRIS FROM LAB AND SHOP INCLUDING

**GLOVES, BEAKE** 

WASTE ID: 196941

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SHOP TOWELS AND WIPES. DATE OF GENERATION: 10-01-02. WASTE CODE

**INACTIVATEDBECAU** 

WASTE ID: 201441

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: DISCARDING OBSOLETE OR OUT-OF-DATE ADHESIVES OR SEALANTS.

WASTE ID: 201442

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ABSORBANTS USED TO CAPTURE MINOR SPILLS OF WATER-BASED COOLANTS

**FROM MACHINE SHO** 

WASTE ID: 201443

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: EMPTY PAPER CONTAINERS WITH BICHROMATE RESIDUE. DATE OF

**GENERATION: 7-1-03**WASTE ID: **203416** 

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO** 

WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: SPENT CHROMIC ACID AND SULFURIC ACID SOLUTION

WASTE ID: 204314

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO** 



Order# 121435 Job# 277689 1047 of 1203

WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: FILTER CAKE FROM PLATE AND FRAME FILTER PRESS USED TO DEWATER

**SLUDGE GENERATED B** 

WASTE ID: 204315

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE ABSORBANTS USED TO CLEAN-UP MINOR SPILLS OF ACIDS INTO

**CONTAINMENT AREA OF** 

WASTE ID: 204316

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ABSORBANTS USED TO CLEAN-UP MINOR SPILLS INTO CONTAINMENT AREA

AROUND THE ALODIN

WASTE ID: 220255

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: EXPIRED RESINS AND EPOXIES WHICH ARE SOLIDIFIED.

WASTE ID: 220396

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TANK BOTTOM SLUDGES FROM METAL FINISHING TANKS CONTAINING SULFURIC

ACID AND/OR C

WASTE ID: 220397

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: USED RUBBER TANK LINER FROM TANK ON METAL FINISHING PROCESS.

WASTE ID: 224869

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: MISCELLANEOUS CONTAINERS OF CHEMICALS NO LONGER NEEDED OR EXPIRED.

WASTE ID: 224870

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE AEROSOL PAINT CANS.; HAZARDOUS WASTE CURRENTLY BEING

**MANAGED UNDER UNIVERS** 

WASTE ID: **241710** 

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO** 



Order# 121435 Job# 277689 1048 of 1203

WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: SPENT TRICHROLETHYLENE FROM DEGREASER WITH OIL CONTAMINATION.; ONE

TIME SHIPMENT

WASTE ID: 243436

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TURCO 4215 RINSE FROM SURFACE PREPARATION, NEUTRALIZED IN TREATMENT

SYSTEM.

WASTE ID: 244035

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE DUBL CHECK PENETRANT LIQUID.; DUE TO CHANGE(S) IN THE PRODUCT

PRODUCED, TH

WASTE ID: 352377

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE ADHEASIVES: A NEW HAZARDOUS WASTE DETERMINATION HAS BEEN

PERFORMED ON THIS

WASTE ID: 373447

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WAREHOUSE AND OFFICE TRASH FROM TRASH CANS, DISPOSED OF IN THE

**GENERAL REFUSE DU** 

WASTE ID: 373492

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: RINSE WATER FROM ACID ETCH OF ALUMINUM IN METAL FINISHING PROCESS

WASTE ID: 373493

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: RINSE WATER FROM PHOSPHORIC ACID ANODIZE PROCESS

WASTE ID: 375377

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TREATED WASTE WATER FOR DISCHARGE TO THE POTW FROM METAL FINISHING

WASTE WATER T

WASTE ID: **385175** 

WASTE CODE STATUS: ACTIVE

Order# 121435 Job# 277689 1049 of 1203

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE TRICHLOR FROM DEGREASER CLEAN OUT

WASTE ID: 402646

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LAB PACK OF WASTE PAINT MATERIALS FOR DISPOSAL

WASTE ID: 405260

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE CHROMIC ACID FLAKES EXPIRED, 50 POUND BAGS

Back to Report Summary

**CONTACT INFORMATION** 

ORGANIZATION: PARISH ELECTRIC

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: GREG PARISH

TITLE: NOT REPORTED

PHONE: (817) 4512931 0

**MAP ID# 162** 

Distance from Property: 0.218 mi. (1,151 ft.) W

Elevation: 608 ft.

**FACILITY INFORMATION** 

ID#: 40494

NAME: PARISH ELECTRIC

ADDRESS: 5725 HART ST

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: UNKNOWN
BEGIN DATE: 01/20/1987
STATUS: INACTIVE
EXEMPT STATUS: NO

RECORDS OFF-SITE: **NO**NUMBER OF ACTIVE UNDERGROUND TANKS: **0**NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/05/1986

SIGNATURE NAME & TITLE: HAROLD R PARISH, PRES. ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600806947
NAME: PARISH ELECTRIC INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/20/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/22/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 93703

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

### Dry Cleaner Registration Database (DCR)

**MAP ID# 163** 

Distance from Property: 0.22 mi. (1,162 ft.) SW

Elevation: 695 ft.

#### **FACILITY INFORMATION**

REGISTRATION #: RN104747563 CUSTOMER #: CN603941923

NAME: TREE POINT CLEANERS & TAILOR
ADDRESS: 5081 LITTLE RD STE 103
ARLINGTON, TX 76017

ACCOUNT NUMBER: 24,006,337
PRINCIPAL NAME: JC STANTON INC
PHONE NUMBER: 214-4917285

SITE TYPE: DROP STATION REGISTRATION

FISCAL YEAR: FY2018
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2015
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2014
SOLVENT: NOT REPORTED

# Dry Cleaner Registration Database (DCR)

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2013
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2012
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2011
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2010
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2009

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2008

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2007

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2006

SOLVENT: NOT REPORTED

QUANTITY: NOT REPORTED

FISCAL YEAR: FY2005
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

Back to Report Summary

**MAP ID# 164** 

Distance from Property: 0.226 mi. (1,193 ft.) SSW

Elevation: 605 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 82925 EPA ID: TX0000135814

NAME: FEDEX GROUND PACKAGE SYSTEM INC

TNRCC ID #: 99310

ADDRESS: 1000 FED EX DR

NAME: FEDEX GROUND PACKAGE SYSTEM

**CORAOPOLIS, PA 15108** 

ADDRESS: 4901 VILLAGE CREEK RD

CONTACT: JOSEPH E STEARNS

PHONE: 1-817-5613020

FORT WORTH, TX 76119

FORT WORTH, TX 70113

PHONE: 412-2627306

BUSINESS DESCRIPTION: SMALL PACKAGE TRANSPORTATION/TRUCKING THIS REGISTRATION WAS INACTIVATED

BECAUSETHE FACILITY WAS REGISTERED PRIOR TO 1995 AND NO WASTE ACTIVITY WAS REPORTED IN95

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 02/26/2018

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 99499

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: LAB PACKS GENERATED FROM DAMAGED FREIGHT.

WASTE ID: 179035

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: DAMAGED PRODUCT; SPILL CLEANUP.

WASTE ID: 179036

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO** 

Order# 121435 Job# 277689 1055 of 1203

WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: DAMAGED PAINT PRODUCT; SPILL CLEANUP.

WASTE ID: 181161

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: FIRE EXTINGUISHERS THAT ACCICENTALLY DISCHARGED DURING SHIPPING.

WASTE ID: 181162

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LAB PACKS GENERATED FROM DAMAGED FREIGHT.

WASTE ID: 188814

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: DAMAGED FREIGHT

WASTE ID: 251572

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: BROKEN FLUORESCENT LAMPS FOR RECYCLING THAT CAN NOT BE SHIPPED AS

**UNIVERSAL WAST** 

WASTE ID: 348871

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: LEAD WIEGHTS

WASTE ID: 352801

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NON HAZARDOUS GASES

WASTE ID: 399042

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: MERCURY CONTAMINATED DEBRIS RESULTING FROM CLEANUP ACTIVITIES OF

MERCURY CONTAIN

WASTE ID: **256717** 

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 256931

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

# Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 164** 

Distance from Property: 0.226 mi. (1,193 ft.) SSW

Elevation: 605 ft.

PROGRAM ID: 82925
RN NUMBER: RN100568112
NAME: FEDEX GROUND

ADDRESS: 4901 VILLAGE CREEK RD FORT WORTH, TX 76119

STATUS: INACTIVE
STATUS DATE: 2/5/2001
PHASE: TRANSFERRED
LOCATION DESCRIPTION:

**NOT REPORTED** 

**Back to Report Summary** 

**MAP ID# 164** 

Distance from Property: 0.226 mi. (1,193 ft.) SSW

Elevation: 605 ft.

**FACILITY INFORMATION** 

ID#: 59824

NAME: FEDEX GROUND

ADDRESS: 4901 VILLAGE CREEK RD

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING BEGIN DATE: 09/13/1991

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 4 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/02/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 07/26/2018

SIGNATURE NAME & TITLE: ANTHONY SPALVIERI, ASSISTANT SECRETARY

**ENFORCEMENT ACTION DATE: NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN601263775

NAME: FEDEX GROUND PACKAGE SYSTEM INC

CONTACT ADDRESS: 1000 FED EX DR

**MOON TOWNSHIP PA 15108** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 07/22/2008

CONTACT ROLE: OWNOPRCON

CONTACT NAME: JOSEPH E STEARNS

CONTACT TITLE: ENVIRONMENTAL COORDINATOR

ORGANIZATION: FEDEX GROUND

PHONE: NOT REPORTED FAX: NOT REPORTED EMAIL: NOT REPORTED

OWNER NUMBER: CN602300030

NAME: FEDEX GROUND

CONTACT ADDRESS: PO BOX 108

PITTSBURGH PA 15230

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/10/2000

CONTACT ROLE: OWNOPRCON CONTACT NAME: JERRY C SWART CONTACT TITLE: NOT REPORTED ORGANIZATION: FEDEX GROUND

PHONE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: FRANK VASQUEZ

TITLE: FACILITY MNGR

ORGANIZATION: FEDEX GROUND

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED **CITY NOT REPORTED** 

PHONE: (817) 5613020 0

GeoSearch www.geo-search.com 888-396-0042

1059 of 1203

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OWNER NUMBER: CN601263775

NAME: FEDEX GROUND PACKAGE SYSTEM INC

CONTACT ADDRESS: 1000 FED EX DR

**CORAOPOLIS PA 15108** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/23/1998

CONTACT ROLE: OWNCON

CONTACT NAME: NOT REPORTED

CONTACT TITLE: NOT REPORTED

ORGANIZATION: FEDEX GROUND PACKAGE SYSTEM INC

PHONE: **(412) 2627306 0** FAX: **(412) 8595450** 

EMAIL: JOSEPH.STEARNS@FEDEX.COM

**OPERATOR** 

OPERATOR NUMBER: CN601263775

NAME: FEDEX GROUND PACKAGE SYSTEM INC

CONTACT ADDRESS: 1000 FED EX DR

**MOON TOWNSHIP PA 15108** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 07/22/2008 CONTACT ROLE: OPRCON

CONTACT NAME: STEVEN H TAYLOR CONTACT TITLE: NOT REPORTED

ORGANIZATION: FEDEX GROUND PACKAGE SYSTEM INC

PHONE: **(412) 8592739 0** FAX: **(412) 8592654** 

EMAIL: BRYAN.SMITH@FEDEX.COM
OPERATOR NUMBER: CN602300030

NAME: FEDEX GROUND

CONTACT ADDRESS: 1000 FED EX DR

**MOON TOWNSHIP PA 15108** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/10/2000
CONTACT ROLE: OPRCON
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED

ORGANIZATION: FEDEX GROUND PACKAGE SYSTEM INC

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OPERATOR NUMBER: CN601263775

NAME: FEDEX GROUND PACKAGE SYSTEM INC

CONTACT ADDRESS: 1000 FED EX DR

**MOON TOWNSHIP PA 15108** 

TYPE: CORPORATION/COMPANY

Order# 121435 Job# 277689 1060 of 1203

BEGIN DATE: 10/23/1998 CONTACT ROLE: OPRCON

CONTACT NAME: JERRY C SWART

CONTACT TITLE: MANAGING DIRECTOR - ENVIRONMENTAL SERVICES

ORGANIZATION: FEDEX GROUND PACKAGE SYSTEM INC

PHONE: **(412) 2627375 0** FAX: **(412) 8592232 0** 

EMAIL: GAYLYN.FROSINI@FEDEX.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 307367 SIGNATURE DATE: 07/26/2018

SIGNATURE NAME & TITLE: ANTHONY SPALVIERI, ASSISTANT SECRETARY

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 299402
SIGNATURE DATE: 08/14/2017

SIGNATURE NAME & TITLE: ANTHONY SPALVIERI, ASST SEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 273568
SIGNATURE DATE: 07/20/2016

SIGNATURE NAME & TITLE: ANTHONY SPALVIERI, ASST SEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 257123
SIGNATURE DATE: 07/22/2015

SIGNATURE NAME & TITLE: ANTHONY SPALVIERI, ASST SEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 239822
SIGNATURE DATE: 07/24/2014

SIGNATURE NAME & TITLE: ANTHONY SPALVIERI, ASST SEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 223268
SIGNATURE DATE: 07/16/2013

SIGNATURE NAME & TITLE: ANTHONY SPALVIERI, ASST SEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 140816
SIGNATURE DATE: 07/12/2012

SIGNATURE NAME & TITLE: JERRY C SWART, MANAGING DIRECTOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 140815
SIGNATURE DATE: 07/14/2011

SIGNATURE NAME & TITLE: JERRY C SWART, MANAGING DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 140814
SIGNATURE DATE: 06/22/2010

SIGNATURE NAME & TITLE: JERRY C SWART, MANAGING DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 140813
SIGNATURE DATE: 06/30/2009

SIGNATURE NAME & TITLE: JERRY C SWART, MANAGING DIRECTOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 140812
SIGNATURE DATE: 11/10/2008

SIGNATURE NAME & TITLE: JERRY C SWART, MANAGING DIRECTOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 140811
SIGNATURE DATE: 06/29/2007

SIGNATURE NAME & TITLE: JERRY C SWART, MANAGING DIRECTOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 140810
SIGNATURE DATE: 06/26/2006

SIGNATURE NAME & TITLE: JERRY C SWART, MANAGING DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 140809
SIGNATURE DATE: 06/23/2005

SIGNATURE NAME & TITLE: JERRY C SWART, MANAGING DIRECTOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 140808
SIGNATURE DATE: 06/24/2004

SIGNATURE NAME & TITLE: **JERRY C SWART, MANAGING DIRECTOR** 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 140807
SIGNATURE DATE: 06/25/2003

SIGNATURE NAME & TITLE: JERRY C SWART, MGR DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 140806
SIGNATURE DATE: 06/27/2002

SIGNATURE NAME & TITLE: JERRY C SWART, MANAGING DIRECTOR

FILING STATUS: **RENEWAL** REGISTRATION FLAG: **YES** 



Order# 121435 Job# 277689 1062 of 1203

SELF-CERTIFICATION ID: 140805 SIGNATURE DATE: 04/19/2001

SIGNATURE NAME & TITLE: JERRY C SWART, MGR DIR

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 140804
SIGNATURE DATE: 08/10/2000

SIGNATURE NAME & TITLE: JERRY C STEWART, MANAGING DIRECTOR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 31349

APPLICATION RECEIVED DATE: 05/05/2017

SCHEDULE CONSTRUCTION DATE: 05/15/2017

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

ADD (2) UST'S AND REPIPE LOCATION.

NOTIFICATION CONSTRUCTION ID: 14964

APPLICATION RECEIVED DATE: 02/20/2001

SCHEDULE CONSTRUCTION DATE: 02/13/2001

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

#### **NOT REPORTED**

NOTIFICATION CONSTRUCTION ID: 14963

APPLICATION RECEIVED DATE: 06/09/2008

SCHEDULE CONSTRUCTION DATE: 07/07/2008

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

#### **NOT REPORTED**

NOTIFICATION CONSTRUCTION ID: 14962

APPLICATION RECEIVED DATE: 06/09/2008

SCHEDULE CONSTRUCTION DATE: 07/07/2008

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

### **NOT REPORTED**

NOTIFICATION CONSTRUCTION ID: 14961
APPLICATION RECEIVED DATE: 10/26/2000
SCHEDULE CONSTRUCTION DATE: 11/13/2000

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

#### **NOT REPORTED**

NOTIFICATION CONSTRUCTION ID: 14960
APPLICATION RECEIVED DATE: 12/05/2012
SCHEDULE CONSTRUCTION DATE: 12/05/2012

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REMOVAL OF TWO SPILL BUCKETS AND INSTALLATION OF NEW DOUBLE WALL SPILL BUCKETS.

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1991 REGISTRATION DATE: 09/11/1991

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/03/2008

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED



Order# 121435 Job# 277689 1063 of 1203

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 148361

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT

**BARRIER** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

GROUNDWATER MONITORING, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/17/2001 REGISTRATION DATE: 04/20/2001

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/03/2008

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:
FRP



CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 148362

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE, ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONITORING OF SECONDARY CONTAINMENT BARRIER, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 07/22/2008 REGISTRATION DATE: 11/14/2008

TANK CAPACITY (GAL): 30000 **EMPTY TANK: NOT EMPTY** 

STATUS: IN USE STATUS BEGIN DATE: 07/22/2008

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



1065 of 1203

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 148363

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 30000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/22/2008 REGISTRATION DATE: 11/14/2008

TANK CAPACITY (GAL): 30000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 07/22/2008

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 148364

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 30000

Order# 121435 Job# 277689 1066 of 1203

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/11/2017 REGISTRATION DATE: 02/16/2018

TANK CAPACITY (GAL): 30000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 07/11/2017

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 192696

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 30000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-

OFF VALVE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

Order# 121435 Job# 277689 1067 of 1203

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 7 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/11/2017 REGISTRATION DATE: 02/16/2018
TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 07/11/2017

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 192697

TANK ID: 7

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-

OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES



Order# 121435 Job# 277689 1068 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

# ABOVEGROUND STORAGE TANK INFORMATION NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

OWNER INFORMATION

ADDRESS: 1470 AVENUE T

PHONE: 1-817-4512304

NAME: JAYCO STAMPING COMPANY OF TEXAS

**GRAND PRAIRIE, TX 75050** 

**MAP ID# 165** 

Distance from Property: 0.228 mi. (1,204 ft.) ESE

Elevation: 571 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 96516 EPA ID: NOT REPORTED

TNRCC ID #: 131861

NAME: JAYCO STAMPING COMPANY OF TEXAS

ADDRESS: 6109 DOWDELL RD

FORT WORTH, TX 76119

CONTACT: ARTURO SEPULVEDA

PHONE: 817-4512304

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/23/2016

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 386314

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: CAL PREP 81 AND WATER FROM PART CLEANING PRIOR TO POWDER COATING

WASTE ID: 386315

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: CAL CLEAN 807 AND WATER FROM PART CLEANING PRIOR TO POWDER COATING

**Back to Report Summary** 

Order# 121435 Job# 277689 1070 of 1203

**CONTACT INFORMATION** 

ORGANIZATION: KELLY TOURS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: (817) 5340312 0

**MAP ID# 166** 

Distance from Property: 0.23 mi. (1,214 ft.) SW

Elevation: 640 ft.

#### **FACILITY INFORMATION**

ID#: 75665

NAME: KELLY TOURS

ADDRESS: 4625 MILLER AVE

FORT WORTH, TX 76119

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING BEGIN DATE: 08/31/1987 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 02/10/2003 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/10/2003

SIGNATURE NAME & TITLE: BILL TILGER, OPER MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600247795 NAME: SUN COAST RESOURCES INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/31/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

ABOVEGROUND STORAGE TANK INFORMATION

GeoSearch www.geo-search.com 888-396-0042

1071 of 1203 

AST ID #: 201185 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 3027 REGISTRATION DATE: 02/10/2003

INSTALLATION DATE: 01/14/2003 STATUS BEGIN DATE: 11/10/2004

TANK CAPACITY (GAL): 6000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 167** 

Distance from Property: 0.233 mi. (1,230 ft.) NNW

Elevation: 609 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 80333 EPA ID: TXD988038378

NAME: EXXONMOBIL OIL CORPORATION

TNRCC ID #: 35046

ADDRESS: NOT REPORTED

NAME: MOBIL OIL

PHONE: NOT REPORTED

ADDRESS: 4380 W GREEN OAKS BLVD

**ARLINGTON, TX 76016** 

CONTACT: ASHLEY FORBES

PHONE: 512-4516334

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 12/01/2005

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 105857

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: WATER W/TRACES OF GASOLINE FROM TANK BOTTOM PUMP OUTS.

WASTE ID: 68698

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 121435 Job# 277689 1073 of 1203

**MAP ID# 167** 

Distance from Property: 0.233 mi. (1,230 ft.) NNW

Elevation: 609 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 102477

LPST ID: 102477

FACILITY ID: 0017627 NAME: MOBIL 12 138

ADDRESS: 4380 W GREEN OAKS BLVD

ARLINGTON, TX

#### **LEAKING TANK DETAILS**

LPST ID: 102477 NAME: MOBIL 12 138

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 3.5 - A DESIGNATED MAJOR OR MINOR AQUIFER IS IMPACTED CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 4/29/92

REPORTED DATE: 3/26/1992 ENTERED DATE: 4/29/1992

PRP INFORMATION

NAME: MOBIL OIL CORP

ADDRESS: ADDRESS NOT REPORTED

**DALLAS TX 75212** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1074 of 1203

UST COMPARTMENT ID: 116739

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE

**TEST & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING

(NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING

(NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/14/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 116741

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

Order# 121435 Job# 277689 1075 of 1203

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2B NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 116737

TANK ID: 2B

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 



Order# 121435 Job# 277689 1076 of 1203

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 116740

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

Order# 121435 Job# 277689 1077 of 1203

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 116738

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 167** 

Distance from Property: 0.233 mi. (1,230 ft.) NNW

Elevation: 609 ft.

#### **FACILITY INFORMATION**

ID#: 17627

NAME: GREEN OAKS MOBIL

ADDRESS: 4380 W GREEN OAKS BLVD

ARLINGTON, TX 76016

COUNTY: TARRANT

REGION: 4 TYPE: RETAIL

BEGIN DATE: 09/01/1989 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/21/1986

SIGNATURE NAME & TITLE: TB NEWMAN, MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600253306 NAME: GREEN OAKS MOBIL INC

CONTACT ADDRESS: 4380 W GREEN OAKS BLVD

**ARLINGTON TX 76016** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/08/1986 CONTACT ROLE: OWNCON CONTACT NAME: BOYD YOUNG CONTACT TITLE: NOT REPORTED ORGANIZATION: GREEN OAKS MOBIL

PHONE: (817) 4839818 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600253306 NAME: GREEN OAKS MOBIL INC

CONTACT ADDRESS: 4380 W GREEN OAKS BLVD

**ARLINGTON TX 76016** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/08/1986 CONTACT ROLE: OPRCON

CONTACT NAME: MANHAR MEGHANI

CONTACT TITLE: PRES

#### **CONTACT INFORMATION**

NAME: MANHAR MEGHANI TITLE: NOT REPORTED

ORGANIZATION: GREEN OAKS MOBIL

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 5727855 0



1079 of 1203 

ORGANIZATION: GREEN OAKS MOBIL INC

PHONE: (817) 5727855 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 121473 SIGNATURE DATE: 10/10/2006

SIGNATURE NAME & TITLE: MANHAR MEGHANI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 121472
SIGNATURE DATE: 10/06/2005

SIGNATURE NAME & TITLE: MANHAR MEGHANI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 121471
SIGNATURE DATE: 09/29/2004

SIGNATURE NAME & TITLE: MANHAR MEGHANI, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 121470
SIGNATURE DATE: 01/21/2004

SIGNATURE NAME & TITLE: MANHAR MEGHANI, PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 121469
SIGNATURE DATE: 09/26/2003

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIR MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 121468
SIGNATURE DATE: 09/05/2002

SIGNATURE NAME & TITLE: MANHAR MEGHANI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 121467
SIGNATURE DATE: 01/18/2001

SIGNATURE NAME & TITLE:  $\mbox{\sc Michael}$  K  $\mbox{\sc Garrott},$  SR,  $\mbox{\sc Env}$   $\mbox{\sc Comp}$   $\mbox{\sc MgR}$ 

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 12904

APPLICATION RECEIVED DATE: 02/01/2007

SCHEDULE CONSTRUCTION DATE: 02/01/2007

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

NOT REPORTED

NOTIFICATION CONSTRUCTION ID: 12903



Order# 121435 Job# 277689 1080 of 1203

APPLICATION RECEIVED DATE: 07/06/2007 SCHEDULE CONSTRUCTION DATE: 08/06/2007

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 116739

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE

**TEST & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING

(NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/14/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 116741

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2B NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO

GeoSearch www.geo-search.com 888-396-0042

Order# 121435 Job# 277689 1082 of 1203

PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 116737

TANK ID: 2B

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

Order# 121435 Job# 277689 1083 of 1203

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 116740

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/14/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 116738

Order# 121435 Job# 277689 1084 of 1203

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

OWNER INFORMATION

ADDRESS: 5717 HART ST

PHONE: NOT REPORTED

NAME: RESEARCH CHEMICALS INC

FORT WORTH, TX 76112

**MAP ID# 168** 

Distance from Property: 0.239 mi. (1,262 ft.) W

Elevation: 608 ft.

**FACILITY INFORMATION** 

REGISTRATION#: 35623 EPA ID: TXD008010365

TNRCC ID #: 12724

NAME: RESEARCH CHEMICALS

ADDRESS: 5717 HART ST

FORT WORTH, TX 76112

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT A HW GENERATOR

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/04/2010

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 34881

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 169** 

Distance from Property: 0.239 mi. (1,262 ft.) ESE

Elevation: 566 ft.

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 81780 EPA ID: TX0000094771

NAME: RITE-WAY EQUIPMENT SALES & SERVICE

TNRCC ID #: 36852

ADDRESS: 5900 E BERRY ST STE F

NAME: RITE-WAY EQUIPMENT SALES & SERVICE

FORT WORTH, TX 76119

ADDRESS: 5900 E BERRY ST STE F

PHONE: 1-817-4466581

FORT WORTH, TX 76119

CONTACT: DAN ROBBINS
PHONE: 817-4466581

BUSINESS DESCRIPTION: SALES AND SERVICE OF HEAVY EQUIPMENT. THIS REGISTRATION WAS INACTIVATED

BECAUSETHE FACILITY WAS REGISTERED PRIOR TO 1995 AND NO WASTE ACTIVITY WAS REPORTED IN95

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 01/09/2002

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 77556

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: MINERAL SPIRITS FROM PARTS WASHING NEW.

Back to Report Summary

Order# 121435 Job# 277689 1087 of 1203

**MAP ID# 170** 

Distance from Property: 0.24 mi. (1,267 ft.) SE

Elevation: 600 ft.

**FACILITY INFORMATION** 

ID#: 79586

NAME: ACTION EXCAVATING

ADDRESS: 6824 OAK CREST DR W

FORT WORTH, TX 76140

COUNTY: TARRANT

REGION: 4

TYPE: FLEET REFUELING BEGIN DATE: 08/31/1987

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 1

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 11/07/2008 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 11/07/2008

SIGNATURE NAME & TITLE: HOPPY LEATHERMAN, MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603444084

NAME: PAT INC

CONTACT ADDRESS: 6824 OAK CREST DR W

FORT WORTH TX 76140

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/08/2008 CONTACT ROLE: OWNCON

CONTACT NAME: HOPPY LEATHERMAN

CONTACT TITLE: MGR ORGANIZATION: PAT INC PHONE: (817) 5723478 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN603444084

NAME: PAT INC

CONTACT ADDRESS: 6824 OAK CREST DR W

FORT WORTH TX 76140

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/08/2008 CONTACT ROLE: OPRCON

CONTACT NAME: HOPPY LEATHERMAN

CONTACT TITLE: MGR

**CONTACT INFORMATION** 

NAME: HOPPY LEATHERMAN

TITLE: MGR

ORGANIZATION: ACTION EXCAVATING

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (817) 5723478 0

GeoSearch www.geo-search.com 888-396-0042

1088 of 1203 

ORGANIZATION: PAT INC PHONE: (817) 5723478 0 FAX: NOT REPORTED EMAIL: NOT REPORTED SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

#### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 210848 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 11/07/2008

INSTALLATION DATE: 11/08/2008 STATUS BEGIN DATE: 11/08/2008

TANK CAPACITY (GAL): 3000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

#### **MATERIAL OF CONSTRUCTION**

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 



MAP ID# 171

Distance from Property: 0.242 mi. (1,278 ft.) E

Elevation: 595 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 113562

LPST ID: 113562

FACILITY ID: 0071088

NAME: EASTSIDE WRECHER

ADDRESS: 6401 E LANCASTER AVE

NESS. 0401 E LANCASTEIX AVE

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 113562

NAME: EASTSIDE WRECHER

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 2.5 - GW IMPACT PUBLIC/DOMESTIC WATER SUPPLY WELL W/IN 0.25MI

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 11/6/98

REPORTED DATE: 12/31/3000 ENTERED DATE: 11/6/1998

PRP INFORMATION

NAME: **REPUBLIC SERVICES INC**ADDRESS: **ADDRESS NOT REPORTED** 

**ARLINGTON TX 76011** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1946 REGISTRATION DATE: 10/19/1998

TANK CAPACITY (GAL): 600 EMPTY TANK: NOT EMPTY

STATUS: **PERM FILLED IN PLACE** STATUS BEGIN DATE: **12/12/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1090 of 1203

UST COMPARTMENT ID: 176674

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1946 REGISTRATION DATE: 10/19/1998

TANK CAPACITY (GAL): 600 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/11/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176675

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 600

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

Order# 121435 Job# 277689 1091 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1946 REGISTRATION DATE: 10/19/1998

TANK CAPACITY (GAL): 300 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/11/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176676

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 300

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1952 REGISTRATION DATE: 10/19/1998

Order# 121435 Job# 277689 1092 of 1203

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/16/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176677

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1952 REGISTRATION DATE: 10/19/1998

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/16/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 1093 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176678

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 10/19/1998

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/11/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176679

TANK ID: 6

COMPARTMENT LETTER: A

SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: EASTSIDE WRECHER

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

NAME: MEL JERNIGAN

TITLE: NOT REPORTED

PHONE: (817) 2618812 0

**MAP ID# 171** 

Distance from Property: 0.242 mi. (1,278 ft.) E

Elevation: 595 ft.

#### **FACILITY INFORMATION**

ID#: 71088

NAME: **EASTSIDE WRECHER** 

ADDRESS: 6401 E LANCASTER AVE

FORT WORTH, TX 76112

COUNTY: TARRANT

REGION: 4

TYPE: RETAIL

BEGIN DATE: 08/31/1987 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 10/19/1998 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 12/20/1995 SIGNATURE NAME & TITLE: MELVIN R JERNIGAN, RISK MGR

OTOTAL NAME & TITLE. MILEVIN R DERMICAN, IN

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN604231472

NAME: DUNCAN

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: INDIVIDUAL
BEGIN DATE: 08/31/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1946 REGISTRATION DATE: 10/19/1998
TANK CAPACITY (GAL): 600 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **PERM FILLED IN PLACE** STATUS BEGIN DATE: **12/12/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176674

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1946 REGISTRATION DATE: 10/19/1998

TANK CAPACITY (GAL): 600 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/11/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 1097 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176675

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 600

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1946 REGISTRATION DATE: 10/19/1998

TANK CAPACITY (GAL): 300 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/11/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176676

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 300

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1952 REGISTRATION DATE: 10/19/1998

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/16/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176677

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED

Order# 121435 Job# 277689 1099 of 1203

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1952 REGISTRATION DATE: 10/19/1998

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/16/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176678

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 1

Order# 121435 Job# 277689 1100 of 1203

INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 10/19/1998

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/11/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 176679

TANK ID: 6

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 172** 

Distance from Property: 0.248 mi. (1,309 ft.) WNW

Elevation: 658 ft.

**FACILITY INFORMATION** 

 ID#:
 26596
 NAME: W HARRIS

 NAME:
 RAS 6 3690
 TITLE:
 DEALER

ADDRESS: 3229 E BERRY ST ORGANIZATION: RAS 6 3690

FORT WORTH, TX 76105 MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CONTACT INFORMATION** 

COUNTY: TARRANT CITY NOT REPORTED

REGION: 4 PHONE: (817) 5359643 0

BEGIN DATE: 10/15/1986 STATUS: INACTIVE

TYPE: RETAIL

EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS:  $oldsymbol{0}$  NUMBER OF ACTIVE ABOVEGROUND TANKS:  $oldsymbol{0}$ 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/27/1986

SIGNATURE NAME & TITLE: R N ATHERTON, SUPV ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600123939
NAME: EXXON MOBIL CORPORATION

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/15/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY



STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/31/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36831

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/31/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO TANK DETAILS

MATERIAL: **STEEL** 

CORROSION PROTECTION:

Order# 121435 Job# 277689 1103 of 1203

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36830

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/31/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 36833

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/31/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** MATERIAL: STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** UST COMPARTMENT ID: 36832

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED

1105 of 1203 

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

### Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 173** 

Distance from Property: 0.255 mi. (1,346 ft.) SW

Elevation: 688 ft.

PROGRAM ID: T2216
RN NUMBER: RN105334452

NAME: MASONIC HOME AND SCHOOL OF TEXAS

ADDRESS: 3600 WICHITA ST

FORT WORTH, TX 76119

STATUS: **INACTIVE**STATUS DATE: **12/21/2007** 

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

**MAP ID# 174** 

Distance from Property: 0.276 mi. (1,457 ft.) NNW

Elevation: 620 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 104817

LPST ID: 104817

FACILITY ID: 0005702

NAME: CHEVRON 164475

ADDRESS: 4340 LITTLE RD

ARLINGTON, TX

TANK BETAK O

#### **LEAKING TANK DETAILS**

LPST ID: 104817

NAME: CHEVRON 164475

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6P - FINAL PENDING WELL PLUG

CORRECTIVE ACTION START DATE: 6/23/97

REPORTED DATE: 10/2/1992 ENTERED DATE: 10/26/1992

PRP INFORMATION

NAME: CHEVRON USA INC

ADDRESS: ADDRESS NOT REPORTED

**HOUSTON TX 77210** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/11/2004

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1108 of 1203

UST COMPARTMENT ID: 69090

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **02/11/2004** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 69092

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

Order# 121435 Job# 277689 1109 of 1203

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/11/2004

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 69091

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES

Order# 121435 Job# 277689 1110 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/11/2004

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 69093

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 175** 

Distance from Property: 0.278 mi. (1,468 ft.) S

Elevation: 627 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 096154

LPST ID: 096154

FACILITY ID: 0010457

NAME: MR M FOOD STORE 77

ADDRESS: 6701 FOREST HILL DR
FOREST HILL, TX

TANK DETAIL O

#### **LEAKING TANK DETAILS**

LPST ID: 096154

NAME: MR M FOOD STORE 77

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 7/16/90

REPORTED DATE: 7/12/1990 ENTERED DATE: 7/16/1990

PRP INFORMATION

NAME: **METZGER** 

ADDRESS: ADDRESS NOT REPORTED

DALLAS TX 75215

CONTACT: **NOT REPORTED** PHONE: **NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 176** 

Distance from Property: 0.281 mi. (1,484 ft.) ESE

Elevation: 612 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 102171

LPST ID: 102171

FACILITY ID: 0011373

NAME: JIM CROWS TEXACO STATION ADDRESS: 6545 MEADOWBROOK DR

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 102171

NAME: JIM CROWS TEXACO STATION FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 5 - MINOR SOIL CONTAMINATION - DOES NOT REQUIRE A RAP CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 4/17/92

REPORTED DATE: 1/30/1992 ENTERED DATE: 4/17/1992

**PRP INFORMATION** 

NAME: W R CHILDRESS OIL CO INC
ADDRESS: ADDRESS NOT REPORTED
FORT WORTH TX 76111

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1961 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/01/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT NON-USE SINCE 1974

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1113 of 1203

UST COMPARTMENT ID: 150637

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1961 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/01/1990

STATUS. REMOVED FROM GROUND STATUS BEGIN DATE. 12/01/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT NON-USE SINCE 1974

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 150639

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

Order# 121435 Job# 277689 1114 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1961 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/01/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT NON-USE SINCE 1974

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 150638

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY



Order# 121435 Job# 277689 1115 of 1203

**MAP ID# 177** 

Distance from Property: 0.332 mi. (1,753 ft.) ESE

Elevation: 612 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 107237

LPST ID: 107237

FACILITY ID: 0007329

NAME: 7 ELEVEN STORE 12506

ADDRESS: 6611 MEADOWBROOK DR

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 107237

NAME: 7 ELEVEN STORE 12506

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 10/29/93

REPORTED DATE: **7/26/1993**ENTERED DATE: **10/29/1993** 

PRP INFORMATION

NAME: SOUTHLAND CORP

ADDRESS: ADDRESS NOT REPORTED

**DALLAS TX 75221** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/14/1993

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1117 of 1203

UST COMPARTMENT ID: 25022

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/14/1993

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 25024

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

Order# 121435 Job# 277689 1118 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/14/1993** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 25023

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Order# 121435 Job# 277689 1119 of 1203

**MAP ID# 177** 

Distance from Property: 0.309 mi. (1,632 ft.) ESE

Elevation: 612 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 115425

LPST ID: 115425

FACILITY ID: **0014930** NAME: **CONOCO 43041** 

ADDRESS: 6601 MEADOWBROOK DR

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 115425

NAME: CONOCO 43041

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 3.5 - A DESIGNATED MAJOR OR MINOR AQUIFER IS IMPACTED CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 3/27/02

REPORTED DATE: 3/8/2000 ENTERED DATE: 3/27/2002

PRP INFORMATION

NAME: CONOCO INC

ADDRESS: ADDRESS NOT REPORTED

**HOUSTON TX 77079** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1121 of 1203

UST COMPARTMENT ID: 16215

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 16218

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

Order# 121435 Job# 277689 1122 of 1203

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 16217

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES



Order# 121435 Job# 277689 1123 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 05/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 16216

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1983 REGISTRATION DATE: 06/14/1999

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/07/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



Order# 121435 Job# 277689 1124 of 1203

MATERIAL:

**NOT REPORTED** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 16219

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 178** 

Distance from Property: 0.31 mi. (1,637 ft.) NNE

Elevation: 634 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 094900

LPST ID: 094900

FACILITY ID: 0007560 NAME: FIRE STATION 22

ADDRESS: 4849 WILBARGER ST

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 094900

NAME: FIRE STATION 22

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 3/15/90

REPORTED DATE: 1/23/1990 ENTERED DATE: 3/15/1990

PRP INFORMATION

NAME: CITY OF FORT WORTH

ADDRESS: ADDRESS NOT REPORTED

FORT WORTH TX 75110

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 178** 

Distance from Property: 0.31 mi. (1,637 ft.) NNE

Elevation: 634 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 106295

LPST ID: 106295

FACILITY ID: 0007560

NAME: FIRE STATION 22

ADDRESS: 4849 WILBARGER ST

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 106295

NAME: FIRE STATION 22

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 3/25/93

REPORTED DATE: 3/3/1993 ENTERED DATE: 3/25/1993

PRP INFORMATION

NAME: CITY OF FORT WORTH

ADDRESS: ADDRESS NOT REPORTED

FORT WORTH TX 76102

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 4221 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1964 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/26/1993

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1127 of 1203

UST COMPARTMENT ID: 35647

TANK ID: 4221

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 179** 

Distance from Property: 0.311 mi. (1,642 ft.) ESE

Elevation: 573 ft.

PROGRAM ID: **34995**RN NUMBER: **RN103169991** 

NAME: HYDRA RIG

ADDRESS: 6000 E BERRY ST

FORT WORTH, TX 76119

STATUS: **INACTIVE**STATUS DATE: 3/15/2011

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

**MAP ID# 180** 

Distance from Property: 0.321 mi. (1,695 ft.) W

Elevation: 612 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 103859

LPST ID: 103859

FACILITY ID: 0059413

NAME: AT T

ADDRESS: 1000 S CANTON DR

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 103859 NAME: AT T

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 8/31/92

REPORTED DATE: **7/10/1992** ENTERED DATE: **8/31/1992** 

PRP INFORMATION

NAME: OSBORNE, JAMES

ADDRESS: ADDRESS NOT REPORTED

**DALLAS 75240** 

CONTACT: **NOT REPORTED**PHONE: **NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 08/15/1991

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/02/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1130 of 1203

UST COMPARTMENT ID: 52236

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 181** 

Distance from Property: 0.333 mi. (1,758 ft.) ESE

Elevation: 612 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 110496

LPST ID: 110496

FACILITY ID: 0005687

NAME: CHEVRON FAC 106136

ADDRESS: 6600 MEADOWBROOK DR

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 110496

NAME: CHEVRON FAC 106136

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 3/8/96

REPORTED DATE: 2/9/1996 ENTERED DATE: 3/8/1996

PRP INFORMATION

NAME: CHEVRON USA INC

ADDRESS: ADDRESS NOT REPORTED

**HOUSTON TX 77210** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1132 of 1203

UST COMPARTMENT ID: 68370

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 68371

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

Order# 121435 Job# 277689 1133 of 1203

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1983 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1983

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 68372

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES

Order# 121435 Job# 277689 1134 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

# ABOVEGROUND STORAGE TANK INFORMATION NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 182** 

Distance from Property: 0.36 mi. (1,901 ft.) S

Elevation: 624 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 110392

LPST ID: 110392

FACILITY ID: 0049930

NAME: FOREST HILLS MUNICIPAL GARAGE

ADDRESS: 3415 HORTON RD

**FOREST HILL, TX** 

#### **LEAKING TANK DETAILS**

LPST ID: 110392

NAME: FOREST HILLS MUNICIPAL GARAGE FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 5/6/96

REPORTED DATE: 2/7/1996 ENTERED DATE: 5/6/1996

PRP INFORMATION

NAME: CITY OF FOREST HILL

ADDRESS: ADDRESS NOT REPORTED

**FOREST HILL TX 76140** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 01/05/1990

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/05/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1136 of 1203

UST COMPARTMENT ID: 129775

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 01/05/1990

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/05/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**NOT REPORTED** 

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 129774

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 183** 

Distance from Property: 0.362 mi. (1,911 ft.) NNE

Elevation: 605 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 114579

LPST ID: 114579

FACILITY ID: 0059369 NAME: STOP N SHOP

ADDRESS: 5037 WILBARGER ST

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 114579 NAME: STOP N SHOP

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.0 - ASSESSMENT INCOMPLETE NO APPARENT RECEPTORS IMPACTED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 5/6/99

REPORTED DATE: 5/5/1999 ENTERED DATE: 5/6/1999

PRP INFORMATION
NAME: LUONG, VINH

ADDRESS: ADDRESS NOT REPORTED

**FORT WORTH TX 76119** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 05/18/1999 REGISTRATION DATE: 07/26/1999

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/18/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1139 of 1203

UST COMPARTMENT ID: 145617

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-

OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 05/18/1999 REGISTRATION DATE: 07/26/1999

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/18/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL: COMPOSITE

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 145618

TANK ID: 1

COMPARTMENT LETTER: B
SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-

OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

Order# 121435 Job# 277689 1140 of 1203

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 08/13/1991

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/03/1999** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 145615

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

Order# 121435 Job# 277689 1141 of 1203

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 08/13/1991

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/29/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 145616

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 183** 

Distance from Property: 0.362 mi. (1,911 ft.) NNE

Elevation: 605 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 119448

LPST ID: 119448

FACILITY ID: 0059369
NAME: STOP & SHOP

ADDRESS: 5037 WILBARGER ST

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 119448
NAME: STOP & SHOP

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.0 - ASSESSMENT INCOMPLETE NO APPARENT RECEPTORS IMPACTED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 3/7/16

REPORTED DATE: **7/14/2014** ENTERED DATE: **8/15/2014** 

#### PRP INFORMATION

NAME: NGUYEN, BILLY HUNG

ADDRESS: ADDRESS NOT REPORTED

CITY NOT REPORTED

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 184** 

Distance from Property: 0.364 mi. (1,922 ft.) W

Elevation: 640 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 113025

LPST ID: 113025

FACILITY ID: 0034368

NAME: BHOC 9

ADDRESS: 5734 E LANCASTER AVE

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 113025 NAME: BHOC 9

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.0 - ASSESSMENT INCOMPLETE NO APPARENT RECEPTORS IMPACTED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 3/12/98

REPORTED DATE: 3/12/1998 ENTERED DATE: 3/12/1998

PRP INFORMATION

NAME: BARNEY HOLLAND OIL COMPANY
ADDRESS: ADDRESS NOT REPORTED

FORT WORTH TX 76117

CONTACT: **NOT REPORTED**PHONE: **NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 03/04/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1144 of 1203

UST COMPARTMENT ID: 48156

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 03/04/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 48155

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

Order# 121435 Job# 277689 1145 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **03/04/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 48154

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

Order# 121435 Job# 277689 1146 of 1203

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 03/04/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 48157

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 185** 

Distance from Property: 0.377 mi. (1,991 ft.) NNW

Elevation: 631 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 118909

LPST ID: 118909

FACILITY ID: 0050094

NAME: COLONIAL CAR WASH 3

ADDRESS: 5780 W PLEASANT RIDGE RD

ARLINGTON, TX

#### **LEAKING TANK DETAILS**

LPST ID: 118909

NAME: COLONIAL CAR WASH 3
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.0 - ASSESSMENT INCOMPLETE NO APPARENT RECEPTORS IMPACTED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 8/1/12

REPORTED DATE: 7/2/2012 ENTERED DATE: 8/1/2012

PRP INFORMATION

NAME: MACE SECURITY INTERNATIONAL INC

ADDRESS: ADDRESS NOT REPORTED

**HORSHAM PA 19044** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 01/25/1990

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/19/2012** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1148 of 1203

UST COMPARTMENT ID: 126500

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 01/25/1990

TANK CAPACITY (GAL): 8000 **EMPTY TANK: NOT EMPTY** STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/19/2012

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 126499

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

Order# 121435 Job# 277689 1149 of 1203

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 01/25/1990

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/19/2012** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 126501

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 



Order# 121435 Job# 277689 1150 of 1203

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 186** 

Distance from Property: 0.386 mi. (2,038 ft.) WNW

Elevation: 620 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 107390

LPST ID: 107390

FACILITY ID: 0040480

NAME: SLEEPYS LIQUOR

ADDRESS: 5110 MANSFIELD HWY

**FOREST HILL, TX** 

#### **LEAKING TANK DETAILS**

LPST ID: 107390

NAME: SLEEPYS LIQUOR

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 11/17/93

REPORTED DATE: 10/21/1993 ENTERED DATE: 11/17/1993

PRP INFORMATION

NAME: RUSSELL, RUTH

ADDRESS: ADDRESS NOT REPORTED

FORT WORTH TX 76119

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/19/1993

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1152 of 1203

UST COMPARTMENT ID: 112192

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/19/1993** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 112191

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

## Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 187** 

Distance from Property: 0.394 mi. (2,080 ft.) ESE

Elevation: 581 ft.

PROGRAM ID: **85914**RN NUMBER: **RN100976141** 

NAME: AZZ GALVANIZING KENNEDALE

ADDRESS: 1530 GILMAN RD

FORT WORTH, TX 76140

STATUS: **INACTIVE**STATUS DATE: 6/21/2018

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

**MAP ID# 188** 

Distance from Property: 0.394 mi. (2,080 ft.) ESE

Elevation: 602 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 108913

LPST ID: 108913

FACILITY ID: 0053040

NAME: TEXACO

ADDRESS: 6705 MEADOWBROOK DR

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 108913 NAME: TEXACO

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 2.5 - GW IMPACT PUBLIC/DOMESTIC WATER SUPPLY WELL W/IN 0.25MI

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 12/29/94

REPORTED DATE: 9/8/1994 ENTERED DATE: 12/29/1994

PRP INFORMATION

NAME: STAR ENTERPRISES INC

ADDRESS: ADDRESS NOT REPORTED

**IRVING TX 75038** 

CONTACT: **NOT REPORTED**PHONE: **NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/01/1986 REGISTRATION DATE: 04/05/1990

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 10/01/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1156 of 1203

UST COMPARTMENT ID: 110219

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/01/1986 REGISTRATION DATE: 04/05/1990

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 10/01/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 110222

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

Order# 121435 Job# 277689 1157 of 1203

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/01/1986 REGISTRATION DATE: 04/05/1990

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 10/01/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 110221

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES

Order# 121435 Job# 277689 1158 of 1203

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/01/1986 REGISTRATION DATE: 04/05/1990

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 10/01/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 110220

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)
SPILL CONTAINMENT AND OVERFILL PREVENTION: N/A - ALL DELIVERIES TO TANK <= 25 GAL

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

### Closed & Abandoned Landfill Inventory (CALF)

**MAP ID# 189** 

Distance from Property: 0.397 mi. (2,096 ft.) SE

Elevation: 565 ft.

SITE INFORMATION

SITE NUMBER: 1382 SITE NAME: ABAR

LOCATION:

OAK CREST & HWY. 287 & VILLAGE CREEK.

COUNTY: TARRANT

COMMENTS:

LEGAL JUNKYARD WITH PROMISCUOUS DUMPING. OLD CARS & JUNK, SHINGLES, BUILDING MATERIALS, POSSIBLE

HOUSEHOLD GARBAGE.

INSPECTION:

???

OWNER NAME: PRIVATE

DATE OPEN: 0
DATE CLOSE: 0
SIZE (ACRES): 2.00

SIZE (CUBIC YARDS): 0.00 PARTIES: NOT REPORTED

**LANDFILL CONTENTS** 

HOUSEHOLD: YES CONSTRUCTION DEMOLITION: YES

INDUSTRIAL: YES TIRES: YES

AGRICULTURE: NO BRUSH: NO

OTHER: NO LEGAL: YES

UNAUTHORIZED: NO HAZARD UNLIKELY: YES
HAZARD PROBABLY: NO HAZARD CERTAINLY: NO
DEPTH CD: NR MINIMUM THICKNESS: NR

MAXIMUM DEPTH: 0.00 USE: UK

OTHER DESCRIPTION: NOT REPORTED

REVIEWER: NOT REPORTED

### Brownfields Management System (BF)

**MAP ID# 190** 

Distance from Property: 0.399 mi. (2,107 ft.) N

Elevation: 599 ft.

**SITE INFORMATION** 

ID#: 143121

NAME: PLEASANT RIDGE LAND

ADDRESS: 3801 W. PLEASANT RIDGE ROAD

**ARLINGTON, TX 76016** 

TYPE FUNDING: PETROLEUM

PREDOMINANT PAST USE (ACREAGE):

GREENSPACE: RESIDENTIAL: COMMERCIAL: INDUSTRIAL: NOT REPORTED NOT REPORTED NOT REPORTED

FUTURE USE (ACREAGE):

GREENSPACE: RESIDENTIAL: COMMERCIAL: INDUSTRIAL: 1.55 NOT REPORTED NOT REPORTED NOT REPORTED

PROPERTY HIGHLIGHT:

**NOT REPORTED** 

PROPERTY SIZE (Acres): 1.55
CURRENT OWNER: NOT REPORTED
PROPERTY DESCRIPTION/ FORMER USE:

**NOT REPORTED** 

CONTAMINATE(S): NOT REPORTED

CONTAMINATE(S) CLEANED UP: NOT REPORTED

MEDIA(S) AFFECTED: **NOT REPORTED**MEDIA(S) CLEANED UP: **NOT REPORTED** 

TYPE OF BROWNFIELD GRANT: ASSESSMENT

ENVIRONMENTAL ASSESSMENT ACTIVITY: NOT REPORTED

ASSESSMENT START DATE: NOT REPORTED

ASSESSMENT COMPLETION DATE: NOT REPORTED

CLEANUP REQUIRED: NO

STATE & TRIBAL ENROLLMENT ID: NOT REPORTED
STATE & TRIBAL ENROLLMENT DATE: NOT REPORTED

PROPERTY ENROLLED IN A STATE & TRIBAL PROGRAM?: NOT REPORTED

ARE INSTITUTIONAL CONTROLS REQUIRED?: NO

**Back to Report Summary** 

MAP ID# 191

Distance from Property: 0.401 mi. (2,117 ft.) SW

Elevation: 630 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 119285

LPST ID: 119285

FACILITY ID: 0007325

NAME: AMERICAN FOOD STORE
ADDRESS: 4801 MILLER AVE
FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 119285

NAME: AMERICAN FOOD STORE
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6P - FINAL PENDING WELL PLUG

CORRECTIVE ACTION START DATE: 1/13/14

REPORTED DATE: 11/21/2013 ENTERED DATE: 12/17/2013

PRP INFORMATION
NAME: THAI-MAC INC

ADDRESS: ADDRESS NOT REPORTED

CITY NOT REPORTED

CONTACT: **NOT REPORTED**PHONE: **NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 192** 

Distance from Property: 0.402 mi. (2,123 ft.) W

Elevation: 609 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 102439

LPST ID: 102439

FACILITY ID: 0014875 NAME: TRFRICKS INC

ADDRESS: 5012 DAVID STRICKLAND RD

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 102439

NAME: TR FRICKS INC

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 6 - MINOR SOIL CONTAMINATION - NO REMEDIAL ACTION REQUIRED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 4/21/92

REPORTED DATE: 1/25/1991 ENTERED DATE: 4/21/1992

PRP INFORMATION

NAME: NATIONAL BANK OF TEXAS ADDRESS: ADDRESS NOT REPORTED

**FORT WORTH TX 76106** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/25/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

1163 of 1203 

UST COMPARTMENT ID: 148207

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/25/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 148208

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

Order# 121435 Job# 277689 1164 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/25/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 148210

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

Order# 121435 Job# 277689 1165 of 1203

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/25/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 148209

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 121435 Job# 277689 1166 of 1203

**MAP ID# 193** 

Distance from Property: 0.405 mi. (2,138 ft.) NW

Elevation: 649 ft.

### **FACILITY INFORMATION**

GEOSEARCH ID: 113624

LPST ID: 113624

FACILITY ID: 0031449

NAME: S A FOOD STORE

ADDRESS: 2912 VAUGHN BLVD

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 113624

NAME: S A FOOD STORE

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 11/23/98

REPORTED DATE: 11/6/1998 ENTERED DATE: 11/23/1998

PRP INFORMATION

NAME: YELLOW STAR INC

ADDRESS: ADDRESS NOT REPORTED

**ARLINGTON TX 76017** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/12/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/26/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**NOT REPORTED** 

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1167 of 1203

UST COMPARTMENT ID: 81760

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/12/1986

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/26/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 81762

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED



Order# 121435 Job# 277689 1168 of 1203

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/12/1986

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/26/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 81761

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Order# 121435 Job# 277689 1169 of 1203

## Dry Cleaner Remediation Program Sites (DCRPS)

**MAP ID# 194** 

Distance from Property: 0.439 mi. (2,318 ft.) E

Elevation: 591 ft.

DCRP ID: **DC0289**RN NUMBER: **104028667** 

NAME: FORMER KELL CLEANERS
ADDRESS: 6609 LANCASTER AVENUE

FORT WORTH, TX

COORECTIVE ACTION STATUS: TRRP REMEDY STANDARD A - RESIDENTIAL

PRIORITY STATUS: CLOSED DCRP SITE

RANKING SCORE: N/A

TCEQ PROJECT MANAGER: N/A

## Dry Cleaner Remediation Program Sites (DCRPS)

**MAP ID# 194** 

Distance from Property: 0.439 mi. (2,318 ft.) E

Elevation: 591 ft.

DCRP ID: **DCO289**RN NUMBER: **104028667** 

NAME: FORMER KELL CLEANERS
ADDRESS: 6609 LANCASTER AVENUE

FORT WORTH, TX

COORECTIVE ACTION STATUS: TRRP REMEDY STANDARD A - RESIDENTIAL

PRIORITY STATUS: N/A RANKING SCORE: N/A

TCEQ PROJECT MANAGER: N/A

**MAP ID# 195** 

Distance from Property: 0.475 mi. (2,508 ft.) NE

Elevation: 637 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 112225

LPST ID: 112225

FACILITY ID: 0060883

NAME: FORMER SERVICE STATION
ADDRESS: 3536 MILLER AVE

FORT WORTH, TX

#### **LEAKING TANK DETAILS**

LPST ID: 112225

NAME: FORMER SERVICE STATION
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 4/4/97

REPORTED DATE: 4/2/1997 ENTERED DATE: 4/4/1997

PRP INFORMATION

NAME: TEXAS LAND & INVESTMENT CO INC
ADDRESS: ADDRESS NOT REPORTED

FORT WORTH TY 75402

FORT WORTH TX 76102

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

STATUS: REMOVED FROM GROUND

TANK ID: A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 10/17/1991

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

STATUS BEGIN DATE: 04/19/1997

Order# 121435 Job# 277689 1173 of 1203

UST COMPARTMENT ID: 141177

TANK ID: A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: **B** NUMBER OF COMPARTMENTS: **1** INSTALLATION DATE: **08/31/1987** REGISTRATION DATE: **10/17/1991** 

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/19/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN SINGLE WALL: YES

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 141176

TANK ID: B

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: C NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 06/13/1997

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/19/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT REM WITHIN 60 DAYS

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 141178

TANK ID: C

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: D NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 06/13/1997

Order# 121435 Job# 277689 1175 of 1203

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/19/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT REM WITHIN 60 DAYS

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 141179

TANK ID: D

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: **E**NUMBER OF COMPARTMENTS: **1**INSTALLATION DATE: **08/31/1987**REGISTRATION DATE: **06/13/1997** 

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/19/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT REM WITHIN 60 DAYS

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

Order# 121435 Job# 277689 1176 of 1203

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 141180

TANK ID: E

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

# PIPING SYSTEMS MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 196** 

Distance from Property: 0.481 mi. (2,540 ft.) WNW

Elevation: 632 ft.

#### **FACILITY INFORMATION**

GEOSEARCH ID: 116327

LPST ID: 116327

FACILITY ID: 0000966

NAME: M N FOOD MART

ADDRESS: 5201 MANSFIELD HWY

FOREST HILL, TX

#### **LEAKING TANK DETAILS**

LPST ID: 116327

NAME: M N FOOD MART

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 2 - SITE ASSESSMENT

CORRECTIVE ACTION START DATE: 12/30/04

REPORTED DATE: 10/22/2004 ENTERED DATE: 12/30/2004

PRP INFORMATION

NAME: NEW M & N CORPORATION
ADDRESS: ADDRESS NOT REPORTED
ARLINGTON TX 76012

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/31/2004

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FACTORY INSTALLATION** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

Order# 121435 Job# 277689 1178 of 1203

UST COMPARTMENT ID: 105739

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING

(NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING

(NONCORRODIBLE)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/31/2004

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FACTORY INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 105740

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

Order# 121435 Job# 277689 1179 of 1203

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING

(NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING

(NONCORRODIBLE)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/31/2004** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FACTORY INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 105741

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

Order# 121435 Job# 277689 1180 of 1203

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING

(NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING

(NONCORRODIBLE)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary

# Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 197** 

Distance from Property: 0.525 mi. (2,772 ft.) WNW

Elevation: 642 ft.

PROGRAM ID: T1786
RN NUMBER: RN104653332

NAME: COMET CLEANERS FORT WORTH
ADDRESS: 5656 MEADOWBROOK DR
FORT WORTH, TX 76112

STATUS: INACTIVE
STATUS DATE: 9/7/2004
PHASE: TRANSFERRED
LOCATION DESCRIPTION:

**NOT REPORTED** 

# Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 198** 

Distance from Property: 0.8 mi. (4,224 ft.) ESE

Elevation: 561 ft.

PROGRAM ID: T0672
RN NUMBER: RN101435337

NAME: ATOS IT SOLUTIONS AND SERVICES

ADDRESS: 5000 S BOWEN RD
ARLINGTON, TX 76017

STATUS: INACTIVE
STATUS DATE: 3/18/2002
PHASE: TRANSFERRED
LOCATION DESCRIPTION:

NOT REPORTED

# Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 199** 

Distance from Property: 0.885 mi. (4,673 ft.) W

Elevation: 658 ft.

PROGRAM ID: **T0544**RN NUMBER: **RN104623897** 

NAME: NORTHWESTERN MUTUAL LIFE INSURANCE 820 BUSINESS PARK

ADDRESS: NOT REPORTED FORT WORTH, TX

STATUS: **INACTIVE**STATUS DATE: 10/4/2002

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION: WICHITA ST & SE LOOP 820

# **Unlocated Sites Summary**

This list contains sites that could not be mapped due to limited or incomplete address information.

Database Name	Site ID#	Site Name	Address	City/State/Zip/County
PST	67281	CHAMPAGNE WEBBER	BRENTWOOD STAIR & I 30	FORT WORTH 76119 Tarrant
PST	38979	RAS 668017	US HWY 287	KENNEDALE, TX 76060 TARRANT

AIRSAFS Aerometric Information Retrieval System / Air Facility Subsystem

VERSION DATE: 10/20/14

The United States Environmental Protection Agency (EPA) modified the Aerometric Information Retrieval System (AIRS) to a database that exclusively tracks the compliance of stationary sources of air pollution with EPA regulations: the Air Facility Subsystem (AFS). Since this change in 2001, the management of the AIRS/AFS database was assigned to EPA's Office of Enforcement and Compliance Assurance.

BRS Biennial Reporting System

VERSION DATE: 12/31/15

The United States Environmental Protection Agency (EPA), in cooperation with the States, biennially collects information regarding the generation, management, and final disposition of hazardous wastes regulated under the Resource Conservation and Recovery Act of 1976 (RCRA), as amended. The Biennial Report captures detailed data on the generation of hazardous waste from large quantity generators and data on waste management practices from treatment, storage and disposal facilities. Currently, the EPA states that data collected between 1991 and 1997 was originally a part of the defunct Biennial Reporting System and is now incorporated into the RCRAInfo data system.

CDL Clandestine Drug Laboratory Locations

VERSION DATE: 10/05/17

The U.S. Department of Justice ("the Department") provides this information as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments. The Department does not establish, implement, enforce, or certify compliance with clean-up or remediation standards for contaminated sites; the public should contact a state or local health department or environmental protection agency for that information.

**DOCKETS** EPA Docket Data

VERSION DATE: 12/22/05

The United States Environmental Protection Agency Docket data lists Civil Case Defendants, filing dates as far back as 1971, laws broken including section, violations that occurred, pollutants involved, penalties assessed and superfund awards by facility and location. Please refer to ICIS database as source of current data.

EC Federal Engineering Institutional Control Sites

**VERSION DATE: 08/03/15** 

This database includes site locations where Engineering and/or Institutional Controls have been identified as part



Order# 121435 Job# 277689 1186 of 1203

of a selected remedy for the site as defined by United States Environmental Protection Agency official remedy decision documents. A site listing does not indicate that the institutional and engineering controls are currently in place nor will be in place once the remedy is complete; it only indicates that the decision to include either of them in the remedy is documented as of the completed date of the document. Institutional controls are actions, such as legal controls, that help minimize the potential for human exposure to contamination by ensuring appropriate land or resource use. Engineering controls include caps, barriers, or other device engineering to prevent access, exposure, or continued migration of contamination.

ECHOR06

**Enforcement and Compliance History Information** 

VERSION DATE: 09/01/18

The EPA's Enforcement and Compliance History Online (ECHO) database, provides compliance and enforcement information for facilities nationwide. This database includes facilities regulated as Clean Air Act stationary sources, Clean Water Act direct dischargers, Resource Conservation and Recovery Act hazardous waste handlers, Safe Drinking Water Act public water systems along with other data, such as Toxics Release Inventory releases.

**ERNSTX** 

**Emergency Response Notification System** 

VERSION DATE: 10/28/18

This National Response Center database contains data on reported releases of oil, chemical, radiological, biological, and/or etiological discharges into the environment anywhere in the United States and its territories. The data comes from spill reports made to the U.S. Environmental Protection Agency, U.S. Coast Guard, the National Response Center and/or the U.S. Department of Transportation.

**FRSTX** 

Facility Registry System

VERSION DATE: 10/09/18

The United States Environmental Protection Agency's Office of Environmental Information (OEI) developed the Facility Registry System (FRS) as the centrally managed database that identifies facilities, sites or places subject to environmental regulations or of environmental interest. The Facility Registry System replaced the Facility Index System or FINDS database.

HMIRSR06

Hazardous Materials Incident Reporting System

VERSION DATE: 09/30/18

The HMIRS database contains unintentional hazardous materials release information reported to the U.S. Department of Transportation located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

ICIS

Integrated Compliance Information System (formerly DOCKETS)

VERSION DATE: 09/01/18

ICIS is a case activity tracking and management system for civil, judicial, and administrative federal Environmental Protection Agency enforcement cases. ICIS contains information on federal administrative and federal judicial cases under the following environmental statutes: the Clean Air Act, the Clean Water Act, the Resource Conservation and Recovery Act, the Emergency Planning and Community Right-to-Know Act - Section 313, the Toxic Substances Control Act, the Federal Insecticide, Fungicide, and Rodenticide Act, the Comprehensive Environmental Response, Compensation, and Liability Act, the Safe Drinking Water Act, and the Marine Protection, Research, and Sanctuaries Act.

**ICISNPDES** 

Integrated Compliance Information System National Pollutant Discharge Elimination System

VERSION DATE: 07/09/17

Authorized by the Clean Water Act, the National Pollutant Discharge Elimination System (NPDES) permit program controls water pollution by regulating point sources that discharge pollutants into waters of the United States. This database is provided by the U.S. Environmental Protection Agency.

**LUCIS** 

Land Use Control Information System

VERSION DATE: 09/01/06

The LUCIS database is maintained by the U.S. Department of the Navy and contains information for former Base Realignment and Closure (BRAC) properties across the United States.

**MLTS** 

Material Licensing Tracking System

VERSION DATE: 06/29/17

MLTS is a list of approximately 8,100 sites which have or use radioactive materials subject to the United States Nuclear Regulatory Commission (NRC) licensing requirements. Disclaimer: Due to agency regulations and policies, this database contains applicant/licensee location information which may or may not be related to the physical location per MLTS site.

NPDESR06

National Pollutant Discharge Elimination System

VERSION DATE: 04/01/07

Authorized by the Clean Water Act, the National Pollutant Discharge Elimination System (NPDES) permit program controls water pollution by regulating point sources that discharge pollutants into waters of the United States. The NPDES database was collected from the U.S. Environmental Protection Agency (EPA) from December 2002 through April 2007. Refer to the PCS and/or ICIS-NPDES database as source of current data. This database includes permitted facilities located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

**PADS** 

PCB Activity Database System

VERSION DATE: 09/14/18

GeoSearch www.geo-search.com 888-396-0042

PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the U.S. Environmental Protection Agency of such activities.

PCSR06 Permit Compliance System

VERSION DATE: 08/01/12

The Permit Compliance System is used in tracking enforcement status and permit compliance of facilities controlled by the National Pollutant Discharge Elimination System (NPDES) under the Clean Water Act and is maintained by the United States Environmental Protection Agency's Office of Compliance. PCS is designed to support the NPDES program at the state, regional, and national levels. This database includes permitted facilities located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas. PCS has been modernized, and no longer exists. National Pollutant Discharge Elimination System (ICIS-NPDES) data can now be found in Integrated Compliance Information System (ICIS).

RCRASC RCRA Sites with Controls

VERSION DATE: 11/21/18

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities with institutional controls in place.

SEMSLIENS SEMS Lien on Property

VERSION DATE: 08/13/18

The U.S. Environmental Protection Agency's (EPA) Office of Solid Waste and Emergency Response, Office of Superfund Remediation and Technology Innovation (OSRTI), has implemented The Superfund Enterprise Management System (SEMS), formerly known as CERCLIS (Comprehensive Environmental Response, Compensation and Liability Information System) to track and report on clean-up and enforcement activities taking place at Superfund sites. SEMS represents a joint development and ongoing collaboration between Superfund's Remedial, Removal, Federal Facilities, Enforcement and Emergency Response programs. This is a listing of SEMS sites with a lien on the property.

SFLIENS CERCLIS Liens

VERSION DATE: 06/08/12

A Federal CERCLA ("Superfund") lien can exist by operation of law at any site or property at which United States Environmental Protection Agency has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties. This database contains those CERCLIS sites where the Lien on Property action is



Order# 121435 Job# 277689 1189 of 1203

complete. Please refer to the SEMSLIENS database as source of current data.

SSTS Section Seven Tracking System

VERSION DATE: 02/01/17

The United States Environmental Protection Agency tracks information on pesticide establishments through the Section Seven Tracking System (SSTS). SSTS records the registration of new establishments and records pesticide production at each establishment. The Federal Insecticide, Fungicide and Rodenticide Act (FIFRA) requires that production of pesticides or devices be conducted in a registered pesticide-producing or device-producing establishment. ("Production" includes formulation, packaging, repackaging, and relabeling.)

TRI Toxics Release Inventory

VERSION DATE: 12/31/16

The Toxics Release Inventory, provided by the United States Environmental Protection Agency, includes data on toxic chemical releases and waste management activities from certain industries as well as federal and tribal facilities. This inventory contains information about the types and amounts of toxic chemicals that are released each year to the air, water, and land as well as information on the quantities of toxic chemicals sent to other facilities for further waste management.

TSCA Toxic Substance Control Act Inventory

VERSION DATE: 12/31/12

The Toxic Substances Control Act (TSCA) was enacted in 1976 to ensure that chemicals manufactured, imported, processed, or distributed in commerce, or used or disposed of in the United States do not pose any unreasonable risks to human health or the environment. TSCA section 8(b) provides the United States Environmental Protection Agency authority to "compile, keep current, and publish a list of each chemical substance that is manufactured or processed in the United States." This TSCA Chemical Substance Inventory contains non-confidential information on the production amount of toxic chemicals from each manufacturer and importer site.

RCRAGR06 Resource Conservation & Recovery Act - Generator

VERSION DATE: 12/17/18

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities currently generating hazardous waste. EPA region 6 includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

1190 of 1203

RCRANGR06 Resource Conservation & Recovery Act - Non-Generator

VERSION DATE: 12/17/18

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities classified as non-generators. Non-Generators do not presently generate hazardous waste. EPA Region 6 includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

ALTFUELS Alternative Fueling Stations

VERSION DATE: 09/01/18

Nationwide list of alternative fueling stations made available by the U.S. Department of Energy's Office of Energy Efficiency & Renewable Energy. Includes Bio-diesel stations, Ethanol (E85) stations, Liquefied Petroleum Gas (Propane) stations, Ethanol (E85) stations, Natural Gas stations, Hydrogen stations, and Electric Vehicle Supply Equipment (EVSE).

FEMAUST FEMA Owned Storage Tanks

VERSION DATE: 12/01/16

This is a listing of FEMA owned underground and aboveground storage tank sites. For security reasons, address information is not released to the public according to the U.S. Department of Homeland Security.

**HISTPST** Historical Gas Stations

VERSION DATE: NR

This historic directory of service stations is provided by the Cities Service Company. The directory includes Cities Service filling stations that were located throughout the United States in 1930.

ICISCLEANERS Integrated Compliance Information System Drycleaners

VERSION DATE: 09/01/18

This is a listing of drycleaner facilities from the Integrated Compliance Information System (ICIS). The U.S. Environmental Protection Agency (EPA) tracks facilities that possess NAIC and SIC codes that classify businesses as drycleaner establishments.

MRDS Mineral Resource Data System

VERSION DATE: 03/15/16

MRDS (Mineral Resource Data System) is a collection of reports describing metallic and nonmetallic mineral resources throughout the world. Included are deposit name, location, commodity, deposit description, geologic characteristics, production, reserves, resources, and references. This database contains the records previously provided in the Mineral Resource Data System (MRDS) of USGS and the Mineral Availability System/Mineral Industry Locator System (MAS/MILS) originated in the U.S. Bureau of Mines, which is now part of USGS.

**MSHA** 

Mine Safety and Health Administration Master Index File

VERSION DATE: 08/31/18

The Mine dataset lists all Coal and Metal/Non-Metal mines under MSHA's jurisdiction since 1/1/1970. It includes such information as the current status of each mine (Active, Abandoned, NonProducing, etc.), the current owner and operating company, commodity codes and physical attributes of the mine. Mine ID is the unique key for this data. This information is provided by the United States Department of Labor - Mine Safety and Health Administration (MSHA).

BF

**Brownfields Management System** 

VERSION DATE: 12/21/18

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. The United States Environmental Protection Agency maintains this database to track activities in the various brown field grant programs including grantee assessment, site cleanup and site redevelopment. This database included tribal brownfield sites.

**DNPL** 

**Delisted National Priorities List** 

VERSION DATE: 11/14/18

This database includes sites from the United States Environmental Protection Agency's Final National Priorities List (NPL) where remedies have proven to be satisfactory or sites where the original analyses were inaccurate, and the site is no longer appropriate for inclusion on the NPL, and final publication in the Federal Register has occurred.

NLRRCRAT

No Longer Regulated RCRA Non-CORRACTS TSD Facilities

VERSION DATE: 12/17/18

This database includes RCRA Non-Corrective Action TSD facilities that are no longer regulated by the United States Environmental Protection Agency or do not meet other RCRA reporting requirements. This listing includes facilities that formerly treated, stored or disposed of hazardous waste.

ODI

Open Dump Inventory

VERSION DATE: 06/01/85

1192 of 1203

The open dump inventory was published by the United States Environmental Protection Agency. An "open dump" is defined as a facility or site where solid waste is disposed of which is not a sanitary landfill which meets the criteria promulgated under section 4004 of the Solid Waste Disposal Act (42 U.S.C. 6944) and which is not a facility for disposal of hazardous waste. This inventory has not been updated since June 1985.

**RCRAT** 

Resource Conservation & Recovery Act - Non-CORRACTS Treatment, Storage & Disposal Facilities

VERSION DATE: 12/17/18

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities recognized as hazardous waste treatment, storage, and disposal sites (TSD).

**SEMS** 

Superfund Enterprise Management System

VERSION DATE: 12/12/18

The U.S. Environmental Protection Agency's (EPA) Office of Solid Waste and Emergency Response, Office of Superfund Remediation and Technology Innovation (OSRTI), has implemented The Superfund Enterprise Management System (SEMS), formerly known as CERCLIS (Comprehensive Environmental Response, Compensation and Liability Information System) to track and report on clean-up and enforcement activities taking place at Superfund sites. SEMS represents a joint development and ongoing collaboration between Superfund's Remedial, Removal, Federal Facilities, Enforcement and Emergency Response programs.

SEMSARCH

Superfund Enterprise Management System Archived Site Inventory

**VERSION DATE: 12/13/18** 

The U.S. Environmental Protection Agency's (EPA) Superfund Enterprise Management System Archived Site Inventory (List 8R Archived) replaced the CERCLIS NFRAP reporting system in 2015. This listing reflects sites at which the EPA has determined that assessment has been completed and no further remedial action is planned under the Superfund program.

**SMCRA** 

Surface Mining Control and Reclamation Act Sites

VERSION DATE: 09/14/18

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by the Office of Surface Mining Reclamation and Enforcement (OSMRE) to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

USUMTRCA Uranium Mill Tailings Radiation Control Act Sites

VERSION DATE: 03/04/17

The Legacy Management Office of the Department of Energy (DOE) manages radioactive and chemical waste, environmental contamination, and hazardous material at over 100 sites across the U.S. The L.M. Office manages this database of sites registered under the Uranium Mill Tailings Control Act (UMTRCA).

**DOD** Department of Defense Sites

VERSION DATE: 12/01/14

This information originates from the National Atlas of the United States Federal Lands data, which includes lands owned or administered by the Federal government. Army DOD, Army Corps of Engineers DOD, Air Force DOD, Navy DOD and Marine DOD areas of 640 acres or more are included.

FUDS Formerly Used Defense Sites

VERSION DATE: 06/01/15

The Formerly Used Defense Sites (FUDS) inventory includes properties previously owned by or leased to the United States and under Secretary of Defense Jurisdiction, as well as Munitions Response Areas (MRAs). The remediation of these properties is the responsibility of the Department of Defense. This data is provided by the U.S. Army Corps of Engineers (USACE), the boundaries/polygon data are based on preliminary findings and not all properties currently have polygon data available. DISCLAIMER: This data represents the results of data collection/processing for a specific USACE activity and is in no way to be considered comprehensive or to be used in any legal or official capacity as presented on this site. While the USACE has made a reasonable effort to insure the accuracy of the maps and associated data, it should be explicitly noted that USACE makes no warranty, representation or guaranty, either expressed or implied, as to the content, sequence, accuracy, timeliness or completeness of any of the data provided herein. For additional information on Formerly Used Defense Sites please contact the USACE Public Affairs Office at (202) 528-4285.

**FUSRAP** Formerly Utilized Sites Remedial Action Program

VERSION DATE: 03/04/17

The U.S. Department of Energy (DOE) established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from the Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations. The DOE Office of Legacy Management (LM) established long-term surveillance and maintenance (LTS&M) requirements for remediated FUSRAP sites. DOE evaluates the final site conditions of a remediated site on the basis of risk for different future uses. DOE then confirms that LTS&M requirements will maintain protectiveness.

NLRRCRAC No Longer Regulated RCRA Corrective Action Facilities

VERSION DATE: 12/17/18



Order# 121435 Job# 277689 1194 of 1203

This database includes RCRA Corrective Action facilities that are no longer regulated by the United States Environmental Protection Agency or do not meet other RCRA reporting requirements.

NMS Former Military Nike Missile Sites

VERSION DATE: 12/01/84

This information was taken from report DRXTH-AS-IA-83A016 (Historical Overview of the Nike Missile System, 12/1984) which was performed by Environmental Science and Engineering, Inc. for the U.S. Army Toxic and Hazardous Materials Agency Assessment Division. The Nike system was deployed between 1954 and the mid-1970's. Among the substances used or stored on Nike sites were liquid missile fuel (JP-4); starter fluids (UDKH, aniline, and furfuryl alcohol); oxidizer (IRFNA); hydrocarbons (motor oil, hydraulic fluid, diesel fuel, gasoline, heating oil); solvents (carbon tetrachloride, trichloroethylene, trichloroethane, stoddard solvent); and battery electrolyte. The quantities of material a disposed of and procedures for disposal are not documented in published reports. Virtually all information concerning the potential for contamination at Nike sites is confined to personnel who were assigned to Nike sites. During deactivation most hardware was shipped to depot-level supply points. There were reportedly instances where excess materials were disposed of on or near the site itself at closure. There was reportedly no routine site decontamination.

NPL National Priorities List

VERSION DATE: 11/14/18

This database includes United States Environmental Protection Agency (EPA) National Priorities List sites that fall under the EPA's Superfund program, established to fund the cleanup of the most serious uncontrolled or abandoned hazardous waste sites identified for possible long-term remedial action.

PNPL Proposed National Priorities List

VERSION DATE: 11/14/18

This database contains sites proposed to be included on the National Priorities List (NPL) in the Federal Register. The United States Environmental Protection Agency investigates these sites to determine if they may present long-term threats to public health or the environment.

RCRAC Resource Conservation & Recovery Act - Corrective Action Facilities

VERSION DATE: 12/17/18

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities with corrective action activity.

1195 of 1203

RCRASUBC Resource Conservation & Recovery Act - Subject to Corrective Action Facilities

VERSION DATE: 12/17/18

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities subject to corrective actions.

RODS Record of Decision System

VERSION DATE: 08/13/18

These decision documents maintained by the United States Environmental Protection Agency describe the chosen remedy for NPL (Superfund) site remediation. They also include site history, site description, site characteristics, community participation, enforcement activities, past and present activities, contaminated media, the contaminants present, and scope and role of response action.

**GWCC** Groundwater Contamination Cases

VERSION DATE: 12/31/17

This is a Joint Groundwater Monitoring and Contamination Report provided by the Texas Commission on Environmental Quality (TCEQ). The annual report describes the status of groundwater monitoring activities conducted or required by each agency at regulated facilities or associated with regulated activities. The report provides a general overview of groundwater monitoring by participating members on a program by program basis. Groundwater contamination is broadly defined in the report as any detrimental alteration of the naturally occurring quality of groundwater.

HISTGWCC Historic Groundwater Contamination Cases

VERSION DATE: 12/31/16

This is a Joint Groundwater Monitoring and Contamination Report provided by the Texas Commission on Environmental Quality (TCEQ) that includes historic groundwater contamination cases reported since 1994. These cases have been closed by a program area or agency, such as the TCEQ, the Railroad Commission of Texas, and/or the Texas Alliance of Groundwater Districts. According to the TCEQ report, although enforcement actions may be closed on these cases, the Activity Status Code descriptions allow that groundwater contamination may still be present at the site and may therefore be of interest to regulatory agencies and the general public.

LANDAPP Land Application Permits

VERSION DATE: 03/01/13

Texas Land Application Permits are a requirement from the Texas Commission on Environmental Quality for any domestic facility that disposes of treated effluent by land application such as surface irrigation, evaporation, drainfields or subsurface land application.

LIENS TCEQ Liens

VERSION DATE: 06/06/18

Liens filed upon State and/or Federal Superfund Sites by the Texas Commission on Environmental Quality.

MSD Municipal Setting Designations

VERSION DATE: 06/01/18

The Texas Commission on Environmental Quality (TCEQ) defines an MSD as an official state designation given to property within a municipality or its extraterritorial jurisdiction that certifies that designated groundwater at the property is not used as potable water, and is prohibited from future use as potable water because that groundwater is contaminated in excess of the applicable potable-water protective concentration level. The prohibition must be in the form of a city ordinance, or a restrictive covenant that is enforceable by the city and filed in the property records. The MSD property can be a single property, multi-property, or a portion of property.

TCEQ Disclaimer: This data is for informational purposes and may not have been prepared for or be suitable for legal, engineering, or surveying purposes. It does not represent an on-the-ground survey and represents only the approximate relative location of property boundaries.

NOV Notice of Violations

VERSION DATE: 02/24/16

This database containing Notice of Violations (NOV) is maintained by the Texas Commission on Environmental Quality. An NOV is a written notification that documents and communicates violations observed during an inspection to the business or individual inspected.

SIEC01 State Institutional/Engineering Control Sites

VERSION DATE: 01/01/19

The Texas Risk Reduction Program (TRRP) requires the placement of institutional controls (e.g., deed notices or restrictive covenants) on affected property in different circumstances as part of completing a response action. In its simplest form, an institutional control (IC) is a legal document that is recorded in the county deed records. In certain circumstances, local zoning or ordinances can serve as an IC. This listing may also include locations where Engineering Controls are in effect, such as a cap, barrier, or other engineering device to prevent access, exposure, or continued migration of contamination. The sites included on this list are regulated by various programs of the Texas Commission on Environmental Quality (TCEQ).

SPILLS Spills Listing

VERSION DATE: 07/20/18

This Texas Commission on Environmental Quality database includes releases of hazardous or potentially hazardous materials into the environment.

TIERII Tier I I Chemical Reporting Program Facilities

VERSION DATE: 12/31/12

The Texas Tier II Chemical Reporting Program in the Department of State Health Services (DSHS) is the state repository for EPCRA-required Emergency Planning Letters (EPLs), which are one-time notifications to the state from facilities that have certain extremely hazardous chemicals in specified amounts. The Program is also the state repository for EPCRA/state-required hazardous chemical inventory reports called Texas Tier Two Reports. This data contains those facility reports for the 2005 through the 2012 calendar years. Please contact the Texas Commission on Environmental Quality Tier II Chemical Reporting Division as the current source for this data, due to confidentiality and safety reasons details such as the location and capacity of on-site hazardous chemicals is only available to local emergency planning agencies, fire departments, and/or owners.

DCR Dry Cleaner Registration Database

VERSION DATE: 11/02/18

The database includes dry cleaning drop stations and facilities registered with the Texas Commission on Environmental Quality.

IHW Industrial and Hazardous Waste Sites

VERSION DATE: 01/04/19

Owner and facility information is included in this database of permitted and non-permitted industrial and hazardous waste sites. Industrial waste is waste that results from or is incidental to operations of industry, manufacturing, mining, or agriculture. Hazardous waste is defined as any solid waste listed as hazardous or possesses one or more hazardous characteristics as defined in federal waste regulations. The IHW database is maintained by the Texas Commission on Environmental Quality.

PIHW Permitted Industrial Hazardous Waste Sites

VERSION DATE: 01/04/19

Owner and facility information is included in this database of all permitted industrial and hazardous waste sites. Industrial waste is waste that results from or is incidental to operations of industry, manufacturing, mining, or agriculture. Hazardous waste is defined as any solid waste listed as hazardous or possesses one or more hazardous characteristics as defined in federal waste regulations. Permitted IHW facilities are regulated under 30 Texas Administrative Code Chapter 335 in addition to federal regulations. The IHW database is maintained by the Texas Commission on Environmental Quality.

**PST** Petroleum Storage Tanks

VERSION DATE: 11/05/18

The Petroleum Storage Tank database is administered by the Texas Commission on Environmental Quality (TCEQ). Both Underground storage tanks (USTs) and Aboveground storage tanks (ASTs) are included in this report. Petroleum Storage Tank registration has been a requirement with the TCEQ since 1986.

APAR Affected Property Assessment Reports

VERSION DATE: 10/05/18

As regulated by the Texas Commission on Environmental Quality, an Affected Property Assessment Report is required when a person is addressing a release of chemical of concern (COC) under 30 TAC Chapter 350, the Texas Risk Reduction Program (TRRP). The purpose of the APAR is to document all relevant affected property information to identify all release sources and COCs, determine the extent of all COCs, identify all transport/exposure pathways, and to determine if any response actions are necessary. The Texas Administrative Code Title 30 §350.4(a)(1) defines affected property as the entire area (i.e. on-site and off-site; including all environmental media) which contains releases of chemicals of concern at concentrations equal to or greater than the assessment level applicable for residential land use and groundwater classification.

BSA Brownfields Site Assessments

VERSION DATE: 01/01/19

The Brownfields Site Assessments database is maintained by the Texas Commission on Environmental Quality (TCEQ). The TCEQ, in close partnership with the U.S. Environmental Protection Agency (EPA) and other federal, state, and local redevelopment agencies, and stakeholders, is facilitating cleanup, transferability, and revitalization of brownfields through the development of regulatory, tax, and technical assistance tools.

CALF Closed & Abandoned Landfill Inventory

VERSION DATE: 11/01/05

The Texas Commission on Environmental Quality, under a contract with Texas State University, and in cooperation with the 24 regional Council of Governments (COGs) in the State, has located over 4,000 closed and abandoned municipal solid waste landfills throughout Texas. This listing contains "unauthorized sites". Unauthorized sites have no permit and are considered abandoned. The information available for each site varies in detail and this historical information is not updated. Please refer to the specific regional COG for the most current information.

**DCRPS** Dry Cleaner Remediation Program Sites

VERSION DATE: 09/01/18

This list of DCRP sites is provided by the Texas Commission on Environmental Quality (TCEQ). According to the TCEQ, the Dry Cleaner Remediation Program (DCRP) establishes a prioritization list of dry cleaner sites and administers the Dry Cleaning Remediation fund to assist with remediation of contamination caused by dry cleaning solvents.

IOP Innocent Owner / Operator Database

VERSION DATE: 01/01/19

Texas Innocent Owner / Operator (IOP), created by House Bill 2776 of the 75th Legislature, provides a certificate to an innocent owner or operator if their property is contaminated as a result of a release or migration of contaminants from a source or sources not located on the property, and they did not cause or contribute to the source or sources of contamination. The IOP database is maintained by the Texas Commission on Environmental Quality.

**LPST** Leaking Petroleum Storage Tanks

VERSION DATE: 11/09/18

The Leaking Petroleum Storage Tank listing is derived from the Petroleum Storage Tank (PST) database and is maintained by the Texas Commission on Environmental Quality. This listing includes aboveground and underground storage tank facilities with reported leaks.



MSWLF Municipal Solid Waste Landfill Sites

VERSION DATE: 09/28/18

The municipal solid waste landfill database is provided by the Texas Commission on Environmental Quality. This database includes active landfills and inactive landfills, where solid waste is treated or stored.

RRCVCP Railroad Commission VCP and Brownfield Sites

VERSION DATE: 11/20/18

According to the Railroad Commission of Texas, their Voluntary Cleanup Program (RRC-VCP) provides an incentive to remediate Oil & Gas related pollution by participants as long as they did not cause or contribute to the contamination. Applicants to the program receive a release of liability to the state in exchange for a successful cleanup.

RWS Radioactive Waste Sites

VERSION DATE: 07/11/06

This Texas Commission on Environmental Quality database contains all sites in the State of Texas that have been designated as Radioactive Waste sites.

STCV Salt Caverns for Petroleum Storage

VERSION DATE: 09/01/06

The salt caverns for petroleum storage database is provided by the Railroad Commission of Texas.

VCP Voluntary Cleanup Program Sites

VERSION DATE: 01/01/19

The Texas Voluntary Cleanup Program (VCP) provides administrative, technical, and legal incentives to encourage the cleanup of contaminated sites in Texas. Since all non-responsible parties, including future lenders and landowners, receive protection from liability to the state of Texas for cleanup of sites under the VCP, most of the constraints for completing real estate transactions at those sites are eliminated. As a result, many unused or underused properties may be restored to economically productive or community beneficial uses. The VCP database is maintained by the Texas Commission on Environmental Quality.

WMRF Recycling Facilities

VERSION DATE: 11/01/12

This listing of recycling facilities is provided by the Texas Commission on Environmental Quality's Recycle Texas Online service. The company information provided in this database is self-reported. Since recyclers post their own information, a facility or company appearing on the list does not imply that it is in compliance with TCEQ

regulations or other applicable laws. This database is no longer maintained and includes the last compilation of the program participants before the Recycle Texas Online program was closed.

IHWCA Industrial and Hazardous Waste Corrective Action Sites

VERSION DATE: 12/10/18

This database is provided by the Texas Commission on Environmental Quality (TCEQ). According to the TCEQ, the mission of the industrial and hazardous waste corrective action program is to oversee the cleanup of sites contaminated from industrial and municipal hazardous and industrial nonhazardous wastes. The goals of this program are to: Ensure that sites are assessed and remediated to levels that protect human health and the environment; Verify that waste management units or facilities are taken out of service and closed properly; and to Facilitate revitalization of contaminated properties.

SF State Superfund Sites

VERSION DATE: 10/13/17

The state Superfund program mission is to remediate abandoned or inactive sites within the state that pose an unacceptable risk to public health and safety or the environment, but which do not qualify for action under the federal Superfund program (NPL - National Priority Listing). As required by the Texas Solid Waste Disposal Act, Texas Health and Safety Code, Chapter 361, the Texas Commission on Environmental Quality identifies and evaluates these facilities for inclusion on the state Superfund registry. This registry includes any recent developments and the anticipated action for these sites.

USTR06 Underground Storage Tanks On Tribal Lands

VERSION DATE: 04/01/18

This database, provided by the United States Environmental Protection Agency (EPA), contains underground storage tanks on Tribal lands located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

**LUSTR06** Leaking Underground Storage Tanks On Tribal Lands

VERSION DATE: 04/01/18

This database, provided by the United States Environmental Protection Agency (EPA), contains leaking underground storage tanks on Tribal lands located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

ODINDIAN Open Dump Inventory on Tribal Lands

VERSION DATE: 11/08/06


This Indian Health Service database contains information about facilities and sites on tribal lands where solid waste is disposed of, which are not sanitary landfills or hazardous waste disposal facilities, and which meet the criteria promulgated under section 4004 of the Solid Waste Disposal Act (42 U.S.C. 6944).


INDIANRES Indian Reservations


VERSION DATE: 01/01/00


The Department of Interior and Bureau of Indian Affairs maintains this database that includes American Indian Reservations, off-reservation trust lands, public domain allotments, Alaska Native Regional Corporations and Recognized State Reservations.




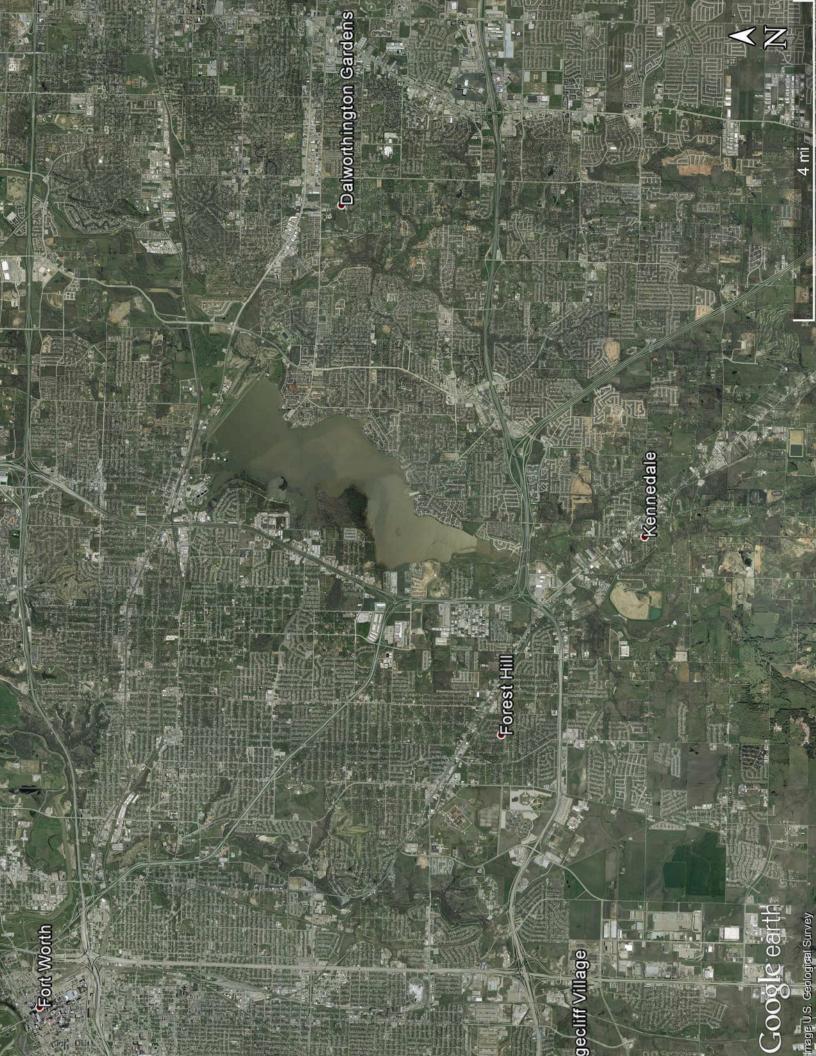


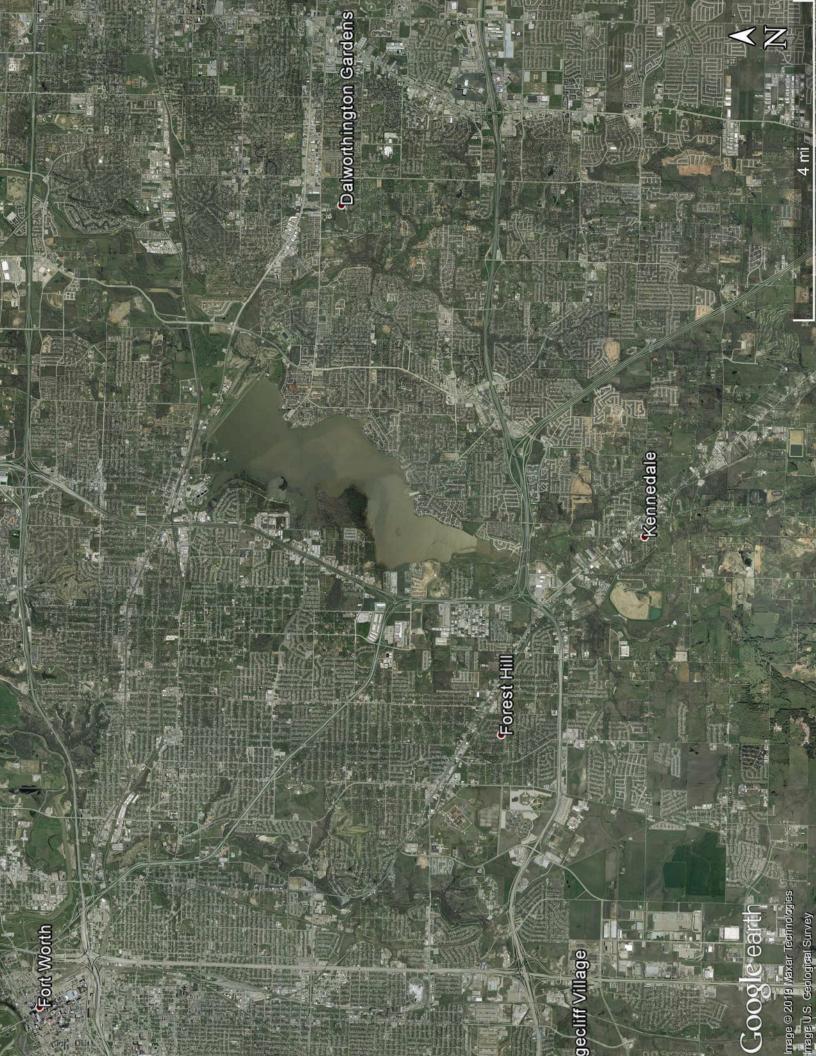


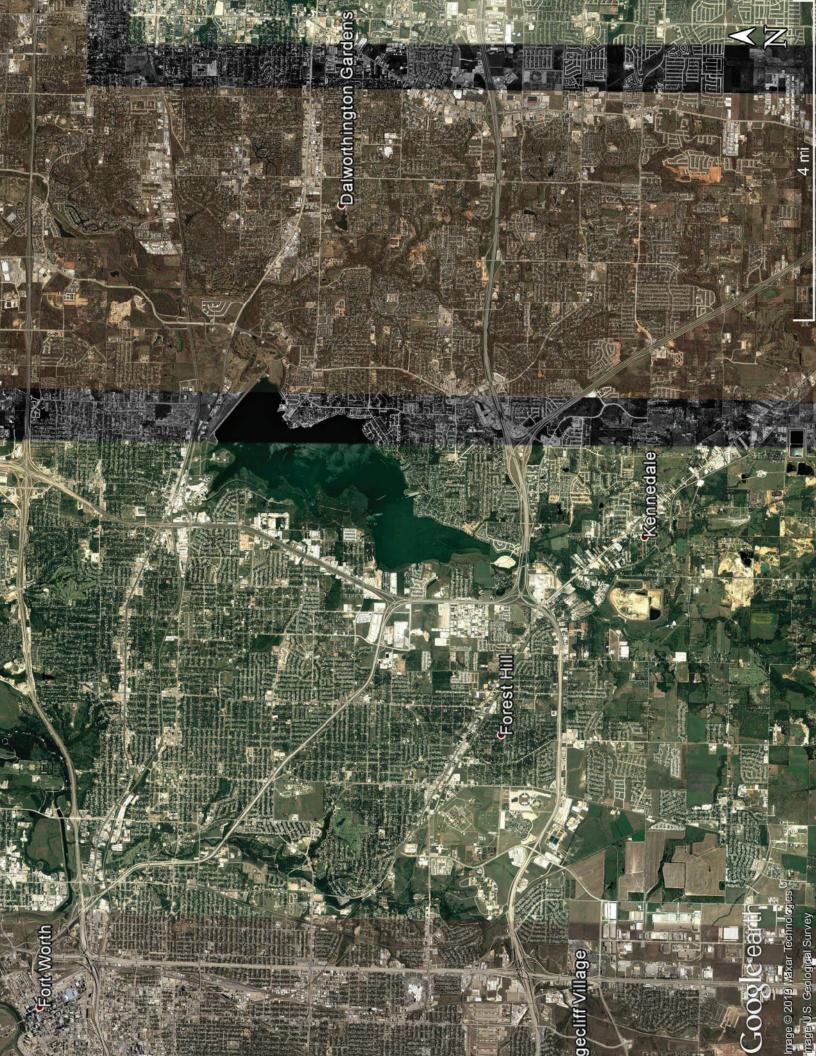


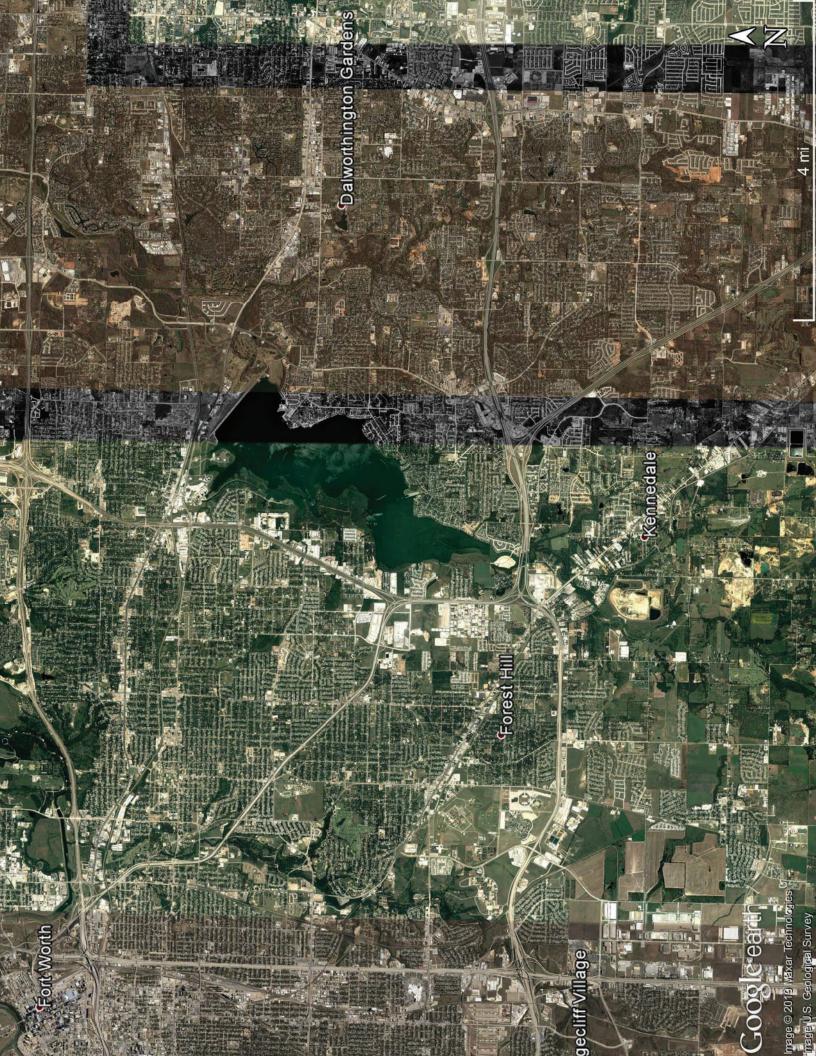


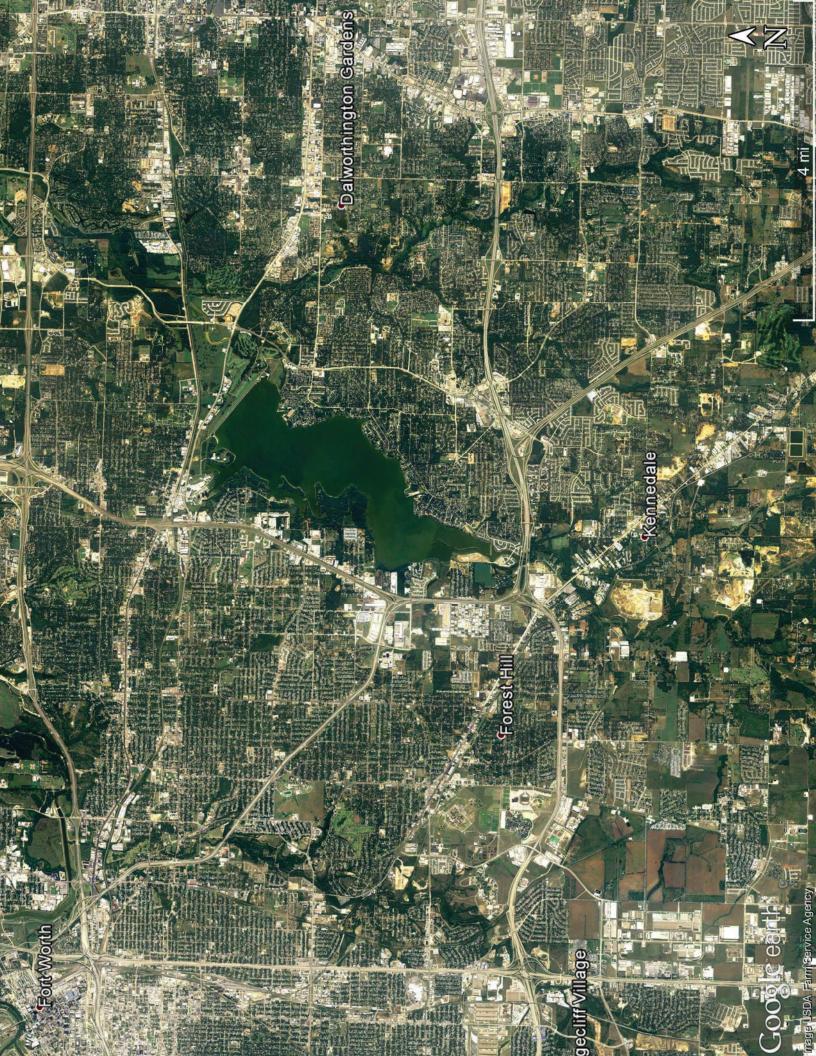


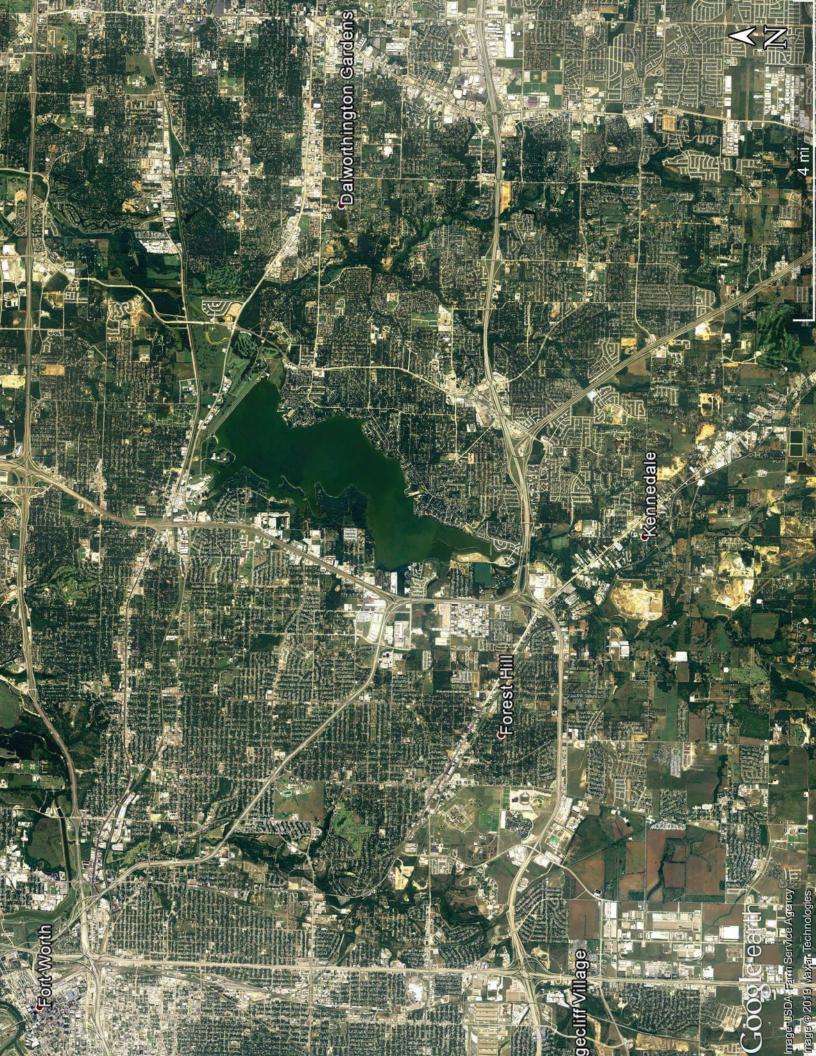


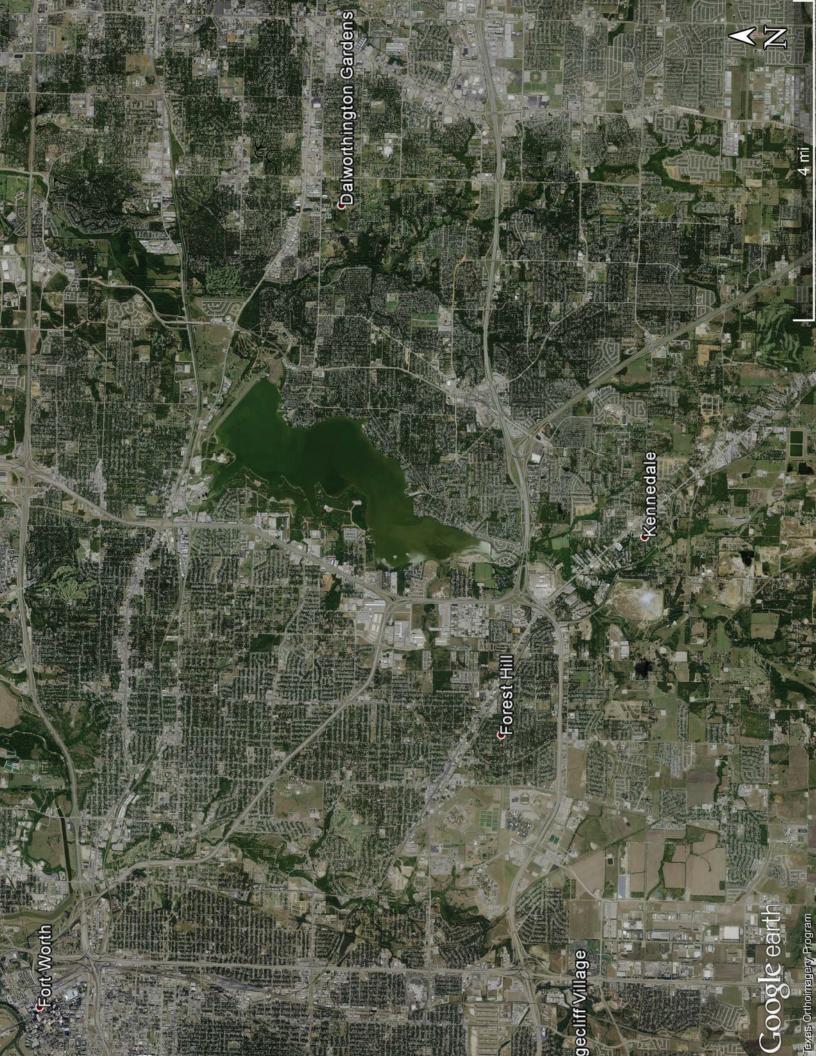


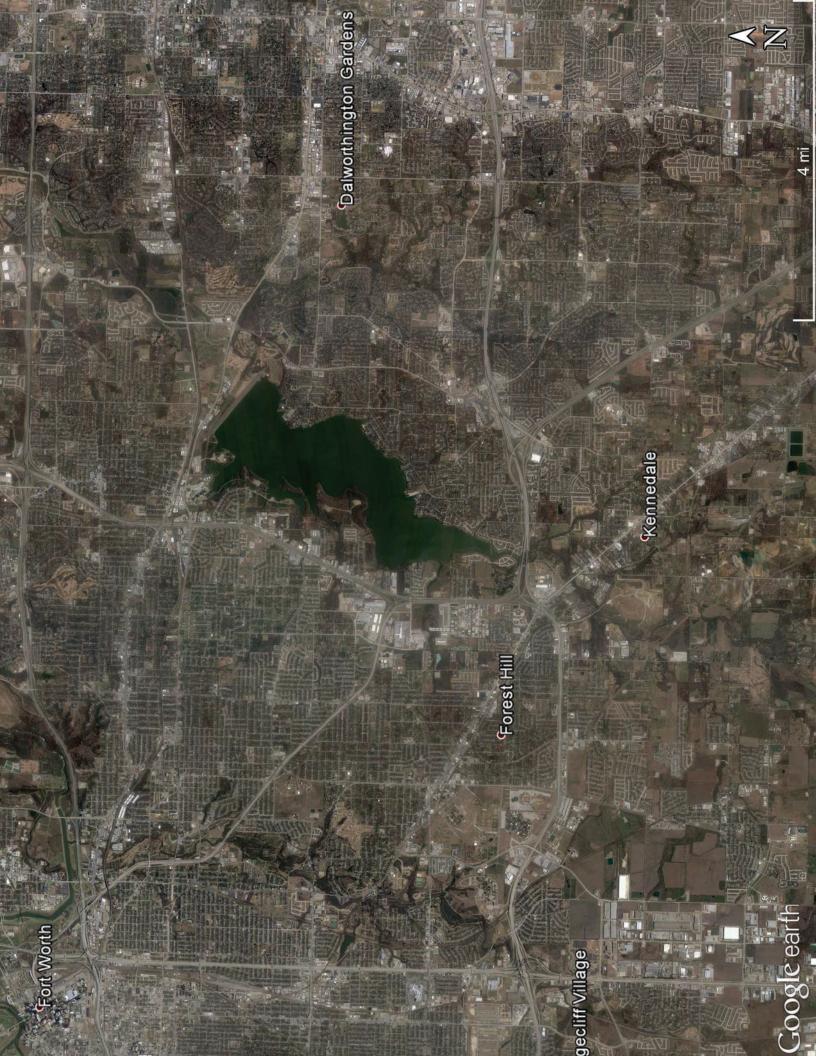


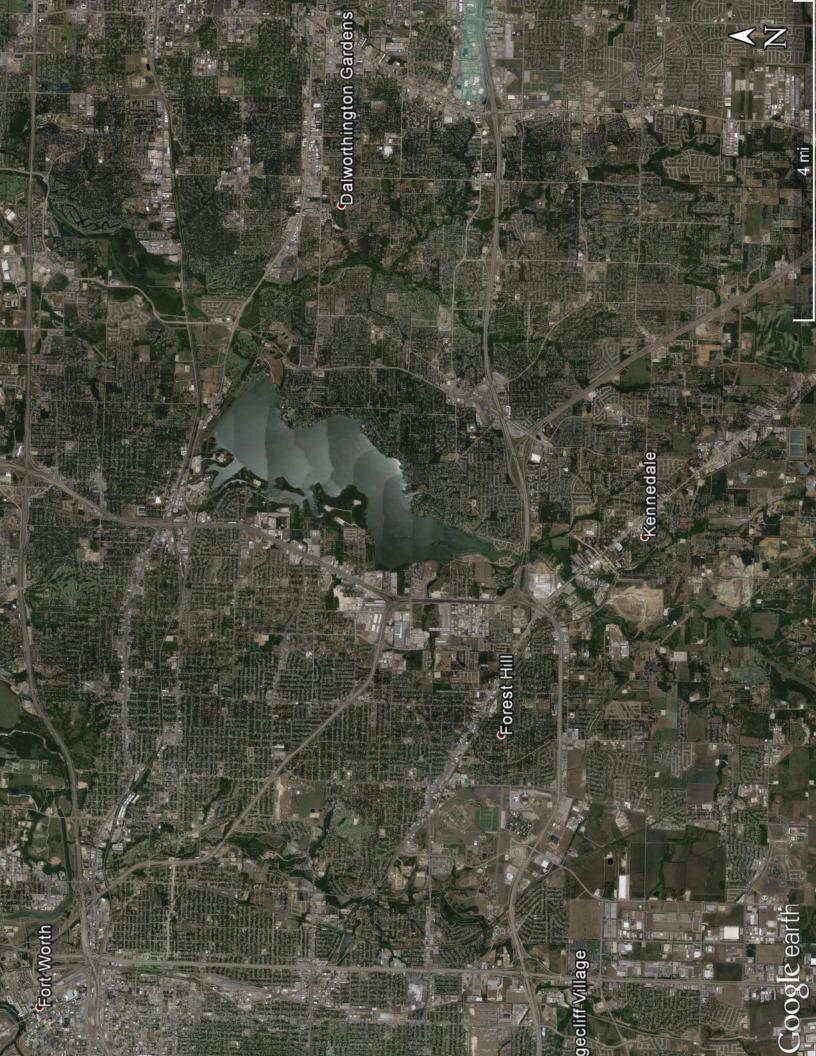


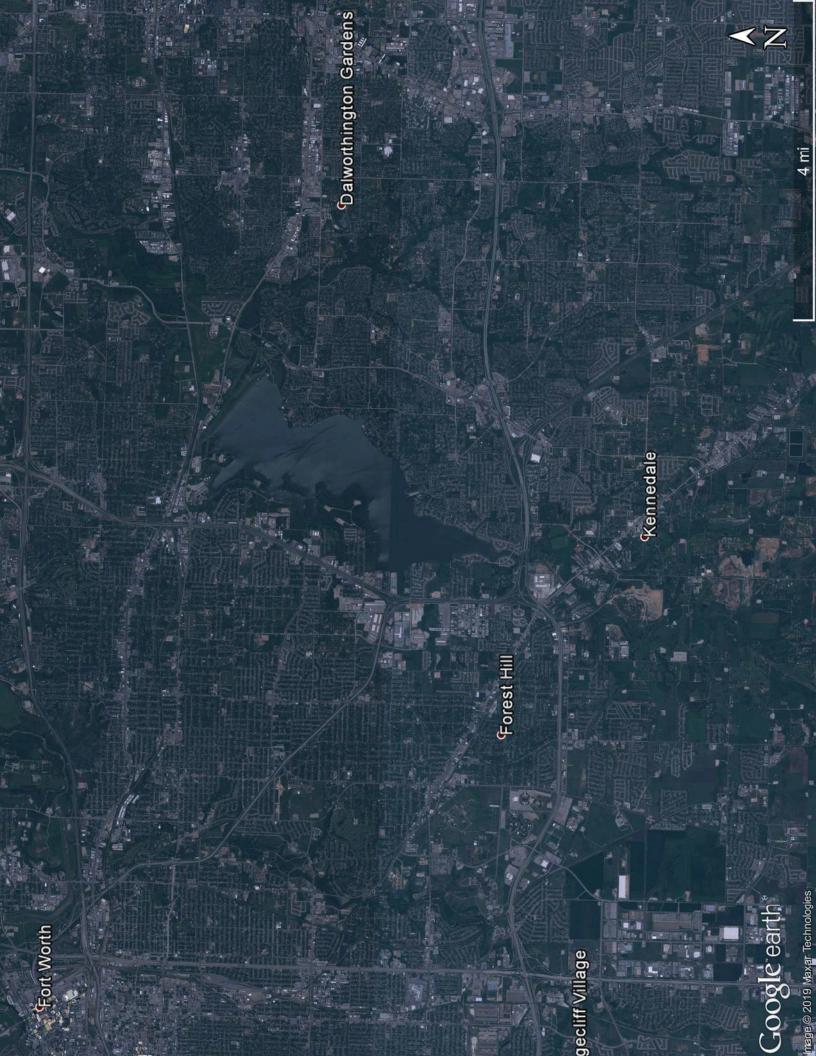


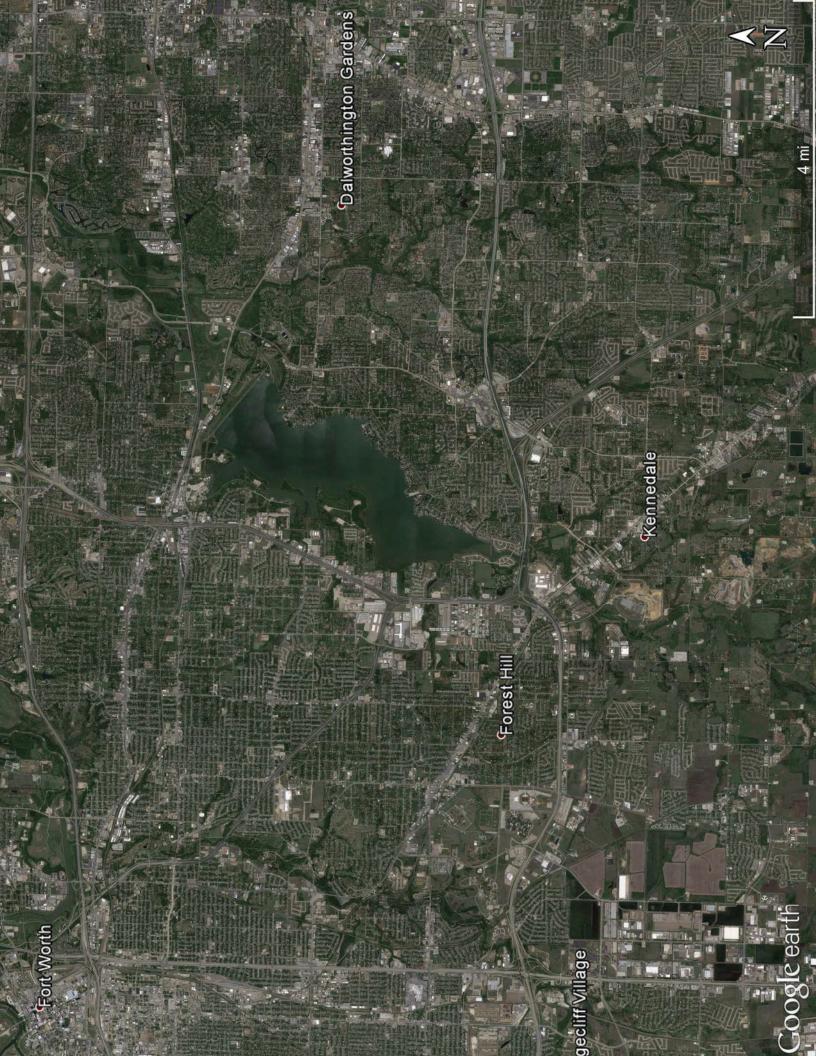


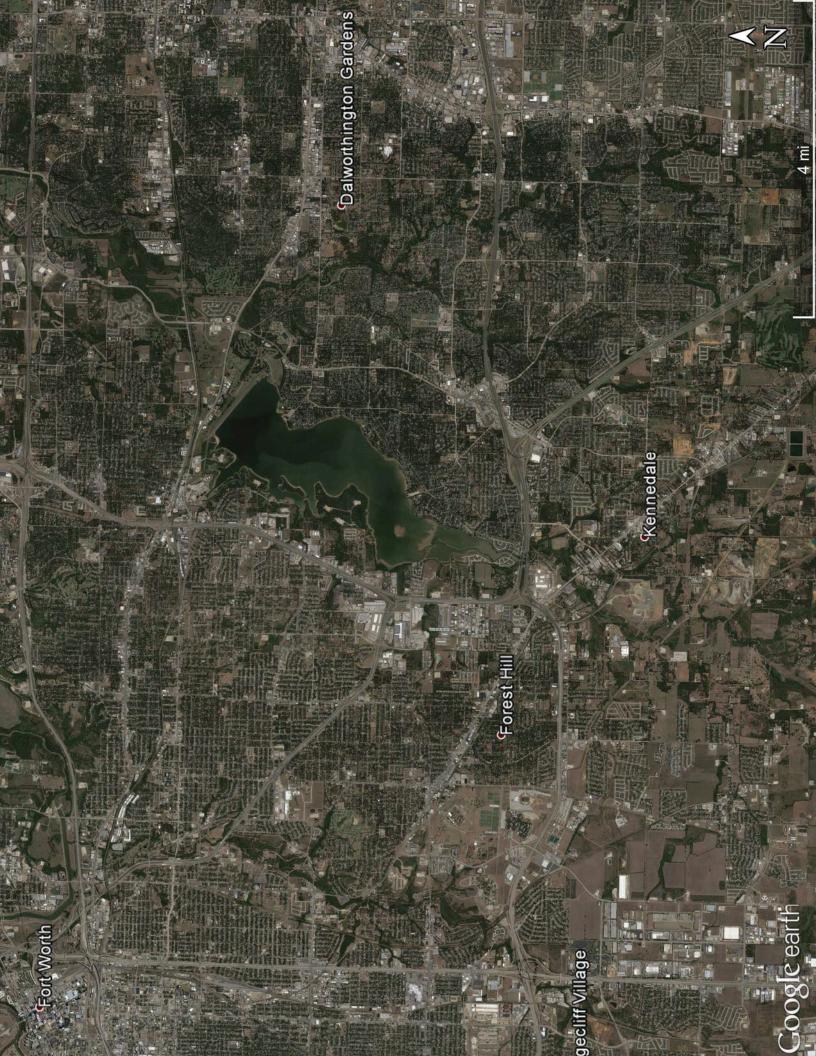

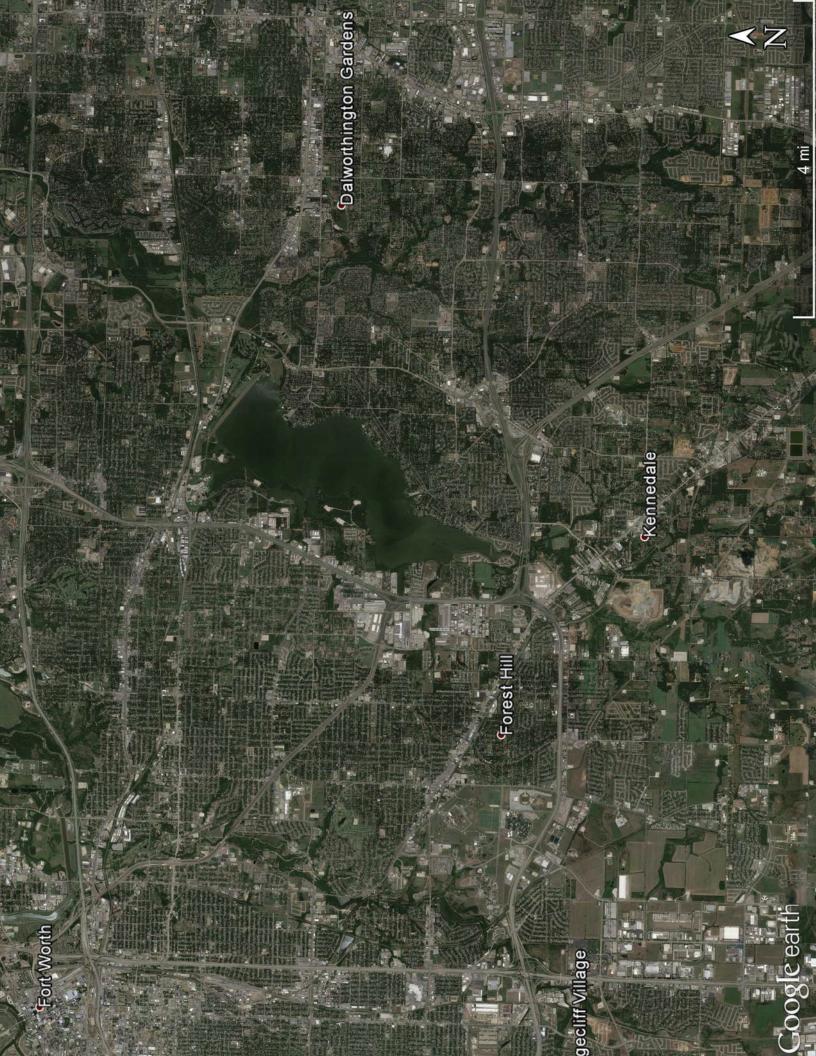

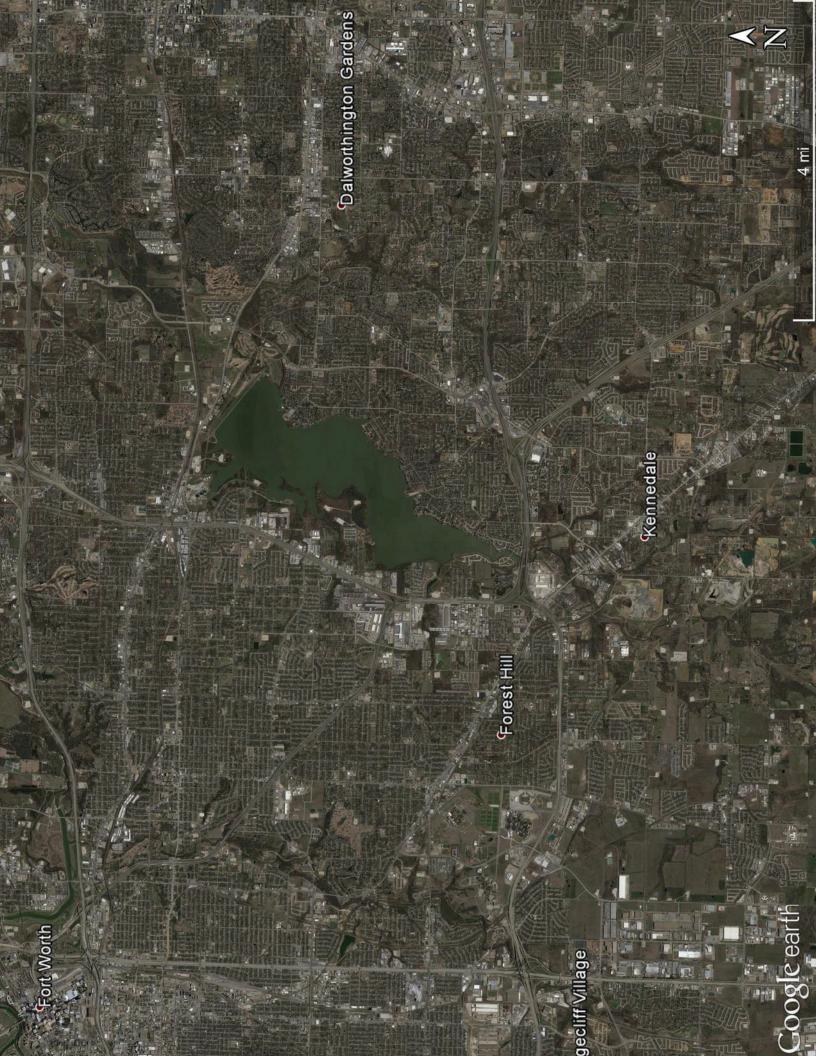

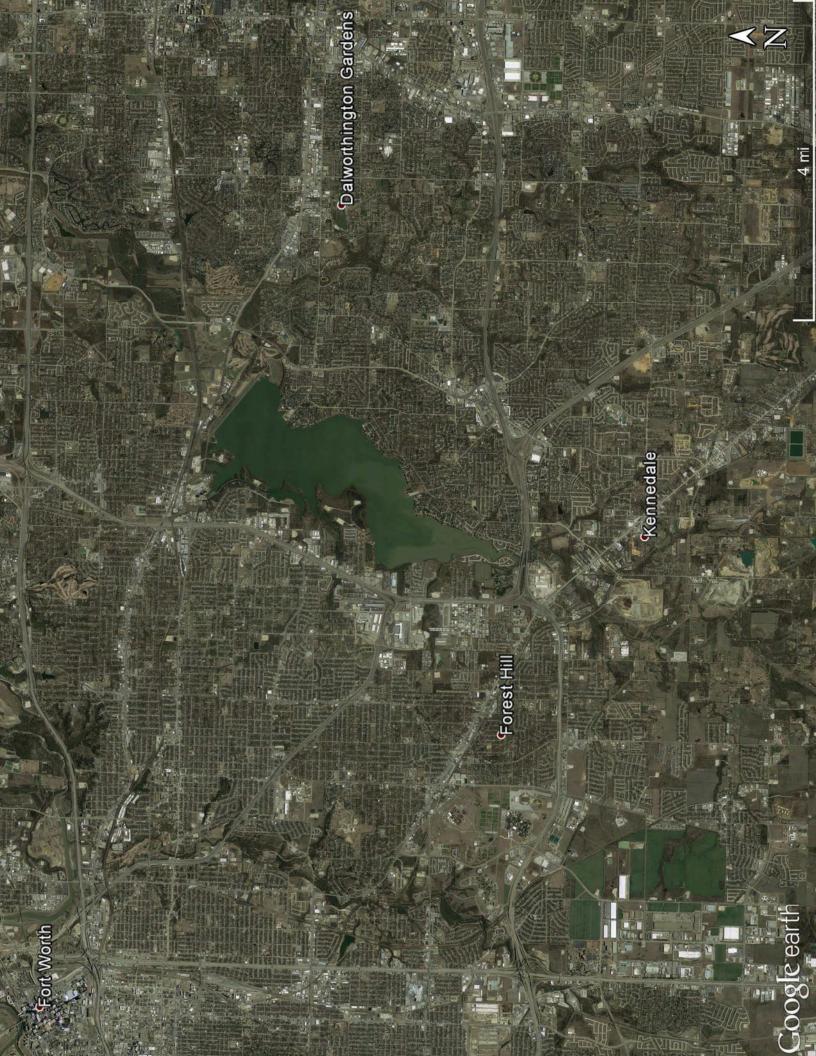

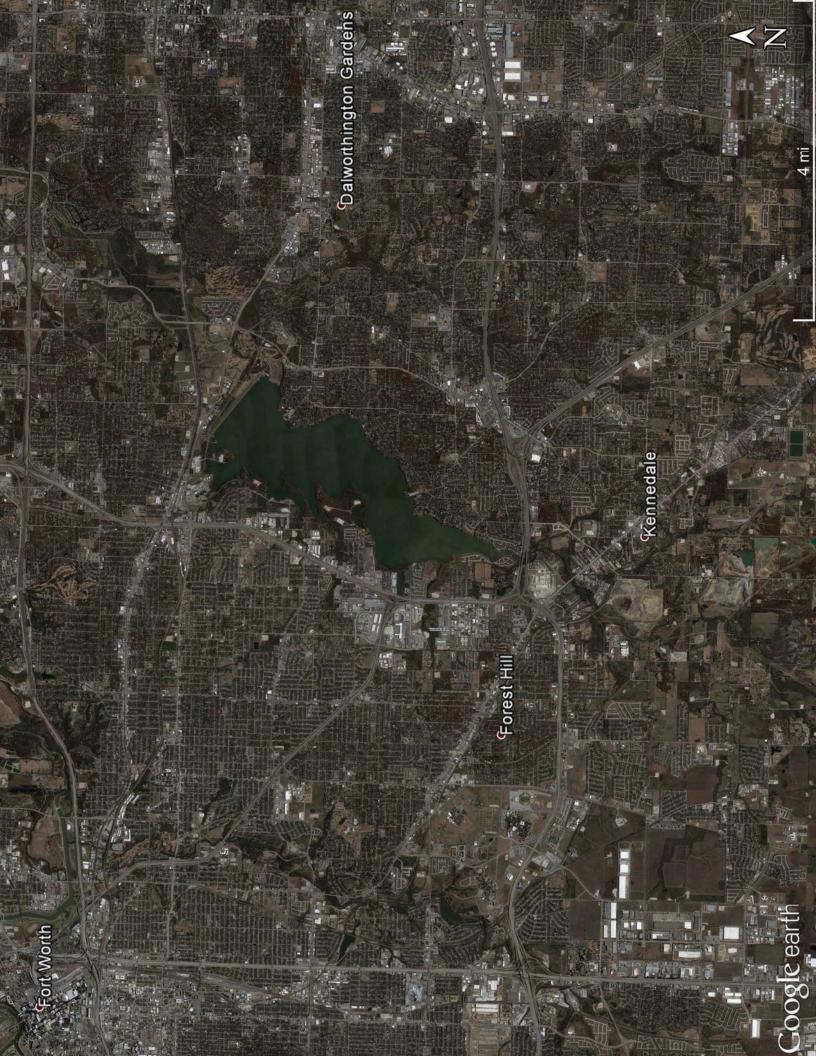












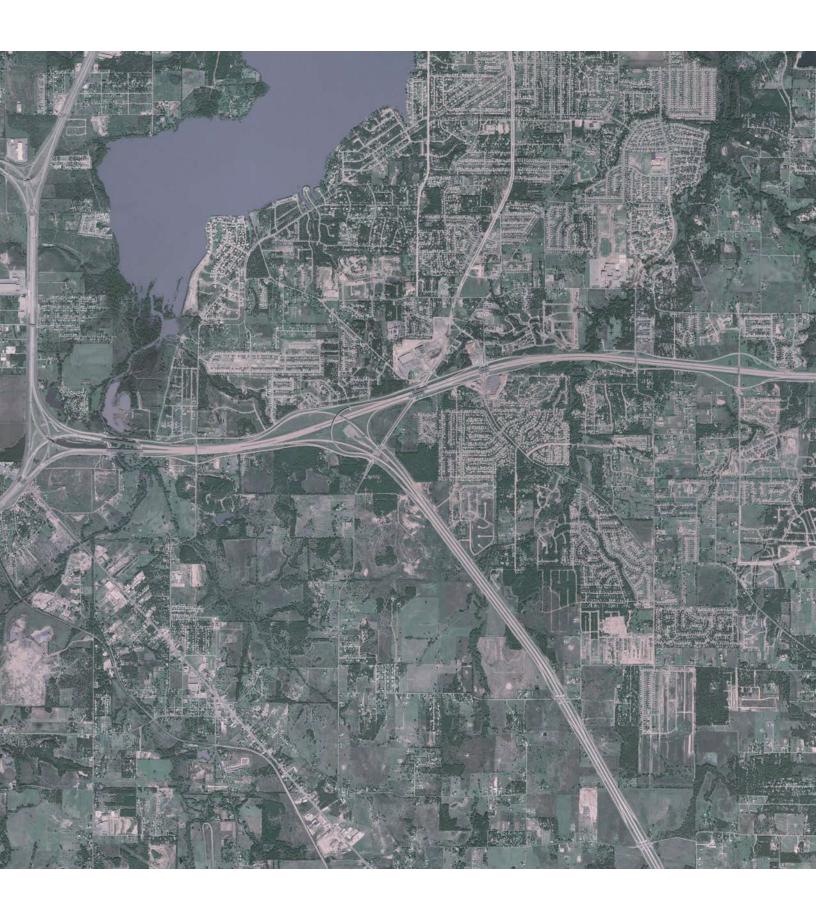














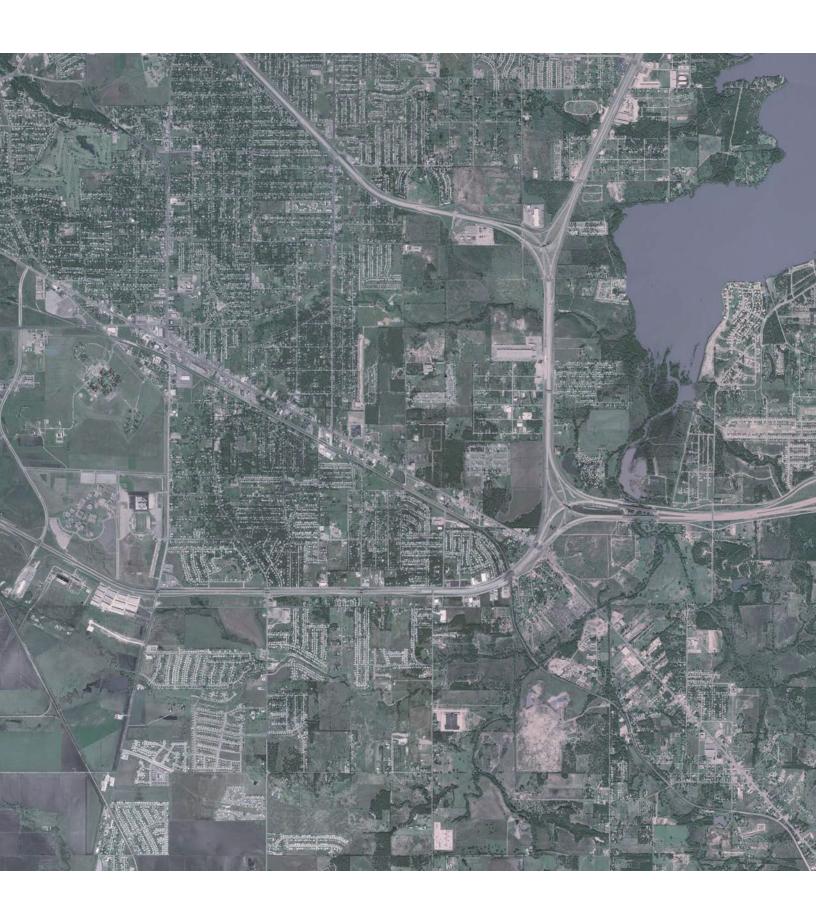


























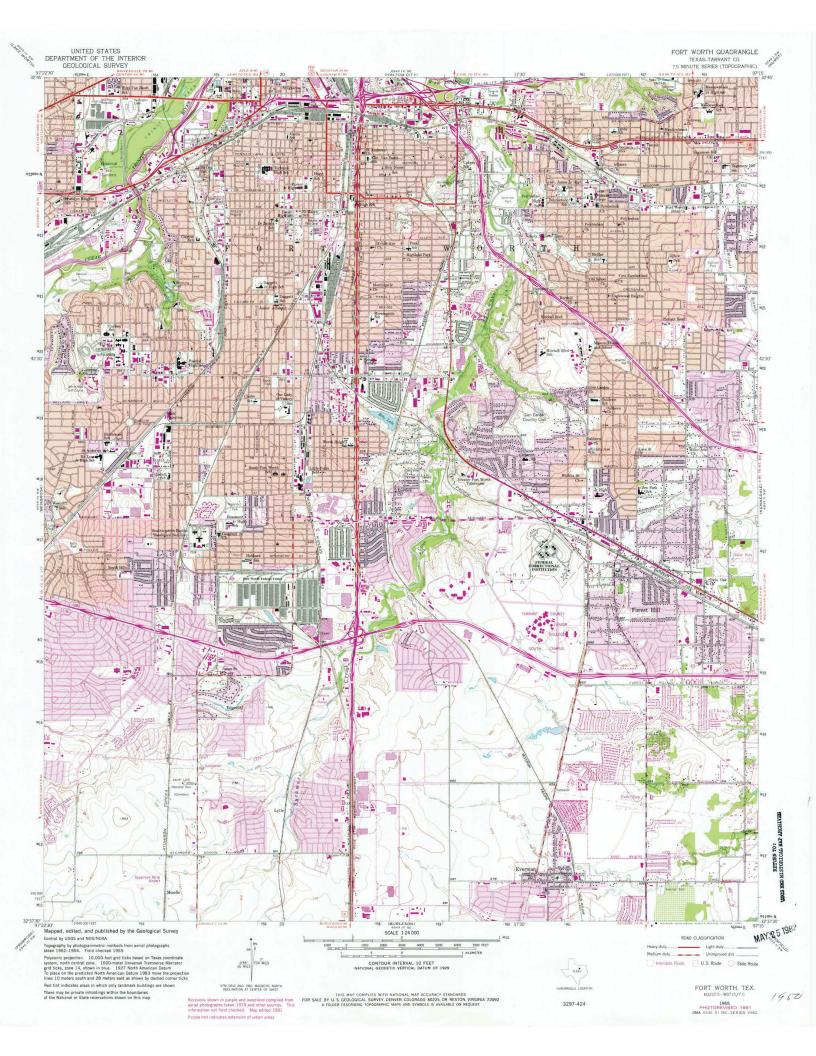


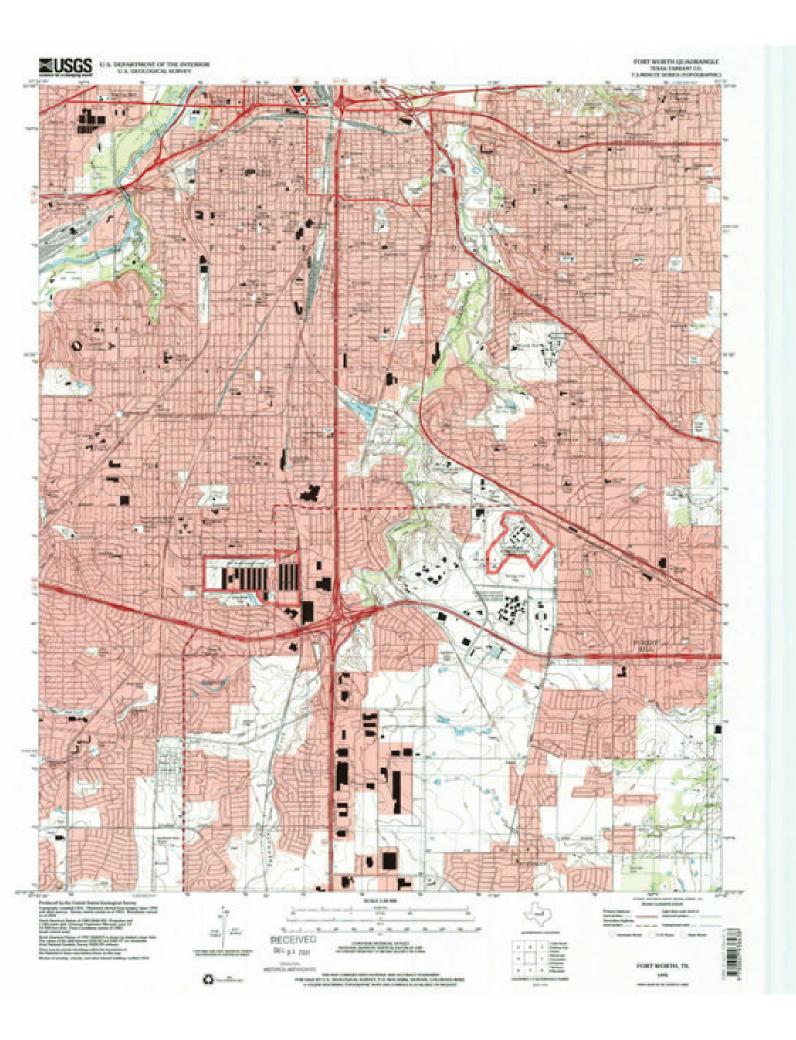








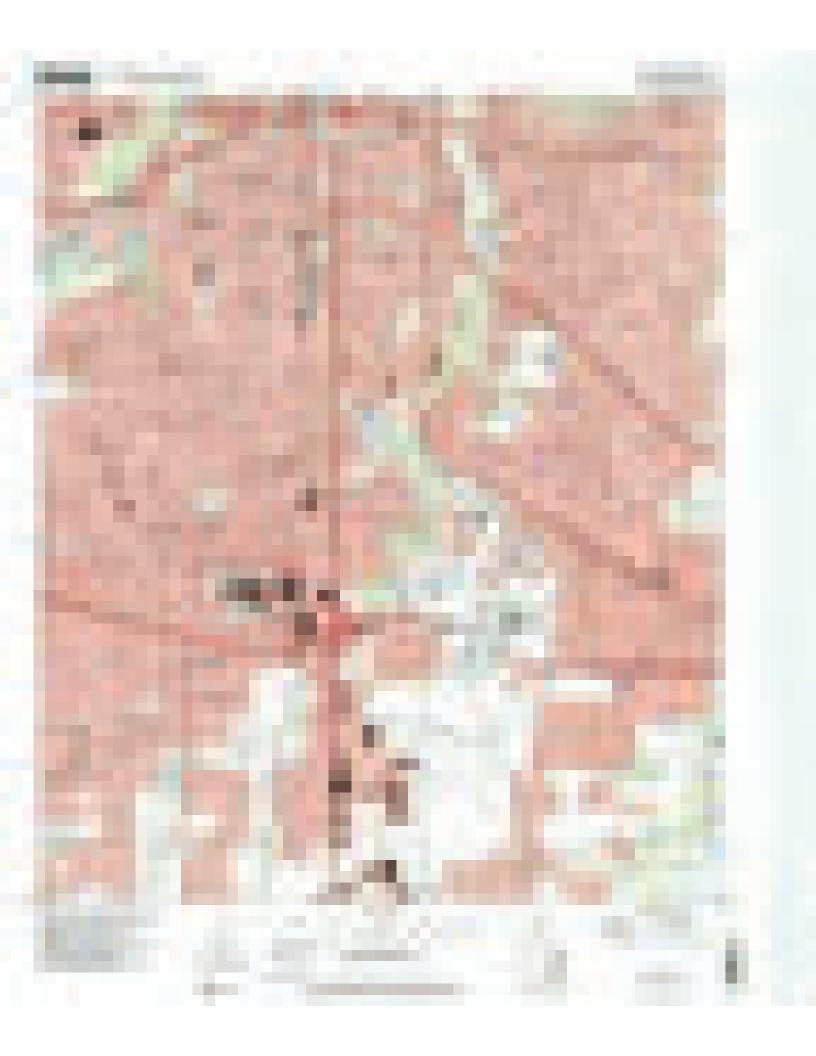


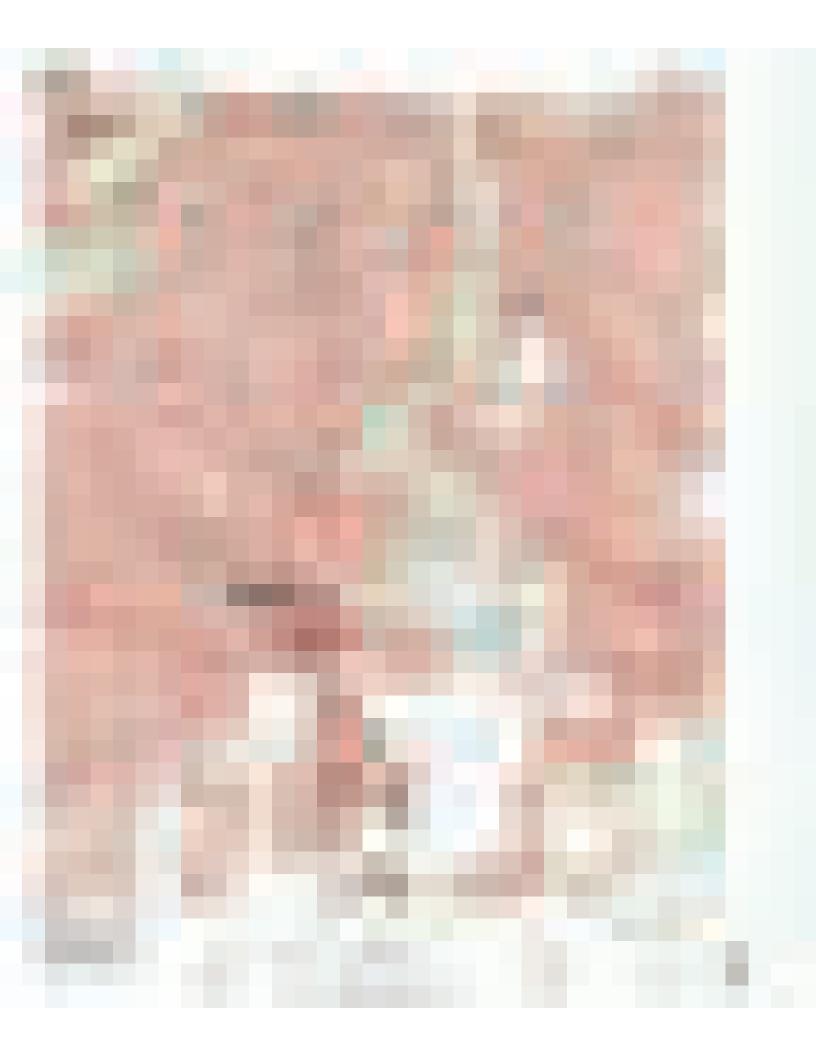


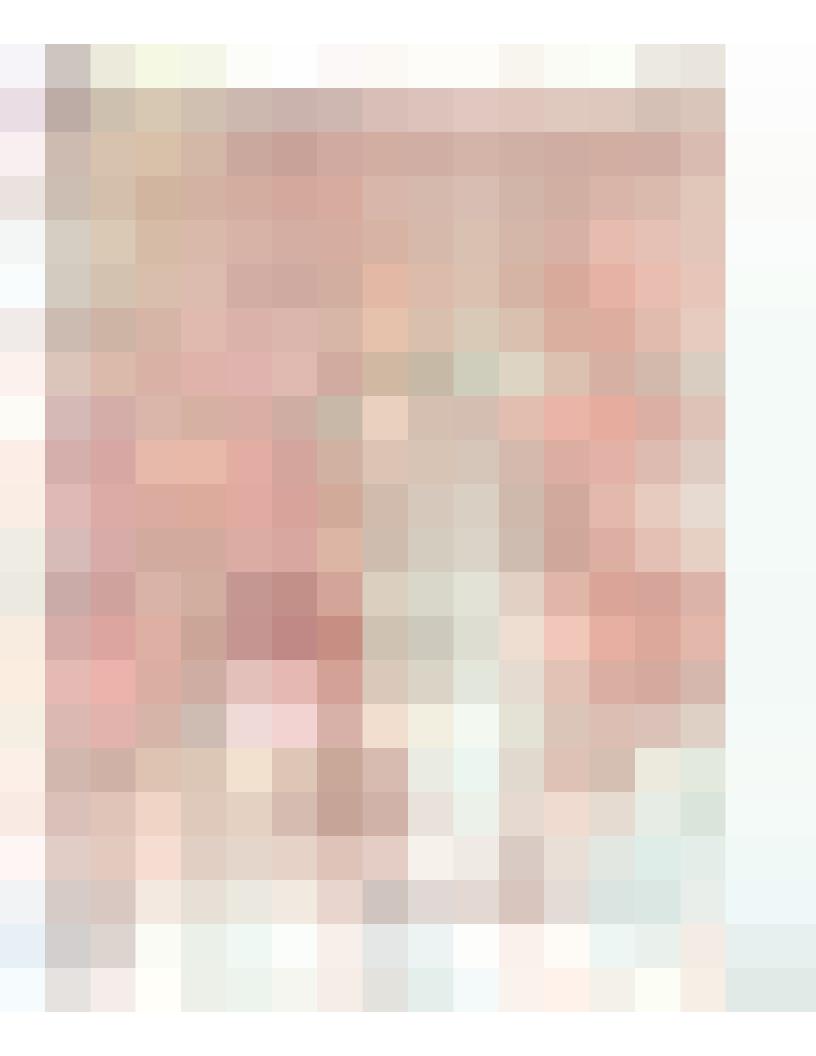

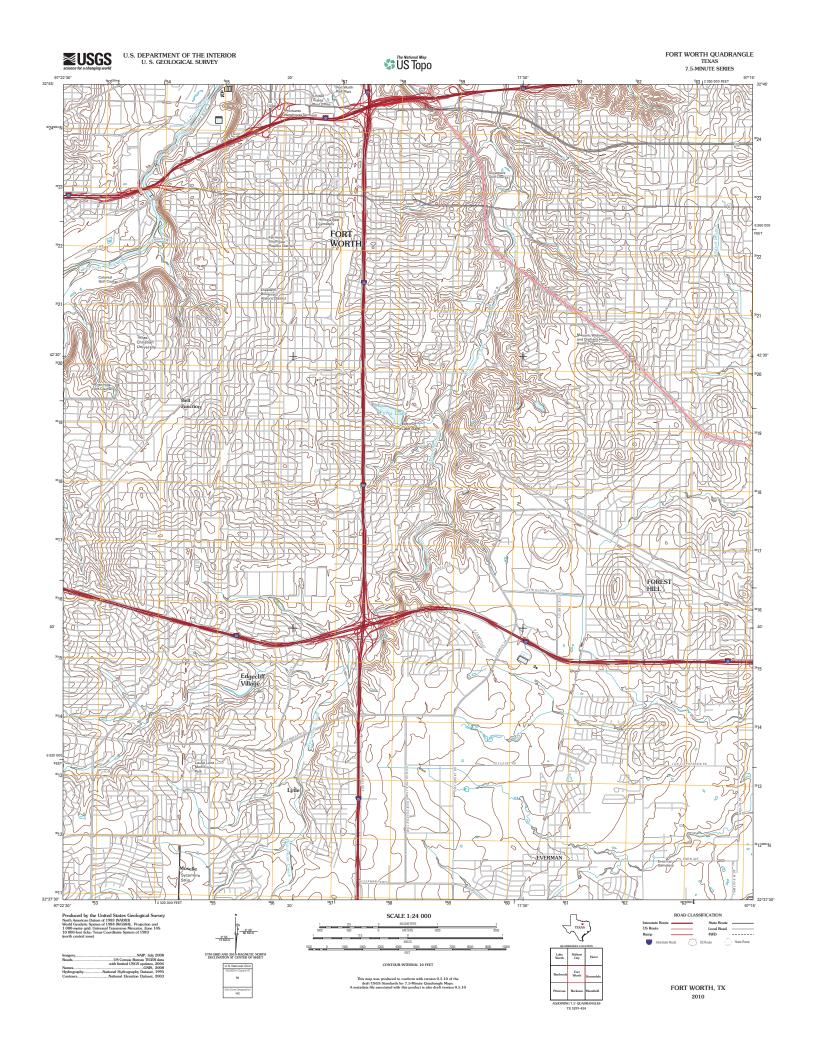


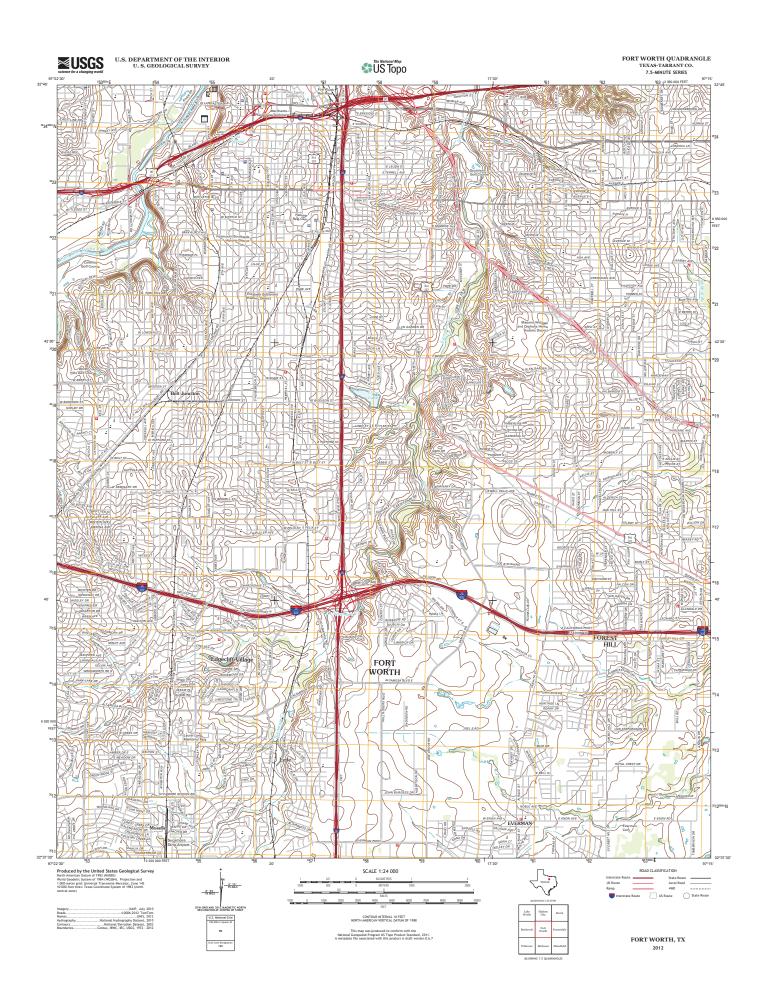


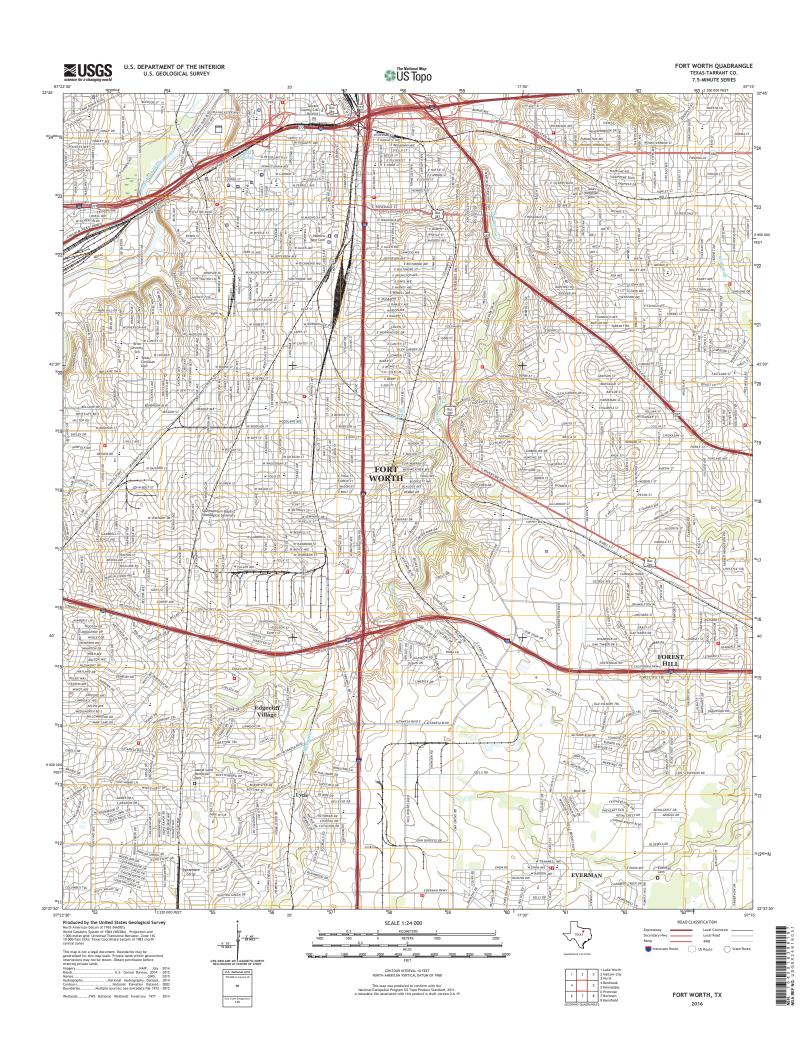


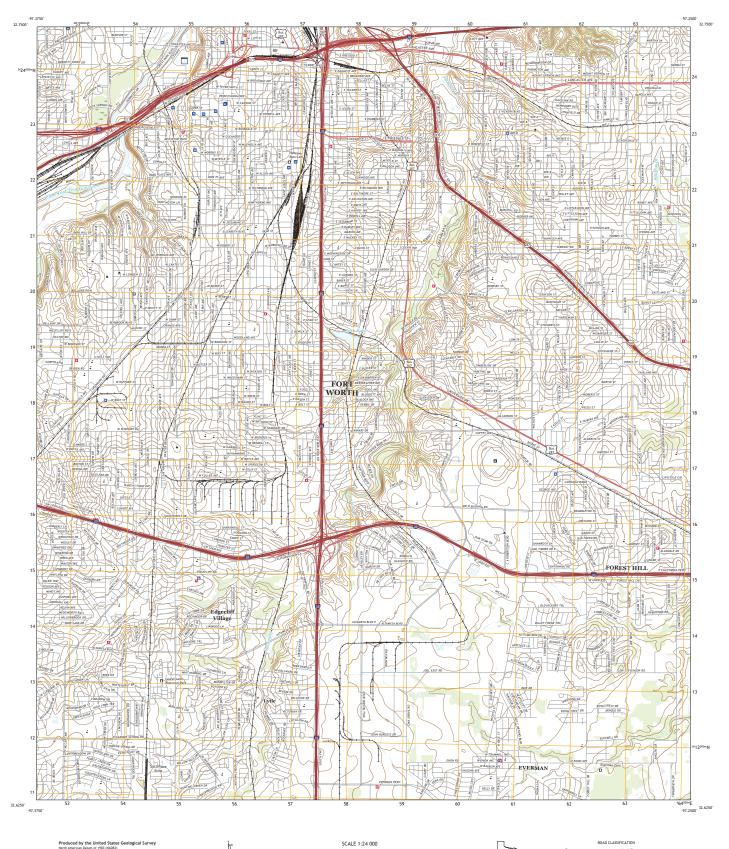





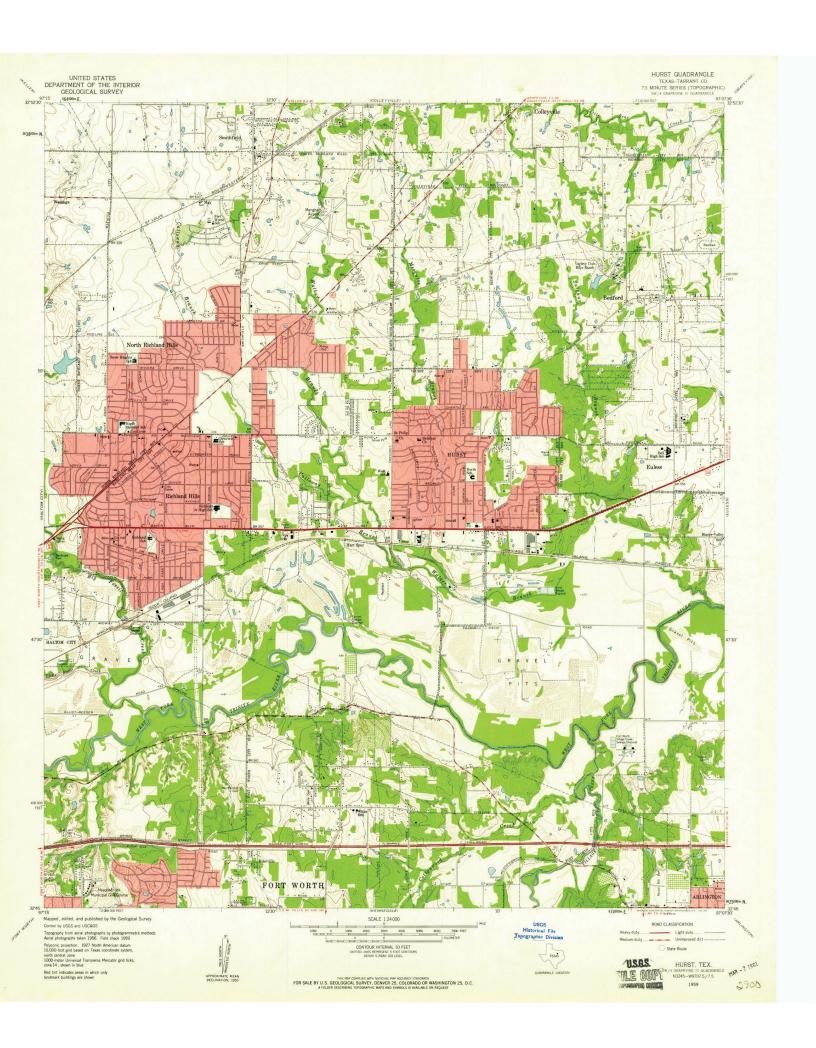


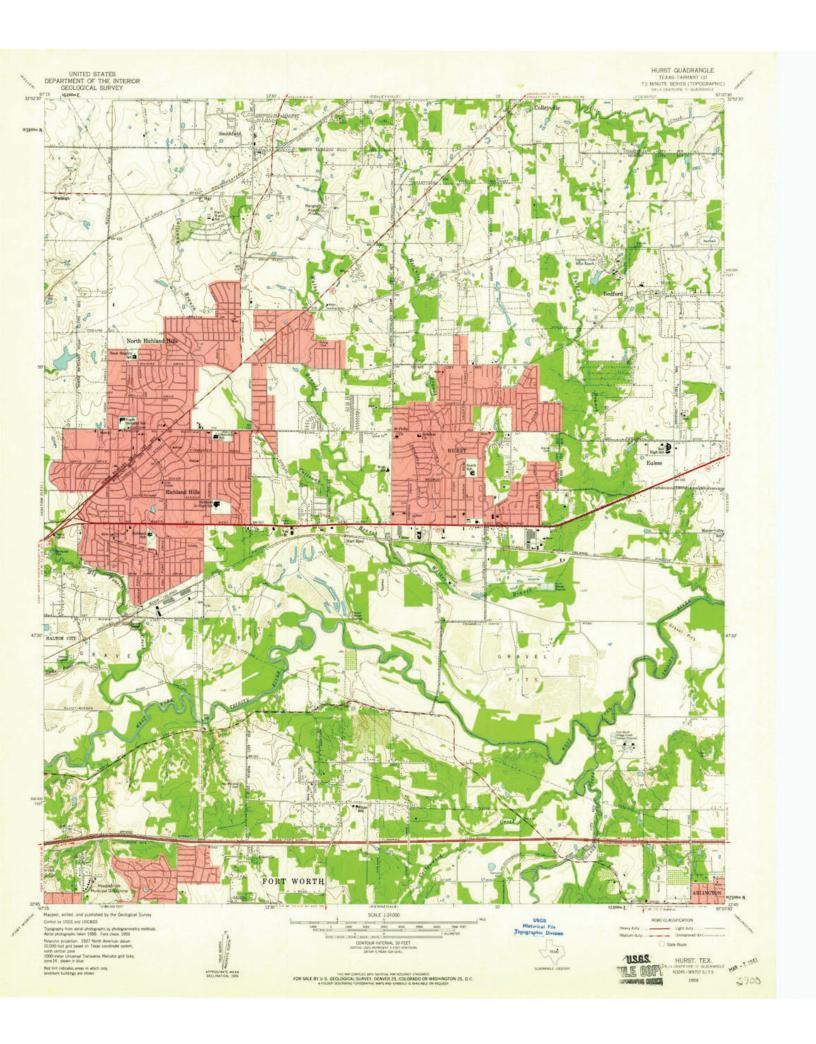

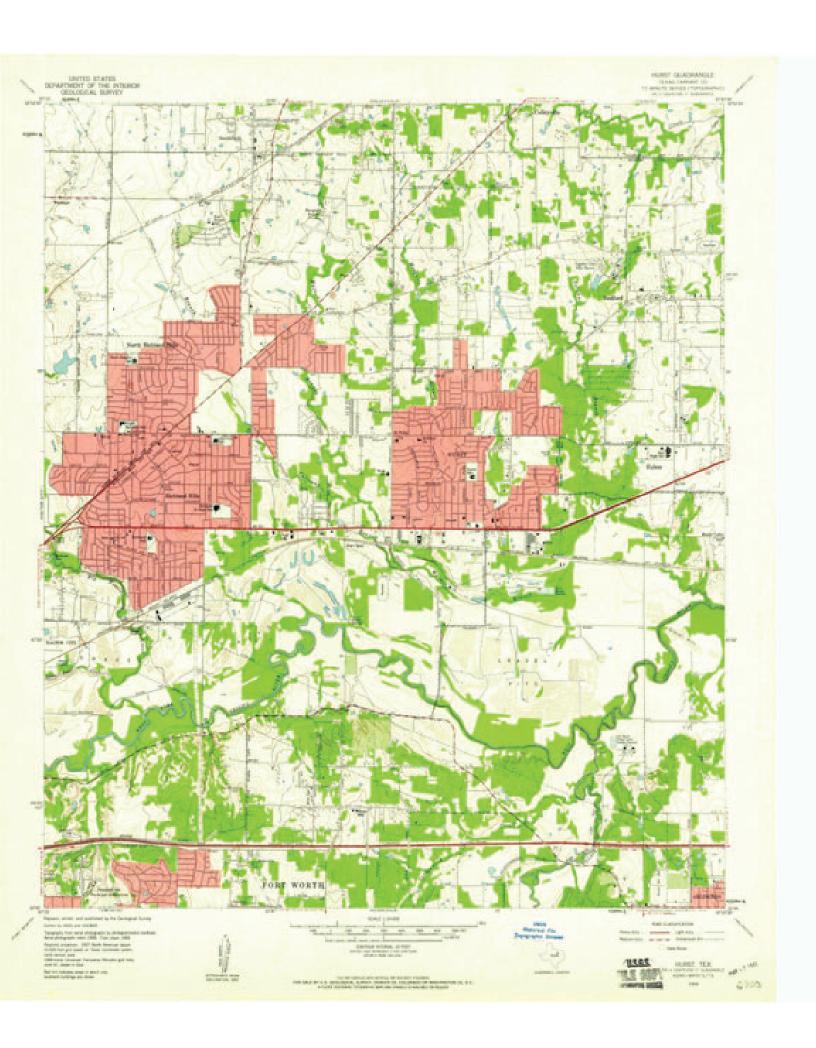

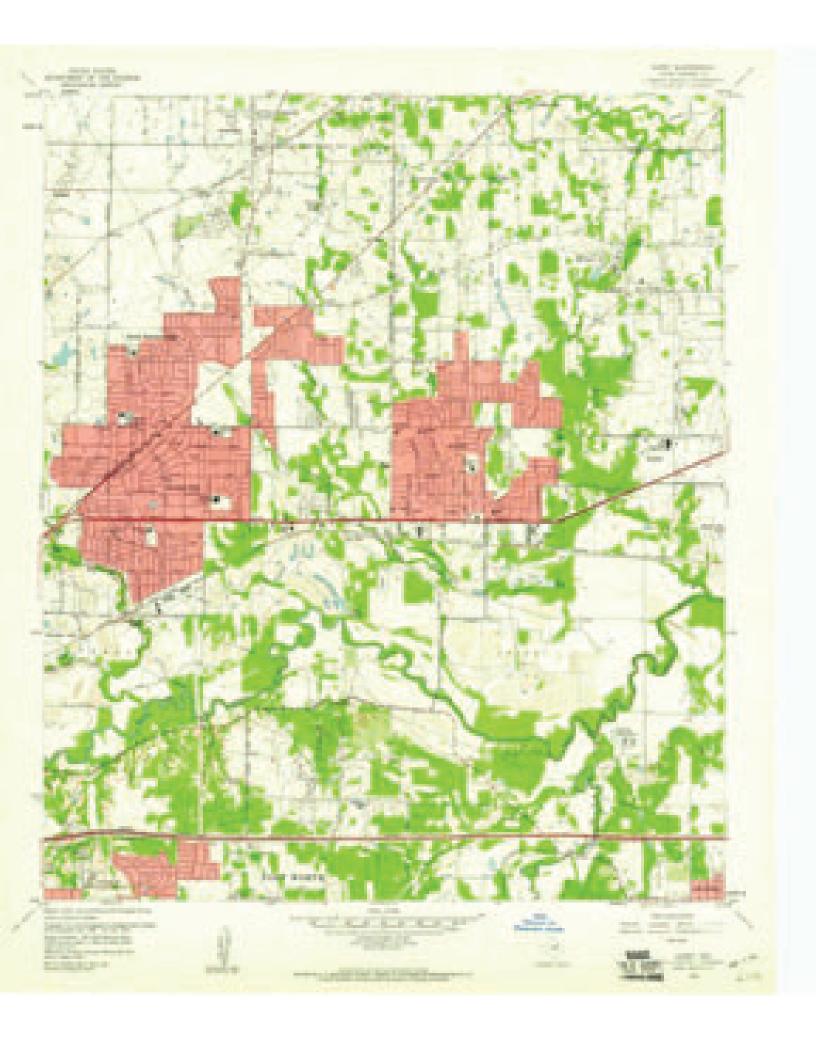


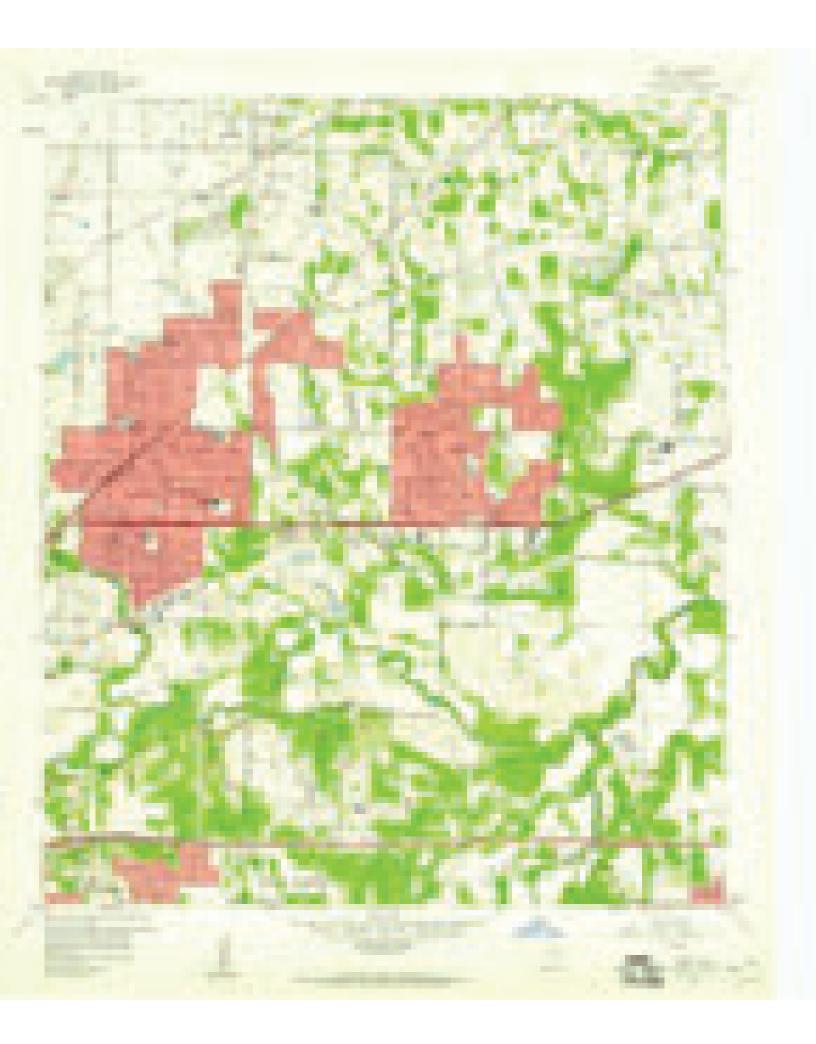


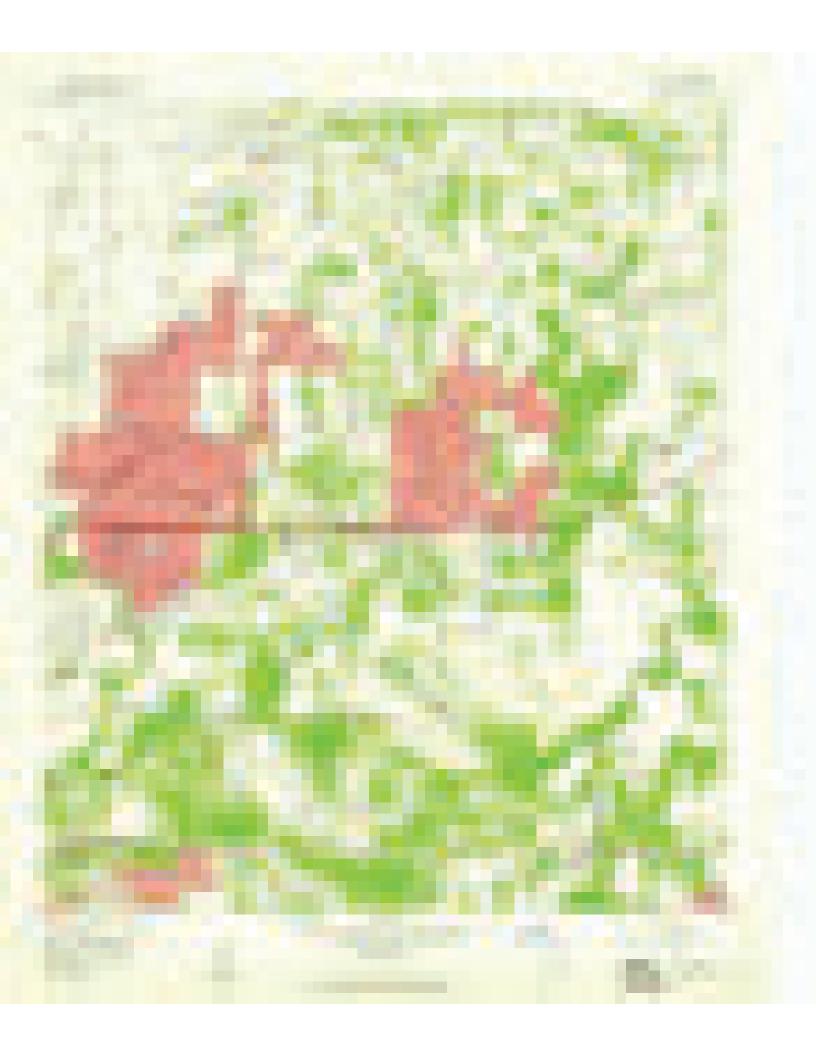







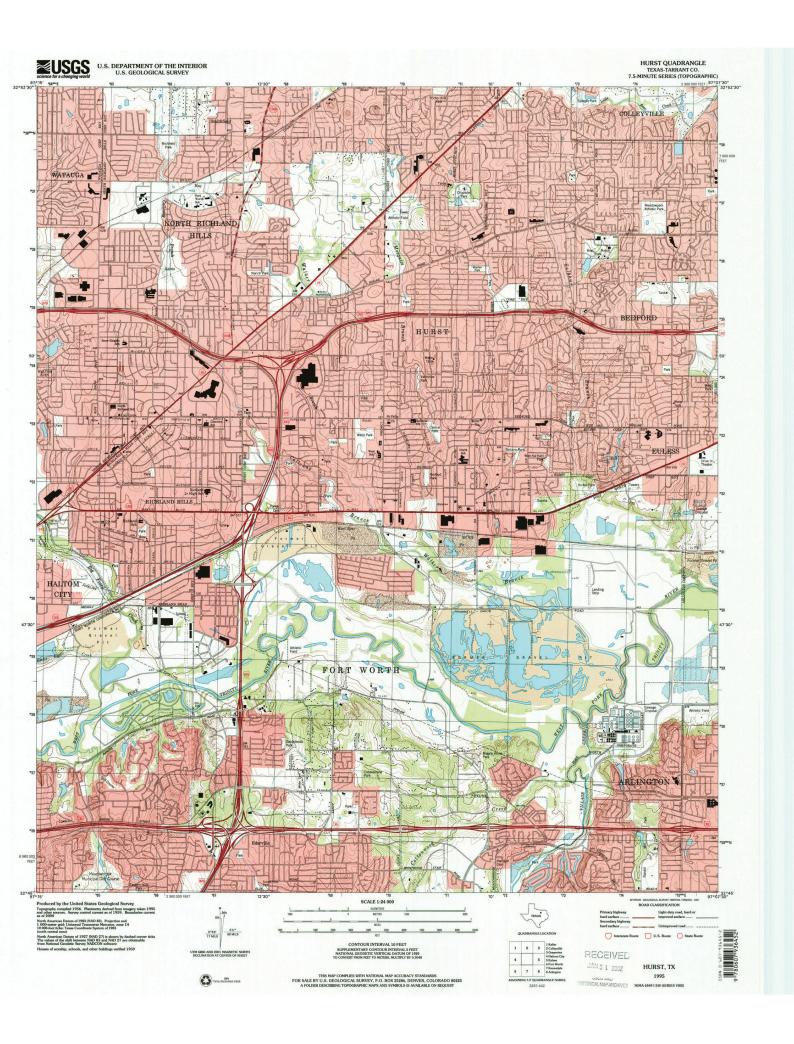

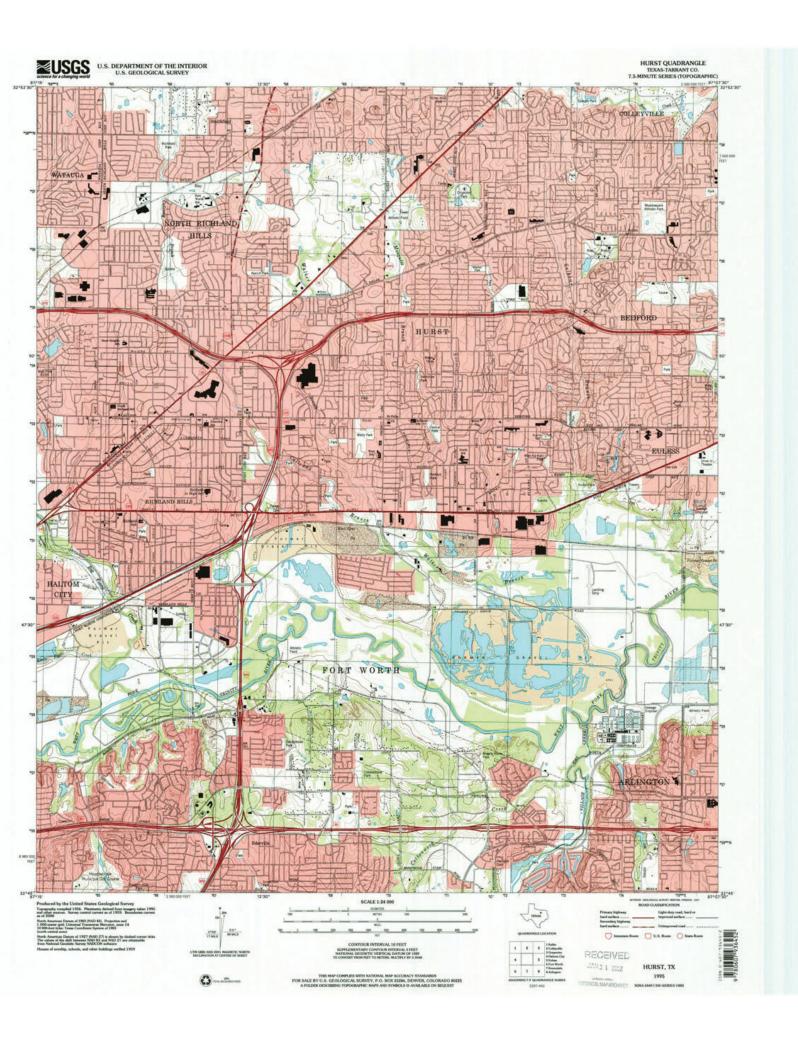


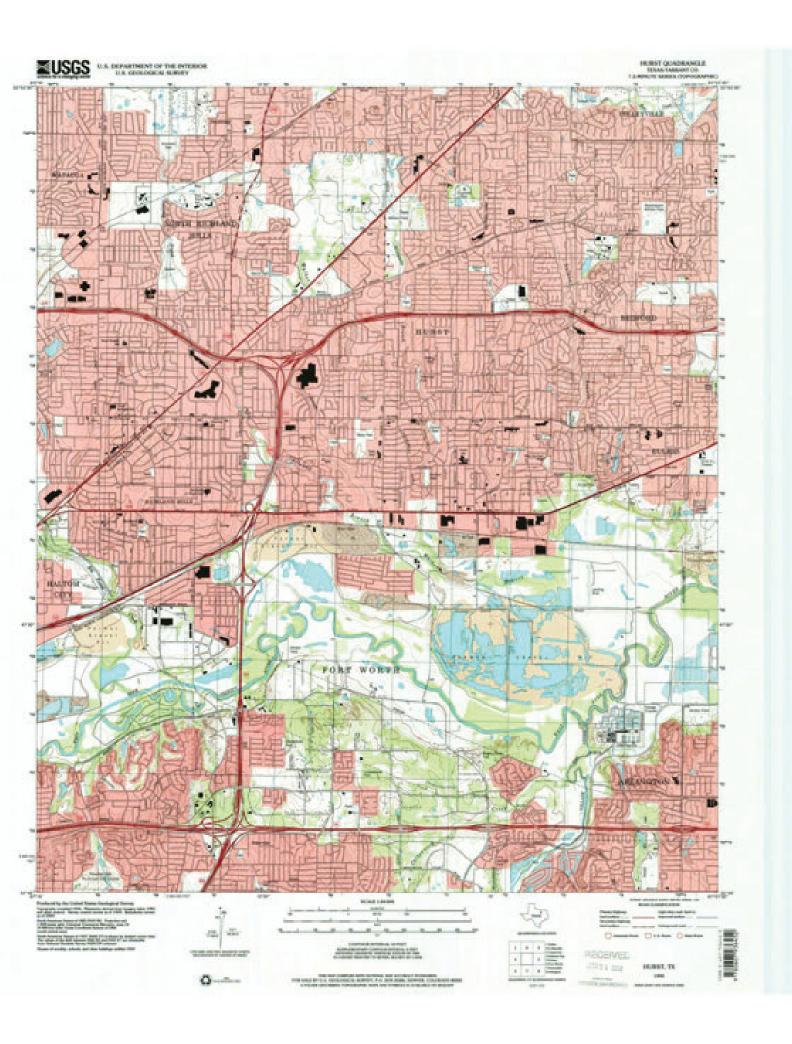


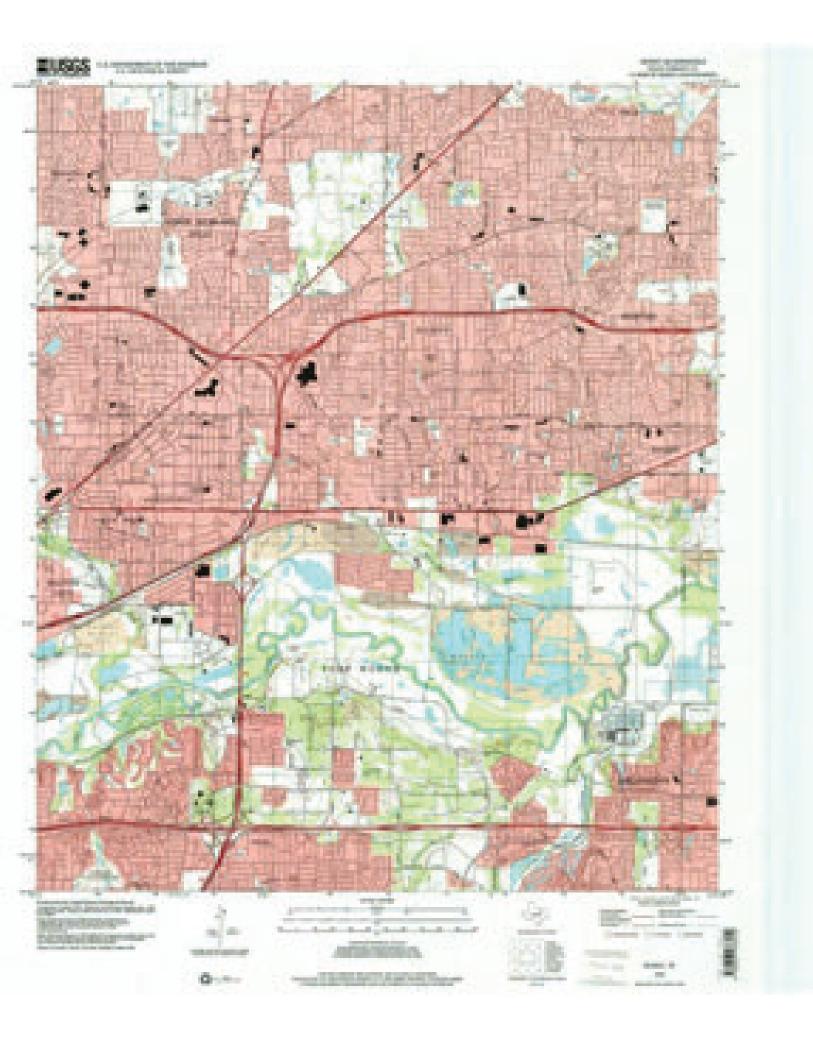








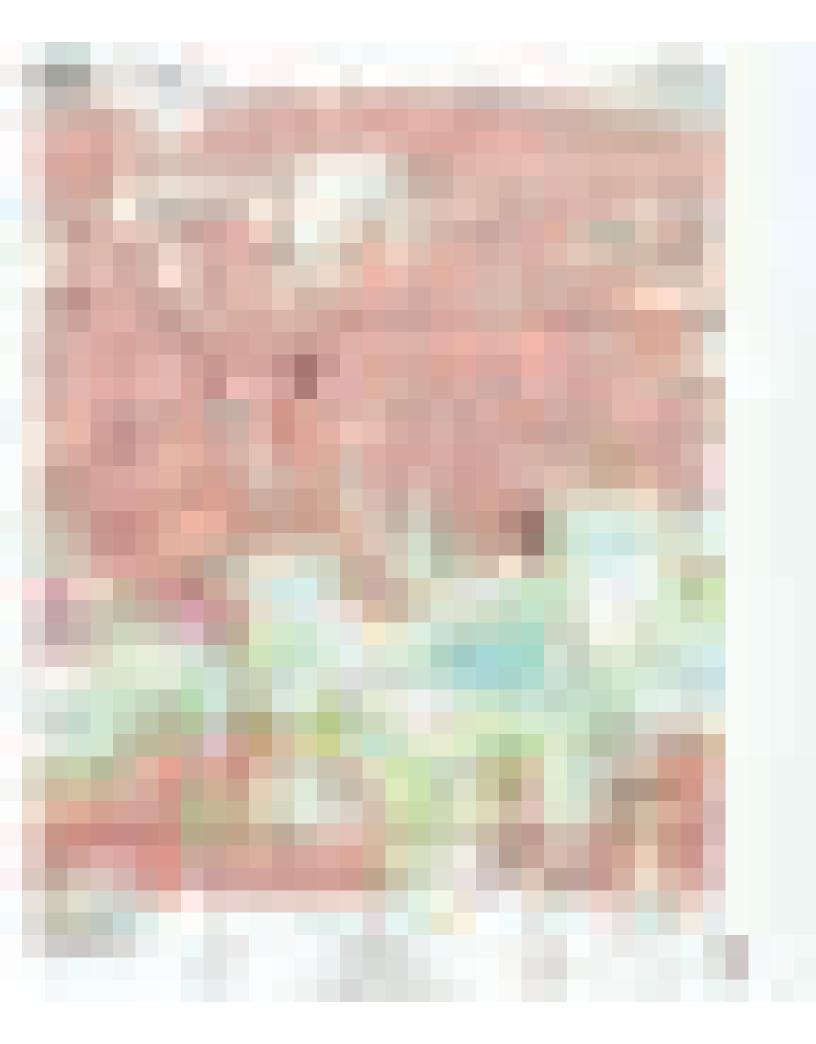


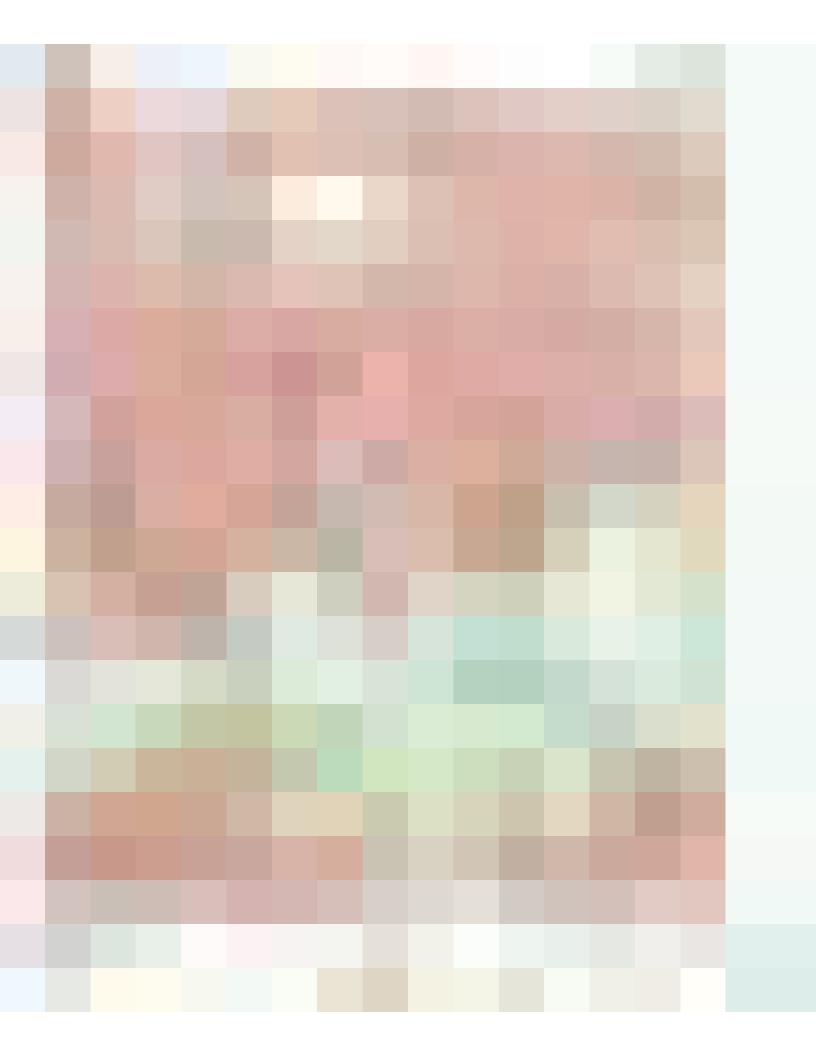


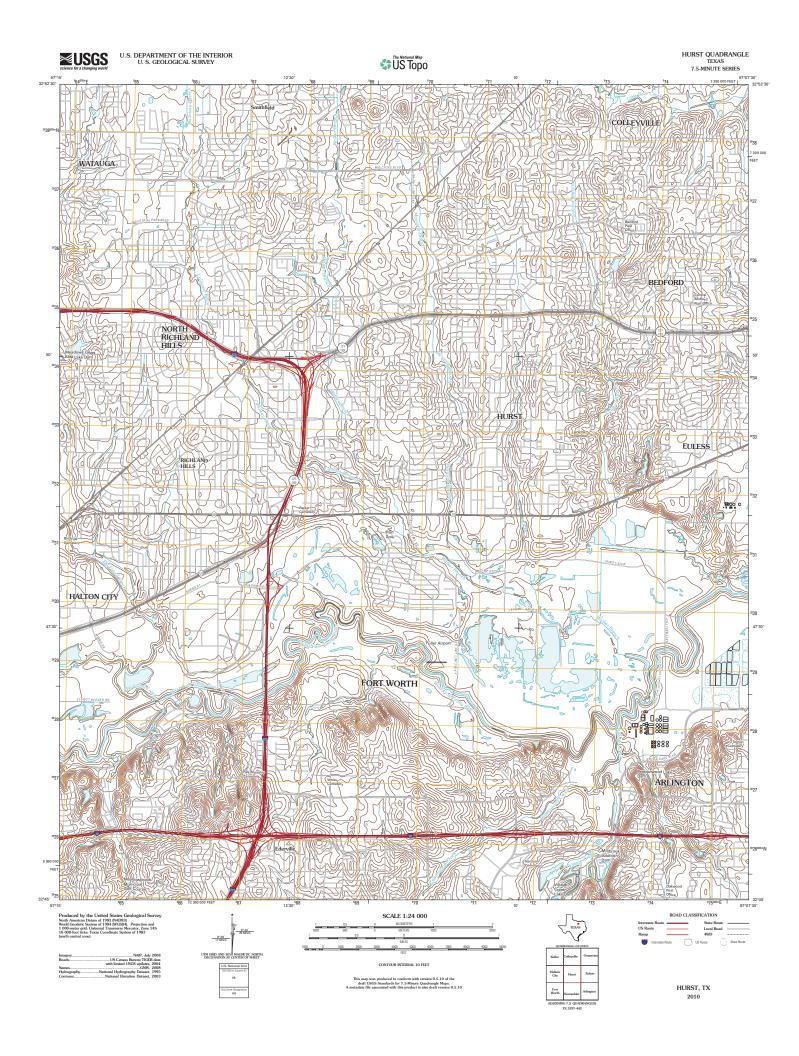

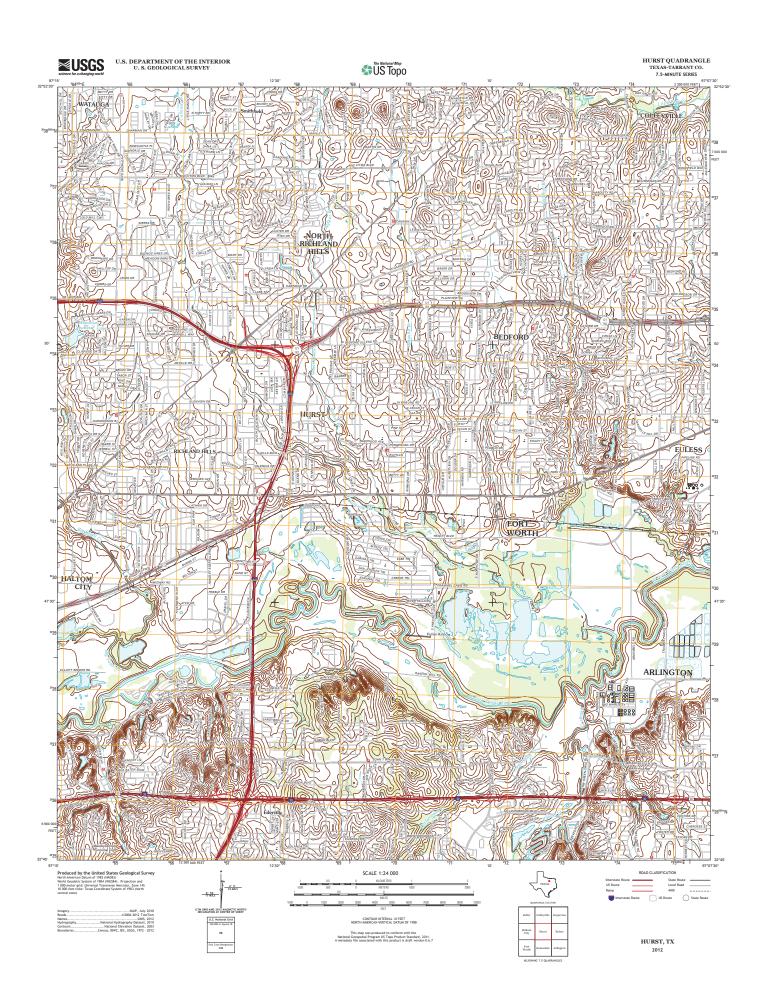

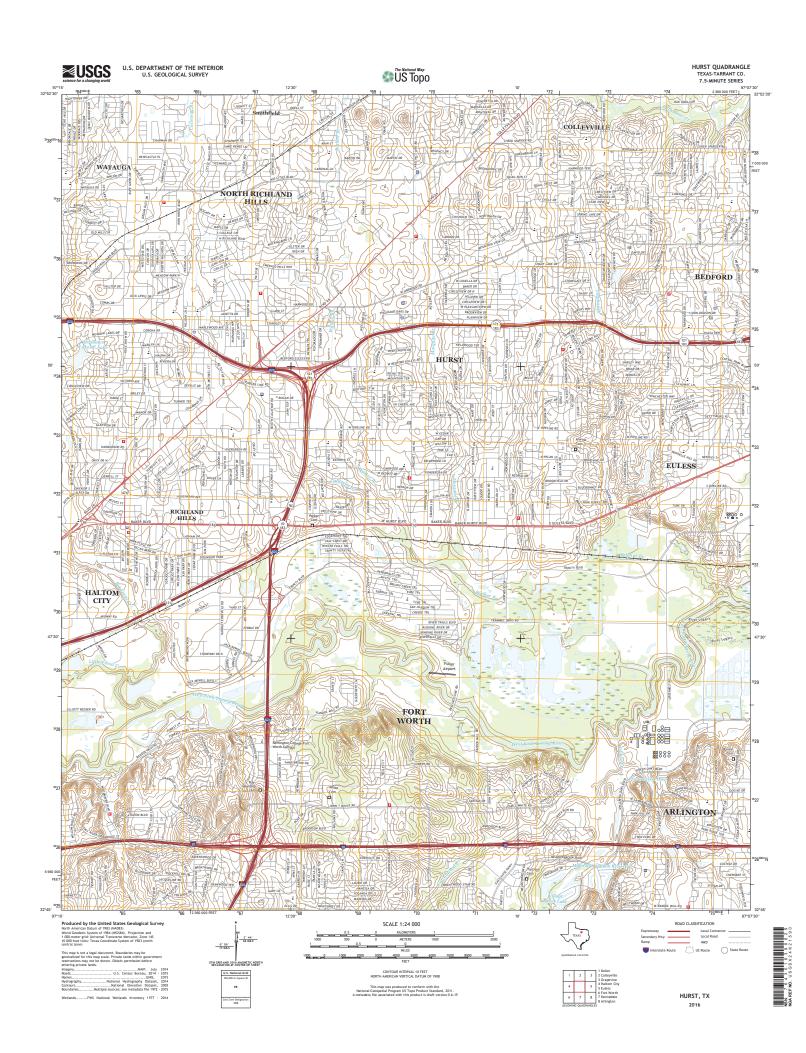

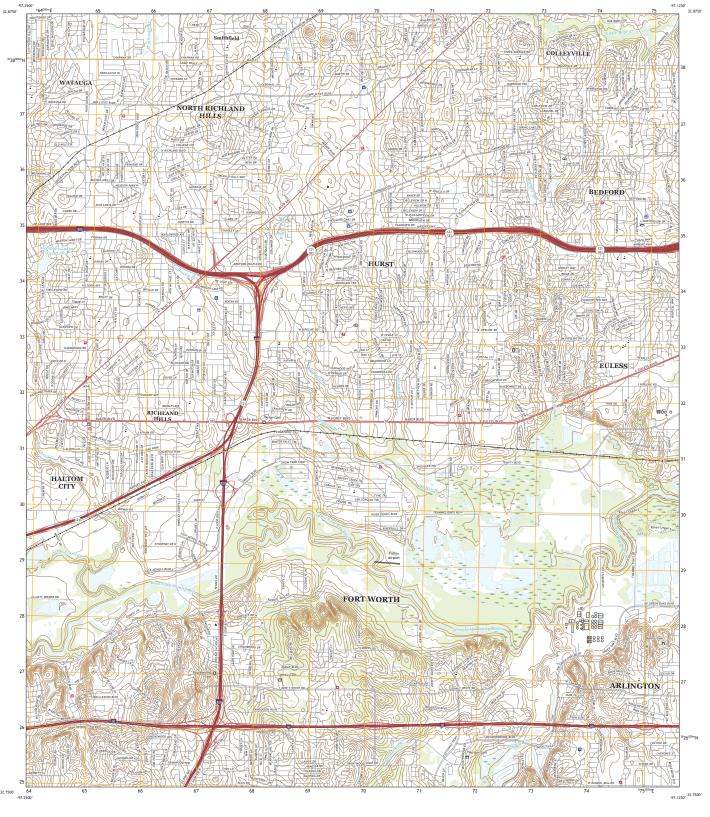



HURST, TX 2019

